



RENAULT CLIO: GD-957-EL

Vinnumber:	VF1RJA00167890985	Versionname:	RENAULT CLIO Business E-Tech hybride 140 -21N VP [5P] bva 6-140CH-5cv (bi-corps)
First Registrationdate:	26/11/2021	Fiscalpower:	
Expertise Mileage:	133032	Power Kw:	103
Bodytype:	Berline	Body colour:	White
Gearbox:	Automatic	Paint type:	Opaque
Transmission:	Front	Interior colour:	Black
Fueltype:	Hybrid	Type of rims (mounted):	Steel
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Steel		
Category:	Passenger Car		

Options

Number of keys total	1	Radio	
Number keys remote	1	Central consol F	
GPS big screen color		Luggage cover	
GPS storage	HD	Headlights Xenon/LED/Laser	
Windows electric F		Rear parking sensors	
Cruise Control		Seat cover lining	Lining Other
Steering wheel multifunctional			
Steering wheel leather			
Type of climate control	Manual climate control		

Tyres


	195/55/16/87 H			
Summer tyres:	Fr.L.	Michelin: 85%	Fr.R.	Michelin: 80%
	Re.L.	Dunlop: 50%	Re.R.	Dunlop: 60%
Tyre profile depth FL				2.3
Tyre profile depth FR				2.8
Tyre profile depth RL				4.9
Tyre profile depth RR				4.4
Tyre size FL				195/55 R 16 87 H
Tyre size FR				195/55 R 16 87 H
Tyre size RL				195/55 R 16 87 H
Tyre size RR				195/55 R 16 87 H
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				Winter
Tyre type RR				Winter
Tyre make FL				261
Tyre make FR				261
Tyre make RL				257
Tyre make RR				257

Assistance equipment

Remote ignition key, Missing, Repair/replace (lump sum)



Interior, Dirty, Cleaning

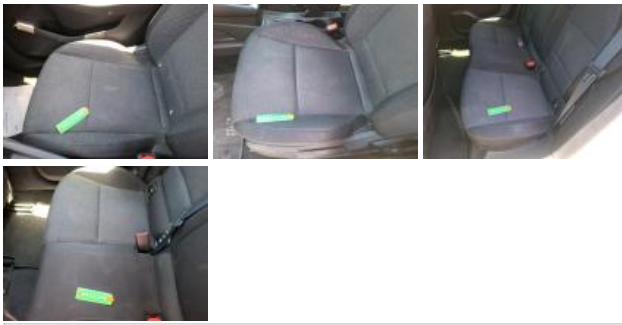

Window handle RR, Broken, Replace




Interior trim, Missing, Replace



Tyre FL, Out of tolerance, Replace




Wheel cover FL, Missing, Replace

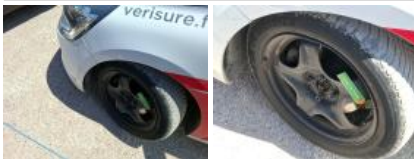

Tyre RL, Out of tolerance, Replace




Tyre RR, Out of tolerance, Replace

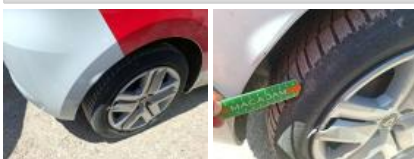

Wheel cover RR, Broken, Replace



Tyre FR, Out of tolerance, Replace

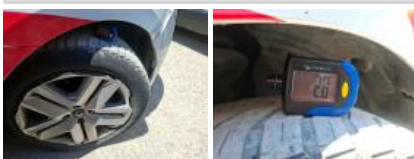

Wheel cover FR, Broken, Replace



Wheel arch cover FR, Unclapsed, Dismount/Mount



Wheel arch cover RR, Broken, Replace



Outside rear-view mirror housing L, Scratch(es), Polish



Door RL, Dent(s), Repair and paint (complete)



Bumper F, Scratch(es), Repair and paint (complete)



Headlight R, Scratch(es), Replace



Bonnet, Dent(s), Repair and paint (complete)



Outer sill R, Dent(s) and scratch(es), Replace and paint



Outside rear-view mirror housing R, Scratch(es), Acceptable



Wing FR, Dent(s), Repair and paint (complete)



Wing RR, Dent(s), Repair and paint (complete)



Bumper R, Scratch(es), Acceptable



Internal boot lining R, Broken, Replace



Bodywork, Not original part, Sticker removal small



Historique Maintenance

Immatriculation: **GD-957-EL** Date de 1ère immatriculation: **26/11/2021**

Modèle: **Renault CLIO Business E-Tech hybride 140 -21N VP [5P] bva 6-140CH-5cv (bi-corps)**

Date	Kilométrage	Fournisseur	Descriptif
02/03/2026	125.575	RIVAUTO	CONTROLE TECHNIQUE
10/09/2025	112.690	RIVAUTO	REVISION ET CLIM ET AIR ET BOUGIES
	0		PLAQUETTES AV RPLT
	0		LIQUIDE DE FREIN
05/03/2025	97.843	RIVAUTO	REPLACEMENT PNEUS 4 SAISONS
	0		REPLACEMENT PNEUS ETE
05/03/2025	97.843	RIVAUTO	GEOMETRIE CTRL
27/02/2025	97.843	RIVAUTO	BATTERIE RPLT
30/08/2024	86.445	SA FABRE RUDELLE	RECYCLAGE
	0		BALAI ESSUIE GLACE AR
	0		REVISION ET CLIM
	0		BALAIS ESSUIE GLACE AV
06/11/2023	69.051	GOODYEAR FRANCE	REPLACEMENT PNEUS HIVER
28/09/2023	61.271	MAJOREL	REVISION ET CLIM ET AIR ET BOUGIES
19/12/2022	30.692	SA FABRE RUDELLE	BALAIS ESSUIE GLACE AV
	0		RECYCLAGE
	0		BALAI ESSUIE GLACE AR
	0		REVISION ET CLIM
06/12/2022	28.862	PROFIL PLUS	REPLACEMENT PNEUS HIVER
	0		GARDIENNAGE