MACADAM







Ford Kuga (UKL): 2BLT413

Vinnumber:	**WF0FXXWPMFMD25273**	Versionname:	**Kuga Titanium 1.5 EcoBlue 120pk/cv 5p**
First Registrationdate:	**6/01/2022**	Fiscalpower:	
Expertise Mileage:	**101416**	Power Kw:	**88**
Bodytype:		Type of rims (mounted)	**Aluminium**
Gearbox:	**MAN 6 VIT**		
Transmission:			
Fueltype:	**Diesel**		
Maintenance	**OK**		
Maintenance	**16%**		
Battery functioning	**Yes**		
Type of rims (mounted)	**Aluminium**		
Certificate of Conformity	**Yes**		
Category	**Passenger Car**		
Registration Certificate Car (BE)	**Yes**		

Options

Number of keys total	**2**	Luggage cover	
GPS		Type of Tow bar	**Tow bar collapsible**
Type of Maintenance book	**Maintenance book present**		
Type of GPS storage	**HD**		

Tyres

Summer tyres:	**225/65/17/102 H**			
	Fr.L.	**Uniroyal: 7 mm**	Fr.R.	**Uniroyal: 7 mm**
	Re.L.	**Bridgestone: 4 mm**	Re.R.	**Bridgestone: 3 mm**

Tyre profile depth FL	**7.0**
Tyre profile depth FR	**7.0**
Tyre profile depth RL	**4.0**
Tyre profile depth RR	**3.0**
Tyre size FL	**225/65 R 17 102 H**
Tyre size FR	**225/65 R 17 102 H**
Tyre size RL	**225/65 R 17 102 H**
Tyre size RR	**225/65 R 17 102 H**
Tyre type FL	**Summer**
Tyre type FR	**Summer**
Tyre type RL	**Summer**
Tyre type RR	**Summer**
Tyre make FL	**265**
Tyre make FR	**265**
Tyre make RL	**255**
Tyre make RR	**255**

Assistance equipment

Emergency spare wheel	**Yes**	Jack	**Yes**

Seat cover FL, Stain, Acceptable




Bumper F, Deformed / Strained, Replace and paint






Headlight R, Broken, Replace

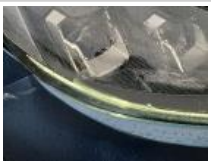

Bumper spoiler F, Scratch(es), Replace




Shutter / cover F, Deformed / Strained, Replace




Door RL, Dent(s), Acceptable




Alloy rim RL, Scratch(es), Repair and paint (complete)






Internal boot lining R, Scratch(es), Acceptable



Internal boot lining L, Scratch(es), Acceptable



Boot lid covering R, Scratch(es), Acceptable





Bumper R, Scratch(es), Spot repair




Bumper trim R, Scratch(es), Smart repair




Wing FR, Deformed / Strained, Replace and paint





Wing trim FR, Deformed / Strained, Replace




Door FR, Dent(s), Paintless dent repair






Bodywork, Chemical polution, Cleaning













Onderhoudshistorie van: WF0FXXWPMFMD25273

ALPHABET

Kenteken	2BLT413
Merk Model	Ford Kuga Titanium 1.5 EcoBlue 120pk/cv 5p
Brandstofsoort	Diesel
Datum deel1	1/6/22

Datum reparatie	Kilometerstand	Reparatie omschrijving	Bewerking
8/13/26	100,639	diagnose	Uitvoeren
7/21/26	101,000	pechverhelping buitenland	Uitvoeren
5/13/25	76,223	75000 km	Uitvoeren
5/13/25	76,223	luchtfilter interieur	Vervangen
5/13/25	76,223	oliezeef	Vervangen
3/1/25	72,923	schokdemper vooraan	Vervangen
2/19/25	72,328	remblokken vooraan	Vervangen
5/15/24	58,113	60000 km	Uitvoeren
5/15/24	58,113	brandstof hoofdfilter	Vervangen
5/15/24	58,113	luchtfilter	Vervangen
5/15/24	58,113	luchtfilter interieur	Vervangen
5/15/24	58,113	oliezeef	Vervangen
5/15/24	58,113	remvloeistof	Vervangen
2/22/23	28,960	30000 km	Uitvoeren
2/22/23	28,960	luchtfilter interieur	Vervangen
2/22/23	28,960	oliezeef	Vervangen