



Expertise

Protocol number: 46313678
Order No. / Reference: 26325910
Inspection date: 3 Jul 2026

Manufacturer: Audi

Model: A4 Avant 35 TDI S tronic

VIN: WAUZZZF43PA028016



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A4 Avant 35 TDI S tronic	
Vehicle Identification number	WAUZZZF43PA028016
Mileage (Read)	141,654 km
First registration	24 Jan 2023
Number of holders	1
Power / Engine displacement	120 kw / 1,968 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Gletscherweiss Metallic (S9R)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
Vehicle with smoke odor	no
readiness to drive	Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	3,200 km
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP839787
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	0588 / BPK 01003		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,165 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 98H	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	225/50 R17 98H	Winter tyres on Light alloy	Continental	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 94Y	Summer tyres (Without wheel rim)	Uniroyal	6mm / 6mm
2)	225/50 R17 94Y	Summer tyres (Without wheel rim)	Uniroyal	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 09/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- AdBlue tank (12 liters)
- Airbag: Front side airbags and head airbag system
- Anti-lock braking system (ABS)
- Audi connect emergency call & service with Audi connect Remote & Control
- Exterior mirror housings in body color
- third brake light, raised
- Black roof rails
- Diesel particulate filter (DPF)
- Door sill trims with aluminum inlay at the front
- Electronic Differential Lock (EDS)
- Driver Information System
- electric window regulator
- Remote key, without SafeLock
- Cruise control system with speed limiter
- rear window wiper
- Interior lighting
- Child lock
- Automatic air conditioning
- boot floor mat
- Loading floor
- LED taillights
- Steering column, manually adjustable in height and axis
- Light/rain sensor
- front center armrest
- Wheel: Alloy wheels, 5-arm
- Radio: MMI Radio plus
- Radio accessories: Digital radio reception (DAB)
- Tire repair kit
- Electromechanical power steering
- Seats: Standard front seats
- Seats: Front seats manually adjustable
- First aid kit with warning triangle
- Electronic immobilizer
- Central locking "Keyless-Go" without deadbolt
- Airbag for driver and front passenger
- Accent areas matte black
- Traction control (ASR)
- Audi pre sense city
- Electrically adjustable and heated exterior mirrors
- Vehicle tool kit
- Fabric headliner
- Decorative inlays diamond lacquer silver grey
- Tachometer
- Electromechanical parking brake
- Electronic Stability Control (ESC)
- Chassis: Standard chassis
- Window channel strips in black (rubber)
- front and rear floor mats
- Transmission: S tronic 7-speed
- Top speed limited to 210 km/h
- Interior mirror dimming
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- Headrests (5)
- Manual cargo cover
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction
- Mild hybrid
- Non-smoking version
- Wheel: Tires optimized for rolling resistance, speed-limited
- Radio accessories: 8 speakers (passive) front and rear
- Tire pressure monitoring system
- Headlights using LED technology
- Fabric seat covers Index
- Seats: Rear seat backrest foldable
- Start-stop system
- Glazing: Windscreen in heat-insulating and acoustic glazing

Extra equipment

- AdBlue tank (24 liters) (larger tank for AdBlue solution to reduce nitrogen oxides in the exhaust gas using an SCR system)
- Audi pre sense basic (within the system's limits, it initiates preventive safety measures for the occupants by networking and coordinating different vehicle systems. In unstable driving conditions, the front seat belts are electrically tightened. Depending on the situation, the windows close. The hazard warning lights are activated to warn following traffic.)
- Deletion of model designation and performance/technology lettering
- Driver information system with color display (high-resolution 7" color display - display content: speed, time, mileage, outside temperature, fuel warning with remaining range, gear shift indicator, current radio station or music track, radio and media lists, telephone menu (in conjunction with multifunction steering wheel), navigation information (if equipped). On-board computer with short- and long-term memory - including break recommendation)
- Electrically operated tailgate (The tailgate can be opened electrically by pressing the button on the vehicle key, in the driver's door, or the soft-touch button on the tailgate handle. Closing the tailgate is just as easy and convenient: simply press the button on the inside of the tailgate, the button in the driver's door, or the button on the vehicle key. A soft-close mechanism makes manual closing easier when necessary.)
- Parking Assistance Package (The parking assistant with parking aid plus detects suitable parking spaces. Targeted steering maneuvers actively support the driver when parking and exiting. A visual display warns of obstacles. For perpendicular parking spaces, the entry path is calculated; for parallel parking spaces, the entry and exit paths are calculated. Four wide-angle surround-view cameras capture the entire area immediately surrounding the vehicle.)
- Package: Ambient Lighting Package (in addition to the interior lighting: - approach lighting in the exterior door handles - entry lights on the underside of the front doors - illuminated front cupholders - front footwell lighting - illuminated interior door handles - ambient door lighting - ambient lighting in the front center console)
- Wheel: Alloy wheels, 5 parallel spokes (7.5 JX 17 with tires 225/50 R 17)
- Seat covers in fabric system (seat center panels in fabric system black or black-red - seat side bolsters, thigh support, headrests in solid black fabric)
- Front seat heating (heats seat and backrest center panels; with leather upholstery, sport seats and S sport seats also seat side bolsters - individually adjustable in multiple stages for driver and front passenger side via the climate control unit)
- Glazing: Sun protection glazing, tinted (rear window, rear door and side windows tinted)
- Audi connect Navigation & Infotainment (Online Points of Interest - Online Traffic Information Plus - Hazard Information - Weather Information - Wi-Fi Hotspot - Online News - Navigation with Google Satellite Maps - Online Search for Navigation Destinations - Online Voice Input - Highly Detailed 3D City Display - On-Street Parking - Online Radio - Hybrid Radio - User Profiles - Amazon Alexa Integration - Online Media Streaming - myAudi Navi. - Online Traffic Sign Information. - HoloRide Interface)
- Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides (including curb view function for passenger-side exterior mirror with integrated LED turn signal, including heated windshield washer nozzles; the curb view function folds the passenger-side mirror down when reverse gear is engaged, giving the driver a better view of the curb edge)
- High-beam assist (within the system's limitations, it automatically detects oncoming headlights, taillights of other road users, and light sources in built-up areas. Depending on the traffic situation, the high beams are automatically switched on or off. The system thus improves the driver's visibility and increases comfort.)
- Fuel tank with increased filling volume (54 l)
- Paint finish: Metallic
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction plus, shift paddles and steering wheel heating (height and distance of the steering wheel are manually adjustable - leather of the steering wheel and gear selector knob is color-matched to the selected color of the dashboard top - 12 multifunction buttons for convenient operation of the available infotainment features - shift paddles for manual changing of the driving modes)
- Business Package (MMI Navigation plus with MMI touch (including driver information system with color display) - Audi phone box - Leather steering wheel in 3-spoke design with multifunction plus - Heated front seats - Automatically dimming, frameless interior mirror - Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides - Rear parking aid - High-beam assistant - Manual sunshade for the rear door windows)
- Wheel: Deselect low rolling resistance tires, remove speed limiter (17 inch) (Tires 225/50 R 17 94Y)
- Wheel: Audi new car tire warranty (36-month term from vehicle handover to the first customer)
- Radio accessories: Audi sound system (10 speakers including center speaker and subwoofer - 6-channel amplifier - total output of 180 watts)
- Seats: 4-way lumbar support (electrically adjustable, horizontally and vertically)
- Front sports seats (with manual adjustment of seat height, seat longitudinal position, seat tilt, backrest tilt, headrest and belt height; with pronounced seat side bolsters for better lateral support in curves, extendable thigh support)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.

Value reducing factors

No.	Component group	Description
1	Side panel - rear left side	Interior trim - Scratch(es) - Loss in value
2	Trim / covers	Boot lid - interior trim - Scratch(es) - Loss in value
3	Side panel - rear right side	Elbow - dent(s) - Smart repair
4	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - Loss in value
5	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - Loss in value
6	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value
7	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value

Wear and tear

No.	Component group	Description
1	Misc.	Inspection / maintenance - No evidence - No deduction
2	Interior	Interior - Scratch(es) - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Body	Body - Scratch(es) - No deduction
5	Side panel - rear right side	Sill - dent(s) - No deduction
6	Rear bumper	Rear bumper - Scratch(es) - No deduction
7	Wheel / tyres	Alloy rim - front right side - Damaged - No deduction
8	Front bumper	Front bumper - Stone chips - No deduction
9	Body	Underbody panelling - Scratched - No deduction
10	Wheel / tyres	Tyre - front right side (gehört nicht zur Ausstattung) - Broken / torn - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side - left, Provided by user / customer, from 2 Aug 2024	2.535,01 €

Repainting

No.	Repainting
1	Door - rear left side, Door - front left side, Professionally carried out, Invoice of repair done Non-existent



Paint coat thickness measurement

Mudguard - left side

162 µm

Door - rear left side

173 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Winterreifen sind kein Bestandteil des Lieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

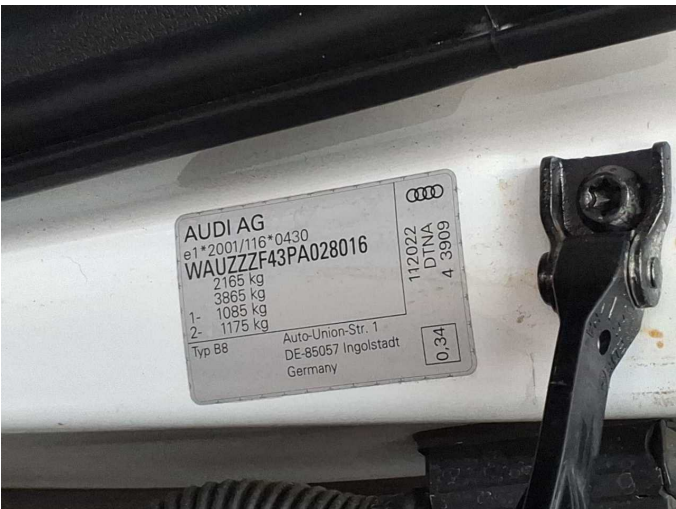


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

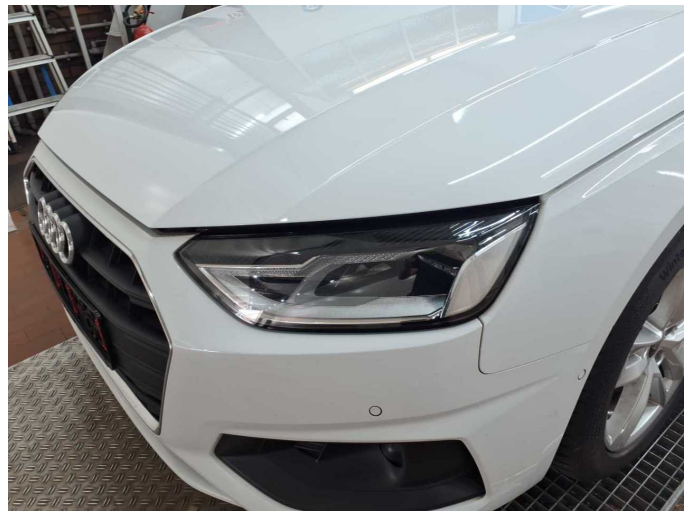


Figure 22: Misc.

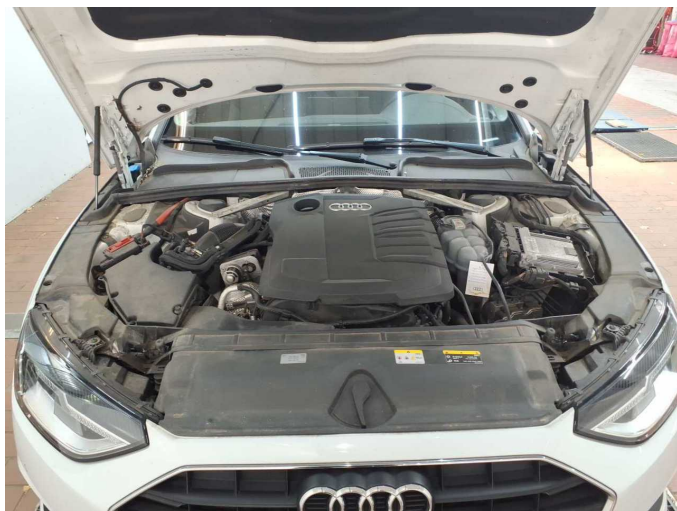


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Damage 1: Side panel - rear left side: Interior trim - Scratch(es) - Loss in value



Damage 1: Side panel - rear left side: Interior trim - Scratch(es) - Loss in value




Damage 2: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value



Damage 2: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value




Damage 2: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value

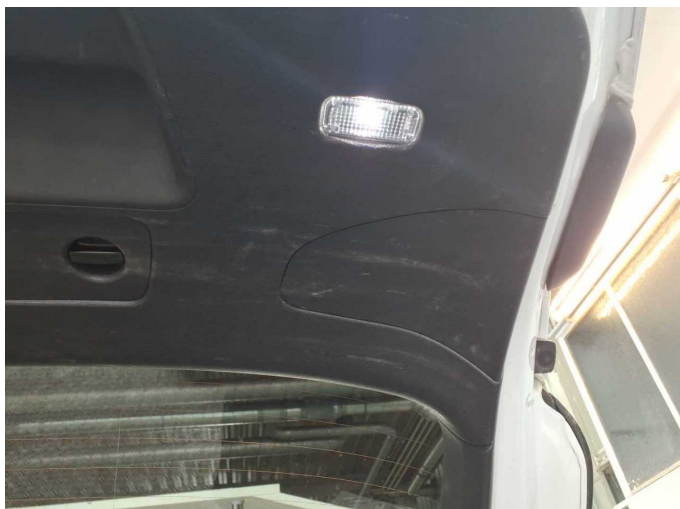

Damage 2: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value




Damage 3: Side panel - rear right side: Elbow - dent(s) - Smart repair

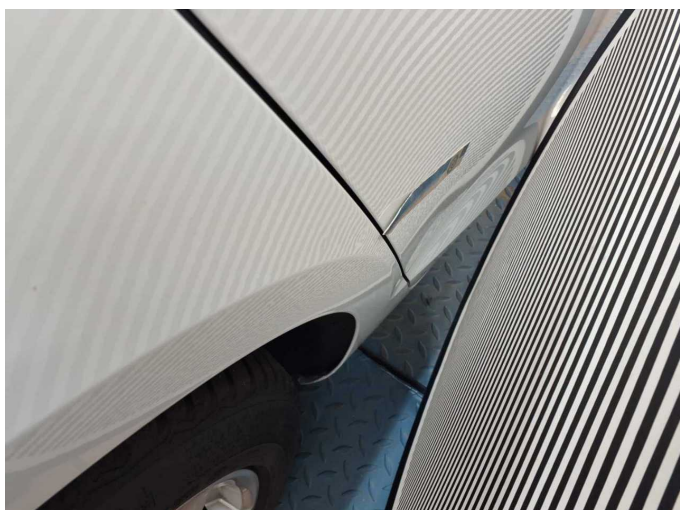

Damage 3: Side panel - rear right side: Elbow - dent(s) - Smart repair



Damage 4: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value

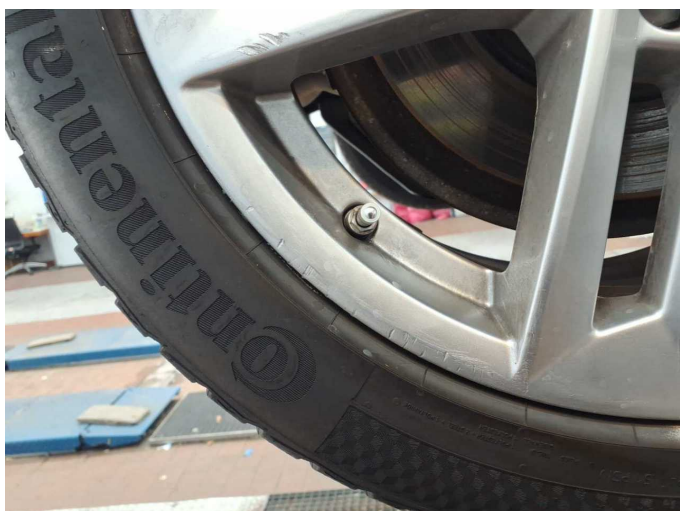

Damage 4: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Damage 4: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Damage 4: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Damage 5: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Damage 5: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Damage 5: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Damage 6: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 6: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 7: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 7: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 7: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Repainting 1: Door - rear left side, Door - front left side



Repainting 1: Door - rear left side, Door - front left side



Repainting 1: Door - rear left side, Door - front left side



Repainting 1: Door - rear left side, Door - front left side