



Expertise

Protocol number: 46047698
Order No. / Reference: 26454450
Inspection date: 19 Jun 2026

Manufacturer: Mercedes-Benz

Model: B 200 d 8G-DCT AMG Line Advanced Plus

VIN: W1K4F1CB9PJ502793



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz B 200 d 8G-DCT AMG Line Advanced Plus	
Vehicle Identification number	W1K4F1CB9PJ502793
Mileage (Read)	102,722 km
First registration	19 Apr 2023
Number of holders	1
Next periodical technical inspection	04/2028
(Report on hand)	
Power / Engine displacement	110 kw / 1,950 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	PATAGONIENROT BRIGHT
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	296 Tag(e)
Last service on / at	04/2026 at 100,550 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS686875
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / AHI 00103		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,090 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 95Y	Winter tyres on Light alloy	Semperit	5mm / 5mm
2)	225/45 R18 95Y	Winter tyres on Light alloy	Semperit	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 95Y	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	225/45 R18 95Y	Summer tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartment in center console with roller blind
- Airbag for driver and front passenger
- Airbag: Automatic passenger airbag deactivation
- Airbag: Side airbag for driver and front passenger
- Ambient lighting with 64 different colors
- Traction control (ASR)
- Heated exterior mirrors (left and right), electrically adjustable from inside
- Brake assist, active
- Third brake light in LED technology
- Door sills with "Mercedes-Benz" lettering
- Chassis: Comfort chassis with lowered suspension
- Fingerprint scanner
- Speed Limit Assistant
- Rear lights with taillights and brake lights using LED light guide technology
- Black fabric headliner
- Mechanical child safety lock
- Rear headrests (3)
- Paint finish: Solid
- LED High Performance headlights including Adaptive High Beam Assist
- Steering column mechanically adjustable in height and length
- Package: KEYLESS-GO comfort package
- Package: Seating comfort
- Package: USB Package Plus
- Tire pressure monitoring system
- Wheels: 45.7 cm (18") AMG light-alloy wheels, 4 in 5-twin-spoke design
- Seats: Rear seat backrests foldable in a 40/20/40 ratio
- Heated seats for driver and front passenger
- Bumpers in body color
- Cruise control
- TIREFIT with tire inflation compressor
- Pre-installation for digital key handover
- Central locking
- ADAPTIVE BRAKE with hill start assist, HOLD function, pre-filling and drying braking in wet conditions
- Airbag: Kneebag for driver
- Airbag: Windowbag
- Anti-lock braking system (ABS)
- Foldable armrest in the center console for driver and front passenger
- Outdoor temperature display
- Diesel particulate filter
- EASY-PACK tailgate
- Electronic Stability Program (ESP)
- Electric windows (4-way)
- Velour floor mats
- Transmission: 8G-DCT automatic
- Rear window wiper with intermittent function
- Heated rear window with timer
- ISOFIX child seat attachment with top tether in the rear
- THERMATIC automatic climate control
- Front headrests are height-adjustable
- Cargo area cover
- Steering wheel: Multifunction sports steering wheel in Nappa leather
- Steering: Direct steering
- Navigation: MBUX Navigation Premium
- Package: Parking package with reversing camera
- Package: Mirror package
- Upholstery: ARTICO leatherette/MICROCUT microfiber
- Remote Services Plus
- Seat belts B-Class
- Seats: 4-way lumbar support for driver and front passenger
- Seats: Sports seats
- Lane Keeping Assist, active
- Phone accessories: Wireless charging system for mobile devices
- Fully digital instrument display
- Electronic immobilizer
- Decorative elements carbon structure

Extra equipment

- Towbar with ESP trailer stabilization
- Paint finish: MANUFAKTUR metallic
- Wheels: Winter complete wheels M+S 4-way 45.7 cm (18")
- Wheels: Complete winter wheel sets fitted at the factory
- Seats: Rear seats longitudinally adjustable
- Seats: Front right seat electrically adjustable with memory
- Dark tinted heat-insulating glass (rear side windows and rear window)
- Rear armrest
- Package: Driving assistance (Active Distance Assist DISTRONIC)
- Seats: Driver's seat electrically adjustable with memory function
- Traffic Sign Assistant



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
2	Roof	Roof rail - right side - dent(s) - Smart repair
3	Side panel - rear right side	Sill - Scratch(es) - Smart repair
4	Vehicle glazing	Windscreen - Stone chips - Smart repair
5	2nd wheel set	2 alloy rims - Scratch(es) - Loss in value
6	Mudguard - right side	Mudguard - right side - Deformed - Replace
7	Front bumper	Front bumper (Mit Blende) - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Body	Body - Scratch(es) - No deduction
2	Boot lid / rear door	Boot lid - Scratch(es) - No deduction
3	Door - front left side	Door - dent(s) - No deduction
4	Door - front left side	Door edge - Scratch(es) - No deduction
5	Body	Underbody panelling - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

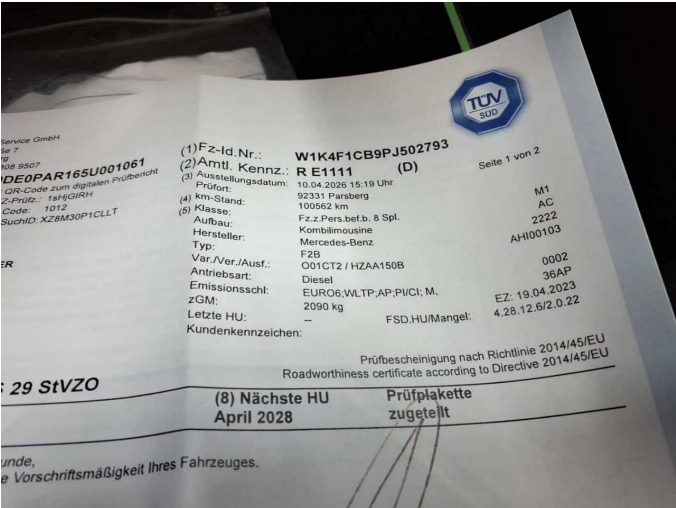


Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

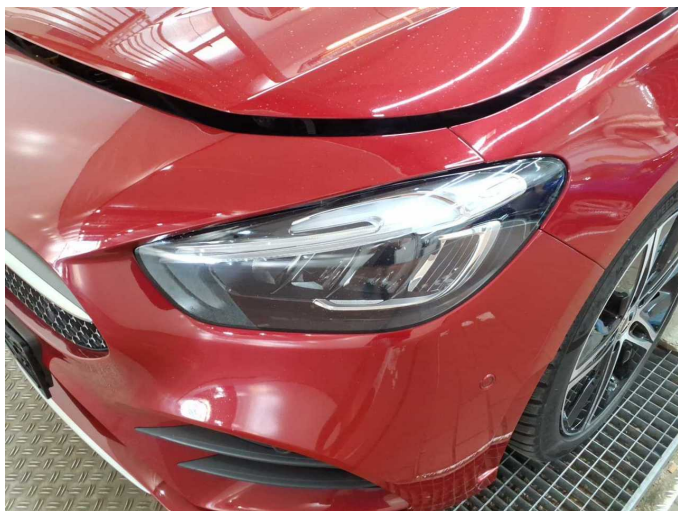


Figure 25: Misc.

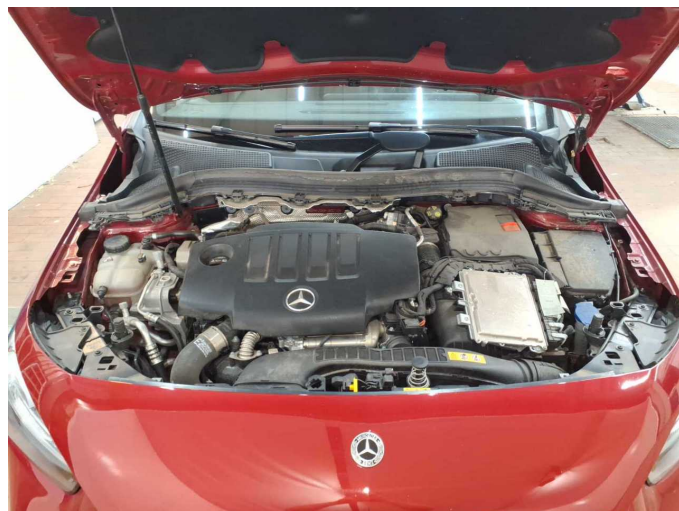


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.




Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.

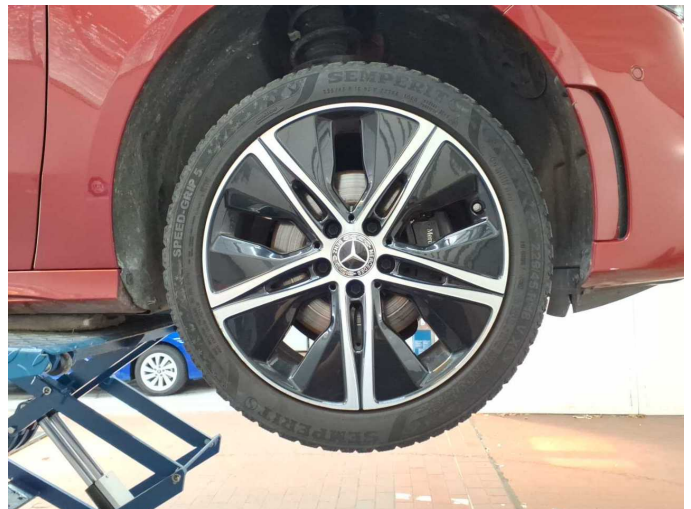

Damage 1: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 1: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 2: Roof: Roof rail - right side - dent(s) - Smart repair



Damage 2: Roof: Roof rail - right side - dent(s) - Smart repair



Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 4: Vehicle glazing: Windscreen - Stone chips - Smart repair



Damage 4: Vehicle glazing: Windscreen - Stone chips - Smart repair



Damage 5: 2nd wheel set: 2 alloy rims - Scratch(es) - Loss in value




Damage 5: 2nd wheel set: 2 alloy rims - Scratch(es) - Loss in value




Damage 5: 2nd wheel set: 2 alloy rims - Scratch(es) - Loss in value



Damage 5: 2nd wheel set: 2 alloy rims - Scratch(es) - Loss in value

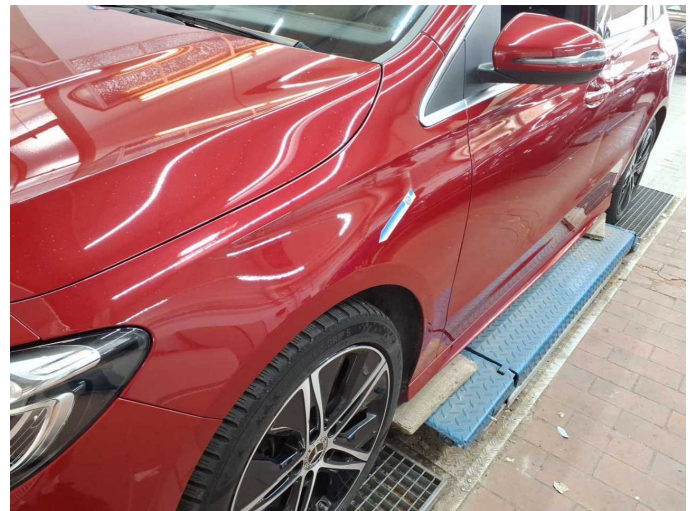

Damage 6: Mudguard - right side: Mudguard - right side - Deformed - Replace

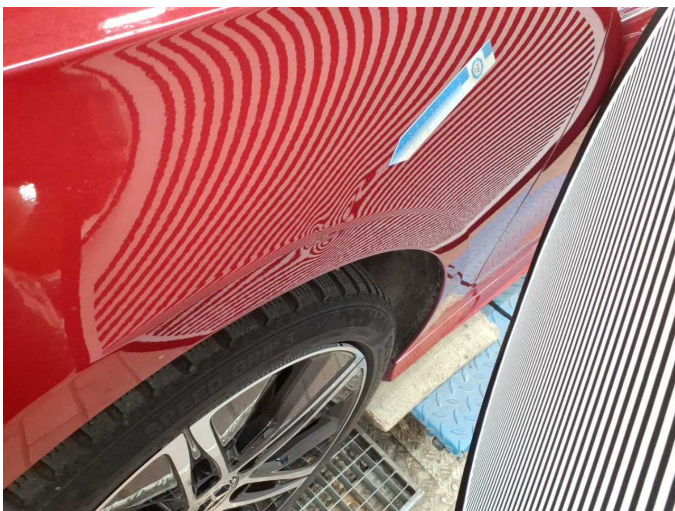

Damage 6: Mudguard - right side: Mudguard - right side - Deformed - Replace




Damage 7: Front bumper: Front bumper (Mit Blende) - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper (Mit Blende) - Scratch(es) - Paint




Damage 7: Front bumper: Front bumper (Mit Blende) - Scratch(es) - Paint

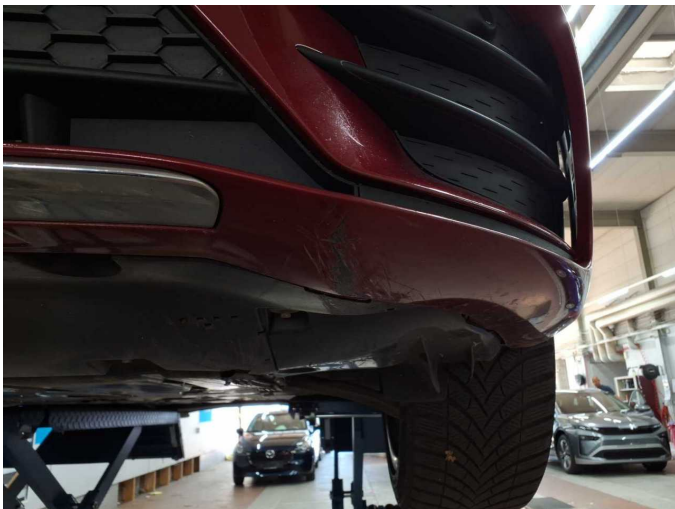

Damage 7: Front bumper: Front bumper (Mit Blende) - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper (Mit Blende) - Scratch(es) - Paint

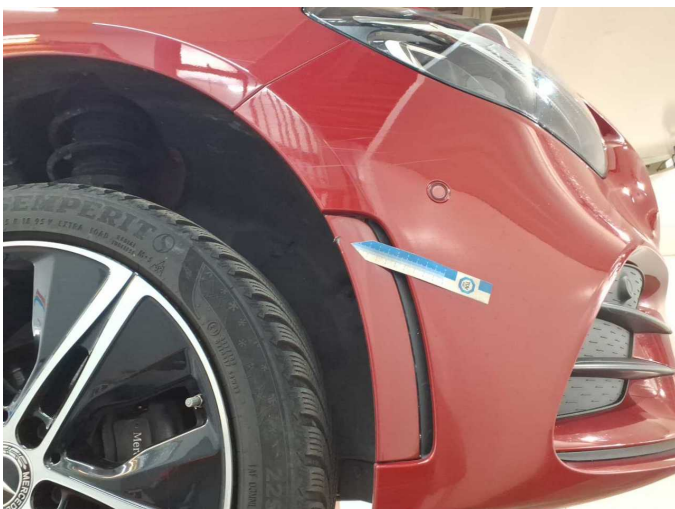

Damage 7: Front bumper: Front bumper (Mit Blende) - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper (Mit Blende) - Scratch(es) - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1K4F1CB9PJ502793

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ B 200 d 8G-DCT AMG Line
Advanced Plus

Datum	KM-Stand	Beschreibung
10.04.2026	100.550	HU + AU; Regelwartungsdienst
11.12.2025	89.826	Bremsscheiben hinten
31.07.2025	74.260	Regelwartungsdienst
07.11.2024	50.389	Bremsinspektion vo + hi; Regelwartungsdienst
11.01.2024	24.476	Regelwartungsdienst