MACADAM











BMW 1 Reeks (UKL): 2BDM100

Vinnumber:	**WBA7M710807K12126**	Versionname:	**116d (F40) 1.5d 116pk/cv 5p**
First Registrationdate:	**12/10/2021**	Fiscalpower:	
Expertise Mileage:	**104818**	Power Kw:	**85**
Bodytype:		Type of rims (mounted)	**Aluminium**
Gearbox:	**MAN 6 VIT**		
Transmission:			
Fueltype:	**Diesel**		
Maintenance	**NOT OK**		
Battery functioning	**Yes**		
Type of rims (mounted)	**Aluminium**		
Certificate of Conformity	**Yes**		
Category	**Passenger Car**		
Registration Certificate Car (BE)	**Yes**		

Options

Number of keys total	**2**	Type of Tow bar	**No Tow bar**
GPS			
Type of Maintenance book	**Digital maintenance**		
Type of GPS storage	**HD**		

Tyres

Summer tyres:	**205/55/16/91 W**			
	Fr.L.	**Bridgestone: 2 mm**	Fr.R.	**Bridgestone: 2 mm**
	Re.L.	**Bridgestone: 5 mm**	Re.R.	**Bridgestone: 5 mm**

Tyre profile depth FL	**2.0**
Tyre profile depth FR	**2.0**
Tyre profile depth RL	**5.0**
Tyre profile depth RR	**5.0**
Tyre size FL	**205/55 R 16 91 W**
Tyre size FR	**205/55 R 16 91 W**
Tyre size RL	**205/55 R 16 91 W**
Tyre size RR	**205/55 R 16 91 W**
Tyre type FL	**Summer**
Tyre type FR	**Summer**
Tyre type RL	**Summer**
Tyre type RR	**Summer**
Tyre make FL	**255**
Tyre make FR	**255**
Tyre make RL	**255**
Tyre make RR	**255**

Assistance equipment

MOT certificate, Missing, Replace



Service, Maintenance, Check



Bonnet, Dent(s), Paintless dent repair




Bonnet, Stone chip(s), Acceptable




Door FL, Scratch(es), Acceptable




Door RL, Scratch(es), Acceptable




Bumper R, Scratch(es), Spot repair





Boot lid covering R, Scratch(es), Acceptable




Outside rear-view mirror R, complete, Scratch(es), Acceptable




Alloy rim RR, Scratch(es), Acceptable




Alloy rim FR, Chemical polution, Acceptable





Bodywork, Paint measurement, Acceptable




Roof, Dent(s), Paintless dent repair



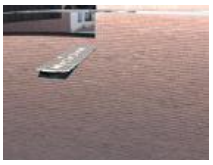

Onderhoudshistorie van: WBA7M710807K12126

ALPHABET

Kenteken	2BDM100
Merk Model	BMW 116d (F40) 1.5d 116pk/cv 5p
Brandstofsoort	Diesel
Datum deel1	10/12/21

Datum reparatie	Kilometerstand	Reparatie omschrijving	Bewerking
9/30/26	104,716	accu	Vervangen
7/31/25	100,788	BMW/MINI service standaard omvang	Uitvoeren
7/31/25	100,788	BMW/MINI service voertuig-check	Uitvoeren
7/31/25	100,788	ruitenwisservloeistof	Bijvullen/-laden
7/31/25	100,788	service luchtfilter	Uitvoeren
7/31/25	100,788	service microfilter	Uitvoeren
7/31/25	100,788	service motorolie	Uitvoeren
4/3/25	91,145	controle niveaus	Uitvoeren
7/26/24	76,310	BMW/MINI service standaard omvang	Uitvoeren
7/26/24	76,310	service brandstoffilter	Uitvoeren
7/26/24	76,310	service microfilter	Uitvoeren
7/26/24	76,310	service motorolie	Uitvoeren
4/4/24	65,319	controle niveaus	Uitvoeren
4/4/24	65,319	remblokken achter	Vervangen
8/21/23	50,965	BMW/MINI service voertuig-check	Uitvoeren
8/21/23	50,965	ruitenwisserrubber achter	Vervangen
8/21/23	50,965	ruitenwisserrubber vooraan	Vervangen
8/21/23	50,965	service luchtfilter	Uitvoeren
8/21/23	50,965	service microfilter	Uitvoeren
8/21/23	50,965	service motorolie	Uitvoeren
9/22/22	26,411	service microfilter	Uitvoeren
9/22/22	26,411	service motorolie	Uitvoeren