



Expertise

Protocol number: 46851186
Order No. / Reference: 26709575
Inspection date: 3 Aug 2026

Manufacturer: Skoda
VIN: TMBJH7NP0L7068175

Model: Superb Combi 2.0 TDI DSG Sportline



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Superb Combi 2.0 TDI DSG Sportline	
Vehicle Identification number	TMBJH7NP0L7068175
Mileage (Read)	201,888 km
First registration	3 Jul 2020
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Black Magic Pearlescent (F9R)
Doors / Seats	5 / 5
Upholstery type	Alcantara / Leather
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	7,000 km
Last service on / at	01/2026 at 191,312 km		
Key is / should be	3 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FU115241
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / APL 00788		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,196 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/40 ZR19 96Y	Summer tyres on Light alloy	Continental	4mm / 5mm
2)	235/40 ZR19 96Y	Summer tyres on Light alloy	Continental	5 mm
	235/40 R19 96W	Summer tyres on Light alloy	Hankook	6 mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 99H	Winter tyres on Light alloy	Dunlop	5mm / 6mm
2)	215/60 R16 99H	Winter tyres on Light alloy	Dunlop	5mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 07/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments (ticket holder on the windshield, 4 roof grab handles, rear with coat hooks, coat hooks on the B-pillar, holder for the warning vests in the front doors, glasses compartment in the headliner, storage compartments in the door panels (front and rear) with 1.5l bottle holders, cup holder in the front center console with easy-open bottle opening, storage pockets on the front seat backrests, storage compartments behind the wheel arches in the trunk including cargo elements, illuminated trunk)
- Illuminated glove compartment
- Hill start assist
- black headliner
- Sportline decorative inlay
- Tachometer
- Dynamic Light Assistant (Masked Continuous High Beam)
- Electric tailgate opening (including boot cover and multifunction storage compartment)
- Electronic Stability Control (ESC)
- Driving profile selection including customizable key (Normal, Eco, Sport, Individual) (incl. additional key)
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Front radar assist including city emergency braking function (The front radar assist warns of impending collisions and initiates braking to reduce the force of an unavoidable impact. The front radar assist continuously monitors the distance to the vehicle ahead using a radar sensor integrated into the radiator grille.)
- Green tec: Start/stop system including brake energy recuperation
- Rear spoiler
- Kessy, keyless entry and start-stop system
- Air Care Climatronic air conditioning (3 zones) (fully automatic, separately adjustable for driver and front passenger, including odor and allergen filter and air-conditioned glove compartment)
- Metal loading sill protector
- LED ambient lighting (decorative strips with selectable color climate, reading lamps, door handles and footwell as well as sun visors with LED lighting - projection of the SKODA lettering from the underside of the door onto the floor (front doors))
- Steering wheel: height and reach adjustable
- Matrix LED headlights (AFS - dynamic high beam assist - automatic headlight range control - headlight cleaning system - LED taillights in crystal glass look - incl. dynamic turn signals)
- Multifunction display with color Maxi-Dot display (with, among other functions: time, outside temperature, current consumption, average consumption, distance traveled, driving time, average speed, fuel range, service interval indicator, door and trunk lid warning, display of information from radio, navigation system and telephone (if available))
- Radio accessories: 2 USB-A ports in the center console
- Radio accessories: In-car communication
- Tire pressure monitoring
- Removable LED rechargeable flashlight in the trunk
- Airbag, driver and switchable passenger airbag
- Airbag, driver's knee airbag
- Airbag, head airbags
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Dashboard in black / black, door trim in black
- Electrically adjustable and heated exterior mirrors
- Electrically folding exterior mirrors (with boarding lights - interior and exterior mirrors with automatic dimming)
- Hydraulic brake assist (HBA)
- Roof rails, painted in glossy black
- Diesel particulate filter and SCR catalyst
- Third brake light
- stainless steel pedals
- Electronic parking brake including auto-hold function
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor (tunnel light, coming and leaving home function)
- Chassis: Adaptive chassis DCC (10 mm lowering, adjustable damper setting) (Driving profile selection including customizable key (Normal, Eco, Sport, Individual) - incl. additional key)
- Front and rear footwell lighting
- Cruise control system (cruise control) including speed limiter
- Transmission: 7-speed dual-clutch transmission (DSG)
- Tinted windows
- Heated rear window
- Rear window wiper including windshield washer system
- ISOFIX preparation on the outer rear seats, including top tether
- Boot cover, roll-up and removable, semi-automatic
- Headrests integrated into front seats, rear headrests height-adjustable
- Radiator grille slats, frame, side moldings, exterior mirror caps, window surrounds in black
- Remote release of the rear seat backrests in the trunk
- Steering wheel: Three-spoke leather steering wheel in sport design with multifunction and shift buttons (including gearshift and handbrake lever in leather (telephone, infotainment and driver assistance system operation))
- Reading lights at the front and rear of the headliner
- Rear center armrest with cup holders and pass-through option
- Front center armrest with storage compartment
- Engine drag torque control (MSR)
- Multi-collision brake
- LED fog lights with integrated cornering lights
- Rear parking sensors
- Upholstery: Alcantara trim in sport black
- Radio: Bolero music system (including capacitive 8" touchscreen in glass design)



- Tire mobility kit (tire repair spray incl. compressor)
- Heated windshield washer nozzles
- Electromechanical power steering
- Seats: Heated front seats
- Seats: Adjustable lumbar support in the front seats
- Seats: Electrically adjustable front seats with memory function
- Seats: Front sports seats
- Sun visor on driver and passenger side with illuminated make-up mirror
- 12V socket in the trunk
- 12V socket in the center console, front and rear
- Sunset (rear window and rear side windows tinted dark)
- Telephone: Comfort hands-free telephone system (without connection to the external antenna)
- Textile floor mats
- Clock display on the rear center console (not included when selecting 3-zone Climatronic)
- Lashing eyes in the trunk
- Central locking with remote control

- Radio accessories: Digital radio reception DAB+
- Radio accessories: SmartLink+ (Apple CarPlay - Android Auto - MirrorLink - SmartGate)
- Wheels: 19" Vega alloy wheels, diamond-cut/anthracite (8J x 19" ET 44 with 235/40 R19 tires)
- Superb safety belts (Height-adjustable three-point front seat belts with belt tensioners - Three three-point rear seat belts - Belt fastening indicator for all seats)
- Seats: Height-adjustable front seats
- Seats: Rear seat backrest split 60:40, foldable
- SKODA Care Connect (SOS emergency call function (Emergency Call incl. automatic activation in the event of an accident with airbag deployment), Mobility service (connection for rapid assistance in case of breakdown), Information service (connection to the hotline for all questions relating to vehicle functions), Free remote vehicle access for 1 year (Remote Access) with access to vehicle data and functions via smartphone, e.g. parking position, activating hazard warning lights, current fuel level)
- Chrome-plated elements (on air vents, light switches, music or navigation systems, air conditioning)
- Immobiliser

Extra equipment

- Adaptive Cruise Control (ACC) (control range up to 210 km/h) (replaces cruise control)
- Paint finish: Pearl effect
- Front and rear parking sensors
- Radio: CANTON sound system (11 speakers - 1 subwoofer - digital equalizer 610W)
- Wheels: 19" Supernova alloy wheels, black/gloss-turned (8J x 19" ET 44 with 235/40 R19 tires)
- Reversing camera with washer nozzle
- Auxiliary heater with radio remote control
- Variable loading floor in the trunk including organizer and aluminum crossbars
- Swiveling trailer hitch including trailer stabilization
- Digital instrument cluster (Virtual Cockpit) 10.2"
- Package: Business Amundsen (Combi) (Amundsen dynamic radio navigation system - 8" capacitive touchscreen in glass design - color Maxi-Dot display - traffic sign recognition - Phonebox with inductive charging function (connection via external antenna) - voice control - driver fatigue detection - 230 V socket and USB ports - Sunset - Infotainment Online (3-year subscription) - luggage net partition)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Wing mirror - right side	Cap - Scratch(es) - Smart repair
2	Door - front left side	Door - Dent / paintcoat damage - Smart repair
3	Door - front left side	Brightware - upper - Scratched - Replace
4	Wheel / tyres	Tyre - rear right side (nicht fahrbereit) - Damaged - Replace
5	Wheel / tyres	Tyre - front right side (nicht fahrbereit) - Damaged - Replace
6	Wheel / tyres	Alloy rim - front left side (Materialabtrag) - Scratch(es) - Replace
7	Wheel / tyres	Alloy rim - front right side (Materialabtrag) - Scratch(es) - Replace
8	Rear bumper	Rear bumper - Scratch(es) - Paint
9	Front bumper	Front bumper - Scratch(es) - Paint
10	Vehicle glazing	Windscreen - Stone chips - repair according to calculation

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 13 Dec 2021	1.848,27 €
2	Rear, Side - left, Provided by user / customer, from 31 Jan 2025	2.139,22 €
3	Front, Provided by user / customer, from 21 Feb 2023	3.331,44 €
4	Rear, Side right, Provided by user / customer, from 24 Mar 2024	3.360,72 €
5	Front, Rear, Side right, Provided by user / customer, from 1 Sept 2024	10.152,90 €

Repainting

No.	Repainting
1	Side panel - rear left side, Professionally carried out
2	Side panel - rear right side

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 8: Instrument panel



Figure 10: Cargo area

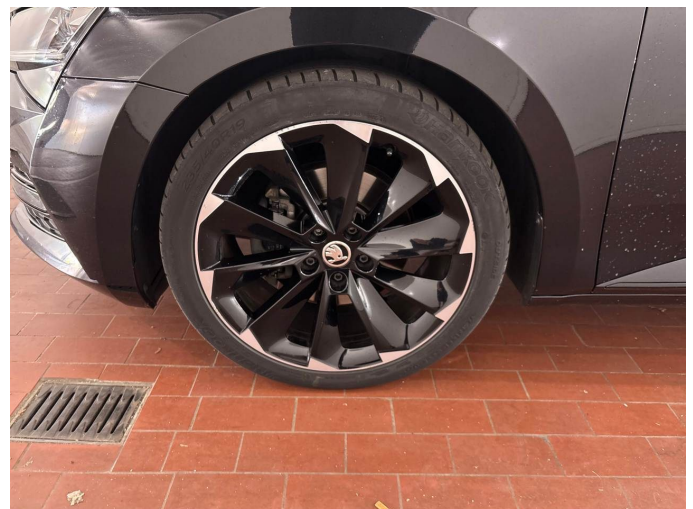


Figure 12: Mounted tyres

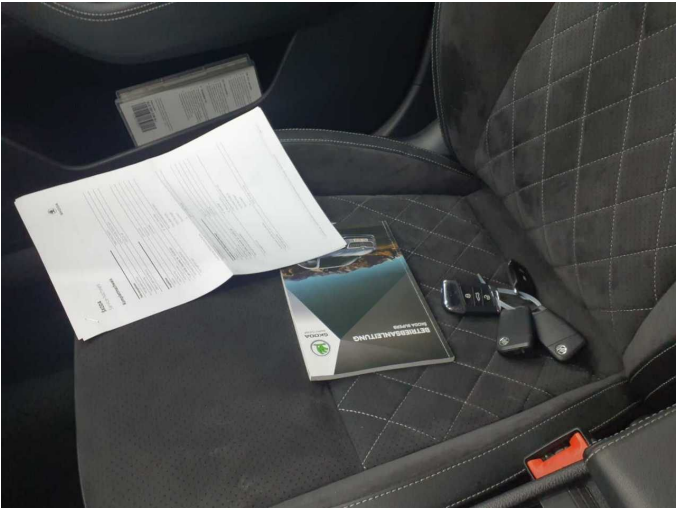


Figure 13: Documents

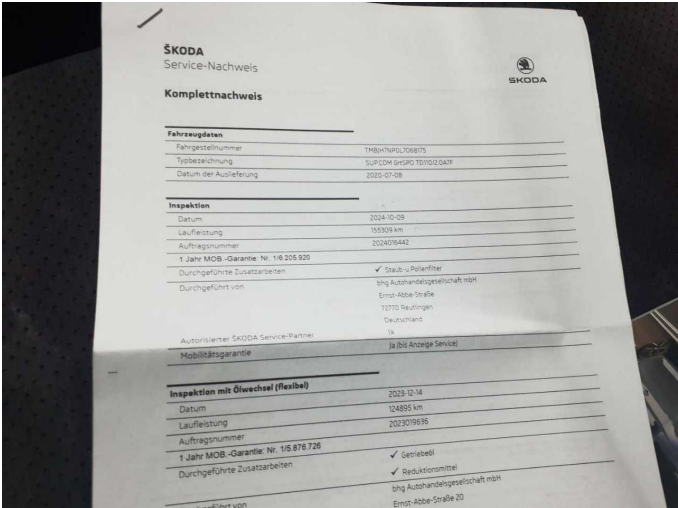


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.

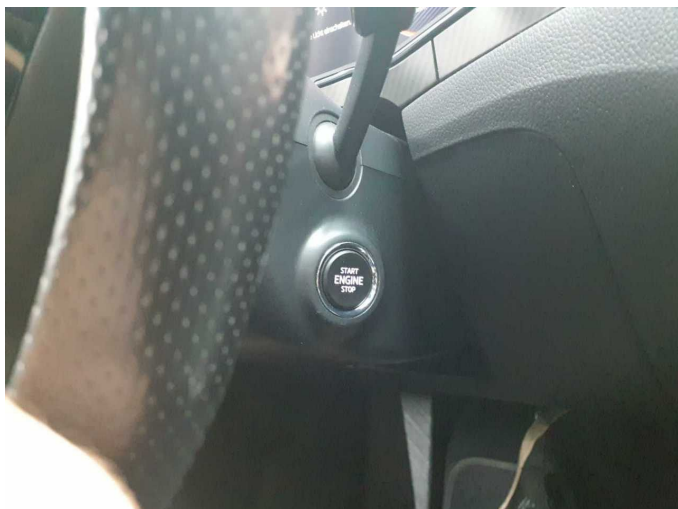


Figure 19: Misc.



Figure 20: Misc.

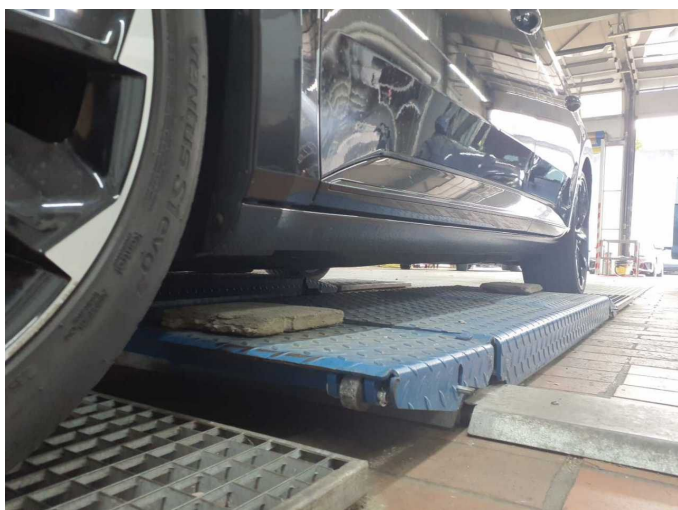


Figure 21: Misc.



Figure 22: Misc.

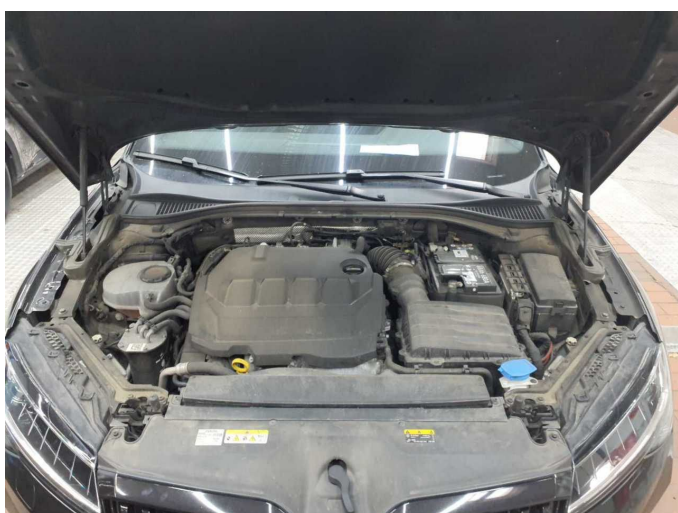


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

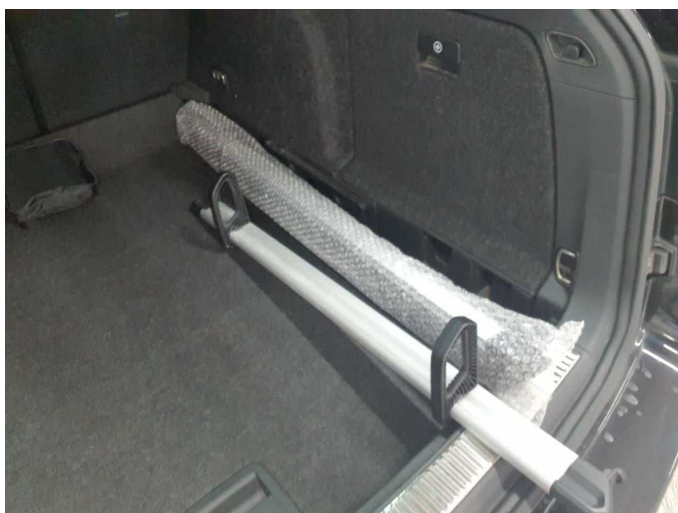


Figure 29: Misc.



Figure 30: Misc.




Figure 31: Misc.




Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair




Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair

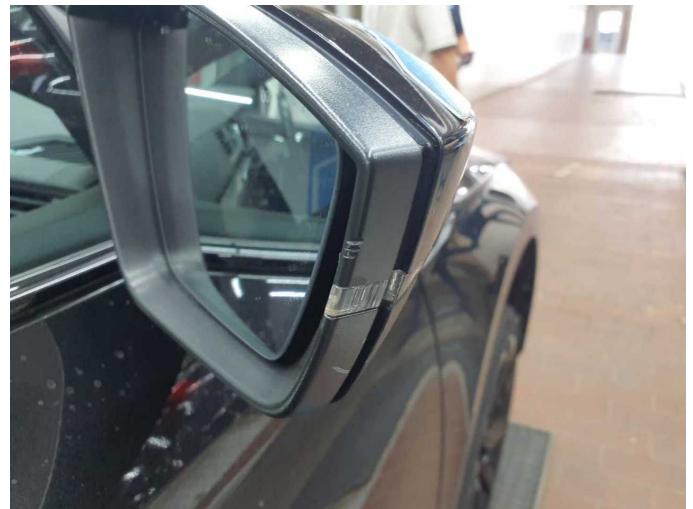

Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair

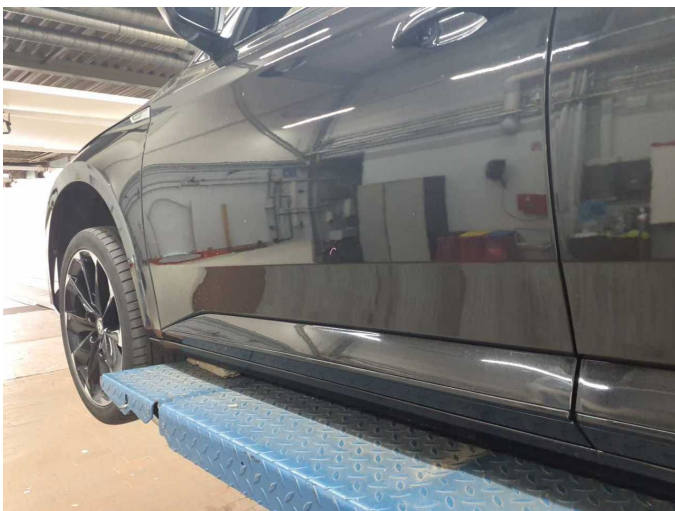


Damage 2: Door - front left side: Door - Dent / paintcoat damage - Smart repair

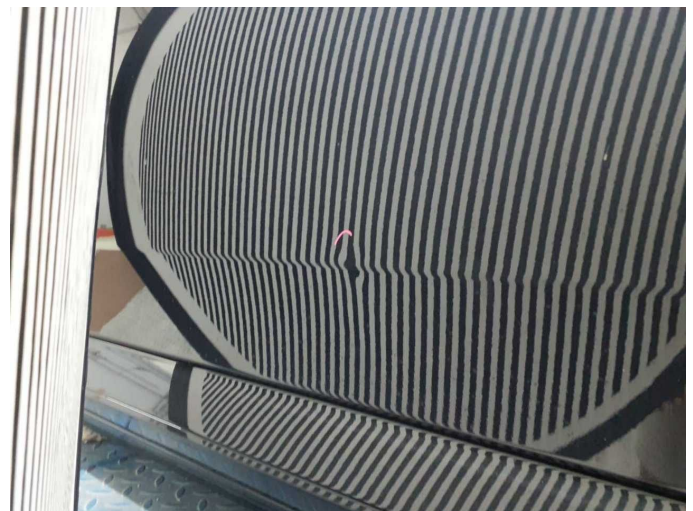


Damage 2: Door - front left side: Door - Dent / paintcoat damage - Smart repair



Damage 3: Door - front left side: Brightware - upper - Scratched - Replace

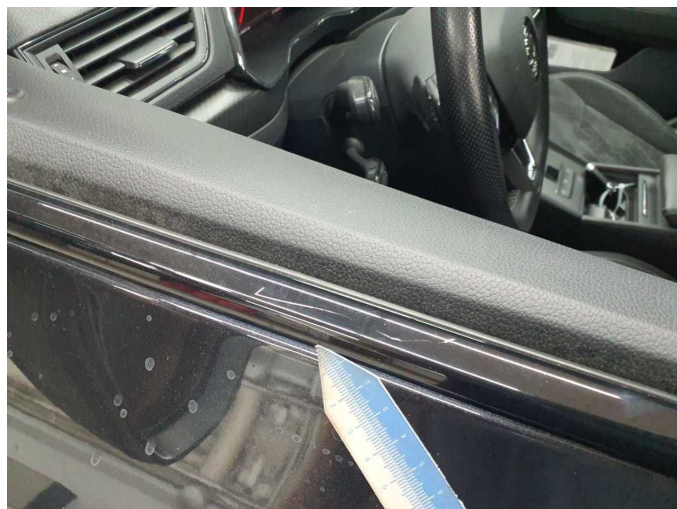


Damage 3: Door - front left side: Brightware - upper - Scratched - Replace

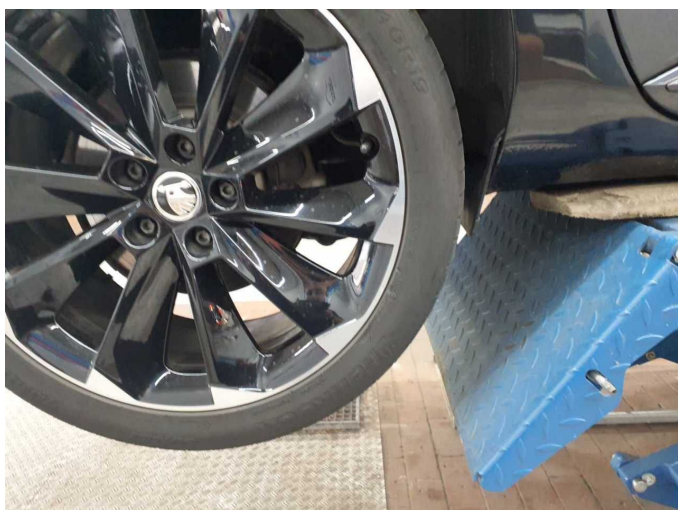


Damage 4: Wheel / tyres: Tyre - rear right side (nicht fahrbereit) - Damaged - Replace



Damage 4: Wheel / tyres: Tyre - rear right side (nicht fahrbereit) - Damaged - Replace

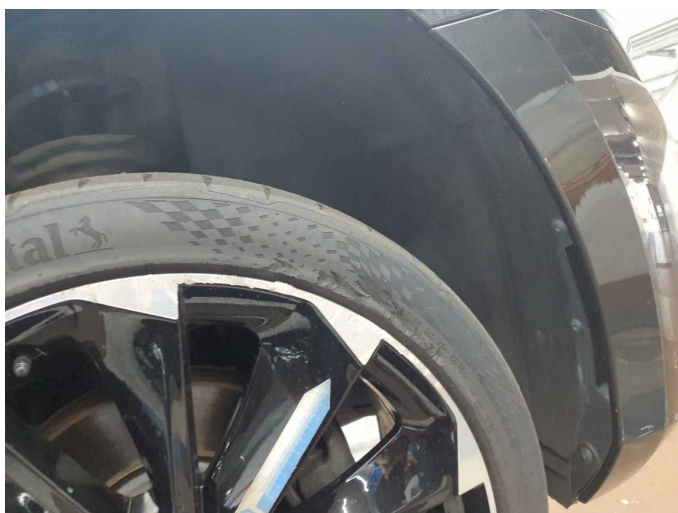

Damage 5: Wheel / tyres: Tyre - front right side (nicht fahrbereit) - Damaged - Replace

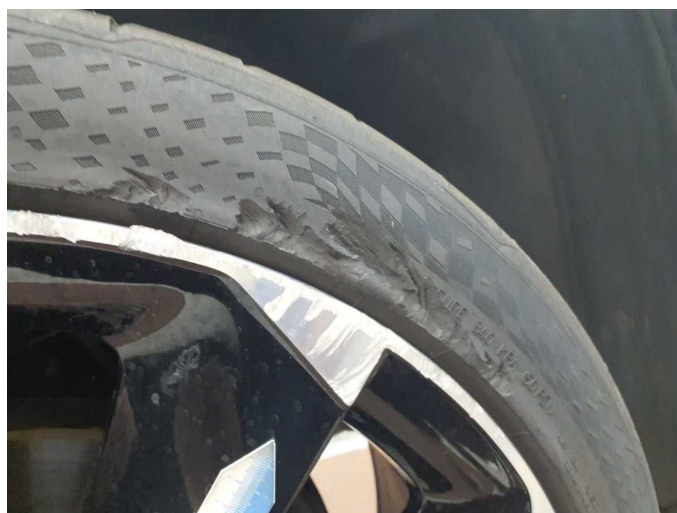

Damage 5: Wheel / tyres: Tyre - front right side (nicht fahrbereit) - Damaged - Replace



Damage 5: Wheel / tyres: Tyre - front right side (nicht fahrbereit) - Damaged - Replace



Damage 6: Wheel / tyres: Alloy rim - front left side (Materialabtrag) - Scratch(es) - Replace



Damage 6: Wheel / tyres: Alloy rim - front left side (Materialabtrag) - Scratch(es) - Replace




Damage 7: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratch(es) - Replace



Damage 7: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratch(es) - Replace



Damage 7: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratch(es) - Replace

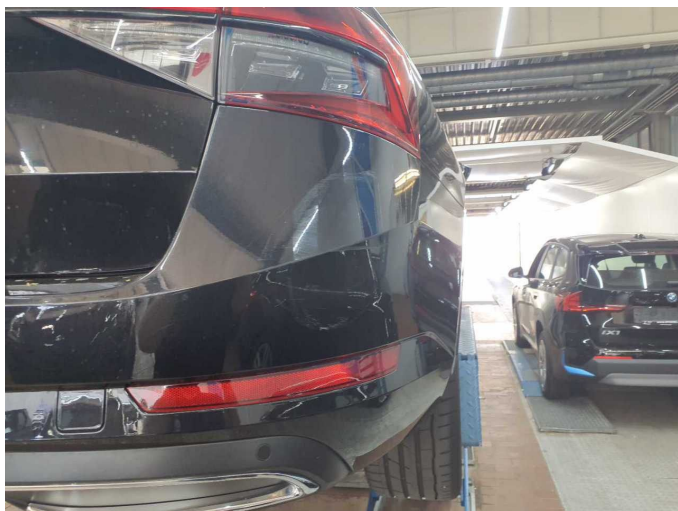

Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 9: Front bumper: Front bumper - Scratch(es) - Paint



Damage 9: Front bumper: Front bumper - Scratch(es) - Paint

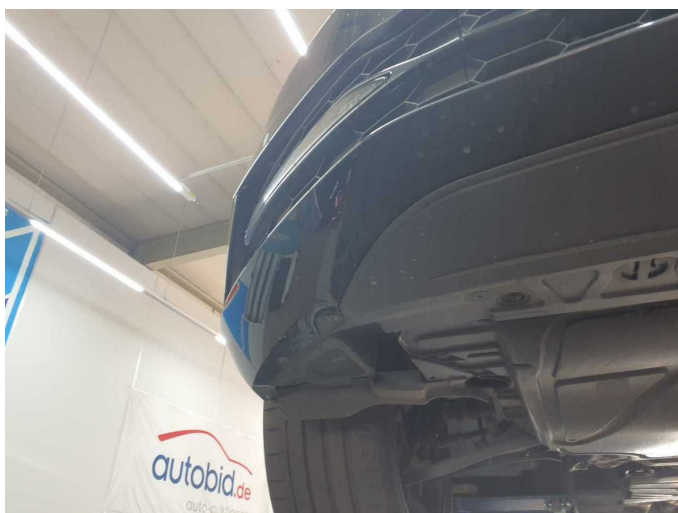

Damage 9: Front bumper: Front bumper - Scratch(es) - Paint

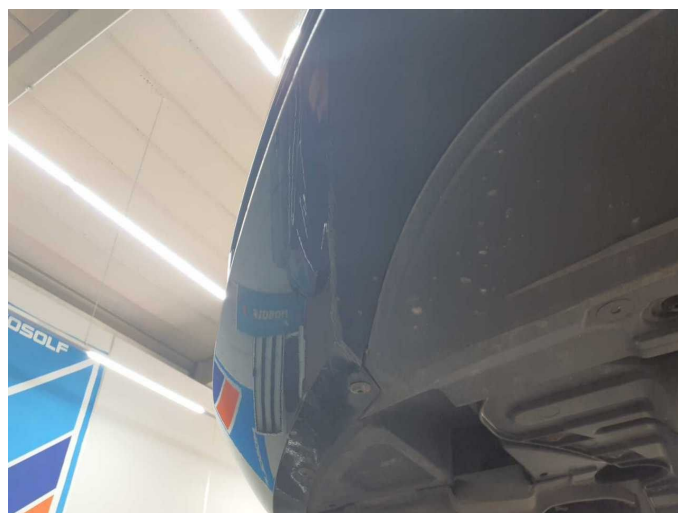

Damage 9: Front bumper: Front bumper - Scratch(es) - Paint



Damage 9: Front bumper: Front bumper - Scratch(es) - Paint



Damage 9: Front bumper: Front bumper - Scratch(es) - Paint



Damage 10: Vehicle glazing: Windscreen - Stone chips - repair according to calculation



Damage 10: Vehicle glazing: Windscreen - Stone chips - repair according to calculation



Previous damage 1: Side right




Previous damage 1: Side right




Repainting 1: Side panel - rear left side



Repainting 1: Side panel - rear left side

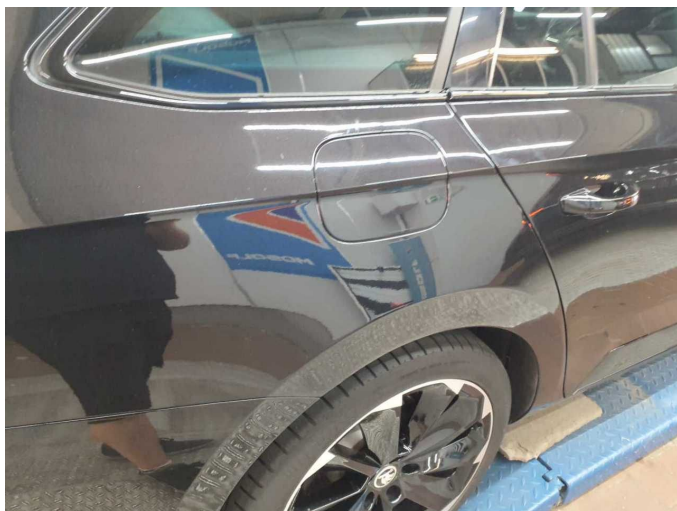

Repainting 2: Side panel - rear right side

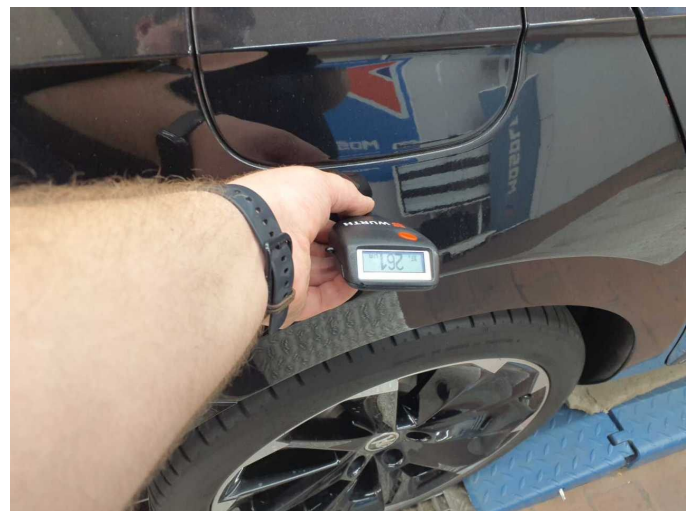

Repainting 2: Side panel - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJH7NP0L7068175
Hersteller / Modell: SKODA SKODA Superb Combi 2.0 TDI DSG Sportline

Datum	KM-Stand	Beschreibung
23.01.2026	191.312	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
29.09.2025	178.816	AU; Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst; Wartung Sonstiges
13.02.2025	165.322	Batterie ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/ Eigendiagnose; Wartung Sonstiges
14.11.2024	155.309	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Regelwartungsdienst
28.06.2024	145.458	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges
23.12.2023	124.895	Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
08.09.2023	115.186	AU; Bremsflüssigkeit; Bremsflüssigkeit ern
25.05.2023	104.605	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
25.01.2023	90.482	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst; Systemtest/Eigendiagnose
21.09.2022	78.444	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
22.04.2022	60.372	Regelwartungsdienst; Wartung Sonstiges
10.02.2022	51.537	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
30.06.2021	30.137	Regelwartungsdienst
24.03.2021	22.230	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges