

MACADAM

ALFA ROMEO STELVIO MY20

Vehicle information

Make:	ALFA ROMEO	License:	
Gearbox:	Automatic	Body color:	Dark Grey
Model:	STELVIO MY20	VIN:	ZARPAHDXXL7D00036
Fuel type:	Diesel	Power:	
Version:	2.2 D 210CH AT8 Q4	First registration	08/12/2020
Mileage:	155332 km	N° of doors:	

Damage summary

Front	1
Interior	2
Left	3
Rear	4
Right	2
Wheels	5

Commercial pictures





Options according to the inspector

Rear view camera	Yes	Sun Roof electric	Yes
------------------	-----	-------------------	-----


Damages

Alloy rim FL
Scratch(es)
Repair/replace (lump sum)
Wheels



Alloy rim FR

Scratch(es)
Repair/replace (lump sum)
Wheels

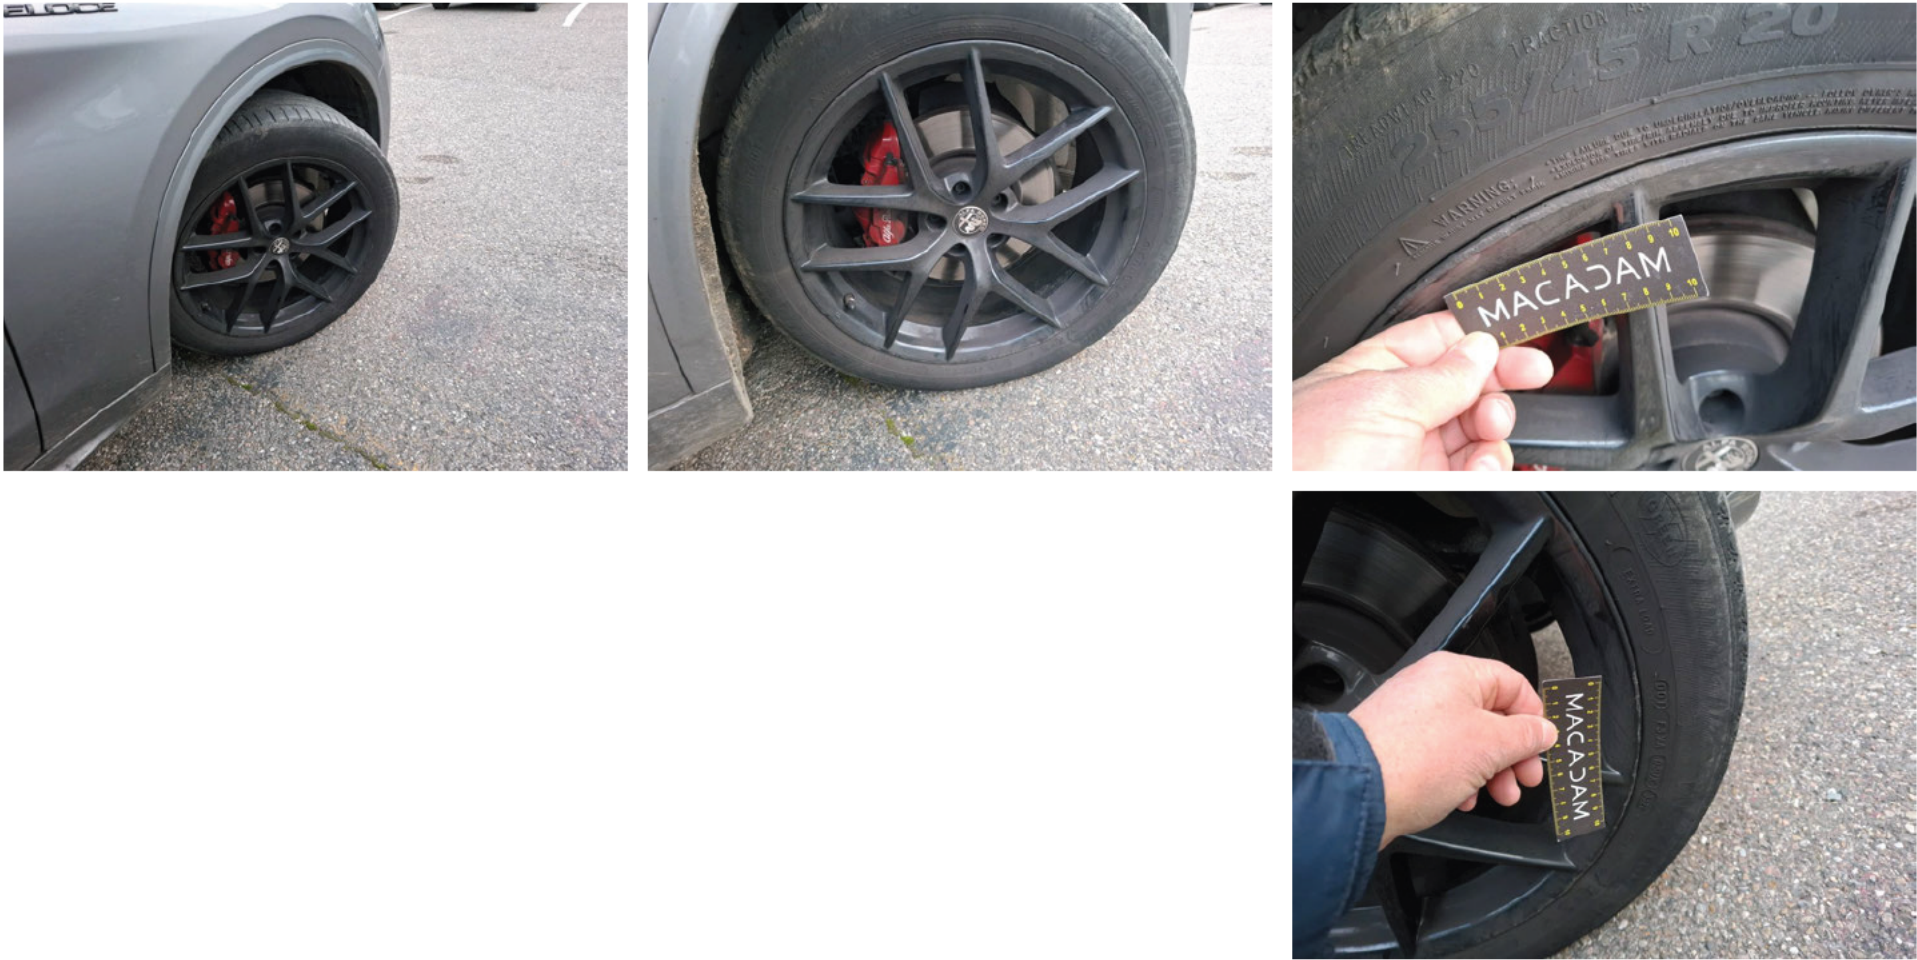

Alloy rim RL

Scratch(es)
Repair/replace (lump sum)
Wheels



Alloy rim RR

Scratch(es)
Repair/replace (lump sum)
Wheels



Bumper F

Scratch(es)
Paint
Front



Bumper moulding R

Scratch(es)
Paint
Rear



Bumper R

Deformed / Strained
Repair and paint (complete)
Rear



Interior

Stain
Chemical cleaning
Interior



Outer sill R

Dent(s) and scratch(es)
Repair and paint (complete)
Right




Reflector
Broken
Replace
Rear



Remote ignition key (no insert)
Missing
Repair/replace (lump sum)
Interior



Tailgate / Boot
Dent(s) and scratch(es)
Repair and paint (complete)
Rear

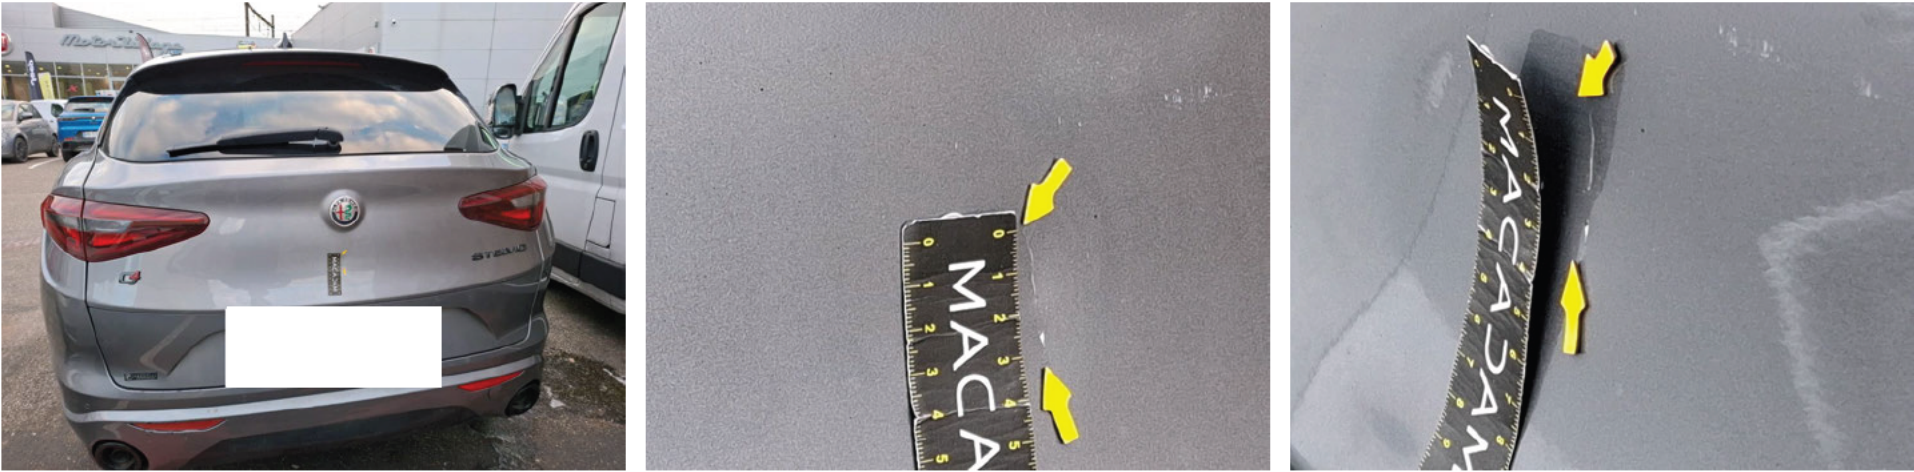

Tyre RL
Tear
Replace
Wheels



Wing RL

Dent(s) and scratch(es)
Repair and paint (complete)
Left



Wing RR

Dent(s) and scratch(es)
Repair and paint (complete)
Right



Wing trim FL

Scratch(es)
Paint
Left



Wing trim RL
Scratch(es)
Paint
Left



Tyres

	Front Left
	Summer
	255/45/20/105/V
	Michelin
	4.3 mm
	Front Right
	Summer
	255/45/20/105/V
	Michelin
	4.5 mm
	Rear Left
	Summer
	255/45/20/105/V
	Michelin
	4.3 mm
	Rear Right
	Summer
	255/45/20/105/V
	Michelin
	4.2 mm

Checks

Body colour	Dark Grey	Category	Passenger Car
Charging cable present?		Compressor	Yes
	Combustion engine vehicle / non-rechargeable		
Emergency spare wheel	N/A	Engine functioning	Yes
Fuel Level	50	Jack	N/A
Luggage cover	Yes	Maintenance	OK
Number head rests	5	Number keys remote	1
Number of keys total	1	Number of seats	5
Paint type	Metalic	Registration Certificate	No
Registration Certificate	N/A	Repair kit	Yes
Roof rack	N/A	Runflat	N/A
Service book	No	Spare wheel	N/A
Type of rims (mounted)	Aluminium	User's manual	Yes
Warning lights (maintenance, pollution, etc ..) ?	No		

Information on the content and the scope of the inspection report:

- The assessment is based on the sales standards specified by the customer.
- Acceptable usage damages according to the sales standards are not always documented in this status report.
- The specified repair methods and/or resulting repair times have been determined, taking into account modern industrial repair methods.
- The purchasing dealer should assess individual repair costs.
- The inspection was carried out in a non-disassembly condition. Macadam cannot be held responsible for any missing information. For further information, please contact the seller.