MACADAM








Volkswagen Arteon (KKL): 2CHU862

Vinnumber:	**WVWZZZ3HZPK000618**	Versionname:	**Arteon SB R-Line Business Premium 2.0TDi 150pk/cv 5p DSG7**
First Registrationdate:	**3/08/2022**	Fiscalpower:	
Expertise Mileage:	**69263**	Power Kw:	**110**
Bodytype:		Type of rims (mounted)	**Aluminium**
Gearbox:	**Automatic**		
Transmission:			
Fueltype:	**Diesel**		
Maintenance	**OK**		
Maintenance	**21400.0**		
Battery functioning	**Yes**		
Type of rims (mounted)	**Aluminium**		
Certificate of Conformity	**Yes**		
Category	**Passenger Car**		
Registration Certificate Car (BE)	**Yes**		

Options

Number of keys total	**1**	Luggage cover	
GPS		Type of Tow bar	**No Tow bar**
Type of Maintenance book	**Digital maintenance**		
Type of GPS storage	**HD**		

Tyres

Summer tyres:	**245/45/18/96 W**			
	Fr.L.	**Continental: 5 mm**	Fr.R.	**Continental: 5 mm**
	Re.L.	**Continental: 6 mm**	Re.R.	**Continental: 6 mm**

Tyre profile depth FL	**5.0**
Tyre profile depth FR	**5.0**
Tyre profile depth RL	**6.0**
Tyre profile depth RR	**6.0**
Tyre size FL	**245/45 R 18 96 W**
Tyre size FR	**245/45 R 18 96 W**
Tyre size RL	**245/45 R 18 96 W**
Tyre size RR	**245/45 R 18 96 W**
Tyre type FL	**Summer**
Tyre type FR	**Summer**
Tyre type RL	**Summer**
Tyre type RR	**Summer**
Tyre make FL	**256**
Tyre make FR	**256**
Tyre make RL	**256**
Tyre make RR	**256**

Assistance equipment


Emergency spare wheel	**Yes**	Jack	**Yes**

Ignition key, Missing, Replace



Interior, Dirty, Cleaning



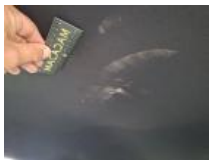





Engine insulation, Damaged, Replace




Windscreen, Repaired, Acceptable




Alloy rim FL, Scratch(es), Repair and paint (complete)






Door RL, Dent(s), Acceptable




Alloy rim RL, Scratch(es), Repair and paint (complete)





Bumper R, Scratch(es), Acceptable





Alloy rim RR, Scratch(es), Repair and paint (complete)






Step R, Dent(s), Acceptable




Alloy rim FR, Scratch(es), Repair and paint (complete)





Outside rear-view mirror housing R, Scratch(es), Acceptable




Wing FR, Repaired, Check




Door FR, Repaired, Check




Wing RR, Repaired, Check




Onderhoudshistorie van: WVWZZZ3HZPK000618

ALPHABET

Kenteken	2CHU862
Merk Model	Volkswagen Arteon SB R-Line Business Premium 2.0TDi 150pk/cv 5p DSG7
Brandstofsoort	Diesel
Datum deel1	8/3/22

Datum reparatie	Kilometerstand	Reparatie omschrijving	Bewerking
8/4/26	69,262	klein materiaal	
8/4/26	69,262	Onderhoudsbeurt (variabel interval)	Uitvoeren
8/26/25	53,487	klein materiaal	
8/26/25	53,487	koelwatervloeistof	Bijvullen/-laden
8/26/25	53,487	Onderhoudsbeurt (variabel interval)	Uitvoeren
8/26/25	53,487	remblokken achter	Vervangen
8/26/25	53,487	ruitenwisservloeistof	Bijvullen/-laden
2/17/25	44,862	airco systeem reiniging	Uitvoeren
2/17/25	44,862	batterij	Vervangen
2/17/25	44,862	klein materiaal	
2/17/25	44,862	koelwatervloeistof	Bijvullen/-laden
2/17/25	44,862	luchtfilter interieur	Vervangen
2/17/25	44,862	remvloeistof	Vervangen
2/17/25	44,862	ruitenwisserrubber achter	Vervangen
2/17/25	44,862	ruitenwisserrubber vooraan	Vervangen
2/17/25	44,862	ruitenwisservloeistof	Bijvullen/-laden
2/17/25	44,862	Tussentijds onderhoud (vast interval)	Uitvoeren
10/3/23	24,512	Inspectie met olieververvanging (vast in	Uitvoeren
10/3/23	24,512	klein materiaal	
10/3/23	24,512	koelwatervloeistof	Bijvullen/-laden
10/3/23	24,512	ruitenwisservloeistof	Bijvullen/-laden
12/9/22	6,912	controle niveaus	Uitvoeren
12/9/22	6,912	klein materiaal	
12/9/22	6,912	ruitenwisservloeistof	Bijvullen/-laden