



Expertise

Protocol number: 47203481  
Order No. / Reference: 26766169  
Inspection date: 24 Aug 2026

Manufacturer: Volkswagen  
VIN: WVGZZZ5NZNW526895

Model: Tiguan 2.0 TDI SCR R-Line



| Vehicle details                         |                         |
|-----------------------------------------|-------------------------|
| Manufacturer / Type / Model / Equipment |                         |
| Volkswagen Tiguan 2.0 TDI SCR R-Line    |                         |
| Vehicle Identification number           | WVGZZZ5NZNW526895       |
| Mileage (Read)                          | 141,708 km              |
| First registration                      | 13 Jun 2022             |
| Number of holders                       | 1                       |
| Next periodical technical inspection    | 08/2027                 |
| (Report not on hand)                    |                         |
| Fuel type                               | Diesel                  |
| Engine displacement / Cylinder          | 1,968 ccm / 4           |
| Power                                   | 110 kW                  |
| Gearbox / Number of gears               | Manual / 6              |
| Type of drive                           | Front drive             |
| Type of vehicle                         | SUV                     |
| Colour / colour code                    | Oryxweiß Perlmutteffekt |
| Doors / Seats                           | 5 / 5                   |
| Upholstery type                         | Cloth                   |
| Colour of upholstery                    | Grey-Black              |
| Vehicle with smoke odor                 | no                      |



## Vehicle details

|                                                      |                          |                                |                                                            |
|------------------------------------------------------|--------------------------|--------------------------------|------------------------------------------------------------|
| <b>Maintenance booklet / proof</b>                   | digital proof / complete | <b>Next maintenance in</b>     | 5,100 km                                                   |
| <b>Last service on / at</b>                          | 08/2025 at 117,535 km    |                                |                                                            |
| <b>Key is / should be</b>                            | 2 / 2                    | <b>FZG documents</b>           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                                      |                          | <b>Letter No.</b>              | GJ168157                                                   |
| <b>Previous damage / Accident</b>                    | None detectable          | <b>Repainting</b>              | None detectable                                            |
| <b>Inspection conditions</b>                         | sufficient               | <b>Lifting equipment / pit</b> | yes                                                        |
| <b>Test drive</b>                                    | Not performed            | <b>Engine function test</b>    | Performed                                                  |
| <b>Manufacturer key number/<br/>type code number</b> | 0603 / BZG 21285         |                                |                                                            |
| <b>Emission standard</b>                             | EURO6                    | <b>fine dust sticker</b>       |                                                            |
| <b>Permitted total weight</b>                        | 2,140 kg                 | <b>Empty weight</b>            |                                                            |

## Tyres

### Mounted tyres

| #  | Tyre size       | Type of tyre                | Manufacturer | Tread depth |
|----|-----------------|-----------------------------|--------------|-------------|
| 1) | 255/40 R20 101V | Summer tyres on Light alloy | Continental  | 4mm / 4mm   |
| 2) | 255/40 R20 101V | Summer tyres on Light alloy | Continental  | 4mm / 4mm   |

### Additional tyres

| #  | Tyre size       | Type of tyre                | Manufacturer | Tread depth |
|----|-----------------|-----------------------------|--------------|-------------|
| 1) | 215/65 R17 103H | Winter tyres on Light alloy | Continental  | 5mm / 5mm   |
| 2) | 215/65 R17 103H | Winter tyres on Light alloy | Continental  | 5mm / 5mm   |

### Replacement

| Typ | Tyre size       | Type of tyre          | Manufacturer | Tread depth |
|-----|-----------------|-----------------------|--------------|-------------|
| N   | 145/85 R18 103M | Summer tyres on Steel | Sonstige     | 4 mm        |

**Legend:** Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

## Equipment

### Standard equipment

- Airbag for driver and front passenger including knee airbag on the driver's side
- 30-color ambient lighting
- Adaptive Cruise Control (ACC)
- Electrically adjustable and heated exterior mirrors
- Chrome applications on mirror adjustment switches, window regulator switches, door pull handles
- Diesel particulate filter
- Tachometer
- Parking assistance
- Electronic Stability Program with counter-steering support
- Automatic headlight control, with LED daytime running lights
- High beam control Light Assist
- Pedestrian detection
- Transmission: 6-speed manual transmission
- rear window wiper
- Interior mirror automatically dimming
- LED license plate lighting
- Combination instrument cluster with electronic speedometer
- LED reading lights, 2 in the front and 2 in the rear
- Light in the front footwell
- Front center armrest adjustable in height and length, with storage box and rear air vents
- Emergency call service
- Pedals and footrest in brushed stainless steel
- Radio accessories: 8 speakers
- Tire pressure monitoring system
- Drawers under the front seats
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Lumbar support in the front
- Seats: Top comfort seats in the front
- Start-stop system with brake energy recuperation
- Power outlet: 2 USB-C ports on the front
- Textile floor mats front and rear with decorative stitching in grey
- Green thermal insulation glazing, sides and rear
- Airbag: Head airbag system for front and rear passengers including front side airbags
- App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto
- third brake light
- black roof rails
- Decorative inlays "Carbon Grey"
- Display: Digital Cockpit Pro, multicolor, various selectable info profiles
- Electronic parking brake including auto-hold function
- Driving assistant "Travel Assist" and lane keeping assistant "Lane Assist"
- Electric windows front and rear
- Windscreen made of laminated safety glass, heat and sound insulating
- Rear window heated
- Rear spoiler in R-style
- ISOFIX mounting points, also for i-Size child car seats
- Air conditioning system "Air Care Climatronic"
- Rear headrests (3)
- Front headrests
- Steering wheel: Multifunction sports steering wheel in leather, heated, with touch controls
- Fatigue detection
- Non-smoking version
- Package: Winter
- Upholstery: Cloth
- Rain sensor
- Gearshift knob in leather
- electromechanical power steering
- Seats: Front passenger seat backrest folds down completely
- Seats: Rear bench seat asymmetrically split
- Seats: Front seats with height adjustment
- 12-volt socket
- Bumpers in body color, in "R-Line" styling
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Central locking without safe locking, with remote control and 2 remote keys



## Extra equipment

- Foldable towbar (electric release)
- Chassis: Adaptive chassis control DCC (including driving profile selection)
- Paint finish: Pearlescent effect
- LED matrix headlights - IQ.LIGHT (Dynamic Light Assist high beam control for LED matrix headlights - LED headlights with LED daytime running lights and cornering lights - LED taillights, dark red)
- Package: Business Premium (App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto - Leather multifunction steering wheel, heated - Automatically heated front windscreen washer nozzles - Voice control - "Comfort" telephone interface with inductive charging function - Heated front seats)
- Package: Driver assistance package "Plus" (Driving assistant "Travel Assist" and lane keeping assistant "Lane Assist" - Parking steering assistant "Park Assist" incl. parking aid - Proactive occupant protection system in conjunction with "Front Assist" - Lane change assistant "Side Assist" and parking assistant - Traffic sign recognition)
- Wheels: Alloy (4) "Suzuka" 8.5 J x 20, Volkswagen R (in black - AirStop tires 255/40 R 20 - wheel locks with enhanced theft protection)
- Surround view "Area View" (incl. reversing camera "Rear View")
- Electrically adjustable, folding, and heated exterior mirrors, ambient lighting, passenger-side mirror lowering function
- Wirelessly heated windshield (infrared-reflective, noise-reducing)
- Navigation system "Discover Media" incl. "Streaming & Internet" (20.3 cm TFT touchscreen - FM radio reception - Dual tuner with phase diversity for best possible radio reception - Radio Data System (RDS) - Radio station logos - MP3 playback - USB-C interface with Apple compatibility - 4 x 20 watt output power - Map with 2D display - 3-band sound control - Telephone interface - Traffic sign recognition - Points of interest - DAB+ digital radio reception)
- Package: Exterior Design Package "Black Style" (4 "Valencia" 8.5 J x 19 alloy wheels in black, Airstop tires 255/45 R 19, optimized for rolling resistance - black exterior mirror housings - tinted rear side windows and rear window, approximately 90% light-absorbing - bumpers in body color, in "R-Line" styling, with design elements in black - black trim strips)
- Radio accessories: "Harman Kardon" sound system (8+1 speakers - 480 watts total power - digital 16-channel amplifier - subwoofer)
- Wheels: Spare wheel in a weight- and space-saving design (on-board tools and jack - luggage compartment floor height-adjustable in 2 stages - spare wheel in a weight- and space-saving design)

## Brief expert findings

|                      |                                                                                                                                                                              |
|----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy) |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.    |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>Lifting equipment and/or a pit were available for examining the vehicle.                     |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                        |
| Engine function test | An engine test run was performed.                                                                                                                                            |

## Value reducing factors

| No. | Component group          | Description                       |
|-----|--------------------------|-----------------------------------|
| 1   | Wing mirror - left side  | Cap - Scratch(es) - Smart repair  |
| 2   | Wing mirror - right side | Cap - Scratch(es) - Smart repair  |
| 3   | Rear bumper              | Rear bumper - Scratch(es) - Paint |

## Wear and tear

| No. | Component group | Description                               |
|-----|-----------------|-------------------------------------------|
| 1   | Vehicle glazing | Windscreen - Stone chips - No deduction   |
| 2   | Front bumper    | Front bumper - Stone chips - No deduction |
| 3   | Vehicle glazing | Rear window - Scratch(es) - No deduction  |

The vehicle shows signs of wear and tear commensurate with its age and use.



## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
*(Delivery by third-party service providers)*
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
*(Functional testing of driver assistance systems is not included in the scope of services!)*
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

## Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



**Figure 1:** Diagonal front (left)




**Figure 2:** Diagonal front (right)



**Figure 3:** Diagonal rear (left)



**Figure 4:** Diagonal rear (right)

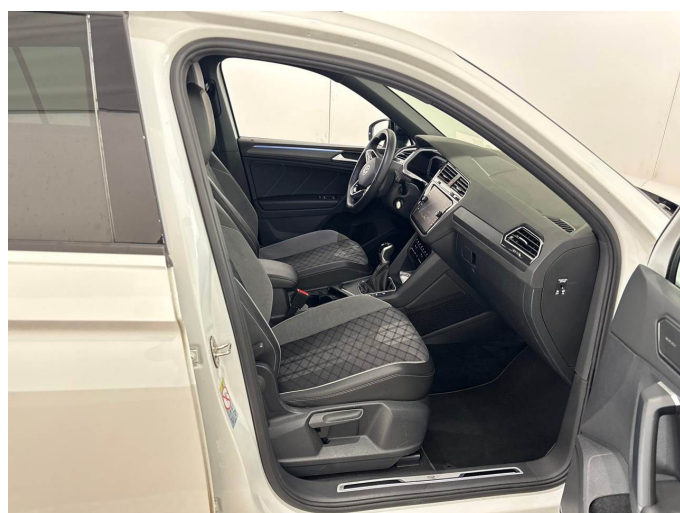

**Figure 5:** Interior - front



**Figure 6:** Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

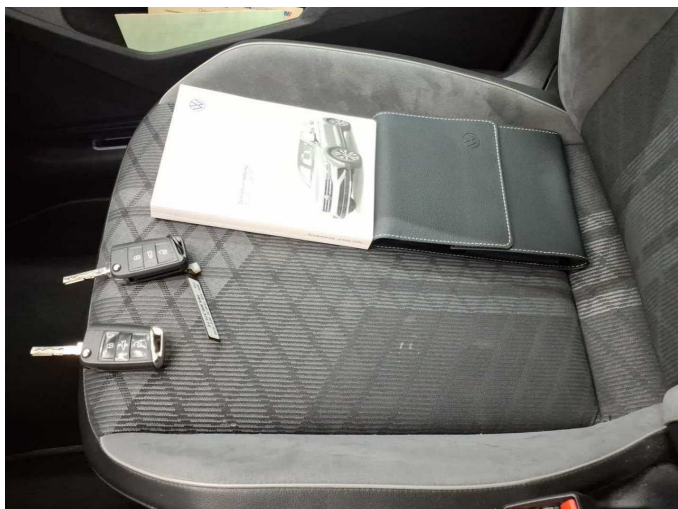


Figure 13: Documents

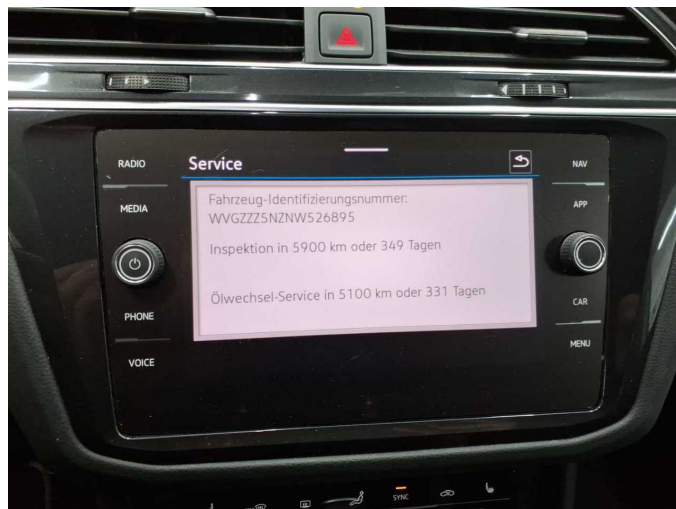


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Additional tyres

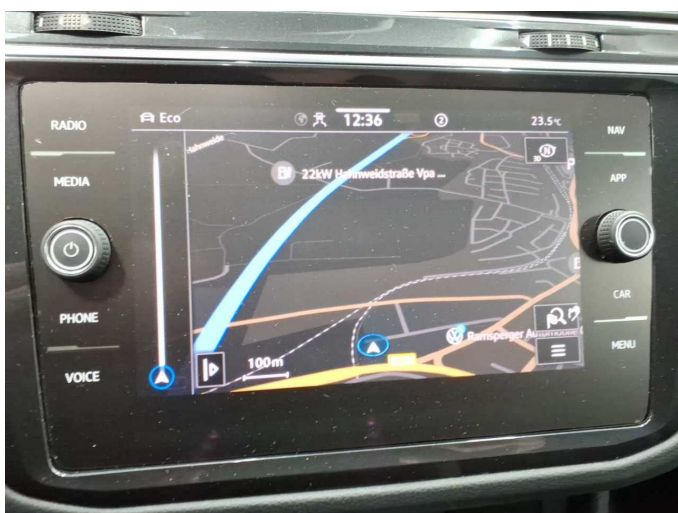


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.

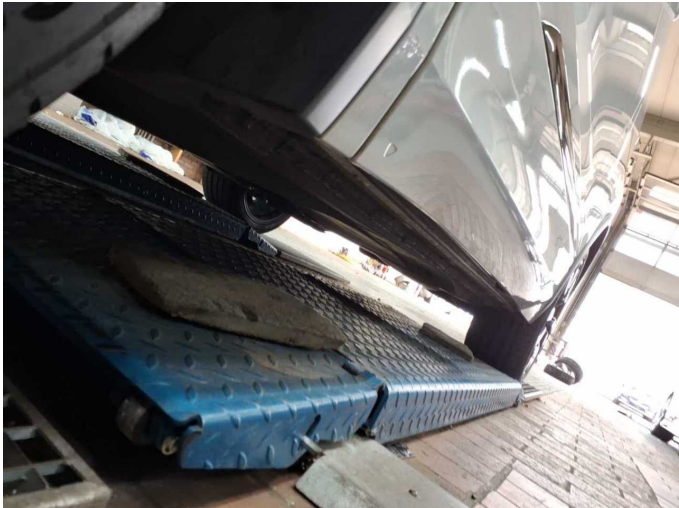


Figure 20: Misc.



Figure 21: Misc.

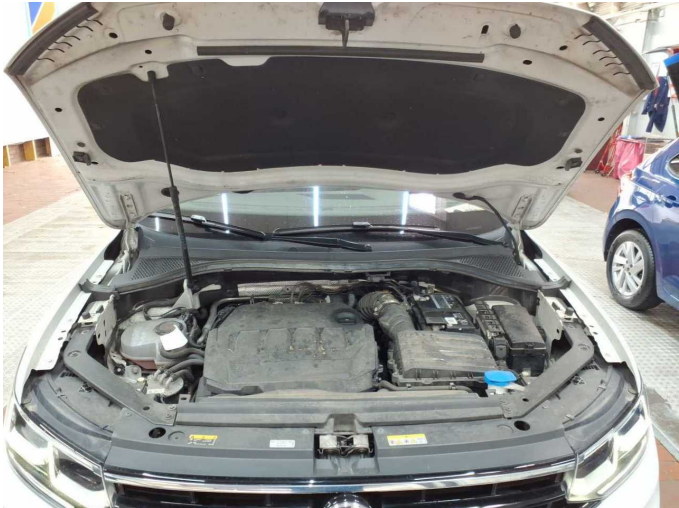


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Damage 1: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 1: Wing mirror - left side: Cap - Scratch(es) - Smart repair



**Damage 2:** Wing mirror - right side: Cap - Scratch(es) - Smart repair



**Damage 2:** Wing mirror - right side: Cap - Scratch(es) - Smart repair



**Damage 3:** Rear bumper: Rear bumper - Scratch(es) - Paint



**Damage 3:** Rear bumper: Rear bumper - Scratch(es) - Paint



**Damage 3:** Rear bumper: Rear bumper - Scratch(es) - Paint



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ5NZNW526895

Hersteller / Modell: VOLKSWAGEN VW Tiguan 2.0 TDI SCR R-Line

| Datum      | KM-Stand | Beschreibung                                                                                                                                                                                                                        |
|------------|----------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 18.09.2025 | 122.809  | Reparatur Sonstiges; Systemtest/Eigendiagnose                                                                                                                                                                                       |
| 08.09.2025 | 118.803  | Systemtest/Eigendiagnose                                                                                                                                                                                                            |
| 08.08.2025 | 117.535  | AU; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges                                                                                                                                                        |
| 27.01.2025 | 88.341   | Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges |
| 06.11.2024 | 80.466   | Reparatur Sonstiges; Reparatur Sonstiges; Systemtest/Eigendiagnose; Systemtest/Eigendiagnose                                                                                                                                        |
| 29.04.2024 | 58.881   | Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsscheiben hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges                                                        |
| 11.04.2023 | 30.554   | Motoröl b. Wartung; Regelwartungsdienst                                                                                                                                                                                             |