

Expertise

Protocol number: 46266353
Order No. / Reference: 26397494
Inspection date: 1 Jul 2026

Manufacturer: Ford

Model: Tourneo Custom 320 L1H1 VA Trend

VIN: WF03XXTTG3NY32977



Vehicle details

Manufacturer / Type / Model / Equipment

Ford Tourneo Custom 320 L1H1 VA Trend

Vehicle Identification number WF03XXTTG3NY32977

Mileage (Read) 60,050 km

First registration 12 May 2022

Number of holders 1

Next periodical technical inspection 07/2027
(Report on hand)

Power / Engine displacement 96 kw / 1,995 ccm

Fuel type / Cylinder Diesel / 4

Gearbox / Number of gears Manual / 6

Type of drive Front drive

Type of vehicle Van

Colour / colour code Obsidian-Schwarz Metallic

Doors / Seats 5 / 8

Upholstery type Cloth

Colour of upholstery Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	15,000 km
Last service on / at	11/2025 at 46,627 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GK810470
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BMX 02892		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	3,190 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109T	Summer tyres on Light alloy	Goodyear	4mm / 4mm
2)	215/65 R16 109T	Summer tyres on Light alloy	Goodyear	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 2 batteries
- Anti-lock braking system with electronic brake force distribution (EBD)
- Flooring: Carpet
- roof, flat
- Tachometer
- Electronic Stability Program (ESP) with Traction Control System (TCS)
- Electric front windows
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Transmission: 6-speed transmission
- Lockable glove compartment with lid
- Interior lighting front and rear with delay function
- Emergency brake assist including emergency brake light
- Front and rear parking pilot system
- Tire Pressure Monitoring System (TPMS)
- Headlights with delayed shut-off
- Sliding door: Sliding door, right and left
- Rear mud flaps
- Side protection strips, plastic
- Seat belts
- Seats: Seat package 16A (Tourneo Custom) (Driver's seat, 4-way manually adjustable (forward/backward, backrest, seat cushion tilt, height) - Individual passenger seat, 4-way manually adjustable (forward/backward, backrest, seat cushion tilt, height) - Height-adjustable headrests - Heated seats for driver and front passenger - Interior armrest for driver - Interior armrest on individual passenger seat - Manual lumbar support (driver's seat) - Front head/shoulder airbags and side airbags - TREND seat cover: fabric)
- Rear water heater
- Heat-insulating glazing, lightly tinted

Extra equipment

- Electrically adjustable, heated and folding exterior mirrors with blind spot assist (with integrated turn signals - blind spot assist incl. cross traffic alert - trailer function)
- Paint finish: Metallic
- Package: Smoker (cigarette lighter and ashtray)
- Radio: Audio system 23: Ford audio system including Ford SYNC 3 with AppLink and DAB/DAB+ (Radio (FM/AM) - FordPass Connect incl. live traffic information - 8" TFT multifunction display - 10 speakers, antenna, 8 USB ports - Integrated control panel and audio remote control on the steering wheel - Ford SYNC 3 with AppLink & touchscreen (Communication and entertainment system, Bluetooth and USB, integration of various telephony functions and hands-free system, voice control, SMS readout/sending function, privacy mode, emergency call assistant) - Supports Android Auto, Apple CarPlay)

- Driver and passenger side airbags
- Exterior mirrors, electrically adjustable, heated and foldable
- On-board computer
- Headliner in driver's cab and passenger compartment
- Third brake light
- Windows: Windows in the 3rd row of the passenger compartment, fixed, right and left
- Ford Easy Fuel
- Generator, 240 A
- Cruise control system with adjustable speed limiter
- Grab handle on the B-pillar of the passenger side
- Rear swing door with heated rear window
- Adjustable steering column
- Package: Style-Color Package
- Particulate filter: diesel particulate filter
- Wheels: 6.5 J x 16 alloy wheels in a 10-spoke design
- Sliding door entry light automatically illuminates when the door is opened
- Front mud flaps
- Power steering
- Seats: 2 rows of seats (3-3) (Trend) (in the 2nd row with 3 individual seats (removable and reversible) with adjustable backrests, height-adjustable headrests, outer armrest and 2 ISOFIX anchor points (each on the outer seat) - in the 3rd row with a single and double seat (removable) with adjustable backrests, height-adjustable headrests, outer armrest and 2 ISOFIX anchor points (on the middle seat and on the outer passenger side))
- Start-stop system
- Power outlet: 12-volt connection
- Lashing eyes 2
- Immobiliser
- Auxiliary heater, electric

- Windows: Windows 2nd row passenger compartment, fixed, right and left
- Air conditioning front and rear (incl. rear water heating - incl. dust and pollen filter)
- Package: Visibility Package I (Heated windshield - Windscreen washer fluid sensor)
- Tire repair kit (space and weight saving, instead of spare wheel (maximum speed of 80 km/h when used))
- Sunshades (for side windows in the passenger compartment)
- Programmable auxiliary heater (fuel-operated auxiliary heater including 2 batteries - with remote control)
- Heat-insulating glazing, medium tint level of the side window(s) of the 2nd row.



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Bonnet	Insulation lining - Damage caused by marten / rodent - Replace
3	Rear bumper	Rear bumper (Stoßfängerecke Hinten Links) - Scratched - Replace
4	Boot lid / rear door	Boot lid - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Front bumper	Front bumper - Stone chips - No deduction
4	Interior	Interior - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side right, Provided by user / customer, from 22 Sept 2025	6.397,08 €

Repainting

No.	Repainting
1	Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent
2	Door - rear right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear right side	290 µm	Door - rear right side	181 µm
------------------------------	--------	------------------------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

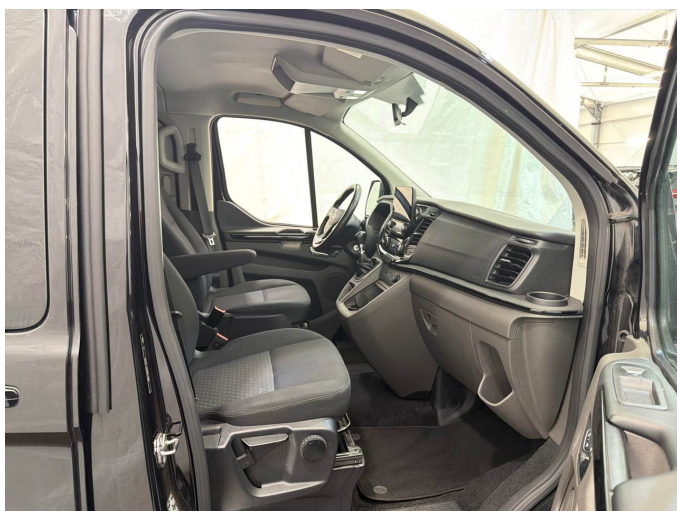


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 13: Documents



Figure 14: Documents

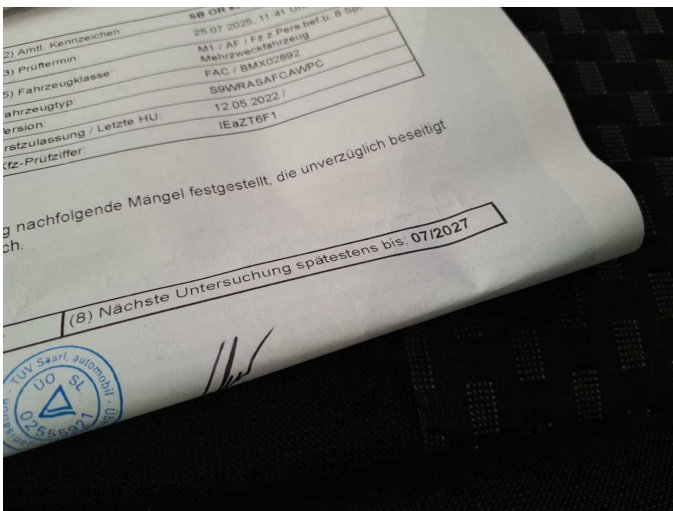


Figure 15: Documents

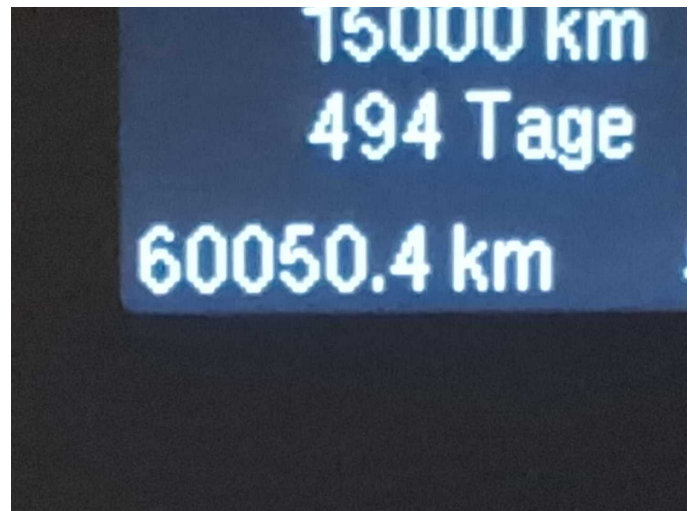


Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

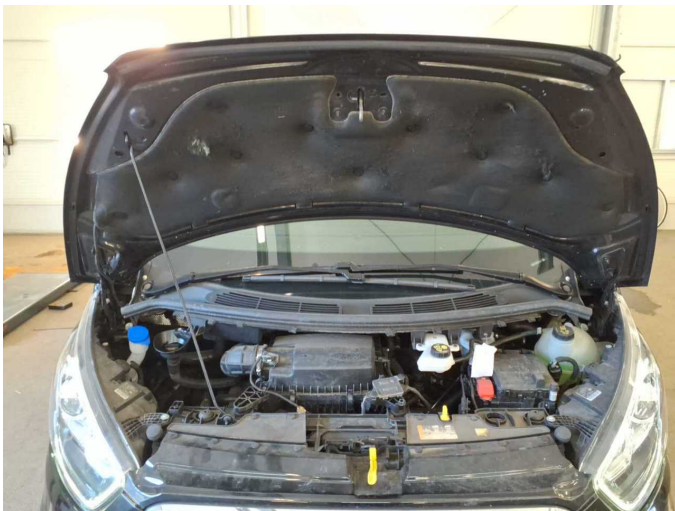


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.




Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.

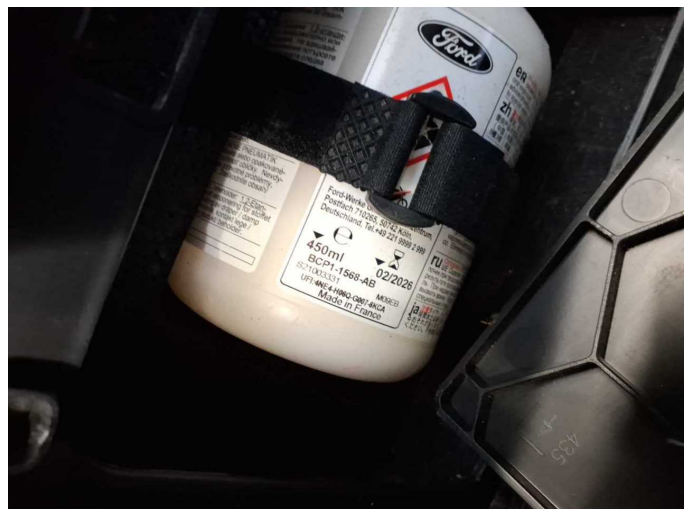

Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Bonnet: Insulation lining - Damage caused by marten / rodent - Replace



Damage 2: Bonnet: Insulation lining - Damage caused by marten / rodent - Replace



Damage 3: Rear bumper: Rear bumper (Stoßfängerecke Hinten Links) - Scratched - Replace



Damage 3: Rear bumper: Rear bumper (Stoßfängerecke Hinten Links) - Scratched - Replace



Damage 3: Rear bumper: Rear bumper (Stoßfängerecke Hinten Links) - Scratched - Replace



Damage 4: Boot lid / rear door: Boot lid - Scratched - Paint



Damage 4: Boot lid / rear door: Boot lid - Scratched - Paint



Repainting 1: Side panel - rear right side



Repainting 1: Side panel - rear right side



Repainting 2: Door - rear right side



Repainting 2: Door - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF03XTTG3NY32977

Hersteller / Modell: FORD FORD Tourneo Custom 320 L1H1 VA Trend

Datum	KM-Stand	Beschreibung
13.11.2025	46.941	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne
07.11.2025	46.627	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
25.07.2025	40.790	AU
08.07.2024	24.003	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges