DEKRA

DEKRA Automotive Solutions

Appraisal Report

Vehicle details

VIN	ZACNJECA4 RPS96648	Registration date	19/12/2024	Exterior Color	Unknown
Brand	JEEP	Licence Plate	EU-FA 8580	Odometer	15 638 km
Model	COMPASS 1.5l GSE T4 48V e -Hybrid Altitud				

Inspection Details

Arrival Date	20/08/2026	Inspection ID	7124324	Inspection date	25/08/2026
Assign Date	20/08/2026	Fleet owner	Leasys FINN	Inspection loc.	Leasys AKB Schöneck



Generic equipment

Removable element

Spare wheel kit	✓
Rear parcel shelf	✓
Floor mat BR	✓
Floor mat BL	✓
Floor mat FR	✓
Floor mat FL	✓


Technical Document

User manual	✓
Warranty booklet	✓
Log books	✓
Spare key	✓
Key	✓
Remote key	✓
Service	✓

Tyres

Goodyear 215/60/17 V All seasons 5.0 mm

Goodyear 215/60/17 V All seasons 5.0 mm

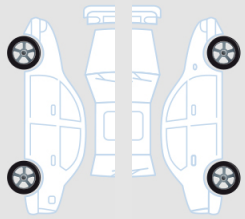



Goodyear 215/60/17 V All seasons 6.0 mm

Goodyear 215/60/17 V All seasons 6.0 mm

Exception / Damage

1



Part	Bumper	Repair Time	1.90	Part Cost	-
Position	Back	Repair Cost	133.00€	Gross Cost	250.00€
Damages	Scratched	Paint Time	1.30	Depreciation %	10.00%
Severity	-	Paint cost	117.00€	Depreciation	- 25.00
Repair mode	Repair	Flat Rate	-	**Net Cost**	**225.00€**

DEKRA

DEKRA Automotive Solutions

Appraisal Report

2



Part	Wing	Repair Time	-	Part Cost	-
Position	Back left	Repair Cost	-	Gross Cost	80.00€
Damages	Dented	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	Smart Repair	Flat Rate	80.00€	**Net Cost**	**80.00€**

3



Part	Door	Repair Time	-	Part Cost	-
Position	Front left	Repair Cost	-	Gross Cost	100.00€
Damages	Scratched	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	Smart Repair	Flat Rate	100.00€	**Net Cost**	**100.00€**

4



Part	Wing	Repair Time	-	Part Cost	-
Position	Back right	Repair Cost	-	Gross Cost	80.00€
Damages	Dented	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	Smart Repair	Flat Rate	80.00€	**Net Cost**	**80.00€**

5

Part	Paint preparation	Repair Time	-	Part Cost	-
Position	-	Repair Cost	-	Gross Cost	72.00€
Damages	-	Paint Time	0.80	Depreciation %	10.00%
Severity	-	Paint cost	72.00€	Depreciation	- 7.20
Repair mode	Plastic paint	Flat Rate	-	**Net Cost**	**64.80€**

Summary Inspection

Gross Price	582.00€	Depreciation	-32.20€	Net Price	549.80€

Labor cost summary

	Hourly Rate	Time	Gross Price	Depreciation %	Depreciation	Net Price
Bodywork	70.00€	1.90	133.00€	10.00 %	-13.30€	119.70€
Paintwork	90.00€	1.30	117.00€	10.00 %	-11.70€	105.30€
Paint preparation	90.00€	0.80	72.00€	10.00 %	-7.20€	64.80€

Miscellaneous

	Gross Price	Depreciation %	Depreciation	Net Price
Small parts / disposal charge	0.00€	-	-	0.00€
Part Cost	0.00€	-	-	0.00€
Flat Rate	260.00€	-	-	260.00€