



Expertise

Protocol number: 46275039
Order No. / Reference: 26565741
Inspection date: 25 Jun 2026

Manufacturer: Volvo

Model: V90 T6 Recharge AWD Plus Bright

VIN: YV1PWH1V9R1219403



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo V90 T6 Recharge AWD Plus Bright	
Vehicle Identification number	YV1PWH1V9R1219403
Mileage (Read)	100,796 km
First registration	4 Oct 2023
Number of holders	1
Next periodical technical inspection	10/2026
(Report not on hand)	
Power / Engine displacement	186 kw / 1,969 ccm
Fuel type / Cylinder	Hybrid P / E ext. charg. / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	Station wagon
Colour / colour code	Vapour Grey
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	23,736 km
Last service on / at	03/2026 at 94,531 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV809896
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	9101 / BSB 00016		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,590 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/40 R19 100W	Summer tyres on Light alloy	Michelin	5mm / 5mm
2)	255/40 R19 100W	Summer tyres on Light alloy	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R18 100V	Winter tyres on Light alloy	Dunlop	5mm / 5mm
2)	245/45 R18 100V	Winter tyres on Light alloy	Dunlop	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
Tirefit		Expiration date 09/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Adaptive Cruise Control
- Aluminum door sill plates with Recharge lettering at the front and rear
- Aluminum loading sill protector in the luggage compartment
- Aluminum roof rails (integrated)
- Android infotainment system (9" touchscreen (22.9 cm diagonal) - Digital Services (includes Google Maps, Google Assistant, Google Play Store and unlimited data for the first 4 years) - Bluetooth hands-free system incl. audio streaming - Digital vehicle owner's manual - Digital radio reception (DAB+) - 2 USB-C ports (compatible with Apple iPod/iPhone/iPad)
- Automatic climate control (with separate temperature control for driver and front passenger and additional air vents for the rear seats including pre-ventilation and reheating of the interior when the engine is switched off via menu)
- Automatic emergency braking (emergency braking mechanism after the deployment of the airbags or seatbelt pretensioners to prevent secondary accidents)
- Brake energy recuperation
- Cargo area roller blind (electric)
- Central locking with two remote controls and integrated emergency key (including automatic locking of the doors while driving (can be deactivated) - comfort opening/closing of the side windows and, if applicable, sunroof via remote control)
- Child safety lock for the rear doors, electric
- Chrome applications on the rear of the vehicle
- Chrome trim strip in the door sill area with Recharge lettering
- Condensation sensor (for automatic activation of the defroster function)
- Digital instrumentation 2nd generation (Full graphic 12.3" driver display (31.2 cm diagonal) with two variable round instruments and information display (e.g. for navigation map view))
- Driver Alert - Attention Warning
- Driver and front passenger airbags with two-stage deployment system (driver's side knee airbag - side airbags for driver and front passenger and head/shoulder airbags (IC) for all occupants)
- Driver Assistance (Adaptive Cruise Control - Emergency Stop Assist (automatic emergency stop system if warnings are ignored due to the driver's failure to steer, brake and accelerate, including activation of the hazard warning lights and automatic braking to a standstill) - Pilot Assist (lane guidance assistant with adaptive cruise control up to speeds of 130 km/h))
- Electric parking brake
- Electric windows front and rear (with auto-down and auto-up function)
- Electrically folding exterior mirrors
- Electronic differential lock
- Electronic Stability Control (ESC)
- ABS - Anti-lock Braking System (with EBV)
- Acoustic Vehicle Alerting System (AVAS) (acoustic pedestrian/cyclist protection through artificially generated driving noises in the speed range up to 20 km/h)
- Active safety belts with belt tensioners
- Advanced air purification system with fine dust filtration according to air quality standard PM2.5
- Airbag, passenger airbag can be deactivated
- Ambient lighting (Extended interior lighting with: - Ambient lighting front and rear - Illuminated door pockets and door handles front and rear - Ambient lighting on the front and rear doors - Front door sill trims with illuminated Volvo lettering - Exit lights in the rear doors - Ambient lighting on the dashboard top panel - Rear footwell lighting - Work light on the tailgate)
- Attachment system for carrier bags in the luggage compartment
- Automatic tailgate (electric)
- Charging box under the cargo floor
- Charging cable Schuko/Type 2 (Mode 2), 7 m length, single-phase, 10 A (for connection to a standard 230-volt household socket)
- Chrome applications in the front bumper
- Chrome window surround
- CleanZone air quality system (with activated carbon filter, automatic recirculation and pre-ventilation of the interior when the vehicle is unlocked)
- Dashboard and door trim in leather look with contrasting stitching
- Digital Services including Google Maps navigation system (Google Services (includes Google Maps, Google Assistant, Google Play Store and unlimited data) - Volvo On Call (includes, among other things, contacting the Volvo On Call service center at the touch of a button and additional convenience services via the Volvo CarsApp) - Usage is time-limited and will be subject to charges thereafter. Further information on renewal is available from a Volvo dealer partner.)
- Driver Awareness (Blind Spot Information System (BLIS), blind spot assist including lane change warning for rapidly approaching vehicles including steering intervention if warning signals are ignored - Cross Traffic Alert (CTA) - cross traffic warning with braking intervention - warning of vehicles, cyclists and pedestrians approaching from the side - rear impact mitigation, preventive protection in case of impending rear collisions by rapid illumination of the hazard warning lights, braking of the vehicle and tightening of the seat belts)
- Electrically adjustable exterior mirrors
- Exterior mirror caps in car color
- First aid kit and warning triangle
- Front grille in waterfall design in chrome
- Front seat belt height adjustment
- Fuel filler neck with misfuelling protection
- Glazing: Acoustic glazing for the side windows (UV and burglar-resistant laminated glass panes)
- Headrests (5)



- Emergency brake lights (brake lights flash rapidly during heavy deceleration; hazard warning lights are automatically activated at speeds below 10 km/h)
- Heated exterior mirrors and rear window (automatic)
- Heated rear window
- High-gloss black louvers in the center console
- Hill Start Assist (HSA)
- Inlays: Checkered aluminum inlay
- Intelligent driver information system (delays incoming calls or vehicle information in dangerous situations)
- Interior and exterior mirrors with automatic dimming function
- Keyless Start (electronic engine start system)
- Lashing eyes in the luggage compartment (foldable)
- LED headlights "Thor's Hammer" (with high beam assist and integrated LED daytime running lights)
- Ottopartikelfilter (petrol particulate filter)
- Outdoor temperature display
- Package: Parking Assistance (front and rear parking aid - reversing camera)
- Package: Winter Package (front seat heating - rear seat heating (outer seats of the 2nd row) - steering wheel heating)
- Parking ticket holder
- Pollen filter
- Power outlet: 12-volt connection in the luggage compartment
- Radio accessories: Smartphone integration Apple CarPlay
- Radio accessories: Two USB-C ports on the back of the center console
- Radio accessory: Roof antenna (fin)
- Rear parking assist with automatic braking intervention (rear)
- Roof edge spoiler
- Safety Assistance (Automatic emergency braking system with detection of vehicles, cyclists, pedestrians and large animals including intersection and emergency braking assistant - Connected Safety - Distance warning (only in conjunction with head-up display) - Driver Alert - Attention warning - Speed limiter (variable) - Cruise control - Lane Keeping Aid (LKA) - Active lane keeping assist - Oncoming Lane Mitigation - Ready to Drive notification - Road Edge Detection - Road Sign Information (RSI))
- Steering wheel: Multifunction buttons on the steering wheel
- Trailer Stability Assist (TSA) - Preparation for trailer stability control
- Transmission: 8-speed Geartronic (automatic transmission)
- Upholstery: Leather/leatherette comfort seats (including rear center armrest)
- Warning tone/indicator when seat belts are not fastened (for all seats)
- Wheels: 19" 8-spoke alloy wheels, diamond cut/high-gloss black (8.5 J x 19 with 255/40 R19 tires)
- Wheels: Tire pressure monitoring system (passive) (with tire-specific pressure loss warning)
- Illuminated makeup mirror for driver and front passenger
- Immobiliser
- Interior lighting (headliner - front and rear reading lights - individually dimmable - front footwell - glove compartment - luggage compartment)
- ISOFIX anchors for the outer rear seats
- Keyless Drive (electronic access system) (with sensor-controlled tailgate, illuminated door handles and puddle lights)
- LED turn signals integrated into the exterior mirrors
- Luggage compartment lid release via remote control or from the driver's seat
- Luggage compartment partition net
- On-board computer with vehicle control functions
- One Pedal Drive (acceleration and deceleration to a standstill via the accelerator pedal - recuperation (brake energy recovery) as soon as the foot is taken off the accelerator pedal, to optimize the range)
- Package: Seating Comfort (Electrically adjustable front passenger seat (8-way) - Electrically adjustable driver's seat (8-way) with memory function for driver's seat and exterior mirror settings (stored in the remote control) - Lumbar support (4-way electrically adjustable) for driver and front passenger seats - Memory function for front passenger seat - Adjustable leg support for driver and front passenger seats)
- Paint finish: Solid
- Premium textile floor mats, front and rear
- Radio accessories: Subwoofer
- Radio: Premium Sound audio system by Harman/Kardon (600 watts of power - 14 speakers - Fresh Air subwoofer - Dirac Unison sound optimization)
- Rain sensor including automatic light function
- Rear headrests foldable, electrically
- rear window wiper
- Run-off Road Protection (preventive protection system in case of unintentional leaving the road or impending rollovers including emergency call via Volvo On Call and door unlocking)
- Safety braking system with disc brakes all around (internally ventilated) (automatic brake system pre-tensioning, brake assist and automatic hold function)
- Safety steering column (adaptive)
- Seats: Rear seat backrests in a 40/60 ratio or fully foldable
- Speed-sensitive power steering
- Start/Stop technology
- Steering wheel adjustable for height and reach
- Sun blinds for the rear side windows (integrated)
- third brake light
- Wheel accessories: Tire sealant (with 12-volt compressor (maximum speed 80 km/h))
- WHIPS whiplash protection system (including immersion protection on all seats and energy-absorbing front seat cushions)



Extra equipment

- Package: Light Package (Headlight cleaning system - Full LED headlights "Thor's Hammer" Active High Beam with extended high beam, dynamic cornering lights, intelligent high beam assistant with adaptive headlight range control and integrated LED daytime running lights)
- Windscreen, heater
- 18" complete winter wheel set on Volvo alloy rims
- Charging cable type 2 / type 2
- Panoramic glass sliding roof with lifting function (with integrated, continuously adjustable sunshade (electric))
- Towbar (semi-electric)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
2	Roof	Roof - dent(s) - Smooth repair work
3	Rear bumper	Rear bumper - Scratch(es) - Smart repair
4	2nd wheel set	1 alloy rim - Scratched - Loss in value
5	Front bumper	Front bumper - Scratched - Paint
6	Bonnet	Bonnet (Anätzung) - Paint defect - Paint
7	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Replace

Wear and tear

No.	Component group	Description
1	Roof	Cowl - right side - Scratch(es) - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Door - rear right side	Door - Scratch(es) - No deduction
4	Sill - left side	Sill - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 8 Sept 2024	1.342,77 €



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres

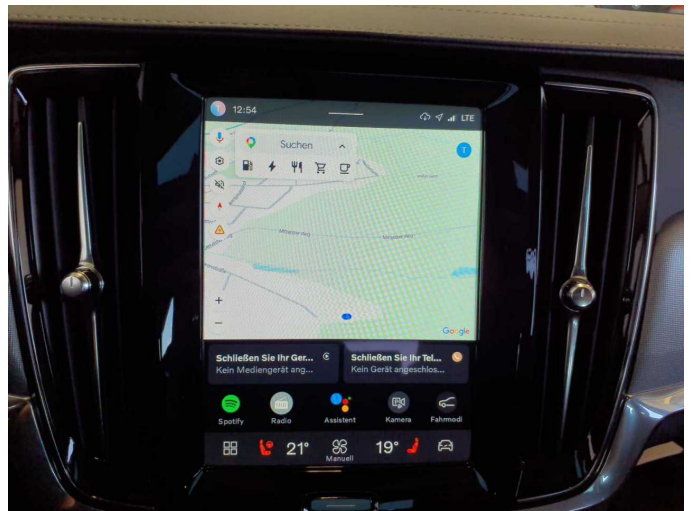


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

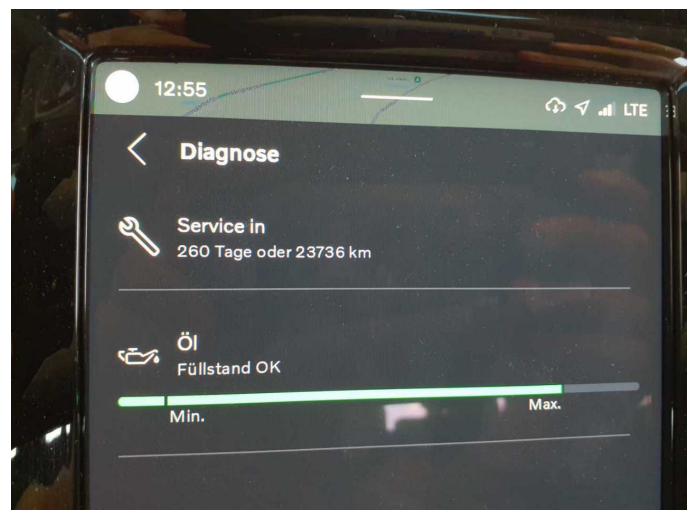


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Damage 1: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage 1: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise




Damage 2: Roof: Roof - dent(s) - Smooth repair work



Damage 2: Roof: Roof - dent(s) - Smooth repair work



Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair

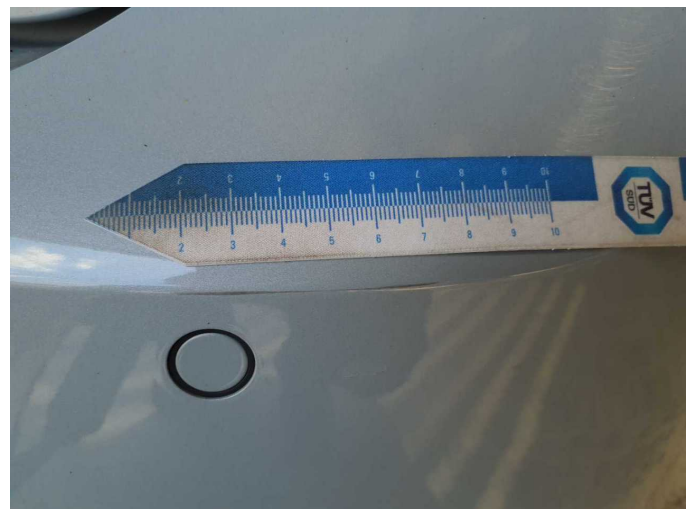

Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 4: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 4: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 4: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 5: Front bumper: Front bumper - Scratched - Paint



Damage 5: Front bumper: Front bumper - Scratched - Paint



Damage 5: Front bumper: Front bumper - Scratched - Paint



Damage 6: Bonnet: Bonnet (Anätzung) - Paint defect - Paint



Damage 6: Bonnet: Bonnet (Anätzung) - Paint defect - Paint



Damage 6: Bonnet: Bonnet (Anätzung) - Paint defect - Paint



Damage 6: Bonnet: Bonnet (Anätzung) - Paint defect - Paint



Damage 7: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 7: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 7: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 7: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace