



Expertise

Protocol number: 46537350
Order No. / Reference: 26630191
Inspection date: 15 Jul 2026

Manufacturer: Skoda
VIN: TMBJC7NY0PF037219

Model: Enyaq iV 80



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Enyaq iV 80	
Vehicle Identification number	TMBJC7NY0PF037219
Mileage (Read)	90,064 km
First registration	20 Apr 2023
Number of holders	1
Power / Engine displacement	150 kw /
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	SUV
Colour / colour code	Black Magic Perleffekt
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	274 Tag(e)
Last service on / at	04/2025 at 56,955 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ563585
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AWS 00129		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,600 kg	Empty weight	
Dimensions	4649 x 1879 x 1612		

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105W	Winter tyres on Light alloy	Bridgestone	7mm / 7mm
2)	255/50 R19 107W	Winter tyres on Light alloy	Bridgestone	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/40 R21 102T	Summer tires (with run-flat tires) on Light alloy	Pirelli	5mm / 5mm
2)	255/40 R21 102T	Summer tires (with run-flat tires) on Light alloy	Pirelli	4mm / 4mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments
- Airbag, driver and passenger
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Evasive steering assist including turn assist
- Outdoor temperature display
- Hill start assist
- Design Selection Loft
- Third brake light
- Electronic parking brake including auto-hold function
- ESC Electronic Stability Control
- Electric windows front and rear
- Cruise control
- Transmission: 1-speed (EV)
- Heated rear window
- Automatic interior mirror dimming
- Isofix anchorage on the outer rear seats including top tether
- Removable boot cover
- Charging cable for AC charging stations (Mode 3 charging cable, Type 2, 16A) (Fast charging connector (CCS / Combo 2))
- Manual headlight range adjustment
- Package: Drive BASIC
- Radio accessories: SmartLink
- Radio accessories: Wireless SmartLink
- Tire pressure monitoring
- Rear seat backrest split 60:40, foldable
- Seat belts
- Seats: Front seats height-adjustable including manually adjustable lumbar support
- Lane keeping assistant (Lane Assist)
- Traffic sign recognition
- Central locking including remote control integrated into the key
- Airbag, center airbag front
- Airbag, front and rear head airbags
- acoustic windscreen
- Traction control (ASR)
- Electrically adjustable, heated and folding exterior mirrors, including automatic dimming.
- Grey headliner
- Digital instrument cluster (Virtual Cockpit)
- E-Sound
- Increased battery charging power max. 125 kW incl. 1 year free monthly basic fee at Ionity
- Front radar assistant with pedestrian and cyclist detection and city emergency braking function
- Tinted windows
- Rear window wiper including windshield washer system
- Isofix anchorage on the front passenger seat
- Child safety locks on the rear doors
- Climatronic air conditioning (2-zone)
- Front and rear headrests are height-adjustable.
- LED headlights with daytime running lights
- LED taillights
- Steering wheel adjustable for height and reach
- Package: Chrome
- Package: Parking BASIC (front and rear parking sensors - reversing camera)
- Rain sensor and driving light assistant with coming and leaving home function
- Power steering
- Safety lights in the front side doors
- Skoda Care Connect
- Speed limiter
- 12V socket - in the trunk
- Immobiliser



Extra equipment

- Swiveling trailer hitch (including trailer stabilization)
- Anti-theft alarm system including safe system (interior monitoring and tilt sensor)
- Luggage net partition
- Paint finish: Pearl effect
- Mobile charging station "iV Universal Charger" with interchangeable connection adapters
- Package: Convenience PLUS in conjunction with anti-theft alarm system (KESSY (Keyless Entry and Start-Stop System) incl. Safe System - Phonebox with inductive charging function (connection via the external antenna) - Sunset tinted windows incl. acoustic side glazing at the front - Extended acoustic measures - Driver fatigue detection - Electric tailgate operation incl. comfort opening - Removable glasses compartment - Free remote vehicle access for 3 years)
- Package: Family BASIC (sunshade roller blind for rear side windows - 230V socket and 2 x USB-C charging ports in the rear - storage box for rear seat row)
- Package: Climate Control PLUS (Heated front and outer rear seats - Heated windshield washer nozzles - Climatronic air conditioning (3-zone), fully automatic, separately adjustable for driver, front passenger and rear passengers including odor and particle filter - Heated windshield)
- Package: Seating comfort BASIC (electrically adjustable driver's seat with memory function - electrically adjustable lumbar support in the driver's seat)
- Package: Transport (Net program in the trunk incl. charging cable bag - Variable loading floor in the trunk - Remote release of the rear seat backrests in the trunk - Cargo elements in the trunk)
- Design Selection Suite (leather seat covers - "Piano black" trim strips - grey headliner - front center armrest including storage compartment - rear center armrest with cup holders and pass-through - floor mats - multi-coloured ambient lighting for instrument panel and front door trim - footwell lighting and illuminated door handle recesses - umbrella)
- Package: Drive SPORT BASIC (paddle shifters for adjusting recuperation strength - driving profile selection - heated leather steering wheel in sport design with multifunction buttons - steering wheel with hands-off detection - progressive steering)
- Package: Driving Assistance PLUS (Predictive Adaptive Cruise Control (pACC) incl. Traffic Jam Assist - Lane Change and Parking Assist - Proactive Occupant Protection - Traveller Assistance System incl. Emergency Assist (Traffic Sign Recognition, Adaptive Lane Keeping Assist))
- Package: Infotainment PLUS (Navigation system - Infotainment Online 3 years (Online map updates for navigation; display of weather data, news, headlines; charging station and parking space search; Online POI search; Online destination import) - Augmented reality head-up display)
- Package: Light & Sight BASIC (LED matrix headlights incl. AFS and dynamic high beam assist; in rain and bad weather conditions, the cornering and curve lights illuminate the area directly in front of the car better - headlight cleaning system - full LED taillights with animated turn signals)
- PPC Equipment Package Parking PLUS
- Wheels: 21" alloy wheels Betria anthracite-gloss turned (front: 8.5Jx21 tires 235/45 R21 101T, Seal rear: 9Jx21 tires 255/40 R21 102T)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Door - front left side	Door edge - Scratch(es) - Smart repair
2	Door - front left side	Brightware - lower - Scratch(es) - Loss in value
3	Side panel - rear right side	Side panel - dent(s) - Smart repair
4	Door - rear right side	Door - dent(s) - Smart repair
5	Rear bumper	Spoiler - Scratch(es) - Loss in value
6	Rear bumper	Rear bumper - Scratch(es) - Smart repair
7	Front bumper	Front bumper - Scratch(es) - Paint
8	2nd wheel set	1 alloy rim (Materialabtrag) - Scratched - Replace
9	2nd wheel set	1 alloy rim (Materialabtrag) - Scratched - Replace
10	2nd wheel set	1 alloy rim (Materialabtrag) - Scratched - Replace
11	2nd wheel set	1 alloy rim (Materialabtrag) - Scratched - Replace

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.

-Der montierte Winterradsatz ist kein Bestandteil des
Auslieferungsumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

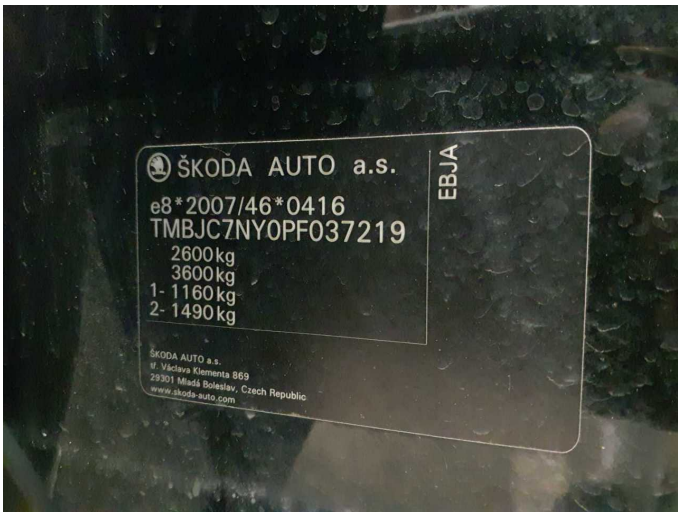


Figure 11: VIN



Figure 12: Mounted tyres

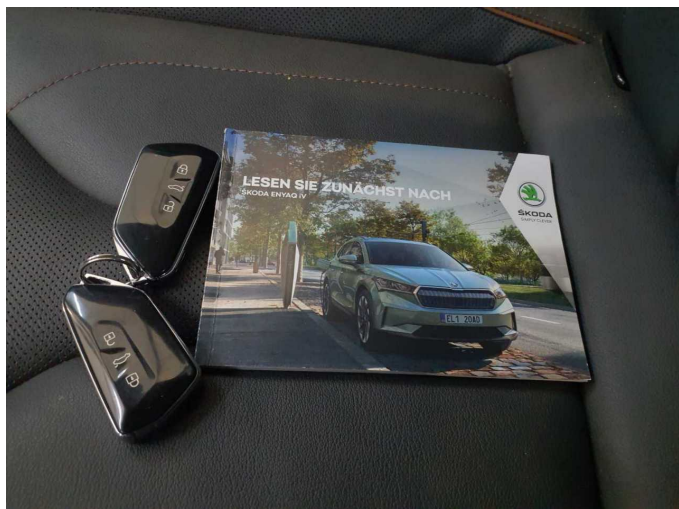


Figure 13: Documents

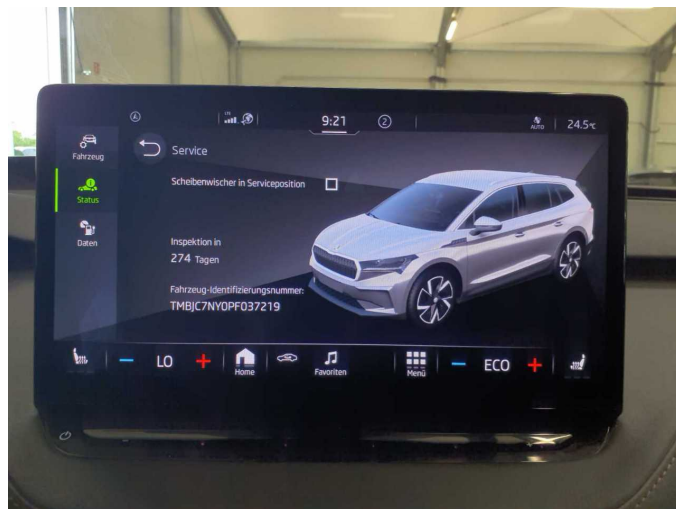


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation

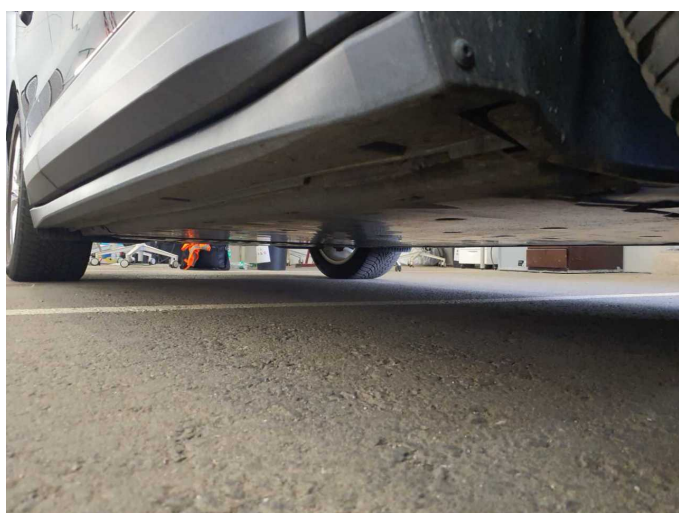


Figure 17: Misc.

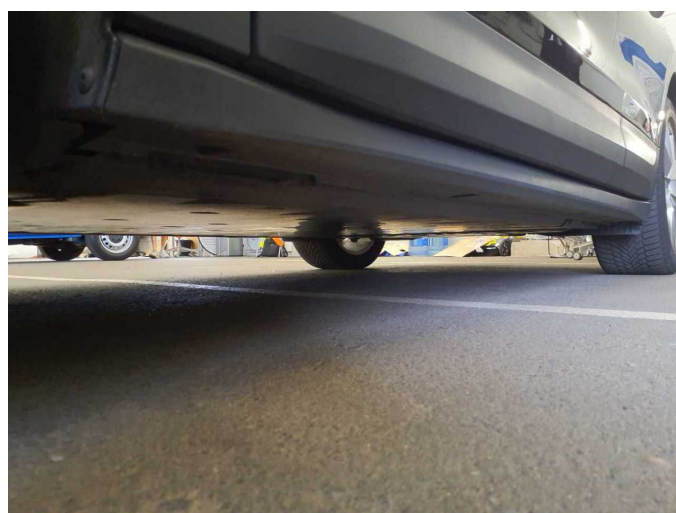


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

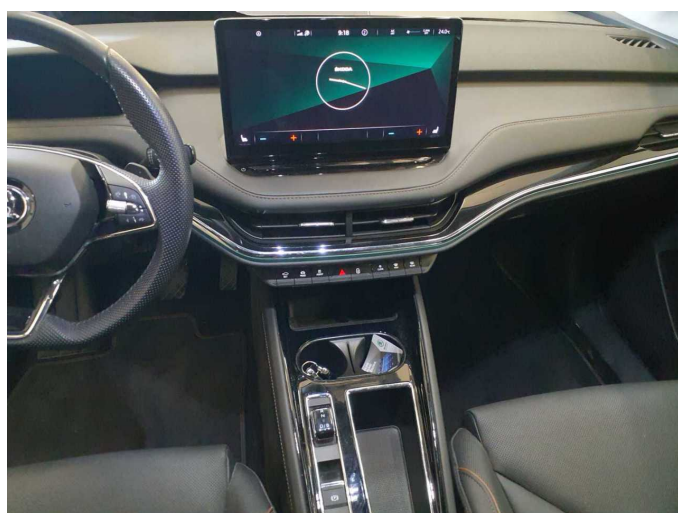


Figure 24: Misc.

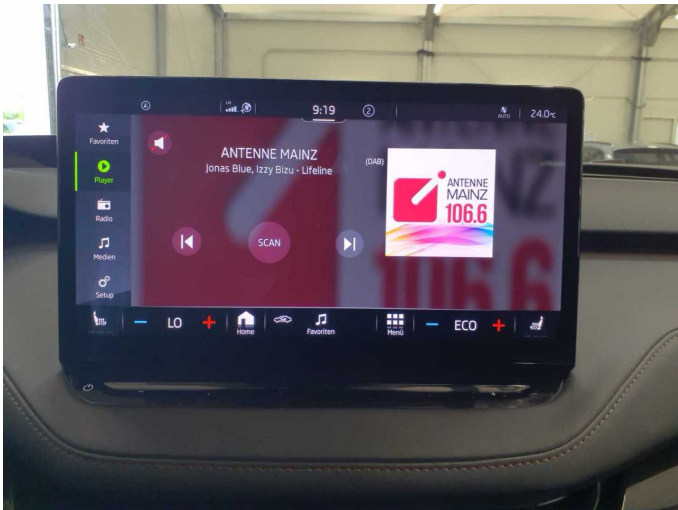


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

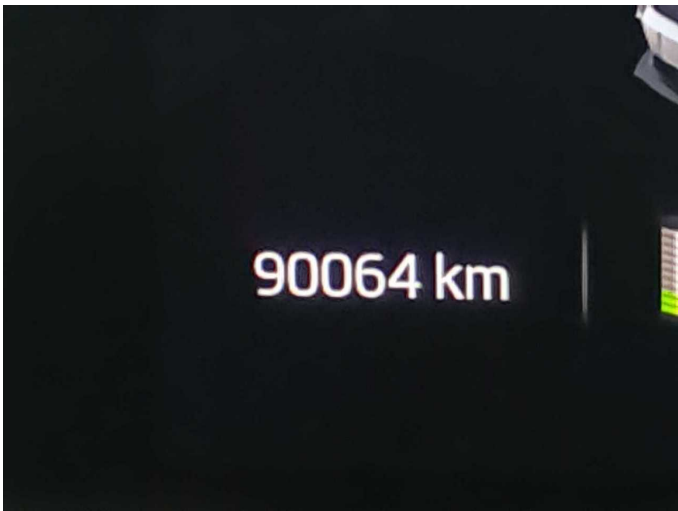


Figure 28: Misc.

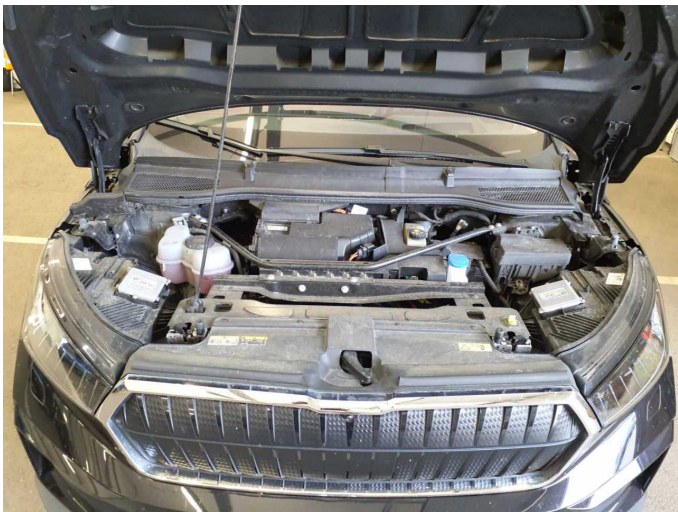


Figure 29: Misc.

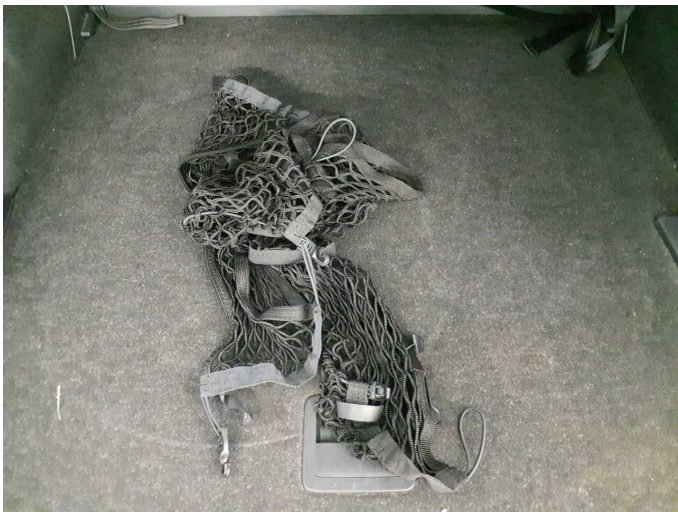


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair




Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 2: Door - front left side: Brightware - lower - Scratch(es) - Loss in value




Damage 2: Door - front left side: Brightware - lower - Scratch(es) - Loss in value

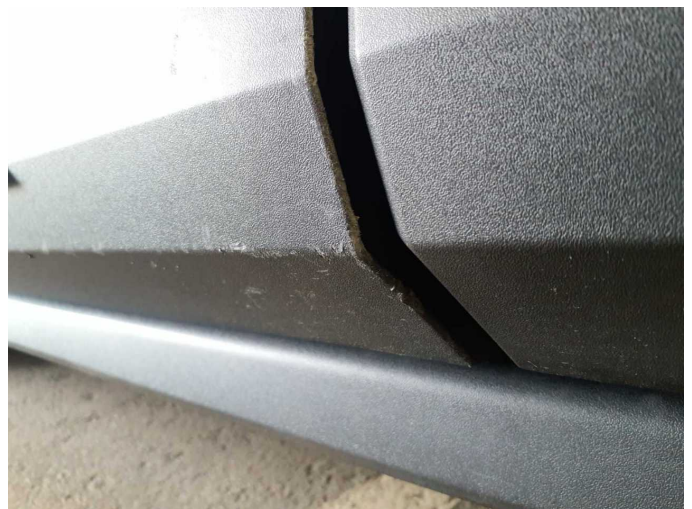


Damage 2: Door - front left side: Brightware - lower - Scratch(es) - Loss in value



Damage 3: Side panel - rear right side: Side panel - dent(s) - Smart repair

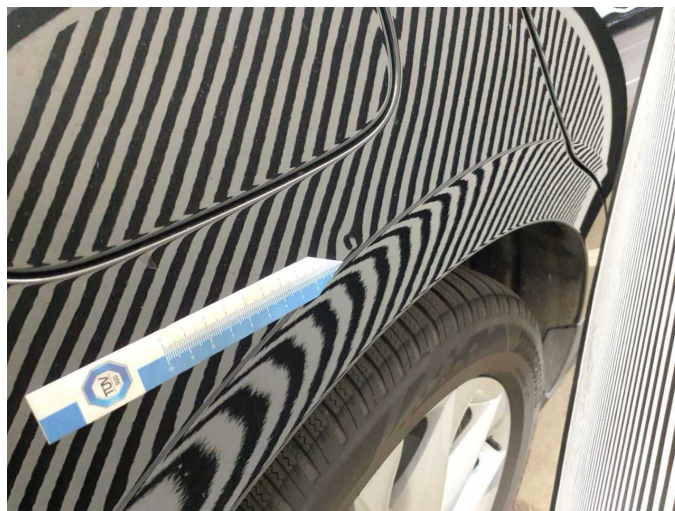


Damage 3: Side panel - rear right side: Side panel - dent(s) - Smart repair

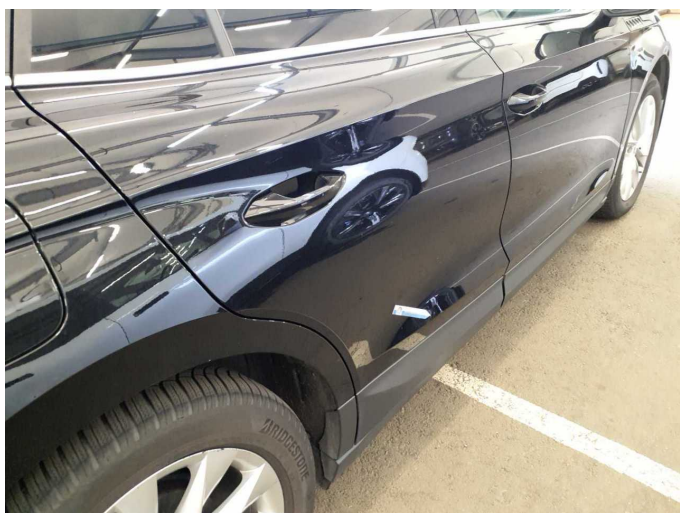

Damage 4: Door - rear right side: Door - dent(s) - Smart repair




Damage 4: Door - rear right side: Door - dent(s) - Smart repair

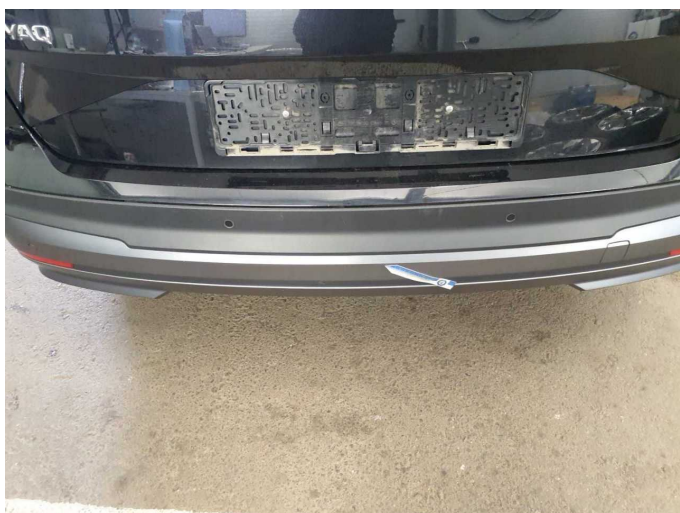

Damage 5: Rear bumper: Spoiler - Scratch(es) - Loss in value




Damage 5: Rear bumper: Spoiler - Scratch(es) - Loss in value

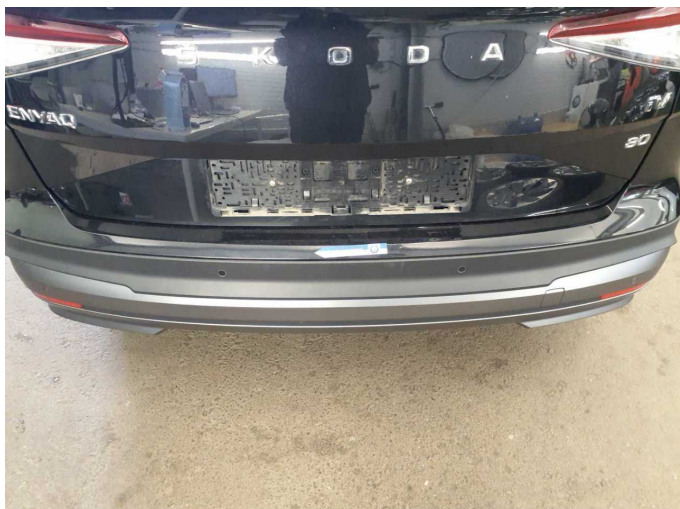

Damage 6: Rear bumper: Rear bumper - Scratch(es) - Smart repair




Damage 6: Rear bumper: Rear bumper - Scratch(es) - Smart repair

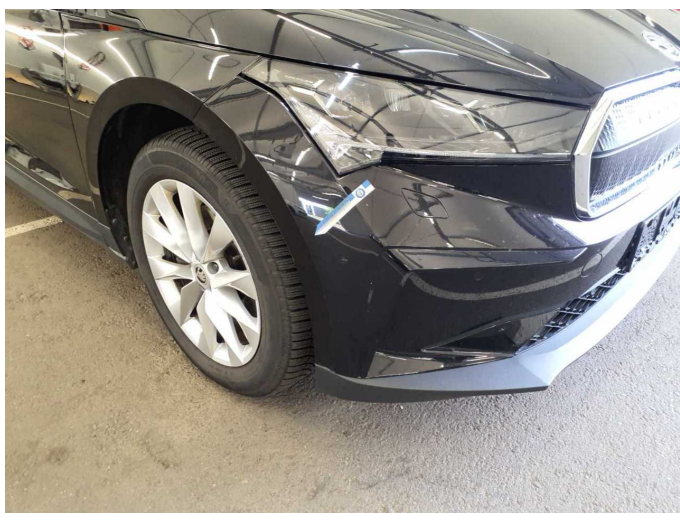

Damage 7: Front bumper: Front bumper - Scratch(es) - Paint




Damage 7: Front bumper: Front bumper - Scratch(es) - Paint

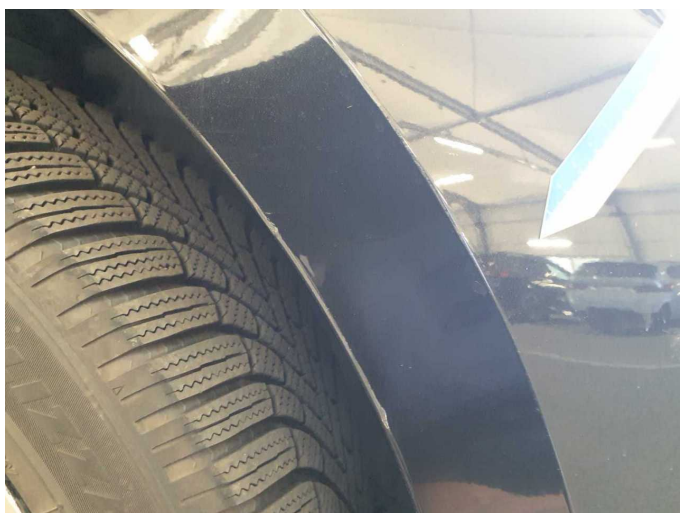

Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint

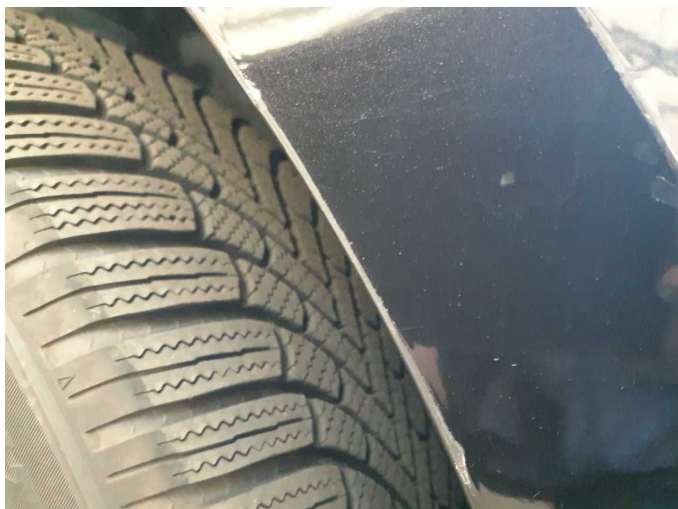

Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 8: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Replace



Damage 8: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Replace



Damage 9: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Replace



Damage 9: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Replace



Damage 10: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Replace



Damage 10: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Replace



Damage 11: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Replace



Damage 11: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJC7NY0PF037219
Hersteller / Modell: SKODA SKODA Enyaq iV 80

Datum	KM-Stand	Beschreibung
15.04.2025	56.955	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst; Wartung Sonstiges