



Expertise

Protocol number: 46904833
Order No. / Reference: 26692863
Inspection date: 4 Aug 2026

Manufacturer: Volkswagen

Model: Tiguan Allspace 2.0 TDI SCR 4Motion DSG R-Line

VIN: WVGZZZ5N6PM083986



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Tiguan Allspace 2.0 TDI SCR 4Motion DSG R-Line	
Vehicle Identification number	WVGZZZ5N6PM083986
Mileage (Read)	166,750 km
First registration	23 May 2023
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	147 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Platinumgrey Metallic (D7X)
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black-Grey
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	606 Tag(e)
Last service on / at	04/2026 at 150,570 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GX760818
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CLE 04824		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,380 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/45 R19 100V	Summer tires (with run-flat tires) on Light alloy	Continental	5mm / 5mm
2)	255/45 R19 100V	Summer tires (with run-flat tires) on Light alloy	Continental	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 100H	Winter tires (with run-flat tires) on Light alloy	Continental	7mm / 7mm
2)	235/55 R18 100H	Winter tires (with run-flat tires) on Light alloy	Continental	8mm / 8mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments in the overhead console
- Airbag, head airbag system including front side airbags (for front and rear passengers)
- Airbag: Side airbags for the outer seats of the 2nd row.
- App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto
- Electrically adjustable and heated exterior mirrors
- Hill descent control
- Chrome applications on mirror adjustment switches, window regulator switches, door pull handles (interior door operation in matte chrome)
- Diesel particulate filter
- Display: Digital Cockpit Pro, multicolor, various selectable info profiles
- Front door sill trims in aluminum, with "R-Line" logo
- Electronic stability program with counter-steering support (including ABS, ASR, EDS, MSR and trailer stabilization)
- Driving assistant "Travel Assist" and lane keeping assistant "Lane Assist"
- Automatic headlight control, with daytime running lights ("Leaving home" function and manual "Coming home" function)
- Driving profile selection (possibility to set different vehicle settings: Comfort, Normal, Sport, Eco, Individual - adaptable vehicle systems include: engine, adaptive chassis control DCC, DSG, steering, start-stop system, cornering lights and "Dynamic Light Assist", automatic distance control ACC, air conditioning)
- Luggage compartment floor height adjustable in 2 stages
- Transmission: 7-speed DSG
- Rear window heated
- Rear window wiper with intermittent function
- Interior mirror automatically dimming
- LED license plate lighting
- Air conditioning "Air Care Climatronic" (3-zone temperature control - allergen filter - rear controls)
- Paint finish: Solid
- LED matrix headlights - IQ.LIGHT (Dynamic Light Assist high beam control for LED matrix headlights - Dynamic headlight range control with dynamic cornering lights - LED taillights, dark red - Bad weather light and cornering light - IQ.LIGHT - LED matrix headlights with LED daytime running lights, cornering lights and dynamic turn signals)
- front center armrest
- Non-smoking version (storage compartment and 12V socket at the front)
- Emergency call service (no registration required, service is activated upon delivery)
- Package: Winter (front windshield washer nozzles automatically heated - front seats heated)
- Upholstery: Fabric inner side panels in "ArtVelours"
- Radio
- Airbag for driver and front passenger including knee airbag on the driver's side (passenger airbag deactivation - knee airbag on driver's side)
- Permanent 4MOTION all-wheel drive
- Adaptive Cruise Control (ACC) "stop & go" with speed limiter
- Exterior mirror housings painted silver
- third brake light
- Chrome trim on the side windows
- Silver anodized roof rails
- Decorative inlays "Carbon Grey" (for instrument panel and front door panels)
- Parking aid (acoustic warning signals for obstacles in the front and rear area)
- Electronic parking brake including Auto Hold function (Volkswagen's Auto Hold function is an extension of the electronic parking brake. The Auto Hold function prevents the vehicle from rolling away unintentionally when stationary or starting off, without the driver having to constantly apply the brakes. In this way, Auto Hold offers maximum driving comfort. - If the ABS wheel speed sensors detect rolling, the braking torque is automatically increased until the vehicle comes to a complete stop.)
- Electric windows front and rear
- Windscreen made of laminated safety glass, heat and sound insulating
- Pedestrian detection
- Luggage compartment lighting (additional, removable and usable as a flashlight)
- Tailgate with electric opening and closing, adjustable opening angle
- Rear spoiler in R-style
- ISOFIX mounting points, also for i-Size child seats (device for attaching 2 child seats to the rear seats)
- Rear headrests (3)
- Front headrests (safety-optimized - adjustable lengthwise and height)
- LED headlights with bad weather light and cornering light
- Steering wheel: Multifunction sports steering wheel in leather, heated, with paddle shifters
- Reading lights: 2 front and 2 rear
- Light in the front footwell
- Illuminated makeup mirrors in the sun visors
- Fatigue detection
- Emergency braking assistant "Front Assist" (detects critical distance situations and helps to shorten the stopping distance - warns the driver visually and audibly in dangerous situations as well as with a preventive brake jolt)
- Stainless steel pedals
- Proactive occupant protection system in conjunction with "Front Assist"
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring system



- Radio accessories: 8 speakers
- Rain sensor
- Wheels: AirStop tires 255/45 R 19, optimized for low rolling resistance
- Gearshift knob in leather
- Drawers under the front seats
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner (3 three-point automatic seat belts at the rear including belt tensioner for the outer rear seats - warning tone and light for unfastened seat belts at the front and rear)
- Seats: Heated front seats
- Seats: Front seats with height adjustment
- Start-stop system with brake energy recuperation
- Power outlet: 2 USB-C ports on the front (charging power up to 45 W)
- Telephone interface
- Textile floor mats front and rear
- Prepared for later activation: Navigation function "Discover Media" incl. "Streaming & Internet"
- Central locking without safe locking, with remote control and 2 remote keys

Extra equipment

- Anti-theft alarm system with safe locking (anti-theft alarm system with interior monitoring, backup horn and tow-away protection, central locking with safe locking, remote control and 2 remote folding keys)
- Mesh partition
- Package: Business Premium incl. Navigation (DSG) (2 USB-C ports in the front, 1 USB-C charging port on the rear center console - Head-up display - Leather multifunction steering wheel, heated, with shift paddles - Automatically heated windshield washer nozzles in the front - Voice control - "Comfort" telephone interface with inductive charging function - Heated front seats)
- Package: Driver assistance package "Plus" without "Side Assist" and proactive occupant protection system (Driving assistant "Travel Assist", lane keeping assistant "Lane Assist" and "Emergency Assist" - parking steering assistant "Park Assist" incl. parking aid - traffic sign recognition)
- Radio accessories: "Harman Kardon" sound system (8+1 speakers - 480 watts total power - digital 16-channel amplifier - subwoofer)
- Keyless locking and starting system "Keyless Access" with safe locking mechanism

- Wheels: Tire Mobility Set omitted
- Wheels: Alloy (4) "Valencia" 8.5 J x 19, Volkswagen R (tires 255/45 R 19)
- Electromechanical power steering (speed-dependent control)
- Seats: Front passenger seat backrest folds down completely
- Seats: Lumbar support in the front
- Seats: Top comfort seats in the front (passenger seat backrest folds down completely - drawers under the front seats)
- 12-volt power outlet (on the rear center console and in the luggage compartment)
- Bumpers in body color, in "R-Line" styling (wheel arch extensions in black)
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Green thermal insulation glazing, sides and rear

- Paint finish: Metallic in combination with R-Line "Black Style"
- Navigation system "Discover Pro" incl. "Streaming & Internet" (8 speakers - App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto - Digital radio reception DAB+ - Navigation system "Discover Pro" incl. "Streaming & Internet" - Radio - Voice control - Traffic sign recognition)
- Package: Design package "Black Style" (4 "Valencia" 8.5 J x 19 alloy wheels in black, Volkswagen R, Airstop tires 255/45 R 19, optimized for rolling resistance - exterior mirror housings in black - rear side windows and rear window tinted, approx. 90% light-absorbing - bumpers in body color, in "R-Line" styling - trim strips in black)
- Package: Leather package "Vienna", Volkswagen R, incl. front seats with memory function (electrically adjustable, folding, heated exterior mirrors with memory function and ambient lighting - electrically adjustable lumbar support in front - leather seat covers - electrically adjustable front seats with memory function; with comfort entry on the driver's side - front seats with active climate control)
- Surround view "Area View" (incl. reversing camera "Rear View")



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front right side	Brightware - lower - Scratch(es) - Smart repair
2	Engine	Engine - Leaking - Perform diagnosis
3	Side panel - rear right side	Interior trim (+ Fehlstellung LED - montieren) - Scratched - Smart repair
4	Vehicle glazing	Side window - rear right side (Dichtung) - Scratch(es) - Loss in value
5	Trim / covers	Carpet - front left side - Holes - Smart repair
6	Side panel - rear right side	Wheel well extension - Scratch(es) - Replace
7	Roof	Roof (+ Steinschlag) - dent(s) - Repair and paint

Wear and tear

No.	Component group	Description
1	Front bumper	Spoiler - Scratch(es) - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction
3	Body	Body - Scratch(es) - No deduction
4	Rear bumper	Rear bumper (Schutzfolie) - Scratch(es) - No deduction
5	Bonnet	Bonnet - Stone chips - No deduction
6	Trim / covers	Floor mats - Holes - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Interior - Boot cover / roller cover

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres

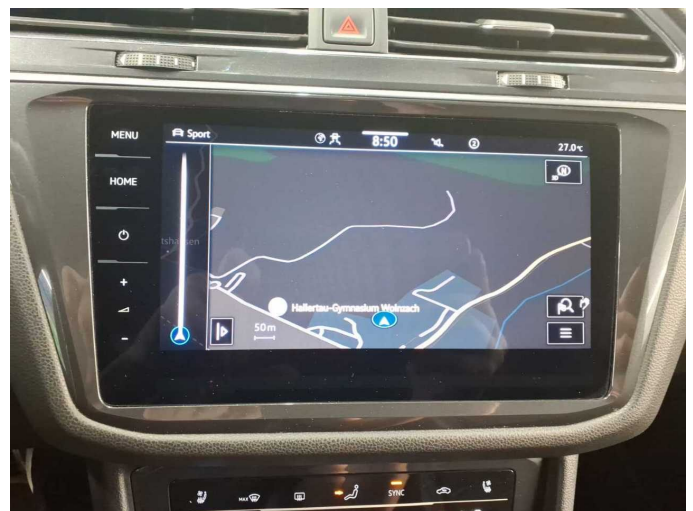


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Damage 1: Door - front right side: Brightware - lower - Scratch(es) - Smart repair



Damage 1: Door - front right side: Brightware - lower - Scratch(es) - Smart repair



Damage 2: Engine: Engine - Leaking - Perform diagnosis



Damage 2: Engine: Engine - Leaking - Perform diagnosis



Damage 3: Side panel - rear right side: Interior trim (+ Fehlstellung LED - montieren) - Scratched - Smart repair



Damage 3: Side panel - rear right side: Interior trim (+ Fehlstellung LED - montieren) - Scratched - Smart repair



Damage 3: Side panel - rear right side: Interior trim (+ Fehlstellung LED - montieren) - Scratched - Smart repair



Damage 3: Side panel - rear right side: Interior trim (+ Fehlstellung LED - montieren) - Scratched - Smart repair



Damage 4: Vehicle glazing: Side window - rear right side (Dichtung) - Scratch(es) - Loss in value




Damage 4: Vehicle glazing: Side window - rear right side (Dichtung) - Scratch(es) - Loss in value



Damage 4: Vehicle glazing: Side window - rear right side (Dichtung) - Scratch(es) - Loss in value



Damage 4: Vehicle glazing: Side window - rear right side (Dichtung) - Scratch(es) - Loss in value

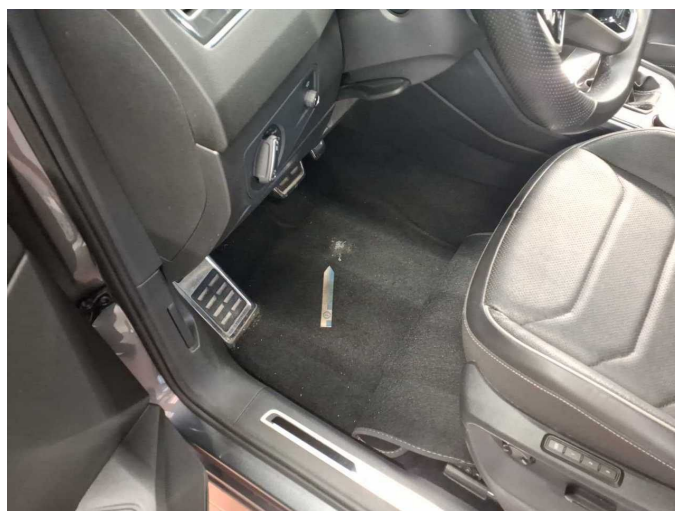

Damage 5: Trim / covers: Carpet - front left side - Holes - Smart repair



Damage 5: Trim / covers: Carpet - front left side - Holes - Smart repair



Damage 6: Side panel - rear right side: Wheel well extension - Scratch(es) - Replace



Damage 6: Side panel - rear right side: Wheel well extension - Scratch(es) - Replace




Damage 7: Roof: Roof (+ Steinschlag) - dent(s) - Repair and paint



Damage 7: Roof: Roof (+ Steinschlag) - dent(s) - Repair and paint



Damage 7: Roof: Roof (+ Steinschlag) - dent(s) - Repair and paint

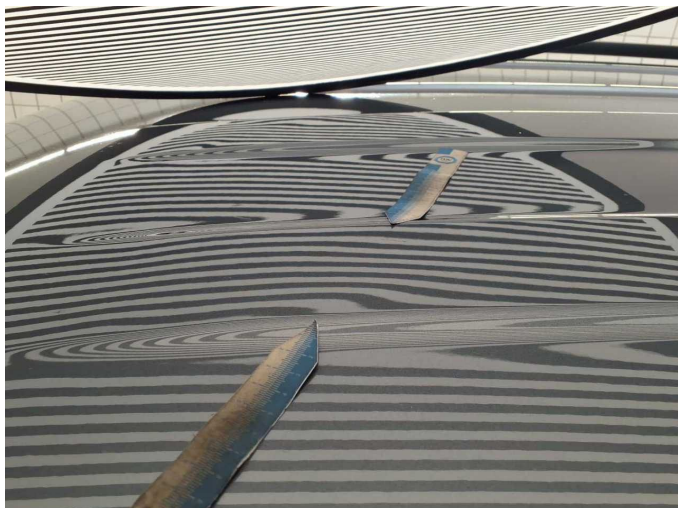

Damage 7: Roof: Roof (+ Steinschlag) - dent(s) - Repair and paint



Damage 7: Roof: Roof (+ Steinschlag) - dent(s) - Repair and paint



Damage 7: Roof: Roof (+ Steinschlag) - dent(s) - Repair and paint



Damage 7: Roof: Roof (+ Steinschlag) - dent(s) - Repair and paint



Damage 7: Roof: Roof (+ Steinschlag) - dent(s) - Repair and paint



Wear and tear 1: Front bumper: Spoiler - Scratch(es) - No deduction



Wear and tear 1: Front bumper: Spoiler - Scratch(es) - No deduction



Wear and tear 5: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 5: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 5: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 5: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 5: Bonnet: Bonnet - Stone chips - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ5N6PM083986

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Tiguan Allspace 2.0 TDI SCR
4Motion DSG R-Line

Datum	KM-Stand	Beschreibung
07.05.2026	0	HU + AU
02.04.2026	150.570	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
19.08.2025	120.063	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Ölwechsel - Hinterachse; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
15.01.2025	91.686	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
05.06.2024	59.662	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
01.12.2023	29.808	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges