



VOLKSWAGEN GOLF: GM-263-NG

Vinnumber:	WVWZZZCDXPW154819	Versionname:	VOLKSWAGEN GOLF 1.5 TSI ACT OPF 130 BVM6 Life
First Registrationdate:	6/03/2023	Fiscalpower:	Soci Busi VF [5P] 6-130CH-7cv (bi-corps VU-)
Expertise Mileage:	173204	Power Kw:	96
Bodytype:	Berline	Body colour:	White
Gearbox:	MAN 6 VIT	Paint type:	Opaque
Transmission:	Front	Interior colour:	Dark Grey
Fueltype:	Petrol	Type of rims (mounted):	Aluminium
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	2		
Number head rests:	2		
Type of rims (mounted):	Aluminium		
Category:	VS		

Options

Number of keys total	2	Radio	
Number keys remote	2	Central consol F	
GPS big screen color		Luggage cover	
GPS storage		Headlights Xenon/LED/Laser	
GPS storage	HD	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Rear view camera	
Cruise Control		Seat cover lining	Lining Other
Steering wheel multifunctional			
Steering wheel leather			
Type of climate control	Autom climate control		

Tyres

	205/55/16/91 H			
Summer tyres:	Fr.L.	Continental: 25%	Fr.R.	Continental: 25%
	Re.L.	Continental: 20%	Re.R.	Continental: 25%
Tyre profile depth FL				6.7
Tyre profile depth FR				6.6
Tyre profile depth RL				6.8
Tyre profile depth RR				6.7
Tyre size FL				205/55 R 16 91 H
Tyre size FR				205/55 R 16 91 H
Tyre size RL				205/55 R 16 91 H
Tyre size RR				205/55 R 16 91 H
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				All seasons
Tyre type RR				All Seasons
Tyre make FL				256
Tyre make FR				256
Tyre make RL				256
Tyre make RR				256

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Glove compartment lid, Scratch(es), Acceptable



Alloy rim RR, Scratch(es), Repair/replace (lump sum)



Alloy rim FL, Scratch(es), Acceptable



Wing FL, Stone chip(s), Acceptable



Outside rear-view mirror housing L, Scratch(es), Acceptable



Bumper F, Scratch(es), Paint




Bonnet, Stone chip(s), Paint



Rear bulkhead lining, Scratch(es), Acceptable



Bumper R, Deformed / Strained, Repair and paint (complete)

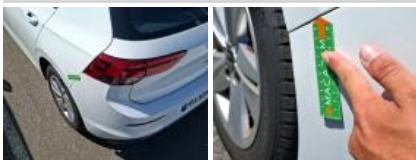

Historique Maintenance

Immatriculation: **GM-263-NG** Date de 1ère immatriculation: **06/03/2023**

Modèle: **Volkswagen GOLF 1.5 TSI ACT OPF 130 BVM6 Life Soci Busi VF [5P] 6-130CH-7cv (bi-corps VU-)**

Date	Kilométrage	Fournisseur	Descriptif
05/06/2026	165.026	DBF ROUTE ESPAGNE TOULOUSE	LIQUIDE LAVE GLACE
			REVISION
			RECYCLAGE
27/02/2026	151.627	CONTITRADE FRANCE	REMPLACEMENT PNEUS 4 SAISONS
09/02/2026	148.691	DBF TOULOUSE AUTOMOBILES	BALAI ESSUIE GLACE AV
			RECYCLAGE
			DISQUES PLAQUETTES AR RPLT
			LIQUIDE LAVE GLACE
			REVISION
10/10/2025	132.296	DBF TOULOUSE AUTOMOBILES	BALAI ESSUIE GLACE AR
			DISQUES PLAQUETTES AV RPLT
			REVISION
			LIQUIDE LAVE GLACE
16/09/2025	126.983	CONTITRADE FRANCE	RECYCLAGE
			PERMUTATIONS PNEUS
			PERMUTATIONS PNEUS
19/05/2025	111.619	CONTITRADE FRANCE	PERMUTATIONS PNEUS
			PERMUTATIONS PNEUS
			PERMUTATIONS PNEUS
			PERMUTATIONS PNEUS
03/03/2025	101.986	DBF TOULOUSE AUTOMOBILES	LIQUIDE DE FREIN
			REVISION
			RECYCLAGE
			BALAI ESSUIE GLACE AV
08/11/2024	83.956	CONTITRADE FRANCE	PLAQUETTES AR RPLT
			PERMUTATIONS PNEUS
			PERMUTATIONS PNEUS
05/08/2024	69.669	DBF TOULOUSE AUTOMOBILES	REVISION
			PLAQUETTES AV RPLT
28/06/2024	63.911	CONTITRADE FRANCE	PERMUTATIONS PNEUS
11/04/2024	53.332	DBF TOULOUSE AUTOMOBILES	REVISION
			BALAI ESSUIE GLACE AR
			RECYCLAGE
09/02/2024	42.622	DBF TOULOUSE AUTOMOBILES	BALAI ESSUIE GLACE AV
27/11/2023	30.727	DBF TOULOUSE AUTOMOBILES	REVISION
27/10/2023	23.369	CONTITRADE FRANCE	REMPLACEMENT PNEUS HIVER