



Expertise

Protocol number: 46512265
Order No. / Reference: 26521592
Inspection date: 14 Jul 2026

Manufacturer: Audi	Model: S7 TDI quattro tiptronic
VIN: WAUZZZF21NN038614	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi S7 TDI quattro tiptronic	
Vehicle Identification number	WAUZZZF21NN038614
Mileage (Read)	172,695 km
First registration	11 Apr 2022
Number of holders	1
Next periodical technical inspection	05/2027
(Report not on hand)	
Power / Engine displacement	253 kw / 2,967 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 6
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	Coupe
Colour / colour code	Brillantschwarz (Y9B)
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Red
Re-import	no
readiness to drive	Roadworthy



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	-500 km
Last service on / at	09/2025 at 142,855 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ031640
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0588 / BWS 00312		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,635 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/35 R21 98Y	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	255/35 R21 98Y	Summer tyres on Light alloy	Pirelli	5mm / 5mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R19 102V	Winter tyres on Light alloy	Pirelli	4mm / 4mm
2)	245/45 R19 102V	Winter tyres on Light alloy	Pirelli	4mm / 4mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- AdBlue tank (12 liters)
- Airbag: Front side airbags and head airbag system
- Anti-lock braking system (ABS)
- Audi drive select
- Audi pre sense basic
- Audi virtual cockpit plus
- Exterior mirror housings in aluminum look
- Outdoor temperature display
- Decorative inlays in dark, matt brushed aluminum
- Diesel particulate filter (DPF)
- Door sills with aluminum inlays at the front and rear, illuminated
- Remote key (without Safe-Lock)
- Cruise control system including speed limiter
- Heated rear window
- Interior lighting
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- Fuel tank with increased filling volume
- LED headlights
- Mild hybrid
- front center armrest
- Package Storage
- Non-smoking package
- Progressive steering
- Wheel: Tire pressure monitoring system
- Radio: MMI Radio plus with MMI touch response
- Power steering
- Seats: 4-way lumbar support
- Seats: Sports seats plus front
- Lane Departure Warning
- Start-stop system
- Glazing: Windscreen in heat-insulating and acoustic glazing
- Central locking
- Airbag for driver and front passenger
- All-wheel drive "quattro" with self-locking center differential
- Audi connect emergency call & service with Audi connect Remote & Control
- Audi pre sense front
- Electrically adjustable, heated and folding exterior mirrors with memory function
- Vehicle tool kit
- Anti-theft alarm system
- Tachometer
- Electronic Stability Control (ESC)
- Chassis: S sport suspension with damper control
- Luggage compartment lid, electrically opening and closing
- Transmission: 8-speed automatic transmission tiptronic
- Rear window, rear door and side windows in clear glass
- Interior mirror dimming
- 4-zone automatic climate control
- Headrests (2) height adjustable
- Paint finish: Solid
- Steering wheel: Leather steering wheel, 3-spoke, with multifunction and paddle shifters
- MMI navigation with MMI touch response
- Package Gloss
- Pedals and footrest in stainless steel
- Wheel: Alloy wheels, 5 double spokes (S-design)
- Wheel: Tire repair kit
- Radio accessories: Audi sound system
- Seat covers in Alcantara/leather combination
- Seats: Rear seat backrest foldable
- Seats: Electrically adjustable front seats including memory function for the driver's seat
- Phone: Audi smartphone interface
- Electronic immobilizer
- thermal insulation glazing



Extra equipment

- AdBlue tank with increased filling volume (AdBlue tank with 22 liter filling volume - for diesel vehicles with SCR technology, to reduce nitrogen oxides in the exhaust gas)
- Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides, with memory function (with integrated LED turn signals and curb view function for the passenger-side exterior mirror, including heated windshield washer nozzles - the curb view function tilts the passenger-side exterior mirror downwards when reverse gear is engaged, giving the driver a better view of the curb)
- Front seat heating (heats seat and backrest center panels; with leather upholstery and sport seats plus also seat side bolsters - individually adjustable in multiple stages for driver and front passenger side via the climate control unit)
- High Beam Assist (The High Beam Assist uses a camera system to automatically detect oncoming traffic, vehicles ahead, and urban light sources within the system's limitations. Based on this information, the high beams are automatically switched on or off. The system thus improves the driver's visibility and increases comfort.)
- Lane change warning including Audi pre sense rear, exit warning and rear cross-traffic assist (Lane change warning helps the driver monitor the blind spot and traffic behind the vehicle. Exit warning warns of a possible collision when opening a door while the vehicle is stationary. Rear cross-traffic assist (Audi pre sense rear) uses data from the radar sensors.
- Package: Black Optics Package Plus (Black optics package with Audi rings front and rear and model designation on the rear in black. On the S model, the model designation in the radiator grille is also finished in black)
- Reversing camera (The reversing camera displays the area behind the vehicle on the upper display. Dynamic display elements such as a steering angle-dependent lane calculation assist with parking or maneuvering.)
- Seat covers in Valcona leather with S embossing for sports seats (seat center panels, seat side bolsters, headrests and front center armrest in black or rotor grey Valcona leather with contrasting stitching; door panel inserts in black Alcantara with S embossing in the backrests of the front seats)
- Tour Assistance Package (Adaptive Driving Assistant - Adaptive Cruise Control, Speed Limiter - Efficiency Assistant supports the driver in anticipatory and therefore fuel-saving driving - Evasive Steering Assist helps the driver to steer the vehicle around an obstacle in a critical situation - Turning Assist - Emergency Assist - High Beam Assist - Camera-based Traffic Sign Recognition)
- Wheel: Winter alloy wheels, 5-arm dynamic (8 J x 19 with winter tires 245/45 R 19)
- Ambient Lighting Package Plus (in addition to the Ambient Lighting Package: - 6 predefined color profiles; additional interactive and individual color profile. - Color-matched contour lighting for front and rear doors - Color-matched ambient fabric lighting for front and rear doors - Color-matched ambient lighting for the front center console - Color-matched contour lighting for the front center console - Contour lighting with illuminated quattro lettering (for all-wheel drive) - Color-matched ambient lighting for the instrument panel)
- Black fabric headliner
- Decorative inlays in carbon fiber body structure (for dashboard, door panels and center console; including aluminum-look trim)
- Glazing: Privacy glazing (tinted windows) (rear window, rear door and side windows tinted)
- Interior elements above and below in imitation leather
- Interior mirror, automatically dimming, frameless
- Parking assistant with parking aid plus (The parking assistant supports parking maneuvers by making suitable steering corrections. Ultrasonic sensors search for suitable parallel and perpendicular parking spaces. For perpendicular parking spaces (forwards and backwards), the ideal parking path is calculated; for parallel parking spaces, the ideal entry and exit paths are calculated. The system takes over the steering. The driver only needs to follow the instructions on the display to change gears, accelerate, brake, and monitor the parking process.)
- Seats: Folding rear seat backrest (2+1 seater in the rear) (pronounced outer rear seats, visually adapted to the front seats, and an additional middle seat option; 3 rear L-shaped headrests, manually height-adjustable for good rear visibility; three 3-point seat belts; rear seat backrest split 40:20:40 or fully foldable; one-piece, foldable rear center armrest with storage compartment)
- Servo closing for the doors (The servo closing mechanism ensures quiet and reliable closing of the vehicle doors. It is sufficient to let the doors fall lightly into the lock: The servo closing mechanism automatically pulls doors that are not fully latched into the lock.)
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction plus, heated (with shift paddles)
- Towbar (ball head mechanically swiveling with electric release - ball rod and head made of forged steel - operation via push button in the luggage compartment - trailer stabilization via the electronic stability control (ESC) The integrated swiveling system socket allows continuous operation of electrical devices in the trailer or caravan while driving and can be swivelled invisibly behind the bumper apron when not in use)
- Wheel: Audi Sport light alloy wheels, 5-V-spoke star, black, gloss-turned (8.5 J x 21 with tires 255/35 R 21)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Body	Body - Glued / labelled - De-glue / neutralise
2	Door - front left side	Door edge - Scratch(es) - Smart repair
3	Side panel - rear right side	Side panel - Scratch(es) - Smart repair
4	Exhaust system	Exhaust system (Blende) - Missing - Replace
5	Interior	Interior - Soiled - Clean
6	2nd wheel set	1 alloy rim - Scratch(es) - Loss in value
7	Tail light	Tail lamp - right side (Materialabtrag) - Scratched - Replace
8	Misc.	Inspection / maintenance - Due - Perform
9	Rear bumper	Rear bumper - Scratched - Paint
10	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint
11	Wheel / tyres	Alloy rim - front left side (Materialabtrag) - Scratched - Replace
12	Wheel / tyres	Alloy rim - front right side (Materialabtrag) - Scratched - Replace
13	Front bumper	Front bumper - Scratched - Replace

Wear and tear

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Mudguard - left side	Mudguard - left side - Stone chips - No deduction
3	Door - rear left side	Door - Scratch(es) - No deduction
4	Seat - front	Seat cover - right side (Hinten) - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

2nd wheel set - Wheel cover set - complete (4x Nabendeckel)

Equipment - Tirefit complete

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 28 Jun 2025	2.630,35 €



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Die beigefügten Reparaturkostenkalkulationen wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

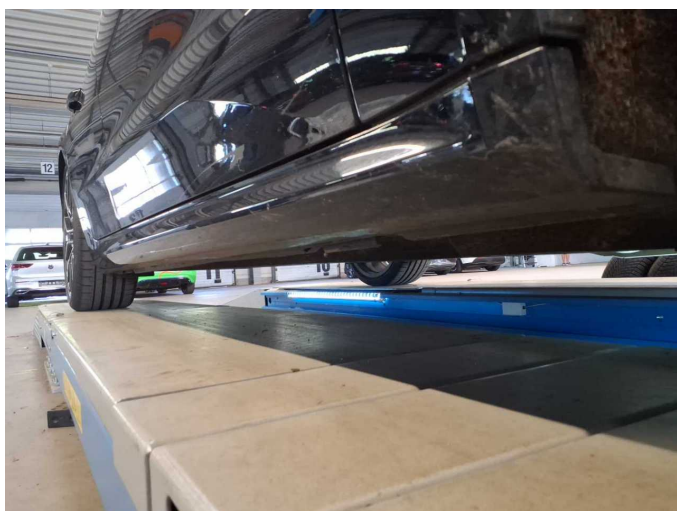


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

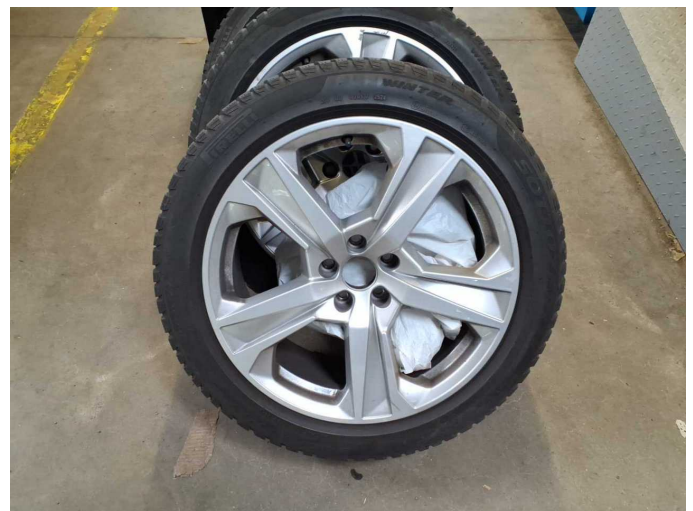


Figure 28: Misc.

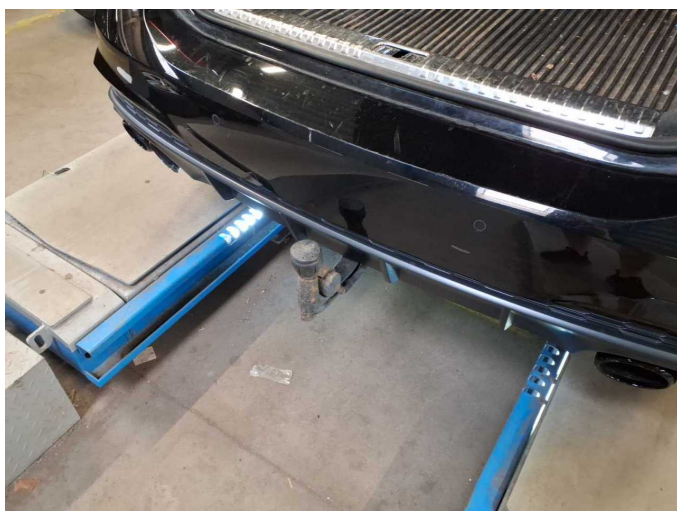


Figure 29: Misc.



Damage 1: Body: Body - Glued / labelled - De-glue / neutralise




Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair




Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair




Damage 3: Side panel - rear right side: Side panel - Scratch(es) - Smart repair

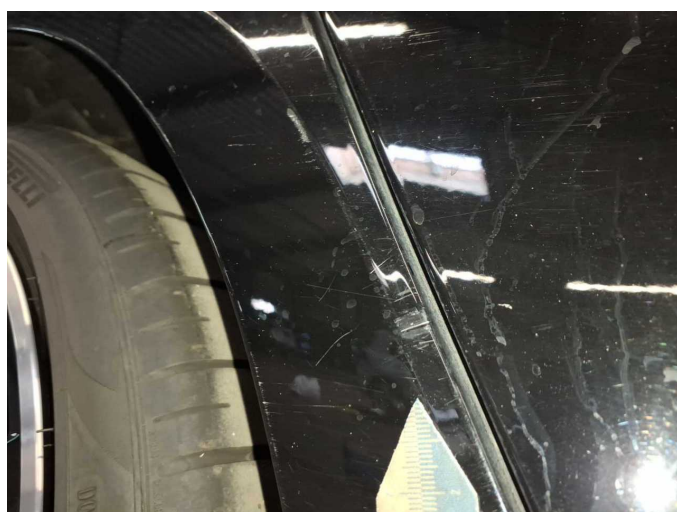


Damage 3: Side panel - rear right side: Side panel - Scratch(es) - Smart repair

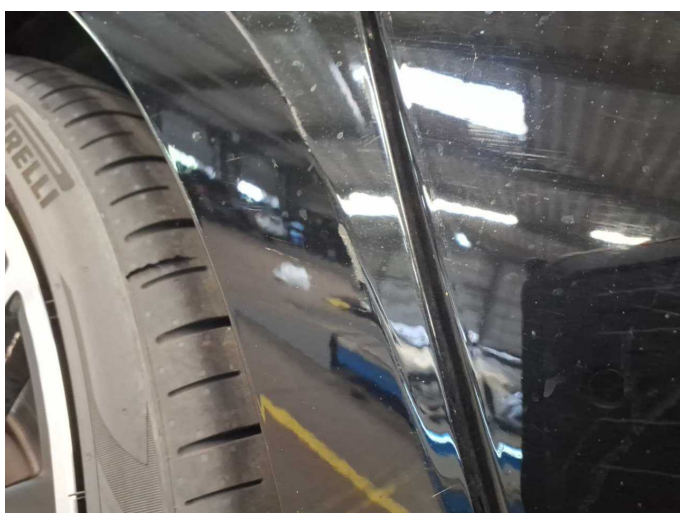

Damage 3: Side panel - rear right side: Side panel - Scratch(es) - Smart repair

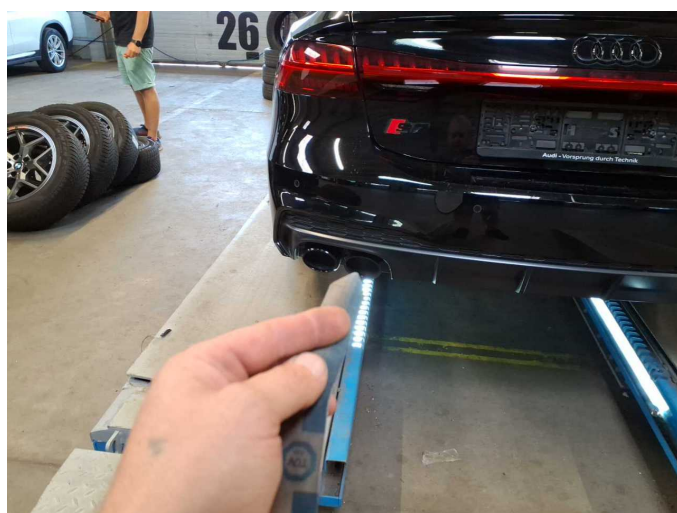


Damage 4: Exhaust system: Exhaust system (Blende) - Missing - Replace

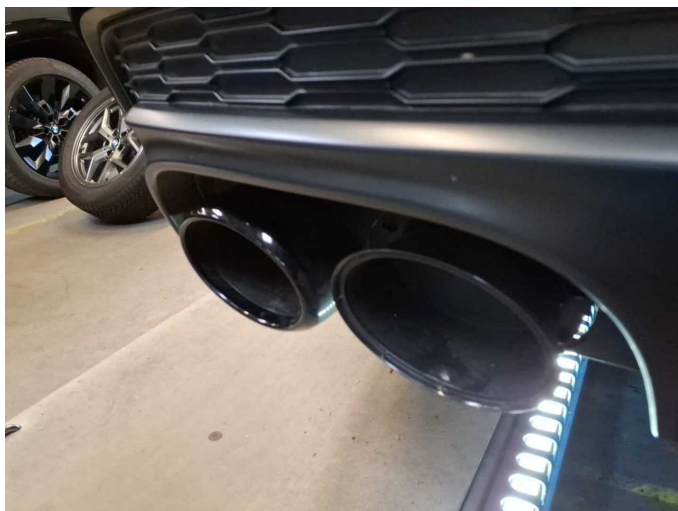

Damage 4: Exhaust system: Exhaust system (Blende) - Missing - Replace




Damage 4: Exhaust system: Exhaust system (Blende) - Missing - Replace

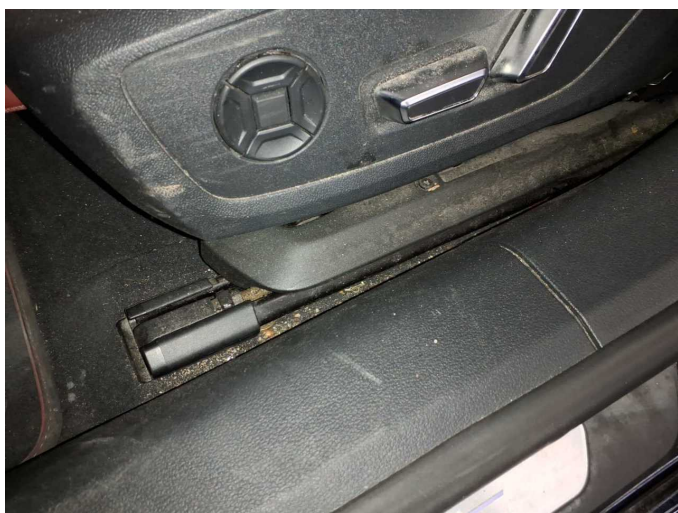

Damage 5: Interior: Interior - Soiled - Clean



Damage 5: Interior: Interior - Soiled - Clean

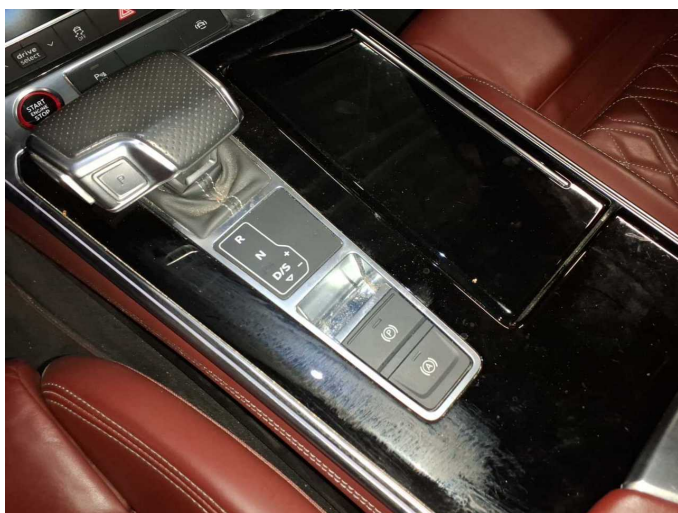

Damage 5: Interior: Interior - Soiled - Clean



Damage 5: Interior: Interior - Soiled - Clean



Damage 5: Interior: Interior - Soiled - Clean



Damage 5: Interior: Interior - Soiled - Clean




Damage 6: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 6: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value




Damage 7: Tail light: Tail lamp - right side (Materialabtrag) - Scratched - Replace

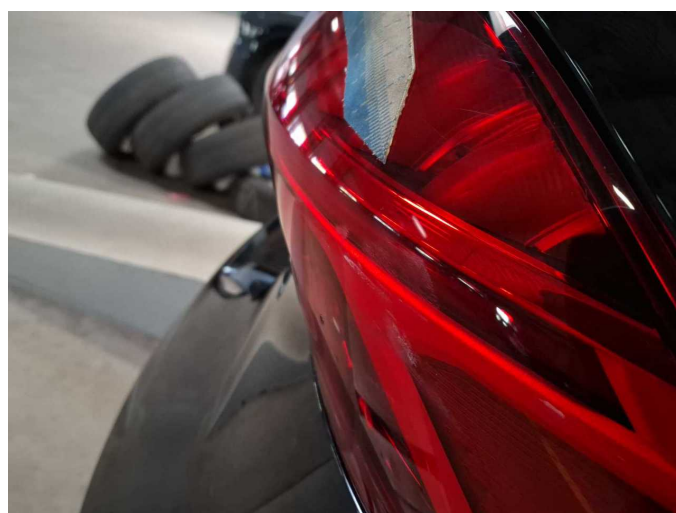

Damage 7: Tail light: Tail lamp - right side (Materialabtrag) - Scratched - Replace



Damage 7: Tail light: Tail lamp - right side (Materialabtrag) - Scratched - Replace

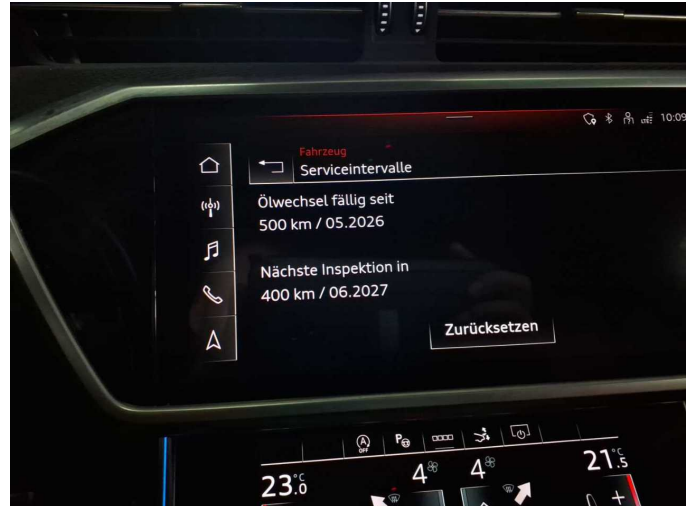

Damage 8: Misc.: Inspection / maintenance - Due - Perform



Damage 9: Rear bumper: Rear bumper - Scratched - Paint



Damage 9: Rear bumper: Rear bumper - Scratched - Paint




Damage 9: Rear bumper: Rear bumper - Scratched - Paint



Damage 9: Rear bumper: Rear bumper - Scratched - Paint



Damage 9: Rear bumper: Rear bumper - Scratched - Paint

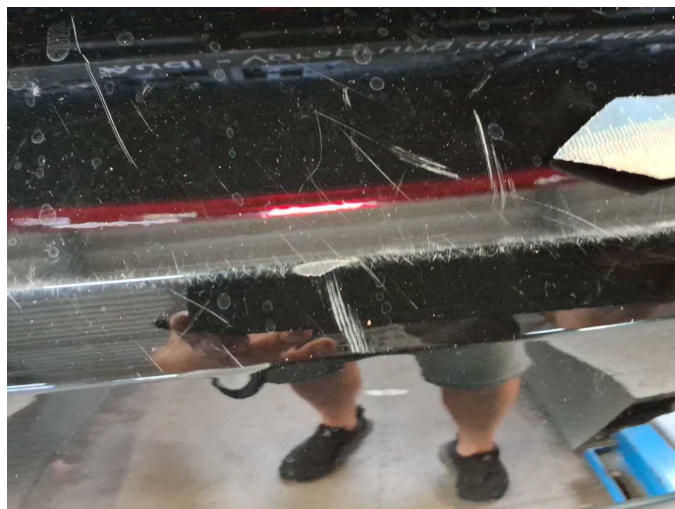


Damage 9: Rear bumper: Rear bumper - Scratched - Paint




Damage 10: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 10: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

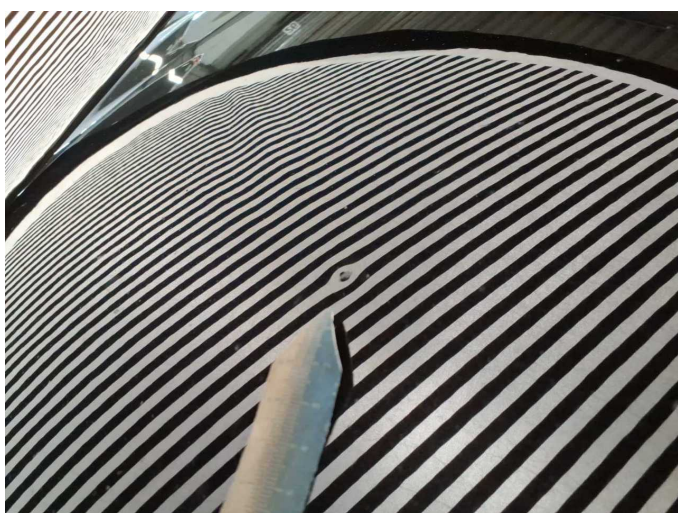

Damage 10: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

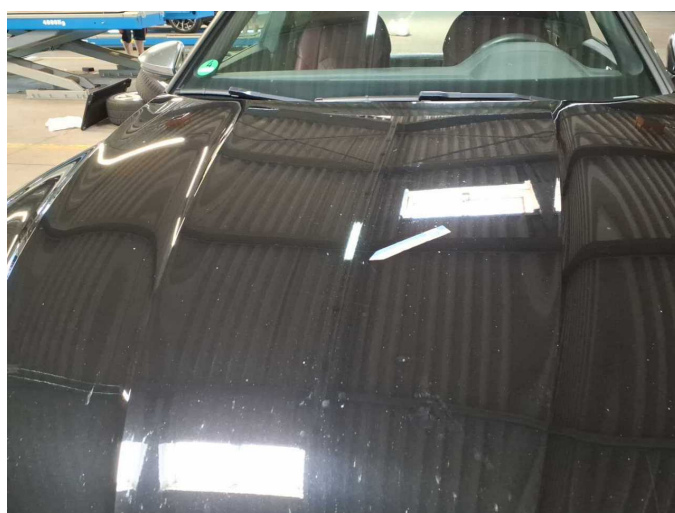

Damage 10: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 10: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 11: Wheel / tyres: Alloy rim - front left side (Materialabtrag) - Scratched - Replace



Damage 11: Wheel / tyres: Alloy rim - front left side (Materialabtrag) - Scratched - Replace



Damage 11: Wheel / tyres: Alloy rim - front left side (Materialabtrag) - Scratched - Replace



Damage 12: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace




Damage 12: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace




Damage 12: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace




Damage 12: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace

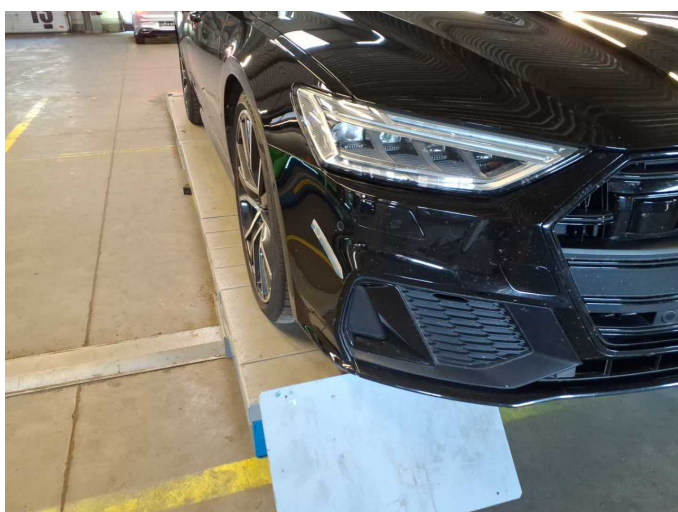


Damage 13: Front bumper: Front bumper - Scratched - Replace

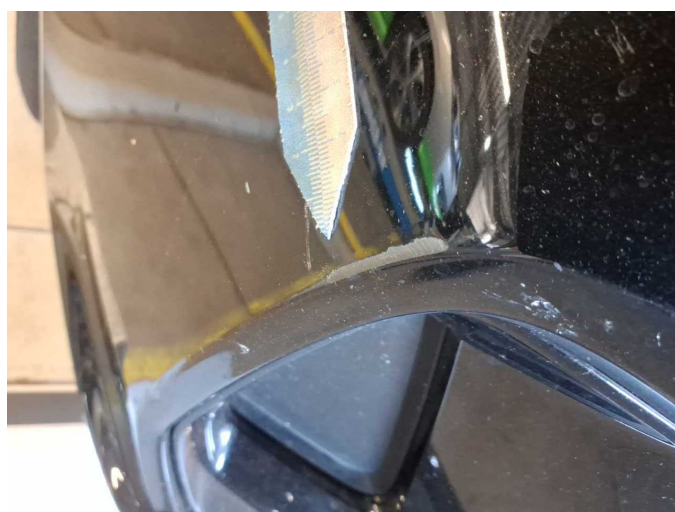

Damage 13: Front bumper: Front bumper - Scratched - Replace

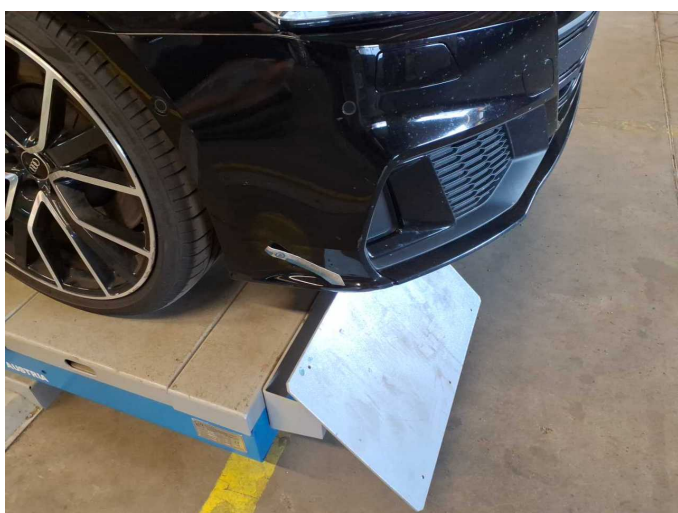


Damage 13: Front bumper: Front bumper - Scratched - Replace

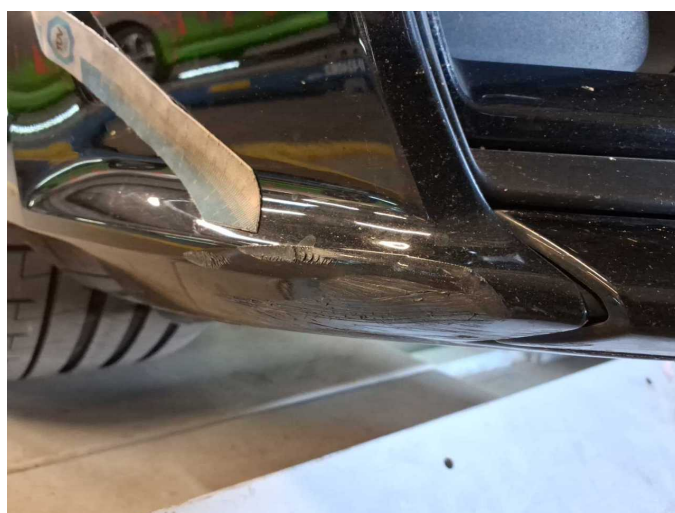


Damage 13: Front bumper: Front bumper - Scratched - Replace




Damage 13: Front bumper: Front bumper - Scratched - Replace

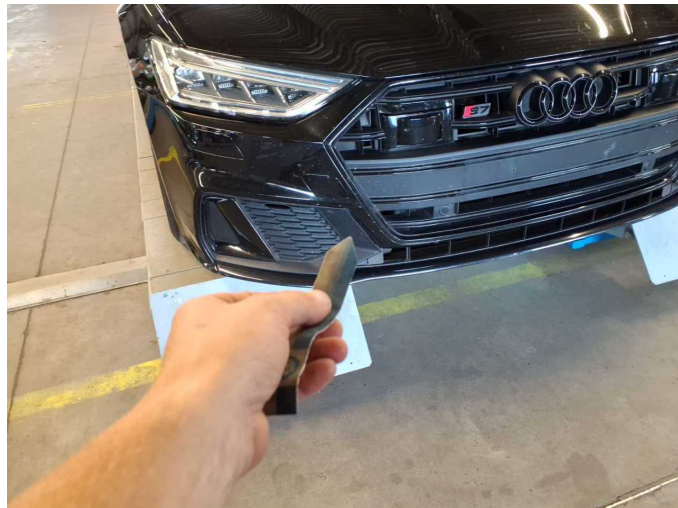

Damage 13: Front bumper: Front bumper - Scratched - Replace

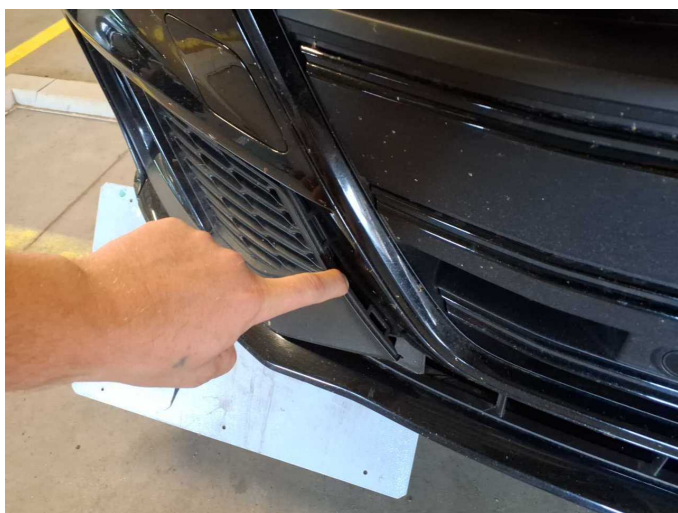

Damage 13: Front bumper: Front bumper - Scratched - Replace

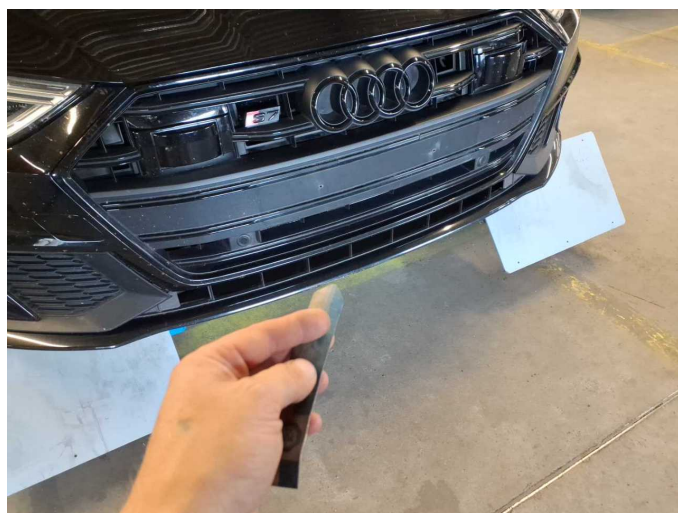


Damage 13: Front bumper: Front bumper - Scratched - Replace




Damage 13: Front bumper: Front bumper - Scratched - Replace




Damage 13: Front bumper: Front bumper - Scratched - Replace

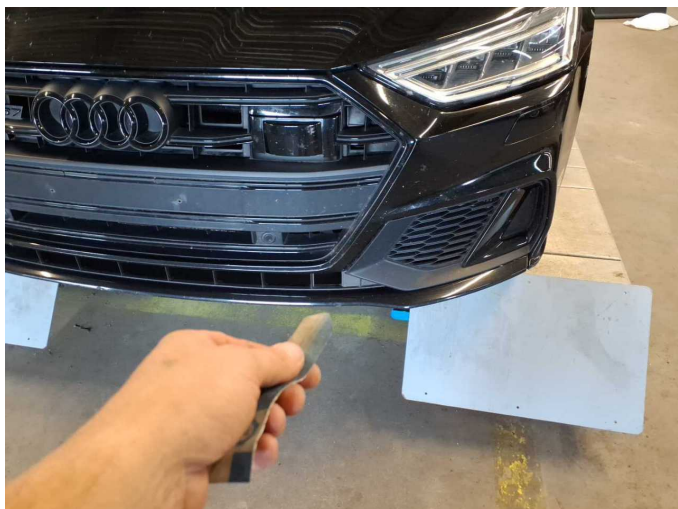


Damage 13: Front bumper: Front bumper - Scratched - Replace

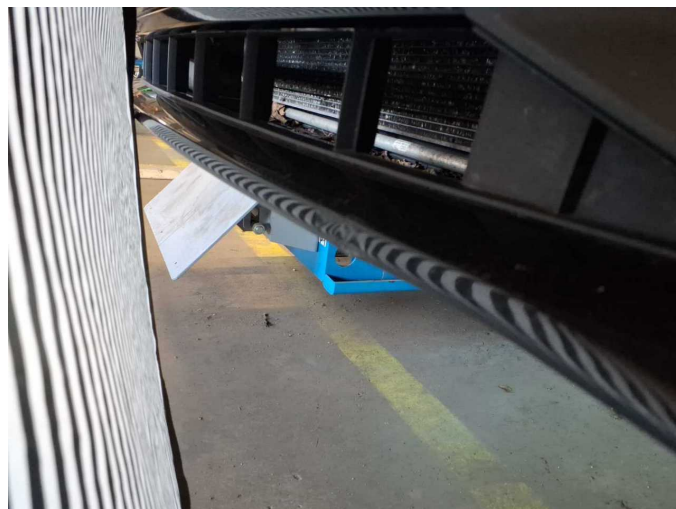


Damage 13: Front bumper: Front bumper - Scratched - Replace

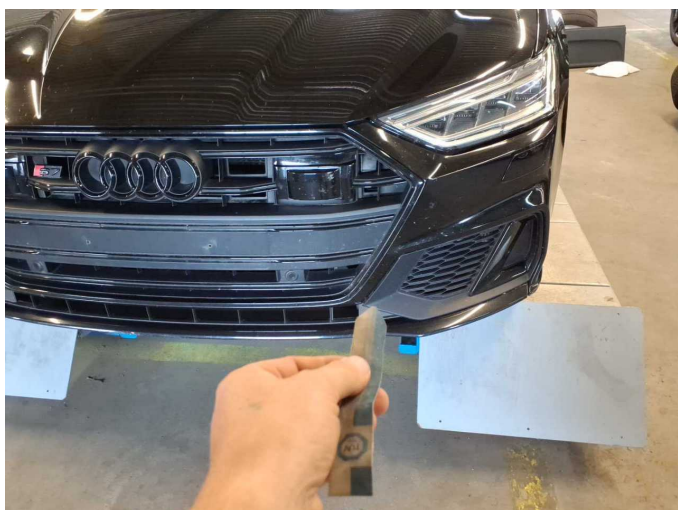

Damage 13: Front bumper: Front bumper - Scratched - Replace

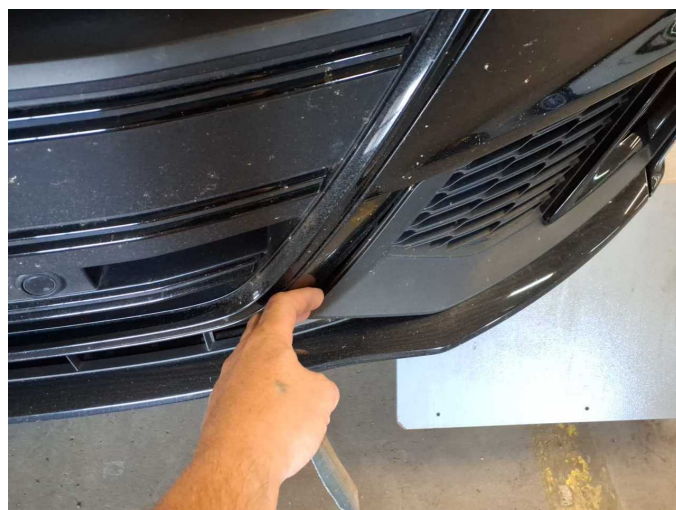

Damage 13: Front bumper: Front bumper - Scratched - Replace

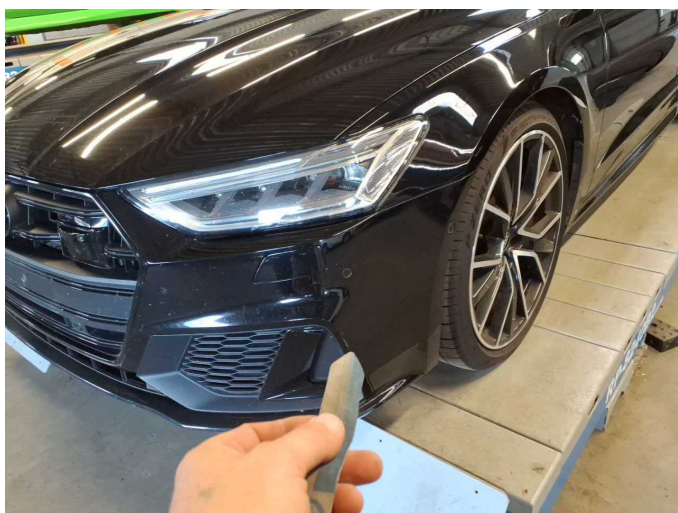

Damage 13: Front bumper: Front bumper - Scratched - Replace



Damage 13: Front bumper: Front bumper - Scratched - Replace



Damage 13: Front bumper: Front bumper - Scratched - Replace




Damage 13: Front bumper: Front bumper - Scratched - Replace



Wear and tear 2: Mudguard - left side: Mudguard - left side - Stone chips
- No deduction



Wear and tear 4: Seat - front: Seat cover - right side (Hinten) -
Scratch(es) - No deduction

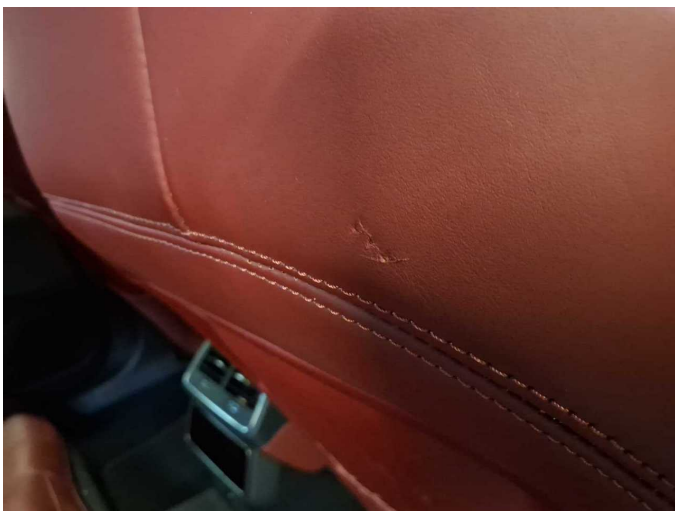

Wear and tear 4: Seat - front: Seat cover - right side (Hinten) -
Scratch(es) - No deduction



Missing part 1: 2nd wheel set: Wheel cover set - complete (4x
Nabendeckel) - Missing - Replace



Missing part 2: Equipment: Tirefit complete - Missing - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF21NN038614
Hersteller / Modell: AUDI AUDI S7 TDI quattro tiptronic

Datum	KM-Stand	Beschreibung
12.03.2026	166.756	Bremsflüssigkeit; Bremsflüssigkeit ern
30.09.2025	142.855	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
26.05.2025	130.586	AU; Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne
09.01.2025	115.761	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
21.03.2024	84.554	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
14.07.2023	54.545	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Regelwartungsdienst
24.11.2022	25.563	Motoröl b. Wartung; Regelwartungsdienst