



Expertise

Protocol number: 46557633
Order No. / Reference: 26580646
Inspection date: 15 Jul 2026

Manufacturer: Audi

Model: Q5 40 TDI quattro S tronic

VIN: WAUZZZFY2N2057145



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi Q5 40 TDI quattro S tronic	
Vehicle Identification number	WAUZZZFY2N2057145
Mileage (Read)	159,825 km
First registration	7 Apr 2022
Number of holders	1
Power / Engine displacement	150 kw / 1,968 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Brillantschwarz uni
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	-7 Tag(e)
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF531146
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BQW 00329		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,510 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/65 R17 108H	Winter tyres on Light alloy	Goodyear	4mm / 4mm
2)	235/65 R17 108H	Winter tyres on Light alloy	Goodyear	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/65 R17 104W	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	235/65 R17 104W	Summer tyres on Light alloy	Continental	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- AdBlue tank (12 liters)
- Airbag: Front side airbags and head airbag system
- "quattro" all-wheel drive with ultra technology
- Traction control (ASR)
- Audi drive select
- Audi pre sense city
- Hill descent control
- Fabric headliner
- Black roof rails with roof rack recognition
- Diesel particulate filter (DPF)
- Rear parking sensors
- Electromechanical parking brake
- Electronic Stability Control (ESC)
- Chassis: Standard chassis
- Remote key (without Safe-Lock)
- Luggage compartment lid, electrically opening and closing
- Transmission: S tronic 7-speed
- rear window wiper
- Interior mirror dimming
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- Rear headrests (3)
- Paint finish: Solid
- LED taillights
- Light/rain sensor
- front center armrest
- Non-smoking version
- Wheel: Alloy wheels, 17" 10-spoke
- Wheel: Tire repair kit
- Radio accessories: Data module Europe
- Seat belts
- Seats: Standard front seats
- Seats: Front seats manually adjustable
- Start-stop system
- Separation net
- Glazing: Windscreen in heat-insulating and acoustic glazing
- thermal insulation glazing
- black decorative trim
- Airbag for driver and front passenger
- Accent areas matte black
- Anti-lock braking system (ABS)
- Audi connect emergency call & service with Audi connect Remote & Control
- Exterior mirror housings in body color
- third brake light
- Roof edge spoiler
- Decorative inlays Micrometallic silver
- Tachometer
- Door sill trims with aluminum inlay at the front
- Electronic Differential Lock (EDS)
- Driver Information System
- Electric windows front and rear
- front and rear floor mats
- Cruise control system including speed limiter
- Heated rear window
- Interior lighting
- Manual child lock
- Automatic air conditioning
- boot floor mat
- Front headrests
- Plastic loading sill protector
- LED headlights
- Mild hybrid
- Model designation according to new performance labeling
- Wheel: On-board tools (excluding jack)
- Wheel: Tire pressure monitoring system
- Radio: MMI Radio plus
- Electromechanical power steering
- Fabric seat covers (synonym)
- Seats: Split-folding rear seat backrest
- Sun visor on driver and passenger side
- Phone: Bluetooth interface
- First aid kit with warning triangle
- Glazing: Clear glass
- Electronic immobilizer
- Central locking with remote control



Extra equipment

- Trailer hitch preparation (Includes pre-wiring and enhanced engine cooling. The trailer hitch is available through Audi Genuine Accessories and should be retrofitted by a specialist workshop, as additional modifications to the vehicle may be required.)
- High-beam assist (within the system's limitations, it automatically detects oncoming headlights, taillights of other road users, and light sources in built-up areas. Depending on the traffic situation, the high beams are automatically switched on or off. The system thus improves the driver's visibility and increases comfort.)
- Business package (Audi phone box - MMI Navigation plus (incl. driver information system with color display) - Audi virtual cockpit - Heated front seats - Automatically dimming interior mirror - Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides incl. curb view function for the passenger mirror - High beam assist - Manual sunshade for rear door windows)
- Electrically adjustable, heated, and folding exterior mirrors with automatic dimming on both sides (including curb view function for the passenger-side exterior mirror with integrated LED turn signal, including heated windshield washer nozzles, convex, flat, or aspherical mirror glass. The curb view function tilts the passenger-side exterior mirror downwards when reverse gear is engaged, providing the driver with a better view of the curb).
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction plus (with 14 multifunction buttons for convenient operation of the available infotainment features such as audio skip, telephony, NAV button or the freely programmable button - adjustable in height and distance - with full-size airbag - shift paddles for manual changing of the driving modes)
- Front seat heating (for driver and front passenger side, individually adjustable in 3 stages via direct selection button on the climate control unit)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Misc.	Inspection / maintenance - No evidence - No deduction
3	Door - front left side	Door (Leiste) - Scratched - Smart repair
4	Side panel - rear right side	Sill - Scratched - Smart repair
5	Side panel - rear right side	Side panel - dent(s) - Smooth repair work
6	Electronic systems	Electronic systems (Pdc vorne und hinten) - Functional / admissibility - Perform diagnosis
7	Seat - front	Seat - right side (Rückenlehne Schale) - Scratched - Replace
8	Misc.	Inspection / maintenance - Due - Perform
9	Rear bumper	Rear bumper - Scratched - Paint
10	Front bumper	Front bumper (Sandstrahl Effekt) - Scratched - Paint

Wear and tear

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Damaged - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Der beiliegende Radsatz ist nicht Bestandteil der vorliegenden Fahrzeugausstattung.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

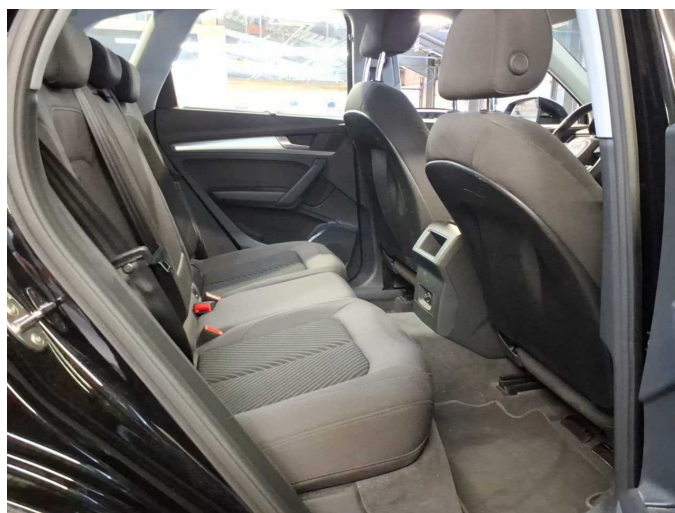


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres

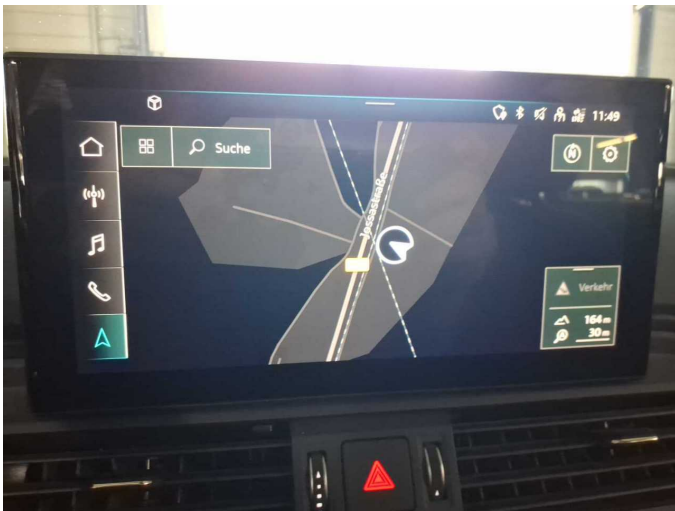


Figure 15: Navigation



Figure 16: Misc.

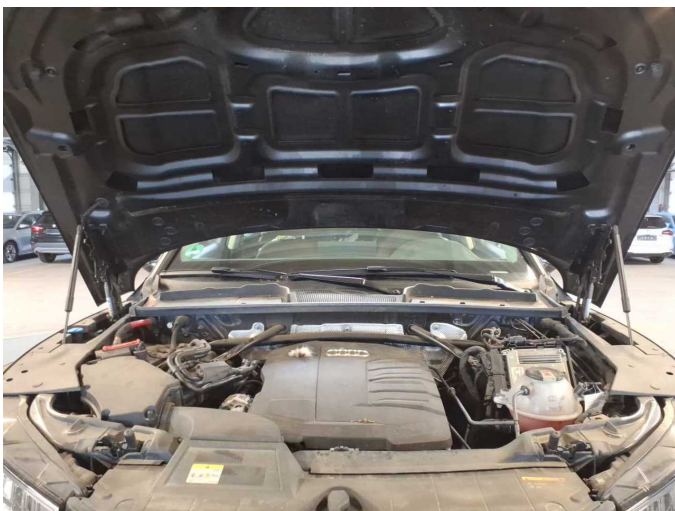


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

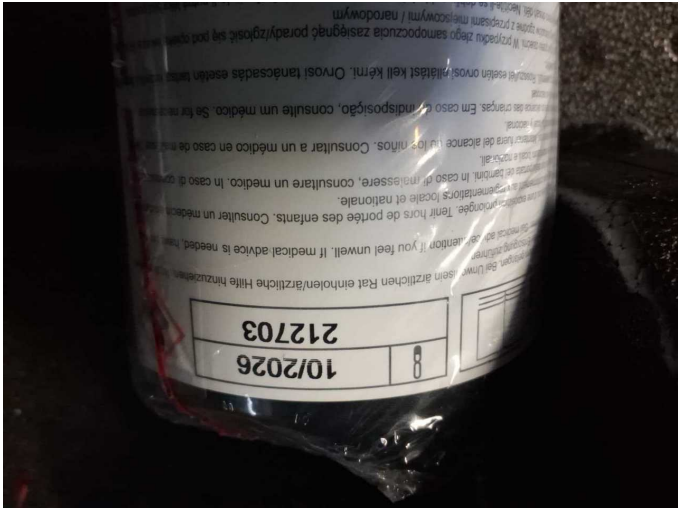


Figure 22: Misc.

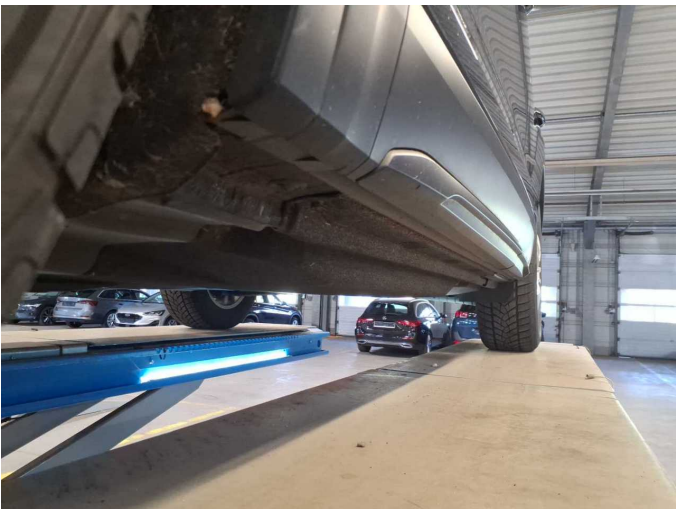


Figure 23: Misc.




Figure 24: Misc.



Figure 25: Misc.




Damage 3: Door - front left side: Door (Leiste) - Scratched - Smart repair

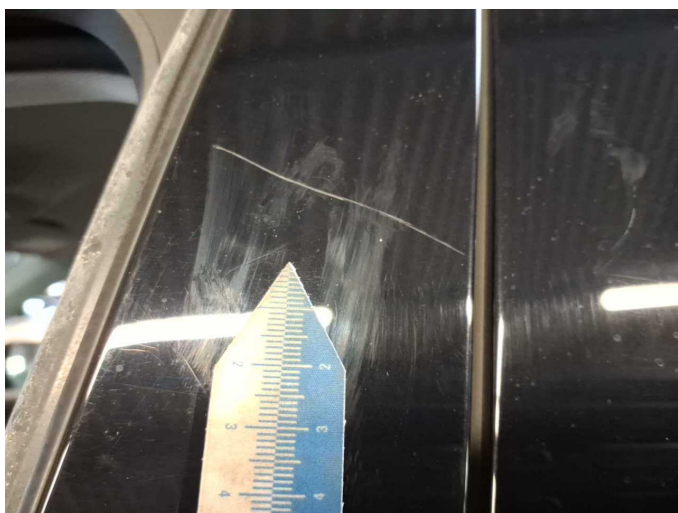


Damage 3: Door - front left side: Door (Leiste) - Scratched - Smart repair




Damage 4: Side panel - rear right side: Sill - Scratched - Smart repair

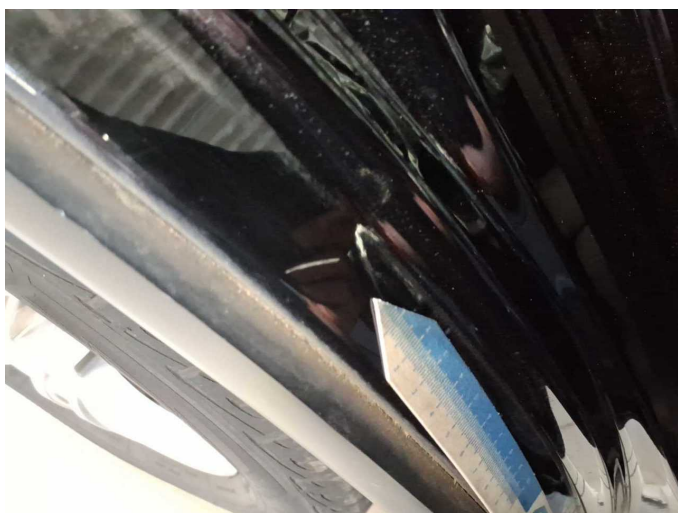

Damage 4: Side panel - rear right side: Sill - Scratched - Smart repair

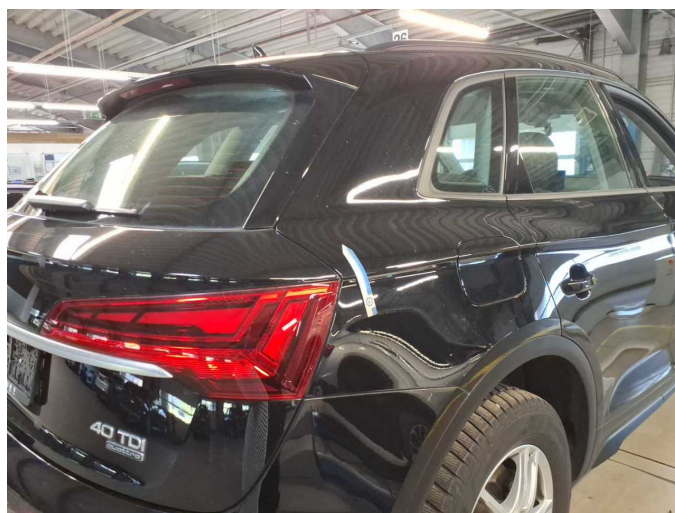

Damage 5: Side panel - rear right side: Side panel - dent(s) - Smooth repair work

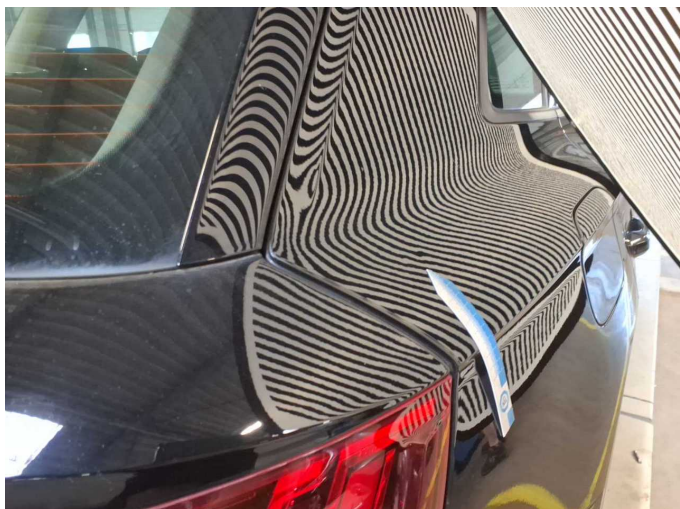

Damage 5: Side panel - rear right side: Side panel - dent(s) - Smooth repair work



Damage 7: Seat - front: Seat - right side (Rückenlehne Schale) - Scratched - Replace



Damage 7: Seat - front: Seat - right side (Rückenlehne Schale) - Scratched - Replace



Damage 8: Misc.: Inspection / maintenance - Due - Perform



Damage 9: Rear bumper: Rear bumper - Scratched - Paint




Damage 9: Rear bumper: Rear bumper - Scratched - Paint




Damage 9: Rear bumper: Rear bumper - Scratched - Paint




Damage 9: Rear bumper: Rear bumper - Scratched - Paint

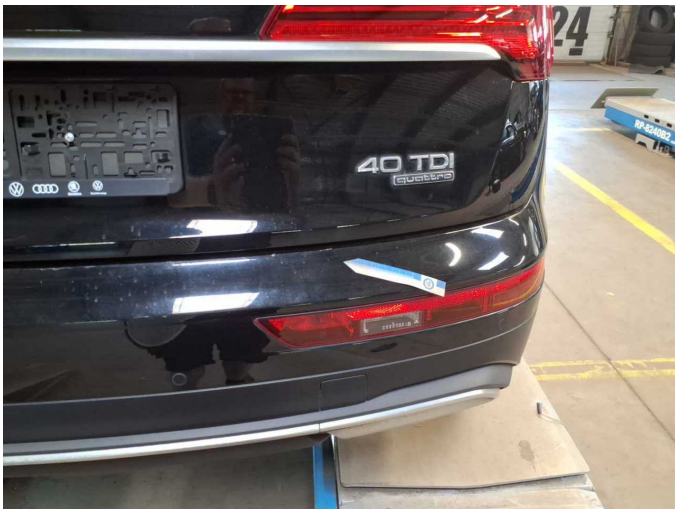

Damage 9: Rear bumper: Rear bumper - Scratched - Paint

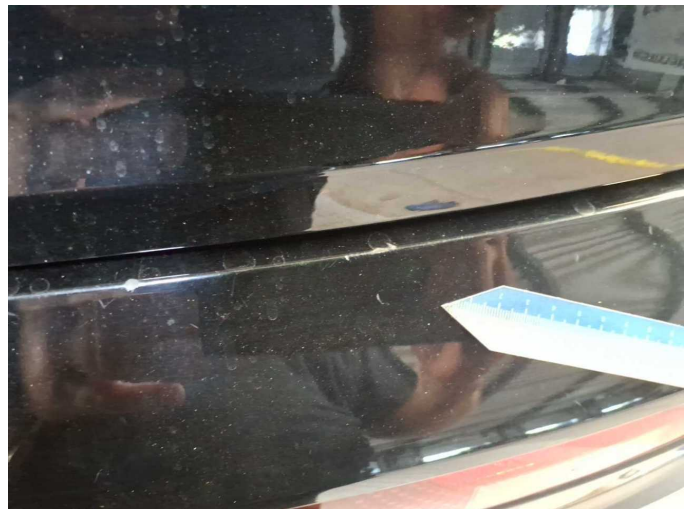


Damage 9: Rear bumper: Rear bumper - Scratched - Paint

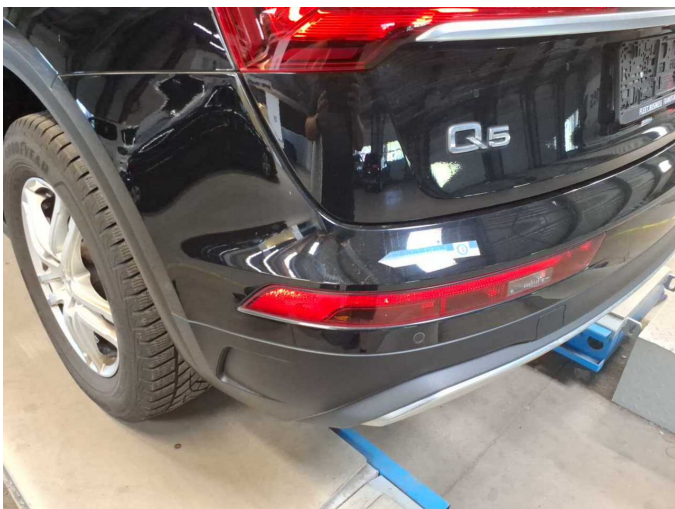

Damage 9: Rear bumper: Rear bumper - Scratched - Paint



Damage 9: Rear bumper: Rear bumper - Scratched - Paint

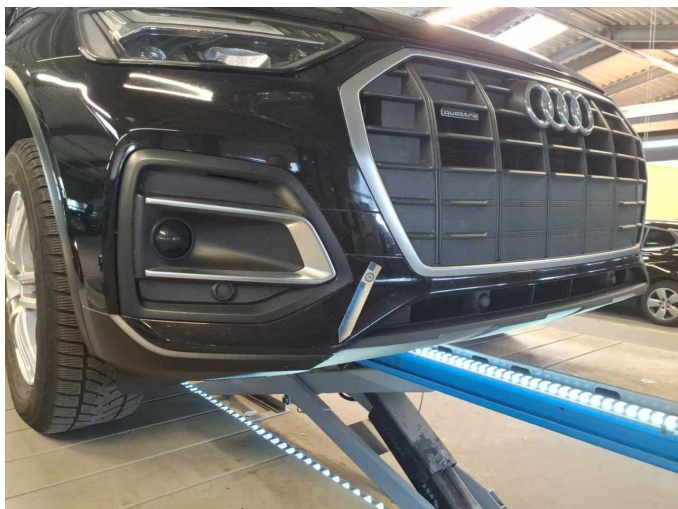

Damage 10: Front bumper: Front bumper (Sandstrahl Effekt) - Scratched - Paint



Damage 10: Front bumper: Front bumper (Sandstrahl Effekt) - Scratched - Paint



Damage 10: Front bumper: Front bumper (Sandstrahl Effekt) - Scratched - Paint



Wear and tear 1: 2nd wheel set: 1 alloy rim - Damaged - No deduction



Wear and tear 1: 2nd wheel set: 1 alloy rim - Damaged - No deduction