



Expertise

Protocol number: 46783208  
Order No. / Reference: 26733973  
Inspection date: 30 Jul 2026

Manufacturer: Skoda  
VIN: TMBJB7NS7P8014670

Model: Kodiah 1.5 TSI ACT DSG Ambition



| Vehicle details                         |                              |
|-----------------------------------------|------------------------------|
| Manufacturer / Type / Model / Equipment |                              |
| Skoda Kodiah 1.5 TSI ACT DSG Ambition   |                              |
| Vehicle Identification number           | TMBJB7NS7P8014670            |
| Mileage (Read)                          | 150,877 km                   |
| First registration                      | 20 Jan 2023                  |
| Number of holders                       | 2                            |
| Fuel type                               | Petrol                       |
| Engine displacement / Cylinder          | 1,498 ccm / 4                |
| Power                                   | 110 kW                       |
| Gearbox / Number of gears               | Automatic / 7                |
| Type of drive                           | Front drive                  |
| Type of vehicle                         | Station wagon                |
| Colour / colour code                    | Graphite Grau Metallic (F7C) |
| Doors / Seats                           | 5 / 5                        |
| Upholstery type                         | Cloth                        |
| Colour of upholstery                    | Black                        |



## Vehicle details

|                                                  |                          |                                |                                                            |
|--------------------------------------------------|--------------------------|--------------------------------|------------------------------------------------------------|
| <b>Maintenance booklet / proof</b>               | digital proof / complete | <b>Next maintenance in</b>     | 27,700 km                                                  |
| <b>Last service on / at</b>                      | 05/2026 at 148,510 km    |                                |                                                            |
| <b>Key is / should be</b>                        | 2 / 2                    | <b>FZG documents</b>           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                                  |                          | <b>Letter No.</b>              | GQ533833                                                   |
| <b>Previous damage / Accident</b>                | None detectable          | <b>Repainting</b>              | None detectable                                            |
| <b>Inspection conditions</b>                     | sufficient               | <b>Lifting equipment / pit</b> | yes                                                        |
| <b>Test drive</b>                                | Not performed            | <b>Engine function test</b>    | Performed                                                  |
| <b>Manufacturer key number/ type code number</b> | 8004 / ATM 04057         |                                |                                                            |
| <b>Emission standard</b>                         | EURO6                    | <b>fine dust sticker</b>       |                                                            |
| <b>Permitted total weight</b>                    | 2,270 kg                 | <b>Empty weight</b>            |                                                            |

## Tyres

### Mounted tyres

| #  | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
|----|----------------|-----------------------------|--------------|-------------|
| 1) | 215/65 R17 99V | Summer tyres on Light alloy | Goodyear     | 5mm / 5mm   |
| 2) | 215/65 R17 99V | Summer tyres on Light alloy | Goodyear     | 7mm / 7mm   |

### Additional tyres

| #  | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
|----|----------------|-----------------------------|--------------|-------------|
| 1) | 215/65 R17 99V | Winter tyres on Light alloy | Dunlop       | 5mm / 5mm   |
| 2) | 215/65 R17 99V | Winter tyres on Light alloy | Dunlop       | 5mm / 5mm   |

### Replacement

| Typ | Tyre size | Type of tyre            | Manufacturer | Tread depth |
|-----|-----------|-------------------------|--------------|-------------|
|     | Tirefit   | Expiration date 06/2029 |              |             |

**Legend:** Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

## Equipment

### Standard equipment

- Storage compartment on the left wheel arch
- Storage compartments
- Airbag, driver and passenger
- Airbag, head airbags
- Allergen filter
- Traction control (ASR)
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Hydraulic brake assist
- Cargo elements in the trunk
- Decorative inlay Anthracite Brushed
- Third brake light
- eCall
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor
- Front radar assistant including city emergency braking function with pedestrian detection
- Tinted windows
- Illuminated glove compartment
- Heated rear window
- Rear spoiler
- ISOFIX preparation on the outer rear seats
- Boot cover, roll-up and removable
- Paint finish: Solid
- Steering wheel: Leather steering wheel with multifunction buttons
- Front center armrest, including storage compartment
- Multifunction display in the instrument cluster
- Network program in the trunk
- Rear parking sensors
- Radio: Swing 6.5" music system
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring
- Rear seat backrest split 60:40, foldable, longitudinally adjustable, backrest angle adjustable
- Headlights washer / wiper system
- Kodiahq seat belts
- Skoda Care Connect
- 12V socket - in the center console and in the trunk
- Telephone: Comfort hands-free telephone system (without connection to the external antenna)
- Immobiliser
- Storage compartments behind the wheel arches in the trunk
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Electrically folding exterior mirrors including interior and exterior mirrors with automatic dimming.
- Hill start assist
- Care Connect: Proactive services (10-year term)
- Roof rails, black
- Tachometer
- Easy Start (start-stop button instead of the ignition lock)
- Electronic parking brake including auto-hold function
- ESC Electronic Stability Control
- Electric windows front and rear
- Cruise control
- Transmission: 7-speed dual-clutch transmission (DSG)
- Green tec (Start/Stop automatic including brake energy recuperation)
- Aero rear window wiper including windshield washer system
- Climatronic air conditioning (2-zone)
- Front and rear headrests are height-adjustable.
- LED taillights
- Rear center armrest with cup holders and pass-through option
- MSR (Motor drag torque control)
- Fog lights with integrated LED daytime running lights
- Otto particulate filter
- Upholstery: Cloth
- Radio accessories: 8 speakers
- Tire mobility kit (tire repair spray incl. compressor)
- Wheels: 17" Ratikon alloy wheels (7Jx17 tires 215/65 R17 99V ET40)
- Heated windshield washer nozzles
- Electromechanical power steering
- Seats: Driver and passenger seats are height-adjustable
- Speed limiter
- Bumpers painted in body color
- Variable fastening concept in the boot (only for 5-seaters)
- Lashing eyes in the trunk
- Central locking with remote control



## Extra equipment

- Trailer hitch preparation (including trailer stabilization)
- Package: Business Amundsen (Amundsen dynamic radio navigation system - 8" capacitive color display - Color multifunction display in the instrument cluster - SmartLink - Wireless SmartLink for Apple CarPlay - Voice control - Phonebox with inductive charging function (connection via external antenna) - Driver fatigue detection - 230 V socket and USB port - Sunset - Luggage net partition - Infotainment Online (3-year subscription))
- Front and rear parking sensors
- Radio: Columbus infotainment system (Ambition) (Columbus dynamic radio navigation system - Capacitive 9.2" color display - SmartLink - Wireless SmartLink for Apple CarPlay - Color multifunction display in the instrument cluster - Voice control - Phonebox with inductive charging function (connection via external antenna) - Infotainment Online (1-year subscription))
- Digital instrument cluster (Virtual Cockpit) (with, among other functions: time, outside temperature, current fuel consumption, average fuel consumption, distance traveled, driving time, average speed, fuel range, service interval indicator, door and trunk lid warning, display of information from radio, navigation system and telephone (if available))
- Package: Family (Removable waste bin for the door panel - Sunshades for the rear side windows - Door edge protectors - Electric child safety lock adjustment)
- Radio: Infotainment system Bolero (Ambition) (Bolero music system - Capacitive 8" color display - SmartLink - Wireless SmartLink for Apple CarPlay (from Ambition) - Voice control - Phonebox with inductive charging function (connection via external antenna))
- Rear view camera
- Seats: Heated front seats
- Variable loading floor in the trunk

## Brief expert findings

|                      |                                                                                                                                                                              |
|----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy) |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.    |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>Lifting equipment and/or a pit were available for examining the vehicle.                     |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                        |
| Engine function test | An engine test run was performed.                                                                                                                                            |

## Value reducing factors

| No. | Component group        | Description                                                         |
|-----|------------------------|---------------------------------------------------------------------|
| 1   | Wheel / tyres          | Tyres - complete set (WR auf Originalfelgen / SR auf Zubehörfelgen) |
| 2   | Equipment              | Vehicle key - Empty - Replace                                       |
| 3   | Seat - front           | Seat cover - right side (Sitze) - Soiled - Clean                    |
| 4   | Boot lid / rear door   | Boot lid - Glued / labelled - De-glue / neutralise                  |
| 5   | Bonnet                 | Insulation lining - Damage caused by marten / rodent - Replace      |
| 6   | 2nd wheel set          | 1 alloy rim - Scratch(es) - Loss in value                           |
| 7   | Body                   | Underbody panelling - Broken / torn - Replace                       |
| 8   | Sill - right side      | Sill - Scratch(es) - Smart repair                                   |
| 9   | Door - front left side | Door (Gewaltschaden) - Scratch(es) - Repair and paint               |
| 10  | Vehicle glazing        | Windscreen - Stone chips - Replace                                  |

## Wear and tear

| No. | Component group       | Description                                                |
|-----|-----------------------|------------------------------------------------------------|
| 1   | Steering system       | Steering wheel sheath - Scratch(es) - No deduction         |
| 2   | Vehicle glazing       | Side window - rear right side - Scratch(es) - No deduction |
| 3   | Door - rear left side | Door - dent(s) - No deduction                              |

The vehicle shows signs of wear and tear commensurate with its age and use.



## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
*(Delivery by third-party service providers)*
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
*(Functional testing of driver assistance systems is not included in the scope of services!)*
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

## Comments

- Der montierte Radsatz ist kein Bestandteil des Auslieferungsumfangs.





**Figure 1:** Diagonal front (left)




**Figure 2:** Diagonal front (right)



**Figure 3:** Diagonal rear (left)



**Figure 4:** Diagonal rear (right)

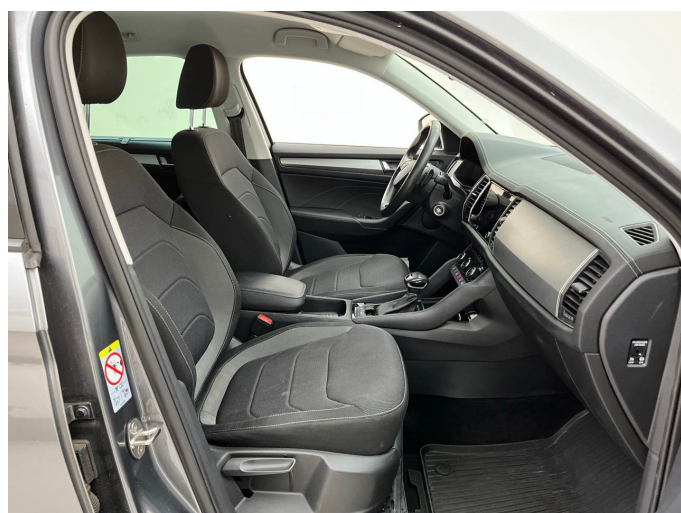

**Figure 5:** Interior - front



**Figure 6:** Interior - rear





Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

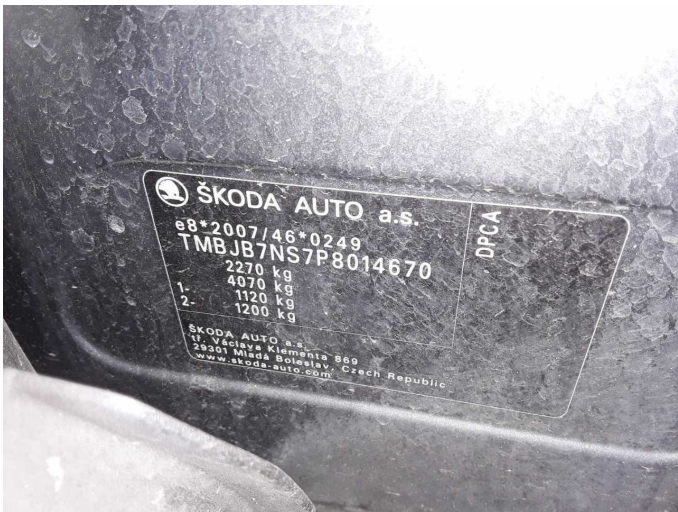


Figure 11: VIN



Figure 12: Mounted tyres





Figure 13: Documents

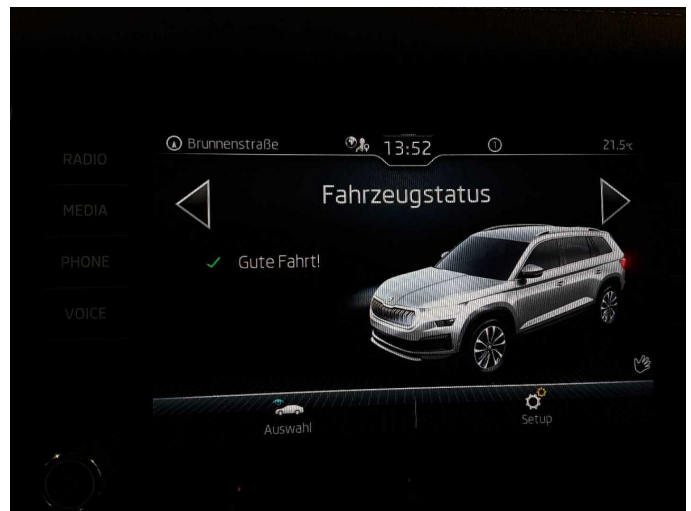


Figure 14: Documents

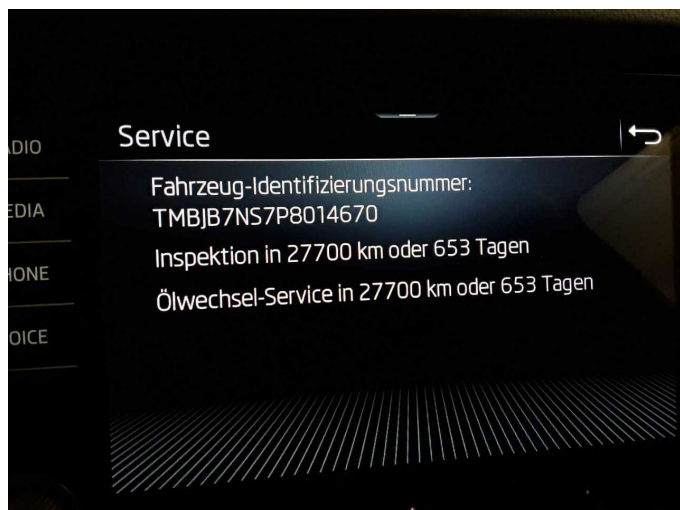


Figure 15: Documents

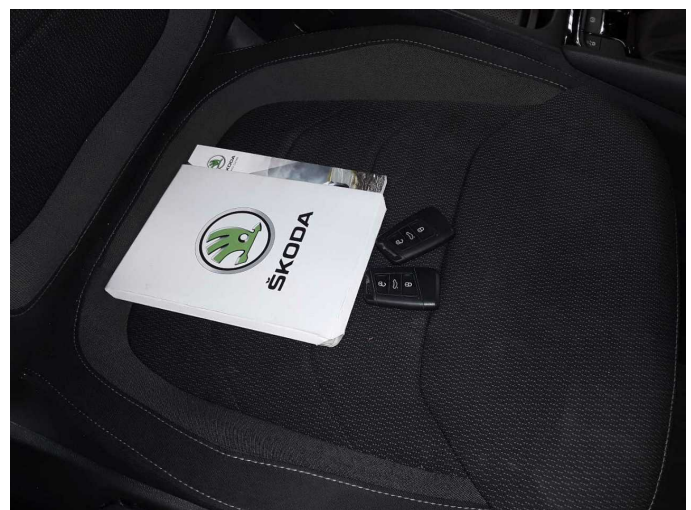


Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Navigation





Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

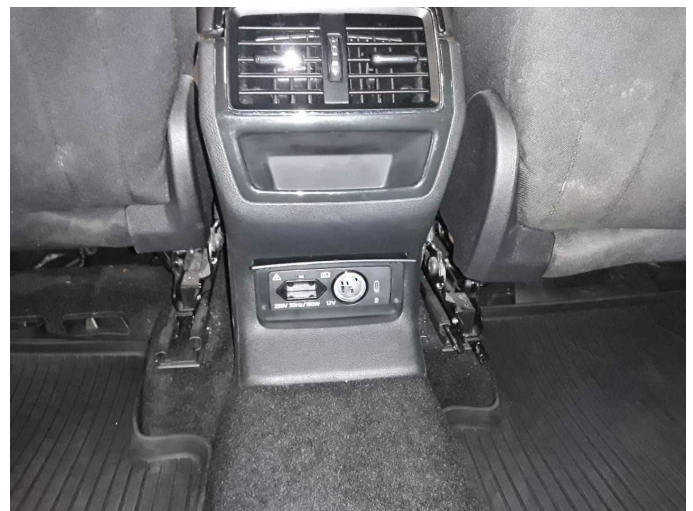


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.





Figure 25: Misc.

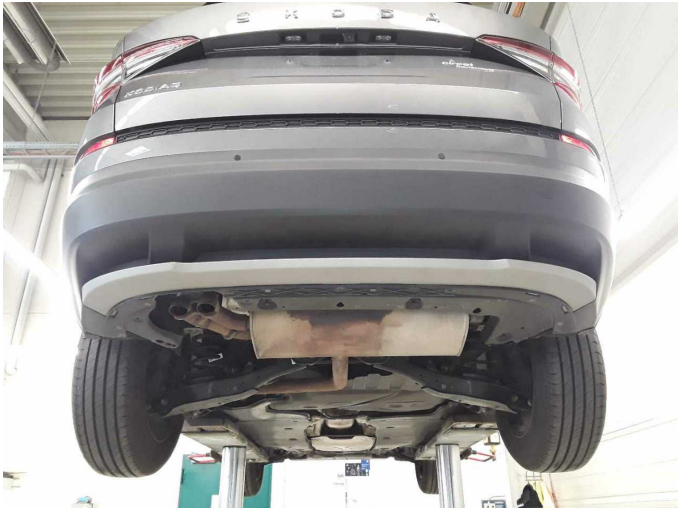


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

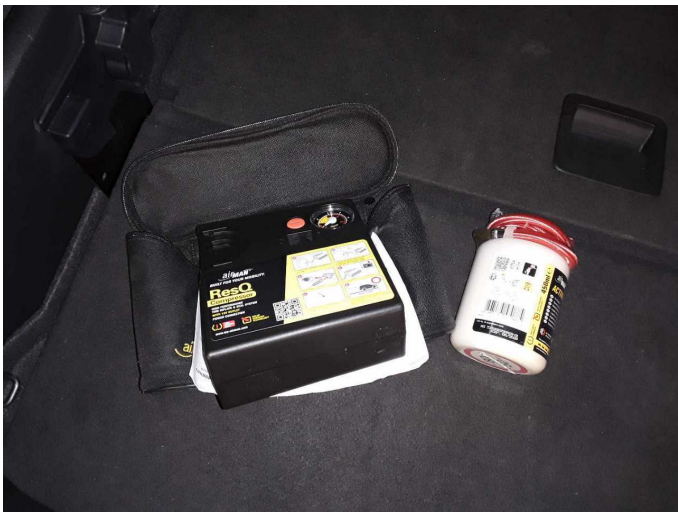


Figure 30: Misc.





Figure 31: Misc.



Figure 32: Misc.



Damage 1: Wheel / tyres: Tyres - complete set (WR auf Originalfelgen / SR auf Zubehörfelgen)



Damage 1: Wheel / tyres: Tyres - complete set (WR auf Originalfelgen / SR auf Zubehörfelgen)



Damage 2: Equipment: Vehicle key - Empty - Replace



Damage 3: Seat - front: Seat cover - right side (Sitze) - Soiled - Clean






**Damage 3:** Seat - front: Seat cover - right side (Sitze) - Soiled - Clean



**Damage 3:** Seat - front: Seat cover - right side (Sitze) - Soiled - Clean

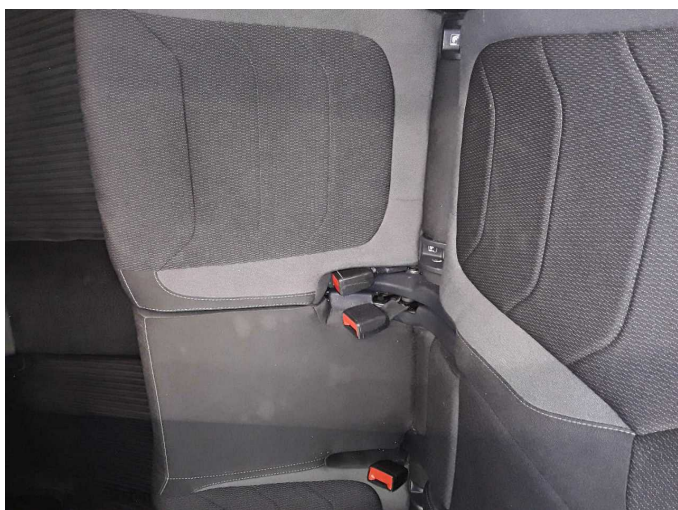

**Damage 3:** Seat - front: Seat cover - right side (Sitze) - Soiled - Clean



**Damage 4:** Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise




**Damage 5:** Bonnet: Insulation lining - Damage caused by marten / rodent - Replace



**Damage 5:** Bonnet: Insulation lining - Damage caused by marten / rodent - Replace



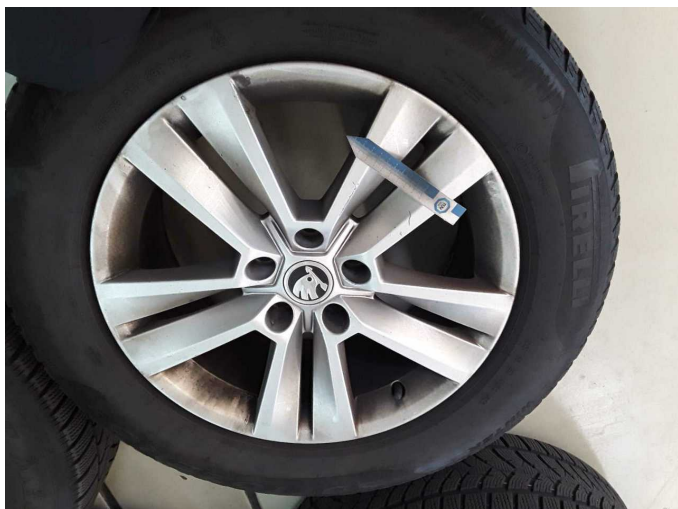

**Damage 6:** 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



**Damage 6:** 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



**Damage 7:** Body: Underbody panelling - Broken / torn - Replace



**Damage 7:** Body: Underbody panelling - Broken / torn - Replace



**Damage 7:** Body: Underbody panelling - Broken / torn - Replace



**Damage 8:** Sill - right side: Sill - Scratch(es) - Smart repair





**Damage 8:** Sill - right side: Sill - Scratch(es) - Smart repair



**Damage 8:** Sill - right side: Sill - Scratch(es) - Smart repair




**Damage 9:** Door - front left side: Door (Gewaltschaden) - Scratch(es) - Repair and paint



**Damage 9:** Door - front left side: Door (Gewaltschaden) - Scratch(es) - Repair and paint



**Damage 10:** Vehicle glazing: Windscreen - Stone chips - Replace

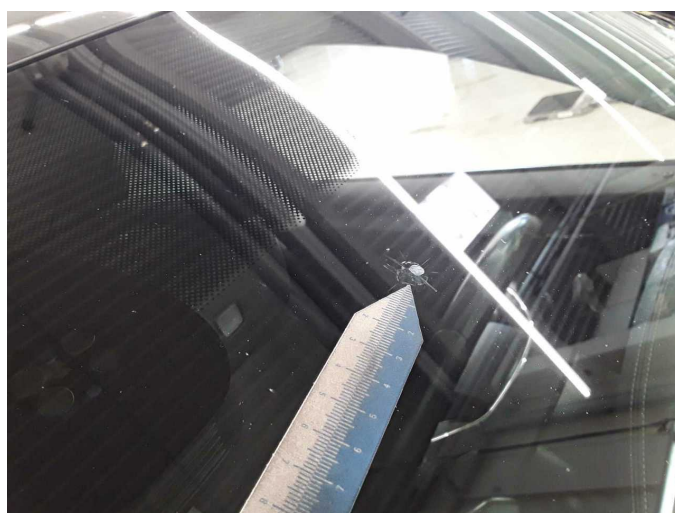

**Damage 10:** Vehicle glazing: Windscreen - Stone chips - Replace



**Damage 10:** Vehicle glazing: Windscreen - Stone chips - Replace



**Wear and tear 1:** Steering system: Steering wheel sheath - Scratch(es) - No deduction



**Wear and tear 1:** Steering system: Steering wheel sheath - Scratch(es) - No deduction



**Wear and tear 2:** Vehicle glazing: Side window - rear right side - Scratch(es) - No deduction



**Wear and tear 2:** Vehicle glazing: Side window - rear right side - Scratch(es) - No deduction



**Wear and tear 2:** Vehicle glazing: Side window - rear right side - Scratch(es) - No deduction





**Wear and tear 3:** Door - rear left side: Door - dent(s) - No deduction



**Wear and tear 3:** Door - rear left side: Door - dent(s) - No deduction



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJB7NS7P8014670

Hersteller / Modell: SKODA SKODA Kodiaq 1.5 TSI ACT DSG Ambition

| Datum      | KM-Stand | Beschreibung                                                                                                                                                                                                      |
|------------|----------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 13.05.2026 | 148.510  | Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges                                                                                                                                          |
| 17.02.2026 | 141.139  | Reparatur Sonstiges; Systemtest/Eigendiagnose                                                                                                                                                                     |
| 11.02.2026 | 141.139  | AU; Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten                                                                                                                                                    |
| 08.01.2025 | 115.780  | Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze vorne; Bremsscheiben vorne; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern |
| 29.08.2024 | 88.961   | Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges                                                                                                                   |
| 27.05.2024 | 63.980   | Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges; Zündkerzen ern                                |
| 30.12.2023 | 40.672   | Bremsflüssigkeit; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges                                                                                                                        |