



Expertise

Protocol number: 47190922
Order No. / Reference: 26775288
Inspection date: 30 Jul 2026

Manufacturer: Hyundai
VIN: KMHK3812ANU909839

Model: KONA 1.0 T-GDI EDITION 30+



Vehicle details	
Manufacturer / Type / Model / Equipment	
Hyundai KONA 1.0 T-GDI EDITION 30+	
Vehicle Identification number	KMHK3812ANU909839
Mileage (Read)	50,904 km
First registration	29 Nov 2022
Number of holders	1
Fuel type	Petrol
Engine displacement / Cylinder	998 ccm / 3
Power	88 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Dark Knight
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	311 Tag(e)
Last service on / at	06/2026 at 50,630 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ178686
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	Conditional: Light/moisture/dirt	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8252 / AHY 00044		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,770 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94V	Summer tyres on Light alloy	Nexen	5mm / 5mm
2)	215/55 R17 98Y	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92T	Winter tyres on Light alloy	Continental	7mm / 7mm
2)	205/60 R16 92T	Winter tyres on Light alloy	Continental	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag: Front airbags for driver and front passenger (passenger airbag can be deactivated)
- Active Lane Keeping Assist (LKA)
- Anti-lock braking system (ABS), with electronic brake-force distribution (EBD)
- Electrically folding exterior mirrors
- Electrically adjustable and heated exterior mirrors (integrated turn signals - painted in car color)
- Roof spoiler with 3rd brake light
- Tachometer
- Rear parking sensors
- Electric windows front and rear (automatic down/up function, driver's side)
- Heated rear window (with automatic shut-off)
- Interior mirror automatically dimming
- Child safety locks on the rear doors
- Automatic air conditioning
- Paint finish: Solid
- LED taillights (brake and driving lights)
- leather steering wheel
- multifunction steering wheel
- Front center armrest with storage compartment
- Otto particulate filter
- Electric parking brake
- Plaque on the B-pillar - "30 years!"
- Upholstery: Cloth
- Radio accessories: DAB+ radio
- Rain sensor
- Wheels: Alloy wheels 7 J x 17 with tires 215/55 R 17
- Rear view camera
- Power steering
- Safety steering column, tilt and length adjustable
- Seats: Driver's seat height adjustable
- Seats: Driver's seat with electrically adjustable lumbar support
- Smart key system with start-stop button
- Telephone: Bluetooth hands-free system for mobile phones
- Door handles painted in car color
- Full LED headlights with high beam assist
- Central locking with key-integrated remote control
- Airbag: Side airbags for driver and front passenger
- Airbag: Curtain airbags extending to the rear seats
- Alarm system
- Attention Assistant (DAW)
- Autonomous Emergency Braking (FCA) (including forward collision warning and pedestrian detection)
- Brake Assist (BAS)
- Roof rails
- Digital cockpit with 10.25-inch color display
- eCall emergency call system
- Electronic Stability Control (ESC)
- Cruise control with limiter
- Transmission: 6-speed manual transmission
- Rear window wiper/washer system
- ISOFIX child seat attachment at the rear (on the outer seats including top tether anchor points)
- Headrests (5) front and rear height adjustable (front also longitudinally adjustable)
- LED daytime running lights
- Heated steering wheel
- Headlight range adjustment, manual
- Fog light
- Package: Navigation Package (10.25-inch color touchscreen - Bluelink telematics services - Lifetime MapCare - LIVE Services - Radio navigation system - Traffic sign recognition (ISLW) - KRELL sound system - Apple CarPlay and Android Auto)
- Tire pressure monitoring system (TPMS)
- Wheels: Tire repair kit
- Windows: dark tinted from the B-pillar back
- Seat belts (three-point belt system on all seats - belt tensioners and belt force limiters in the front - belt warning for all seats - height-adjustable seat belts in the front)
- Seats: Rear seat backrest split 60:40 and foldable
- Front seat heating
- Lane Following Assist (LFA) (The Lane Following Assist keeps the vehicle in the middle of the lane and, in addition to the lane markings, also uses the vehicle in front as a guide.)
- Electronic immobilizer



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	A proper visual inspection of the paintwork and bodywork was only possible to a limited extent due to insufficient lighting conditions/dampness or dirt. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Body	Wheel well - rear right side - Loose - Un- / install
2	Door - rear right side	Door edge - Scratch(es) - Smart repair
3	Door - front right side	Door edge - Scratch(es) - Smart repair
4	Side panel - rear left side	Sill - dent(s) - Smart repair
5	Side panel - rear right side	Sill - dent(s) - Smart repair
6	Door - front left side	Door - Scratch(es) - Smart repair
7	Screen cleaning	Washing container - Broken / torn - Replace
8	Trim / covers	Boot lid - interior trim - Broken / torn - Replace
9	Body	Wheel well - front right side - Broken / torn - Replace
10	Wheel / tyres	Alloy rim - rear left side - Scratched - Loss in value
11	Bonnet	Bonnet - Corrosion - Paint
12	Rear bumper	Rear bumper (Gestaucht + Spoiler gebrochen erneuern) - Deformed - Replace

Wear and tear

No.	Component group	Description
1	2nd wheel set	2 alloy rims - Scratched - No deduction
2	Trim / covers	Door trim - rear right side - Soiled - No deduction
3	Front bumper	Front bumper (unpainted) - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)

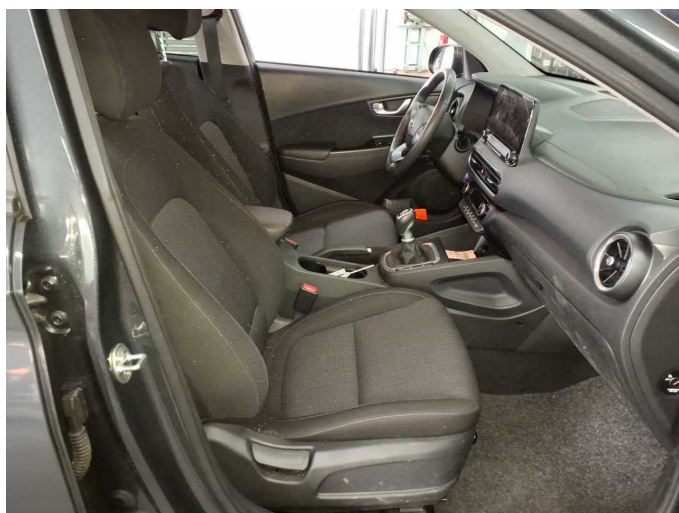


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Cargo area

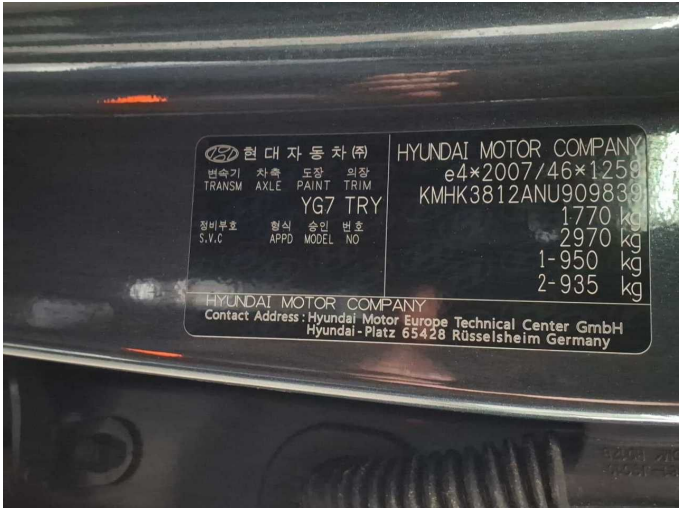


Figure 10: VIN



Figure 11: Mounted tyres



Figure 12: Documents



Figure 13: Documents

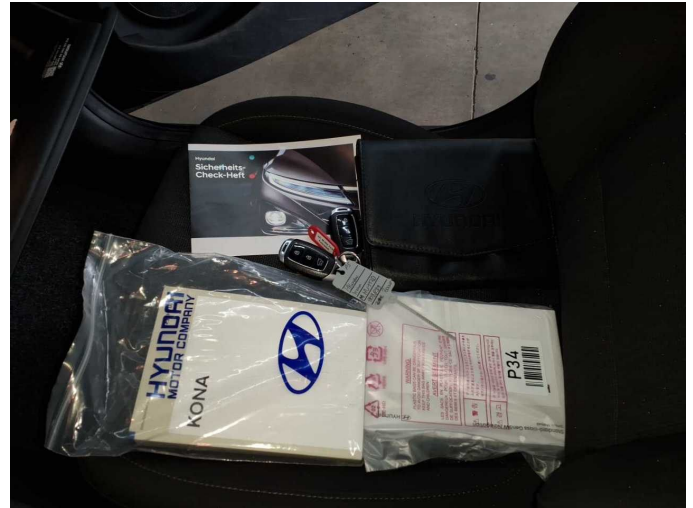


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

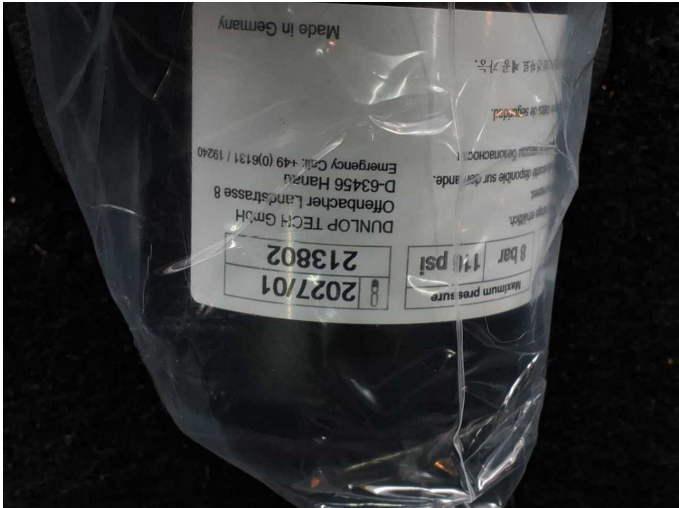


Figure 26: Misc.



Figure 27: Misc.




Figure 28: Misc.




Figure 29: Misc.



Damage 1: Body: Wheel well - rear right side - Loose - Un- / install

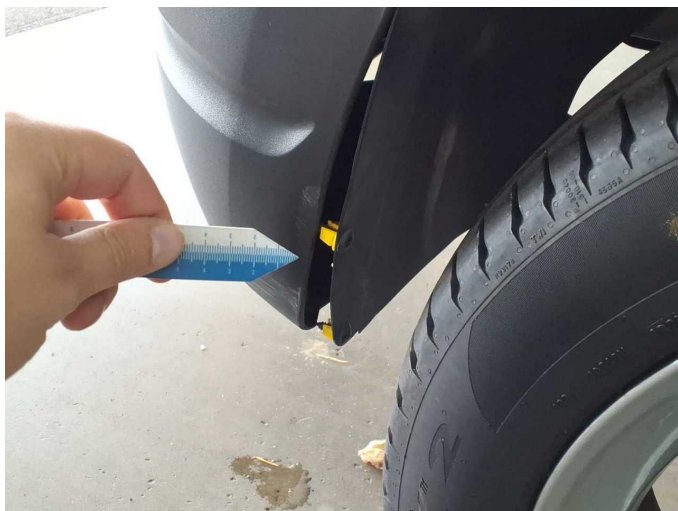


Damage 1: Body: Wheel well - rear right side - Loose - Un- / install

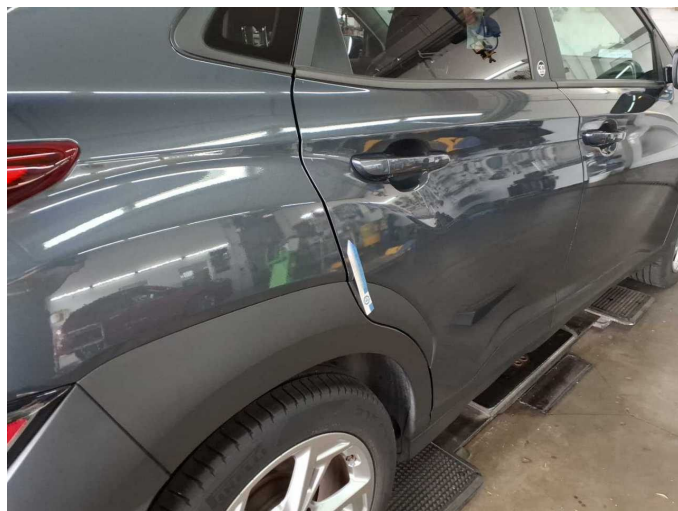

Damage 2: Door - rear right side: Door edge - Scratch(es) - Smart repair



Damage 2: Door - rear right side: Door edge - Scratch(es) - Smart repair

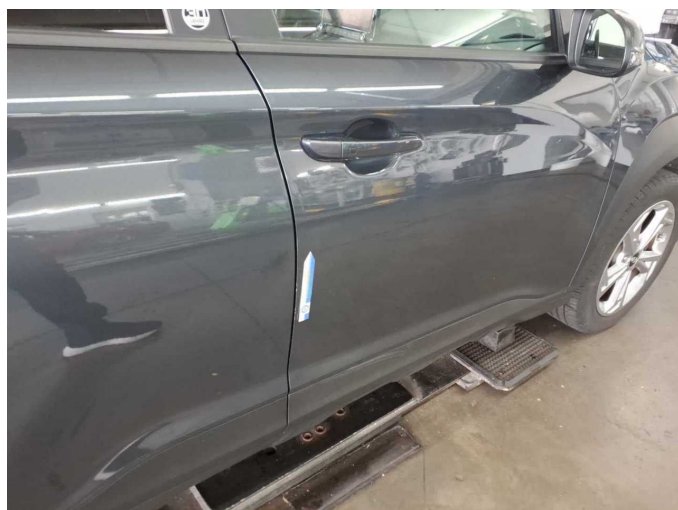


Damage 3: Door - front right side: Door edge - Scratch(es) - Smart repair




Damage 3: Door - front right side: Door edge - Scratch(es) - Smart repair




Damage 4: Side panel - rear left side: Sill - dent(s) - Smart repair

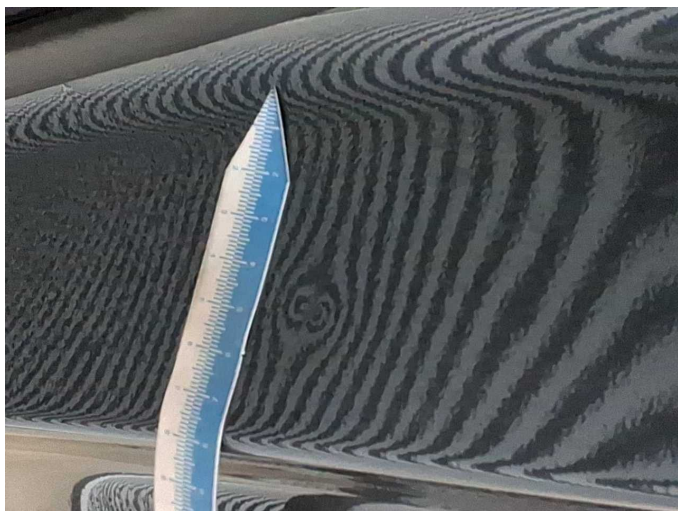

Damage 4: Side panel - rear left side: Sill - dent(s) - Smart repair

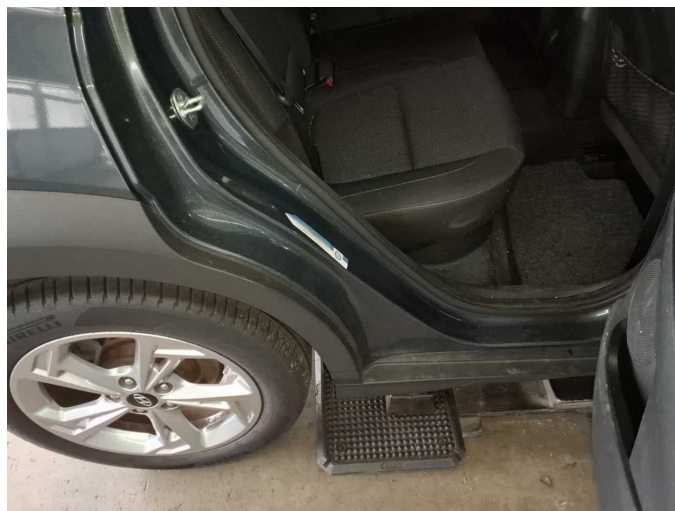


Damage 5: Side panel - rear right side: Sill - dent(s) - Smart repair

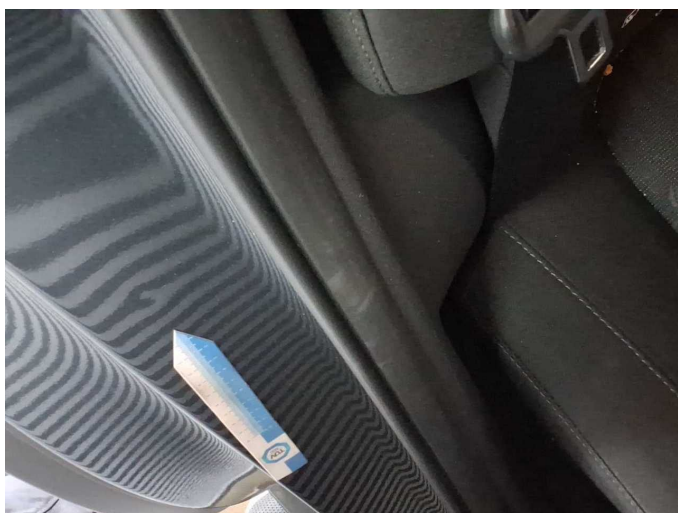


Damage 5: Side panel - rear right side: Sill - dent(s) - Smart repair




Damage 6: Door - front left side: Door - Scratch(es) - Smart repair

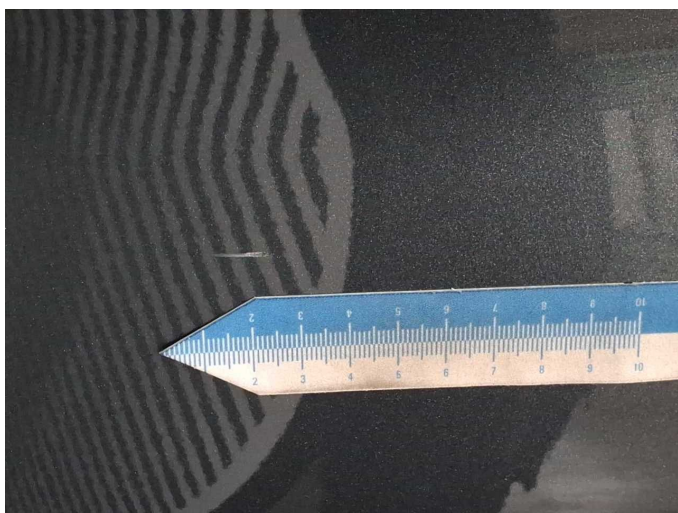


Damage 6: Door - front left side: Door - Scratch(es) - Smart repair

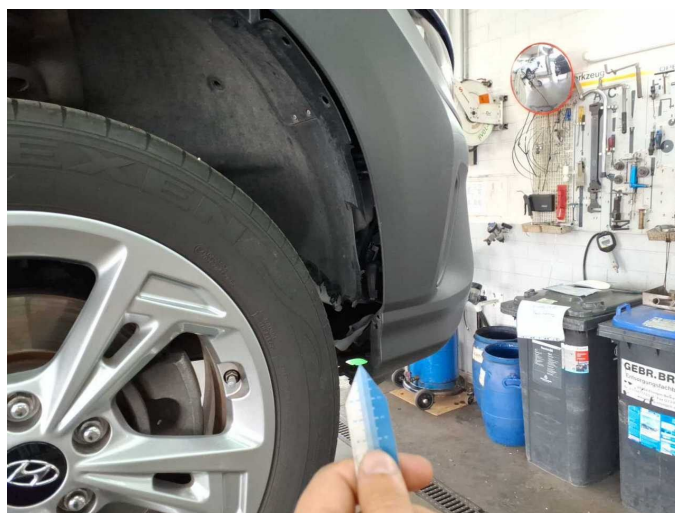

Damage 7: Screen cleaning: Washing container - Broken / torn - Replace

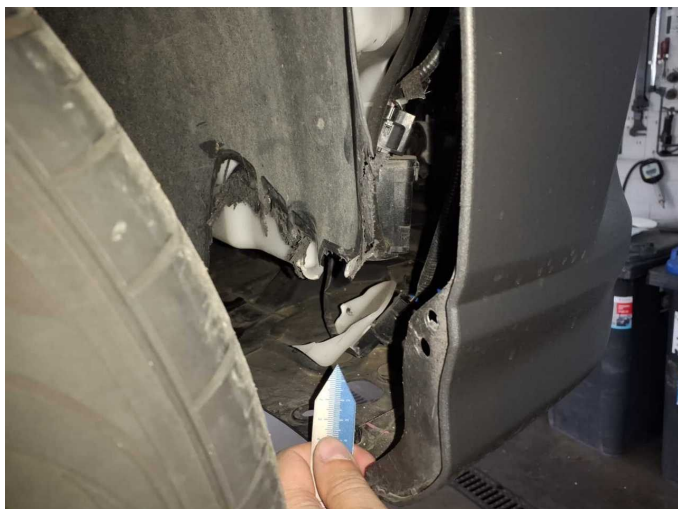


Damage 7: Screen cleaning: Washing container - Broken / torn - Replace

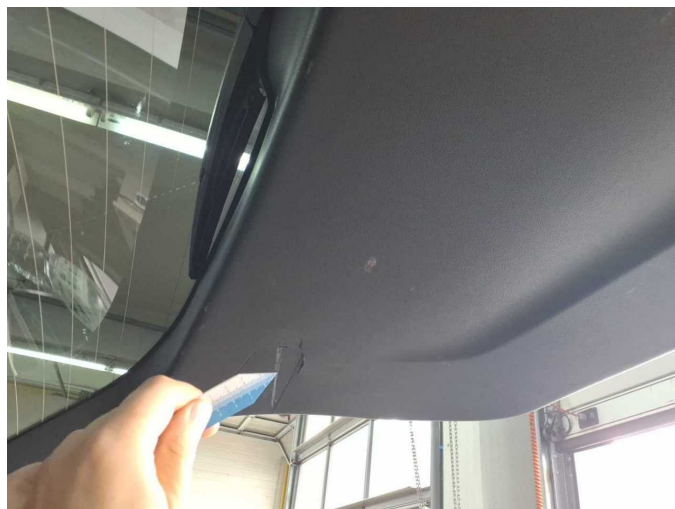


Damage 8: Trim / covers: Boot lid - interior trim - Broken / torn - Replace




Damage 8: Trim / covers: Boot lid - interior trim - Broken / torn - Replace

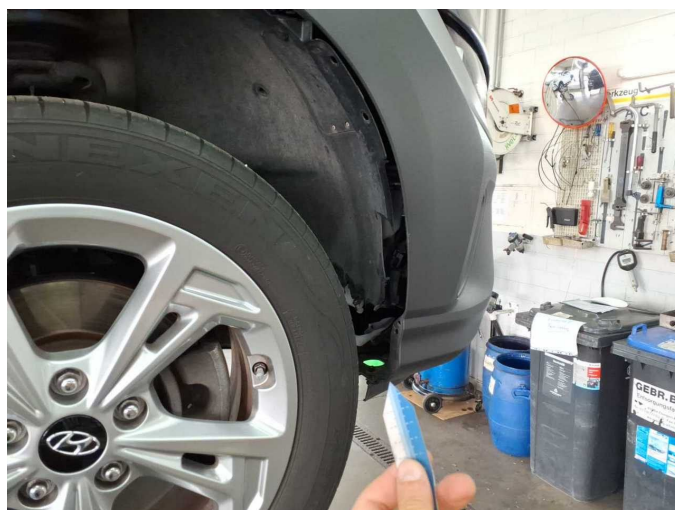

Damage 9: Body: Wheel well - front right side - Broken / torn - Replace

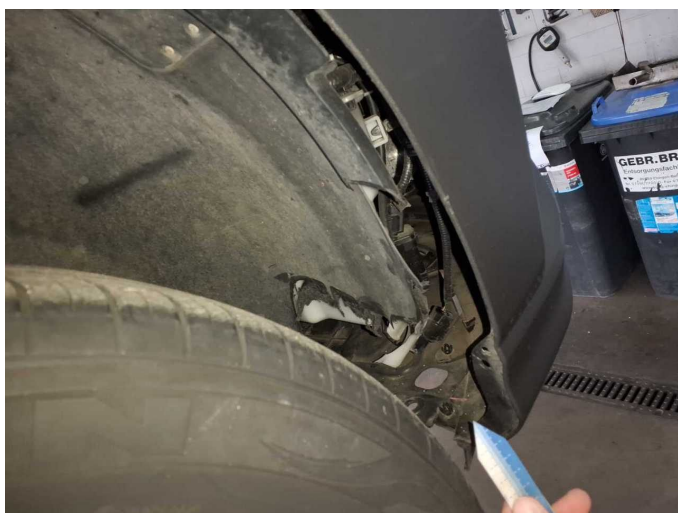

Damage 9: Body: Wheel well - front right side - Broken / torn - Replace

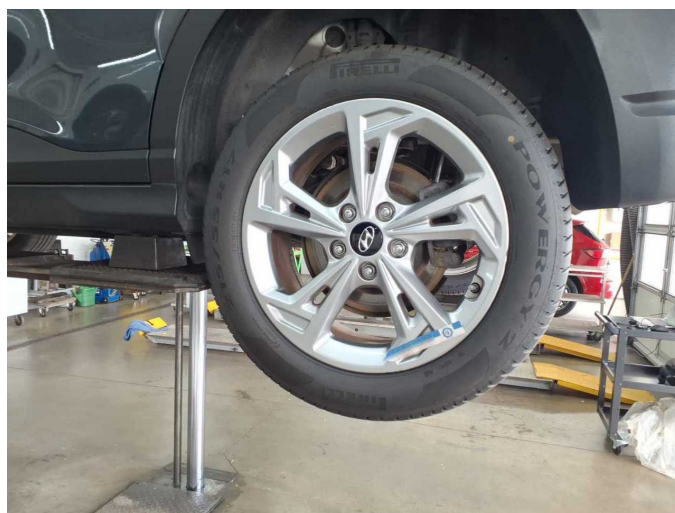

Damage 10: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



Damage 10: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value




Damage 10: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



Damage 11: Bonnet: Bonnet - Corrosion - Paint



Damage 11: Bonnet: Bonnet - Corrosion - Paint

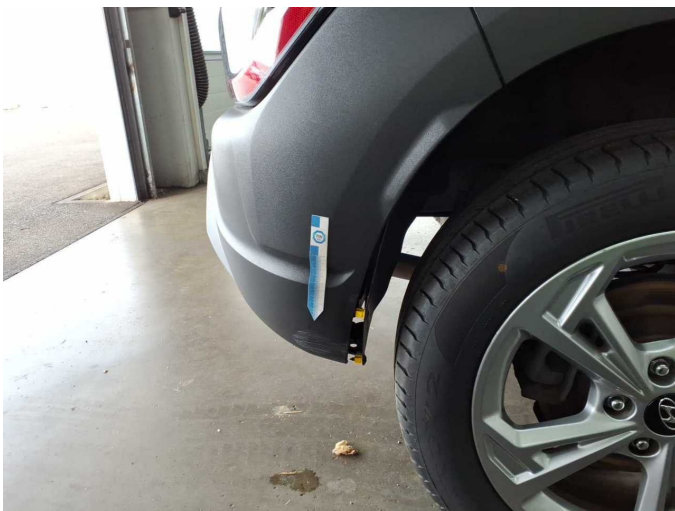

Damage 12: Rear bumper: Rear bumper (Gestaucht + Spoiler gebrochen erneuern) - Deformed - Replace



Damage 12: Rear bumper: Rear bumper (Gestaucht + Spoiler gebrochen erneuern) - Deformed - Replace




Damage 12: Rear bumper: Rear bumper (Gestaucht + Spoiler gebrochen erneuern) - Deformed - Replace



Damage 12: Rear bumper: Rear bumper (Gestaucht + Spoiler gebrochen erneuern) - Deformed - Replace



Damage 12: Rear bumper: Rear bumper (Gestaucht + Spoiler gebrochen erneuern) - Deformed - Replace

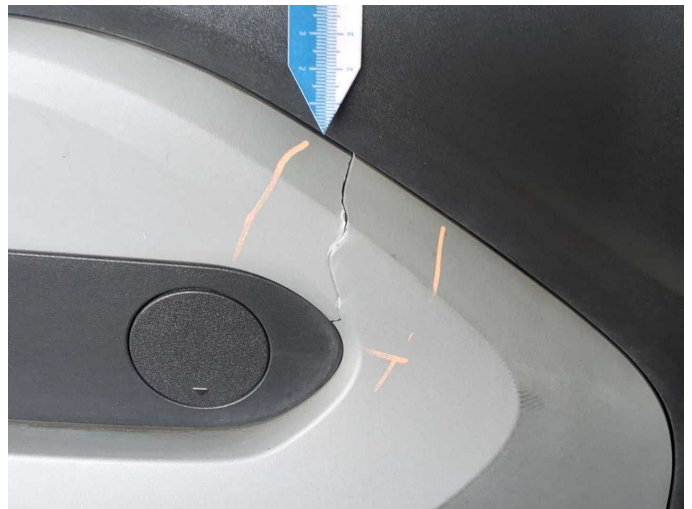

Damage 12: Rear bumper: Rear bumper (Gestaucht + Spoiler gebrochen erneuern) - Deformed - Replace



Damage 12: Rear bumper: Rear bumper (Gestaucht + Spoiler gebrochen erneuern) - Deformed - Replace



Damage 12: Rear bumper: Rear bumper (Gestaucht + Spoiler gebrochen erneuern) - Deformed - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: KMHK3812ANU909839

Hersteller / Modell: HYUNDAI HYUNDAI KONA 1.0 T-GDI EDITION 30+

Datum	KM-Stand	Beschreibung
25.06.2026	50.630	Batterie ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.08.2025	32.155	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
07.05.2024	16.733	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Wartung Sonstiges