



Expertise

Protocol number: 46828069
Order No. / Reference: 26555016
Inspection date: 31 Jul 2026

Manufacturer: Volvo	Model: XC60 T6 AWD Plug-in Hybrid Ultra Black Edition
VIN: LYVUZH1V6TB304442	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo XC60 T6 AWD Plug-in Hybrid Ultra Black Edition	
Vehicle Identification number	LYVUZH1V6TB304442
Mileage (Read)	12,881 km
First registration	1 Oct 2025
Number of holders	1
Fuel type	Hybr.B/E ext.aufl
Engine displacement / Cylinder	1,969 ccm / 4
Power	186 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Onyx Black Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Anthracite-Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	17,128 km
Key is / should be	2 / 2	FZG documents	Registration and title documents unavailable
		Letter No.	HM361509
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	9101 / BRS 00030		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,660 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/40 R21 102V	Summer tyres on Light alloy	Pirelli	7mm / 7mm
2)	255/40 R21 102V	Summer tyres on Light alloy	Pirelli	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2029		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- ABS - Anti-lock Braking System
- Driver and passenger side airbags with two-stage deployment system
- Airbag, side airbags for driver and front passenger and head/shoulder airbags for all occupants
- Ambient lighting
- High-gloss black applications on the rear of the vehicle
- Electrically folding exterior mirrors
- Heated exterior mirrors and rear window (automatic)
- Hill Descent Control (HDC)
- Fog sensor for automatic activation of the defroster function
- On-board computer
- Chrome applications in the front bumper
- Roof edge spoiler
- Deactivating the high-voltage battery
- Digital Instrumentation 2nd Gen.
- Aluminum door sill plates with Volvo lettering at the front
- Electronic differential lock
- Electric windows front and rear
- Window surround in high-gloss black
- Front grille in Volvo Iron Mark Dark design Black Edition
- Transmission: 8-speed automatic transmission
- Hooks for carrier bags in the luggage compartment
- Automatic tailgate
- rear window wiper
- Interior lighting
- Intelligent driver information system
- Keyless Drive (electronic access system)
- Child safety lock for the rear doors (electric)
- Automatic climate control with separate temperature control for driver and front passenger
- Headrests (5) front and rear
- Paint finish: Metallic paint
- Charging box under the cargo floor
- Stainless steel loading sill protector in the luggage compartment
- Steering wheel: Multifunction buttons on the steering wheel
- Air purification system with activated carbon filter
- Front center armrest with integrated storage compartment and cup holders
- One Pedal Drive
- Otto particulate filter
- Package: Driver Assistance Package
- Package: Seat Comfort Package
- Panoramic glass sunroof with lifting function (electric)
- Parking camera with 360° surround view
- Radio: Premium Sound audio system by Harman/Kardon
- Radio accessories: Two USB-C ports on the back of the center console
- Run-off Road Protection
- Wheels: Tire sealant
- Acoustic Vehicle Alerting System (AVAS)
- Passenger side airbag can be deactivated
- Airbag, driver's knee airbag
- Active safety belts with belt tensioners
- All-wheel drive (AWD)
- Android infotainment system
- Dashboard in leather look with contrasting stitching
- Electrically adjustable exterior mirrors
- Outdoor temperature display
- Hill Start Assist (HSA)
- LED turn signals integrated into the exterior mirrors
- third brake light
- Anthracite headliner
- Roof rails in high-gloss black (integrated)
- Digital Services
- Drive Mode
- Electronic Stability Control (ESC)
- Advanced air purification system with fine dust filtration according to air quality standard PM2.5
- Automatic emergency braking
- Luggage compartment partition net
- Front seat belt height adjustment
- Head-up display
- Heated rear window
- Interior and exterior mirrors automatically dimming
- Intelligent Speed Assist
- ISOFIX mounting for the outer rear seats
- Keyless Start
- Automatic climate control with 4-zone temperature control
- Comfort opening/closing of the side windows and, if applicable, the sunroof via radio remote control
- Headrests of the 2nd row of seats can be folded down (electrically)
- charging cable
- Cargo area roller blind
- Steering wheel adjustable for height and reach
- Steering wheel: Sports steering wheel, leather-free
- Illuminated makeup mirror for driver and front passenger
- Model and engine emblem in high-gloss black
- Emergency brake lights
- Optical underide protection front and rear in high-gloss silver
- Package: Light Package
- Package: Winter Package
- Electric parking brake
- Upholstery: Part-leather/mesh-textile sports seats
- Radio accessories: Smartphone integration Apple CarPlay
- Rain sensor
- Tire pressure monitoring system
- Wheels: 21" alloy wheels, 5-twin-spoke design, Black Edition
- Rear seats in a 40/60 split or completely foldable with pass-through function



- Rear view camera
- Safety Assistance
- Headlight cleaning system
- Speed-sensitive power steering
- Seats: Driver and front passenger seats are height-adjustable (electrically)
- Sport exterior mirrors in high-gloss black
- Sport front and rear apron
- Start/Stop technology
- Phone: Inductive smartphone charging system (Qi standard)
- Glazing: Colored glazing
- Volvo On Call
- Warning tone/indicator when seat belts are not fastened (for all seats)

Extra equipment

- Alarm system with motion/tilt sensor (security lock)
- Seats: Massage function for driver and front passenger seats
- Glazing: Side and rear windows tinted (from the B-pillar back)

- Whiplash Protection System (WHIPS)
- Safety braking system with disc brakes all around (internally ventilated)
- Seats: Lumbar support (2-way electrically adjustable) for driver and front passenger seats
- Electric auxiliary heater with timer
- Power socket
- Door sill area in car color
- First aid kit and warning triangle
- Lashing eyes in the luggage compartment (foldable)
- Preparation for Trailer Stability Assist (TSA)
- Immobiliser
- Central locking system with two remote controls and integrated emergency keys

- Upholstery: Nappa leather/imitation leather comfort seats (perforated front seats) Anthracite (with active ventilation and electrically adjustable side bolsters for driver and front passenger seats - incl. rear center armrest - gearshift lever made of Swedish crystal glass by Orrefors)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 1 (registration document) and the vehicle registration certificate Part 2 (title) were not available.
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front left side	Door - Abrasion - Smart repair
2	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Smart repair
3	Wheel / tyres	Alloy rim - rear left side (Materialabtrag) - Scratch(es) - Loss in value
4	Wheel / tyres	Alloy rim - rear right side (Materialabtrag) - Scratch(es) - Loss in value
5	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value
6	Rear bumper	Rear bumper - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Log book



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

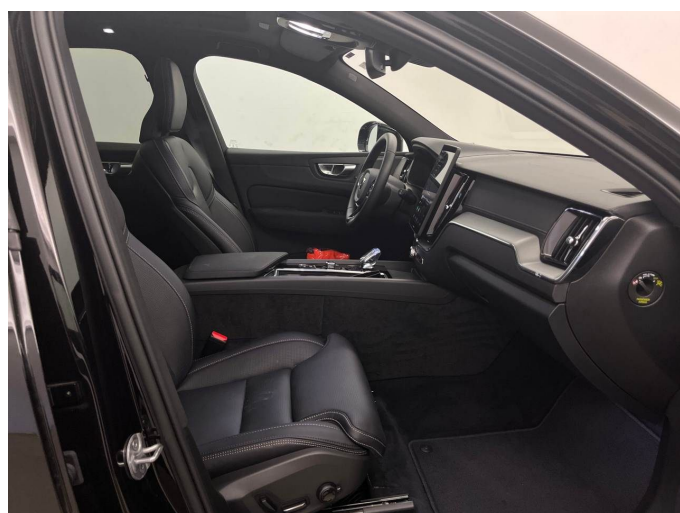


Figure 5: Interior - front

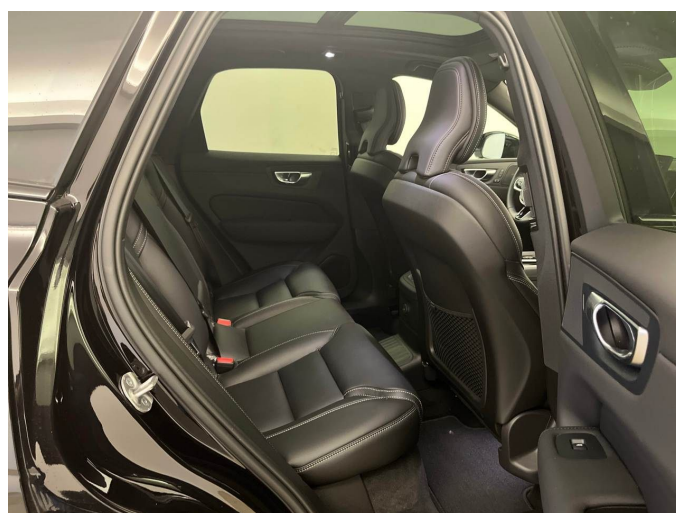


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

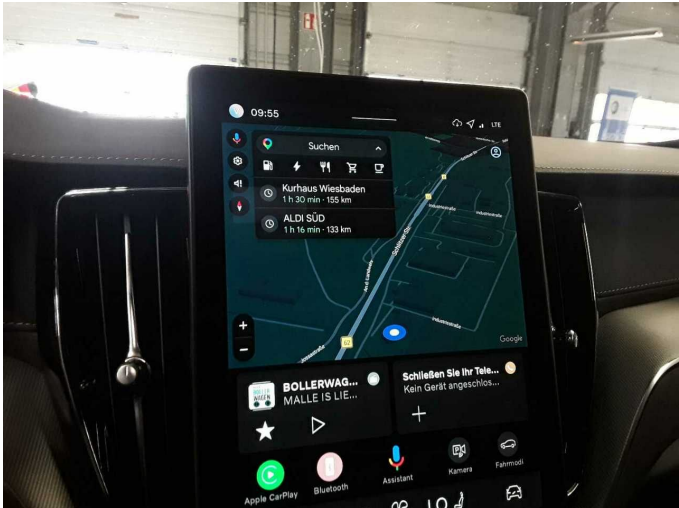


Figure 14: Navigation

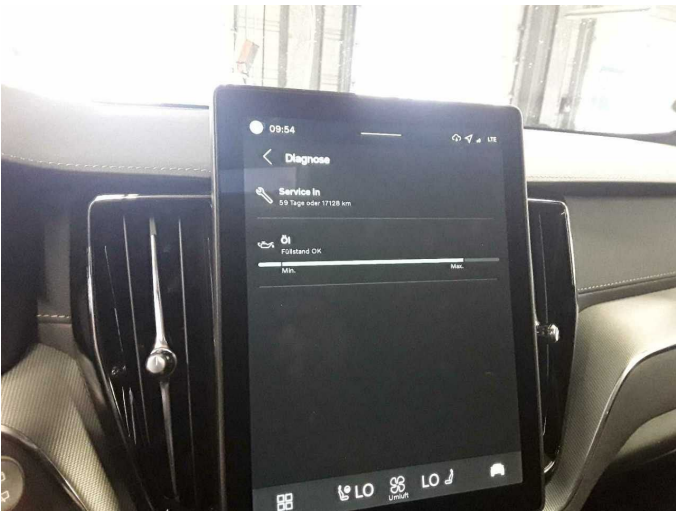


Figure 15: Misc.

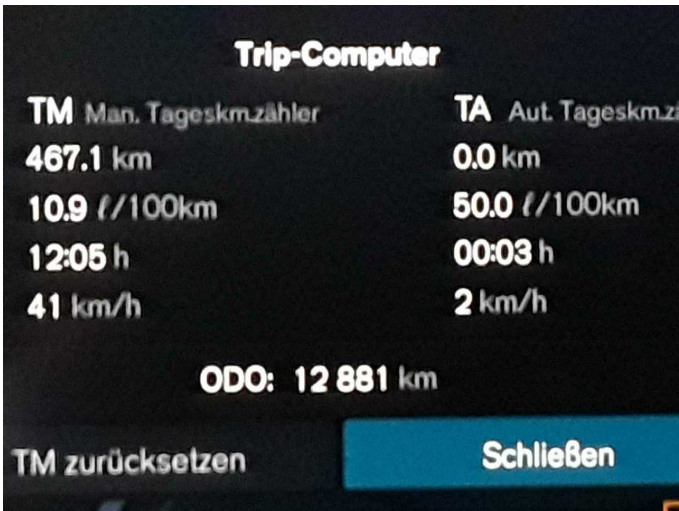


Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.

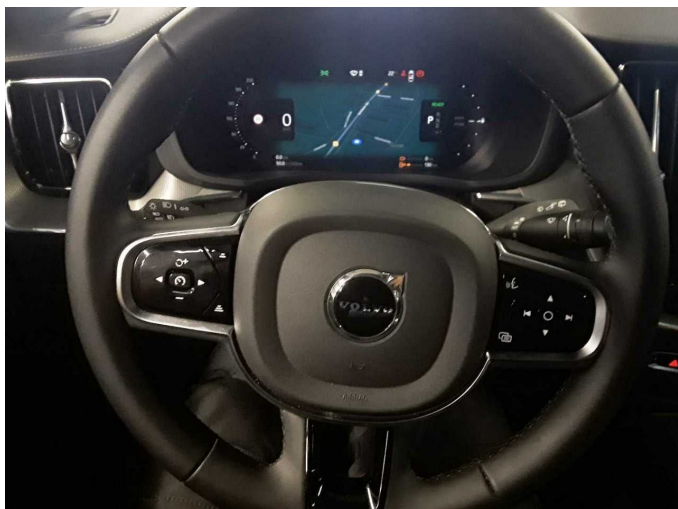


Figure 19: Misc.



Figure 20: Misc.

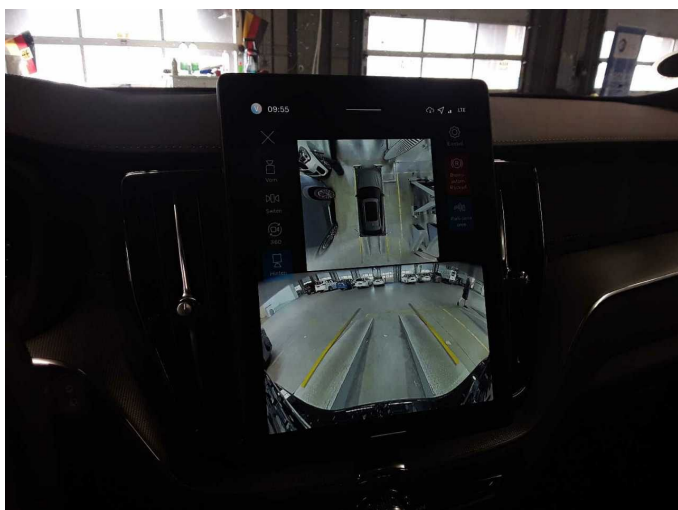


Figure 21: Misc.

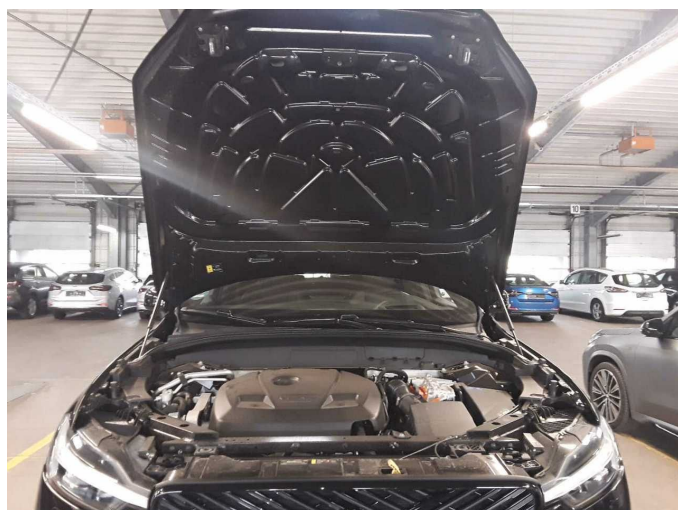


Figure 22: Misc.



Figure 23: Misc.

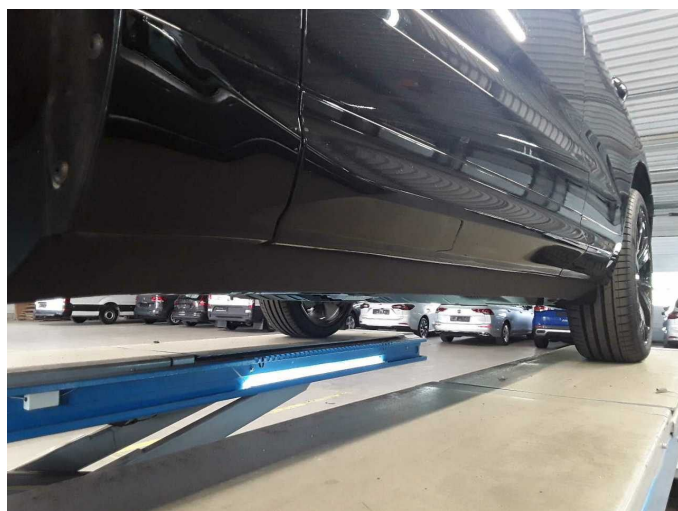


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

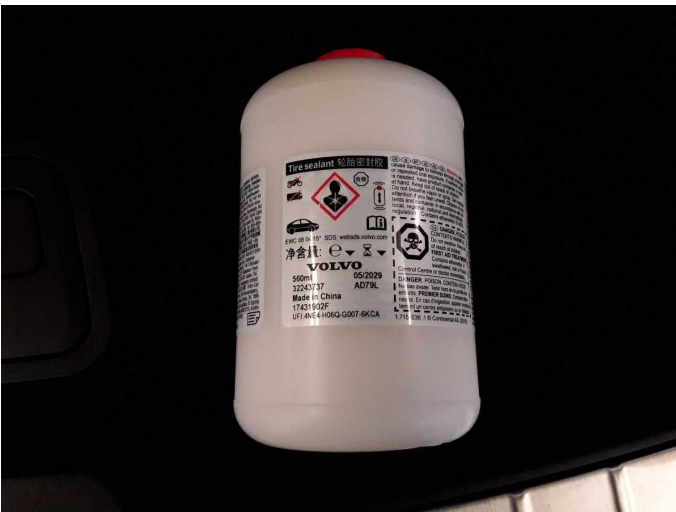


Figure 29: Misc.

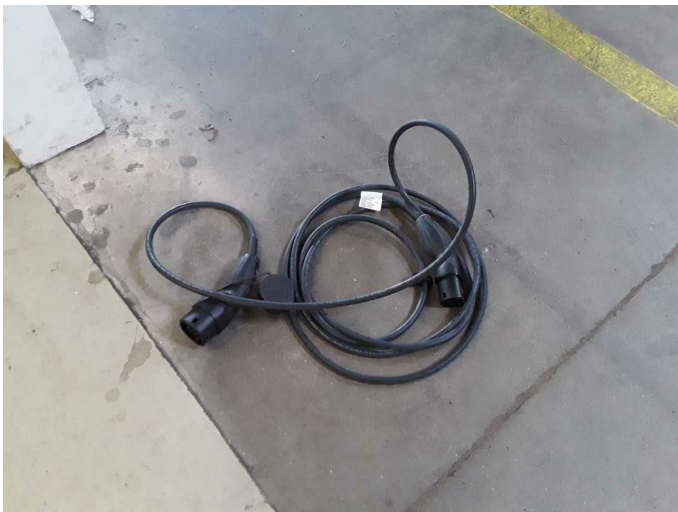


Figure 30: Misc.




Figure 31: Misc.



Damage 2: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Smart repair



Damage 2: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Smart repair

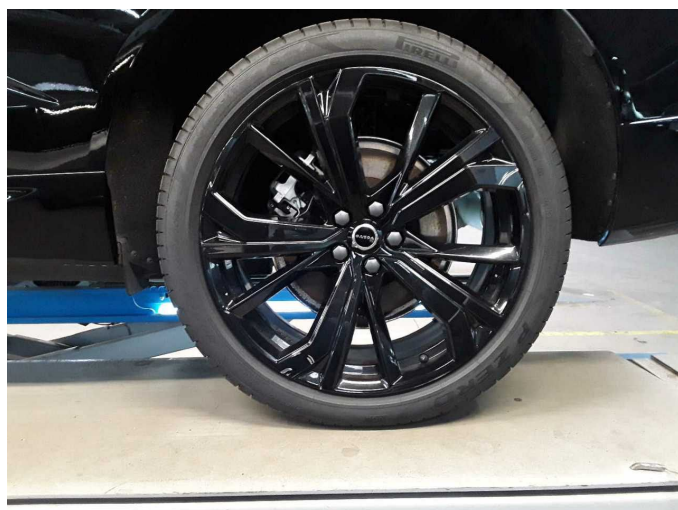

Damage 3: Wheel / tyres: Alloy rim - rear left side (Materialabtrag) - Scratch(es) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - rear left side (Materialabtrag) - Scratch(es) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - rear left side (Materialabtrag) - Scratch(es) - Loss in value



Damage 4: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratch(es) - Loss in value



Damage 4: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratch(es) - Loss in value



Damage 4: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratch(es) - Loss in value



Damage 5: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 5: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 5: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Missing part 1: Documents: Log book - Missing - Replace