



Expertise

Protocol number: 46274240
Order No. / Reference: 26568747
Inspection date: 1 Jul 2026

Manufacturer: Audi
VIN: WAUZZZFY3M2095448

Model: Q5 40 TDI quattro S tronic



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi Q5 40 TDI quattro S tronic	
Vehicle Identification number	WAUZZZFY3M2095448
Mileage (Read)	89,890 km
First registration	27 May 2021
Number of holders	1
Next periodical technical inspection	06/2026
(Report not on hand)	
Power / Engine displacement	150 kw / 1,968 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Manhattangrau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	7,900 km
Last service on / at	02/2026 at 85,995 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GC274147
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BQW 00209		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,510 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/65 R17 104W	Summer tyres on Light alloy	Hankook	4mm / 4mm
2)	235/65 R17 104W	Summer tyres on Light alloy	Hankook	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/65 R17 108H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	235/65 R17 108H	Winter tyres on Light alloy	Pirelli	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- AdBlue tank (12 liters)
- Airbag: Front side airbags and head airbag system
- "quattro" all-wheel drive with ultra technology
- Traction control (ASR)
- Audi drive select
- Audi pre sense city
- Exterior mirror housings in body color
- Fabric headliner
- Decorative inlays Micrometallic silver
- Tachometer
- Door sill trims with aluminum inlay at the front
- Electronic Differential Lock (EDS)
- Driver Information System
- Electric windows front and rear
- Remote key (without Safe-Lock)
- Luggage compartment lid, electrically opening and closing
- Transmission: S tronic 7-speed
- rear window wiper
- Interior mirror dimming
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- Rear headrests (3)
- Plastic loading sill protector
- LED headlights
- Mild hybrid
- Model designation according to new performance labeling
- Wheel: On-board tools (excluding jack)
- Wheel: Tire pressure monitoring system
- Radio: MMI Radio plus
- Electromechanical power steering
- Seats: Standard front seats
- Seats: Front seats manually adjustable
- Start-stop system
- Separation net
- Glazing: Clear glass
- thermal insulation glazing
- Airbag for driver and front passenger
- Accent areas matte black
- Anti-lock braking system (ABS)
- Audi connect emergency call & service with Audi connect Remote & Control
- Electrically adjustable and heated exterior mirrors
- Hill descent control
- Roof edge spoiler
- Diesel particulate filter (DPF)
- Rear parking sensors
- Electromechanical parking brake
- Electronic Stability Control (ESC)
- Chassis: Standard chassis
- Windscreen with acoustic glazing
- front and rear floor mats
- Cruise control system including speed limiter
- Heated rear window
- Interior lighting
- Manual child lock
- Automatic air conditioning
- boot floor mat
- Front headrests
- LED taillights
- Light/rain sensor
- front center armrest
- Non-smoking version
- Wheel: Alloy wheels, 17" 10-spoke
- Wheel: Tire repair kit
- Radio accessories: Data module Europe
- Seat belts
- Seats: Split-folding rear seat backrest
- Sun visor on driver and passenger side
- Phone: Bluetooth interface
- First aid kit with warning triangle
- Electronic immobilizer
- black decorative trim



Extra equipment

- Audi active lane assist including camera-based traffic sign recognition and high-beam assist (lane keeping assist, supports the driver comfortably in staying in their lane within system limits (functional range from approx. 65 to a maximum of 250 km/h). If the system is activated and ready, and the driver has not activated the turn signal, Audi active lane assist helps to guide the vehicle within the detected lane markings by making gentle corrective steering interventions.)
- Parking aid plus (supports the driver with acoustic signals and a display message when parking and maneuvering. The parking aid is activated by engaging reverse gear or via a button in the center console, or automatically when the distance to a detected object is less than 90 cm. Automatic activation can be switched on and off.)
- Camera-based traffic sign recognition (Supports the driver by displaying traffic signs detected within the system's limits, such as speed limits, no-overtaking zones, and temporary speed restrictions, which are within the detection range of the front camera. The traffic sign recognition is displayed automatically in the digital instrument cluster or in the optional Audi virtual cockpit.)
- Ambient lighting package (in addition to the standard interior lighting (LED): - approach lighting in the exterior door handles - entry lights on the underside of the front doors - front footwell lighting - illuminated interior door handles front and rear - ambient lighting in the front and rear doors - illuminated storage compartment below the instrument panel - ambient lighting on the front center console)
- Business package (Audi phone box - MMI Navigation plus (incl. driver information system with color display) - Audi virtual cockpit - Heated front seats - Automatically dimming interior mirror - Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides incl. curb view function for the passenger mirror - High beam assist - Manual sunshade for rear door windows)
- Front seat heating (for driver and front passenger side, individually adjustable in 3 stages via direct selection button on the climate control unit)
- Electrically adjustable, heated, and folding exterior mirrors with automatic dimming on both sides (including curb view function for the passenger-side exterior mirror with integrated LED turn signal, including heated windshield washer nozzles, convex, flat, or aspherical mirror glass. The curb view function tilts the passenger-side exterior mirror downwards when reverse gear is engaged, providing the driver with a better view of the curb).
- Aluminum roof rails with roof rack recognition
- Deletion of performance/technology lettering
- High-beam assist (within the system's limitations, it automatically detects oncoming headlights, taillights of other road users, and light sources in built-up areas. Depending on the traffic situation, the high beams are automatically switched on or off. The system thus improves the driver's visibility and increases comfort.)
- Comfort center armrest at the front (adjustable in tilt and longitudinally sliding or completely foldable)
- Paint finish: Metallic
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction plus including steering wheel heating (with 14 multifunction buttons for convenient operation of the available infotainment features such as audio skip, telephony, NAV button or steering wheel heating - adjustable in height and distance - with full-size airbag - shift paddles for manual changing of the driving modes)
- City Assistance Package (includes a selection of assistance systems specifically for city traffic - Parking aid plus - Reversing camera - Lane change warning - Audi Pre sense basic - Audi Pre sense rear - Exit warning and rear cross traffic assist)
- Gloss package (roof frame and window channel strips in anodized aluminum)
- Seat covers in fabric imprint (seat center panel in fabric imprint black - seat side bolsters, headrest center panel, front center armrest in fabric plain black)
- Seats: Front sports seats

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Rear bumper	Rear bumper - Scratch(es) - Smart repair

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Door - front right side	Door - Scratch(es) - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 20 May 2022	743,95 €
2	Front, Provided by user / customer, from 9 Feb 2024	772,68 €
3	Side right, Provided by user / customer, from 25 Sept 2024	1.431,87 €
4	Side - left, Provided by user / customer, from 12 May 2025	2.855,81 €

Repainting

No.	Repainting
1	Mudguard - right side, Side panel - rear left side, Door - rear left side, Door - front left side, Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)

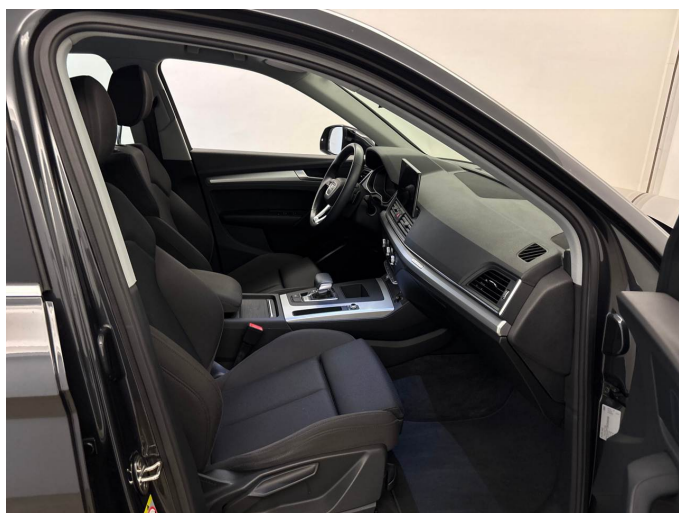


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

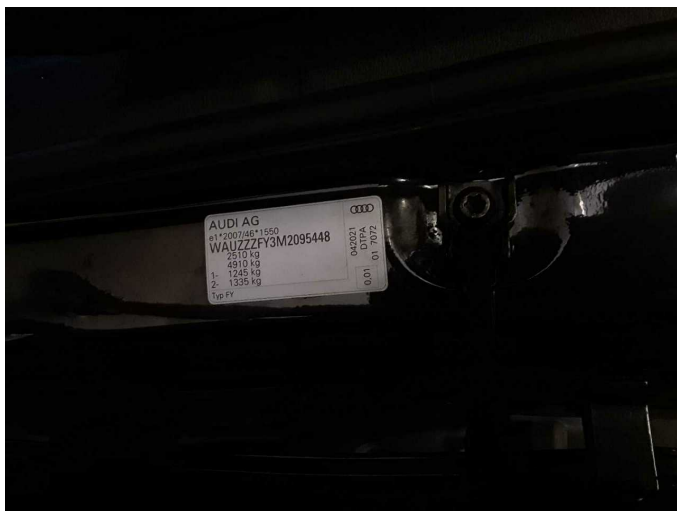


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

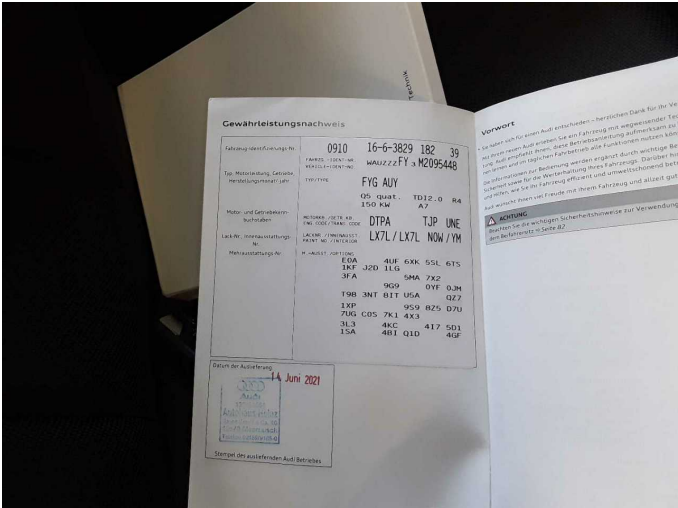


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

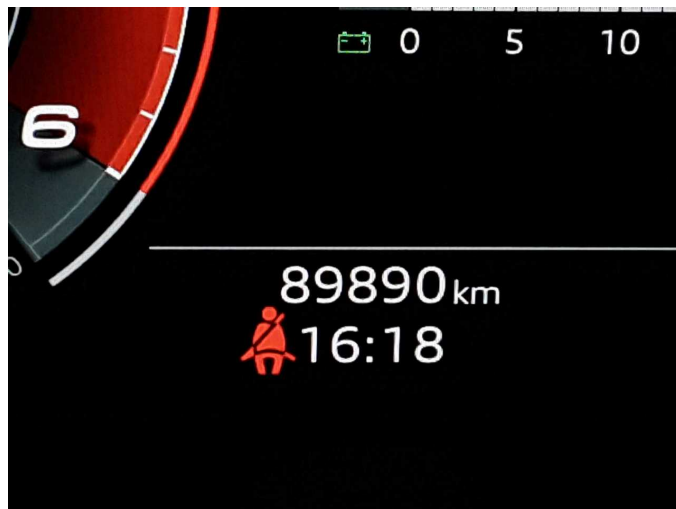


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

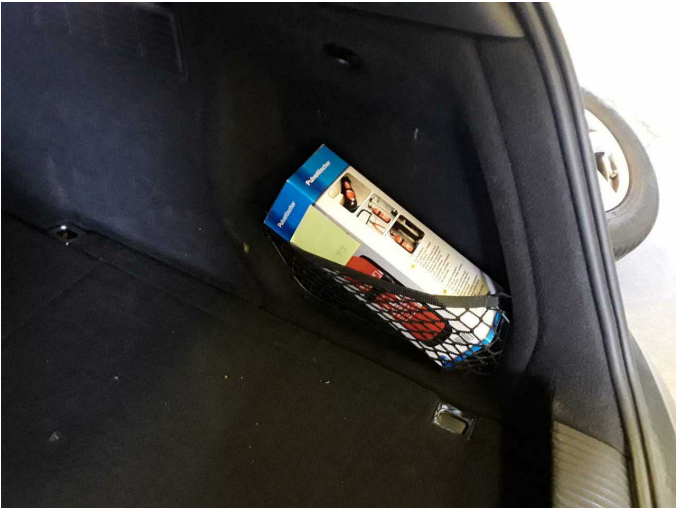


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

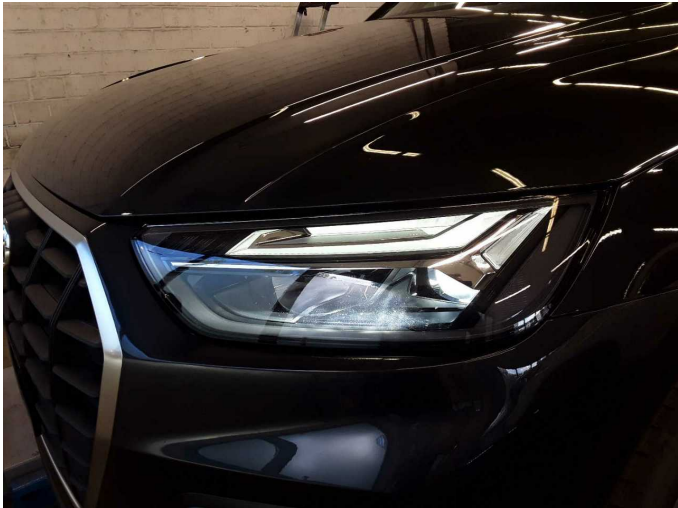


Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.




Figure 31: Misc.




Figure 32: Misc.



Figure 33: Misc.

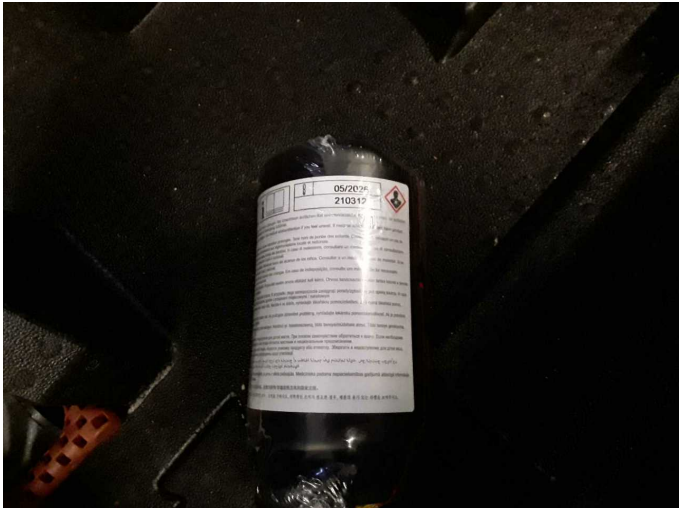

Damage 1: Equipment: Tirefit filler - Expired - Replace

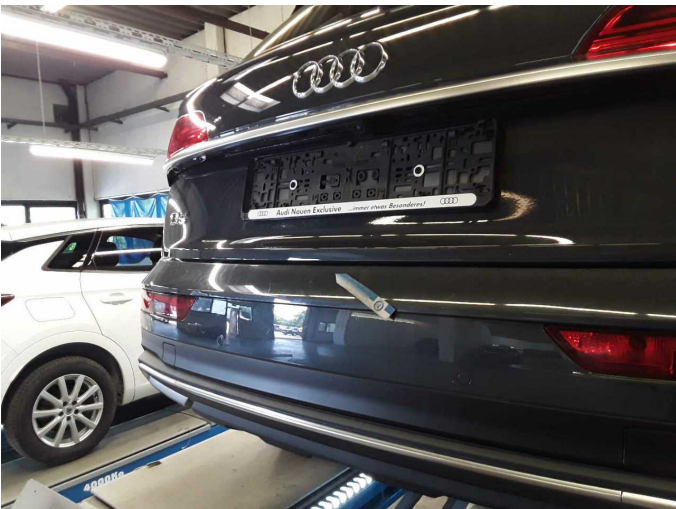

Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 2: Door - front right side: Door - Scratch(es) - No deduction



Wear and tear 2: Door - front right side: Door - Scratch(es) - No deduction



Repainting 1: Mudguard - right side, Side panel - rear left side, Door - rear left side, Door - front left side, Door - front right side



Repainting 1: Mudguard - right side, Side panel - rear left side, Door - rear left side, Door - front left side, Door - front right side




Repainting 1: Mudguard - right side, Side panel - rear left side, Door - rear left side, Door - front left side, Door - front right side



Repainting 1: Mudguard - right side, Side panel - rear left side, Door - rear left side, Door - front left side, Door - front right side




Repainting 1: Mudguard - right side, Side panel - rear left side, Door - rear left side, Door - front left side, Door - front right side

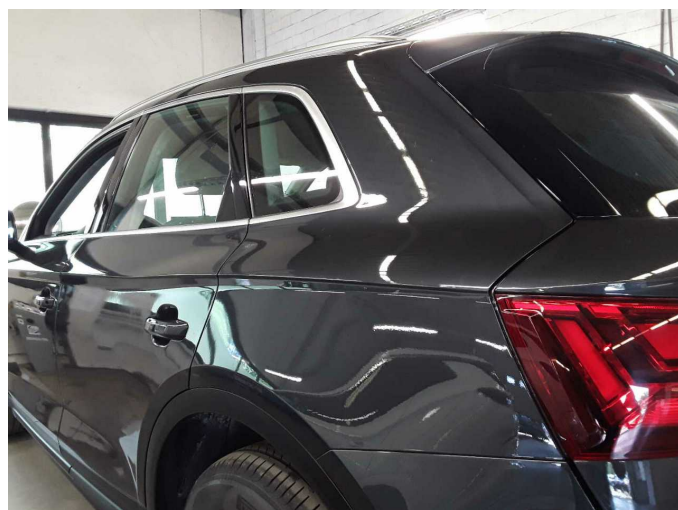

Repainting 1: Mudguard - right side, Side panel - rear left side, Door - rear left side, Door - front left side, Door - front right side



Repainting 1: Mudguard - right side, Side panel - rear left side, Door - rear left side, Door - front left side, Door - front right side

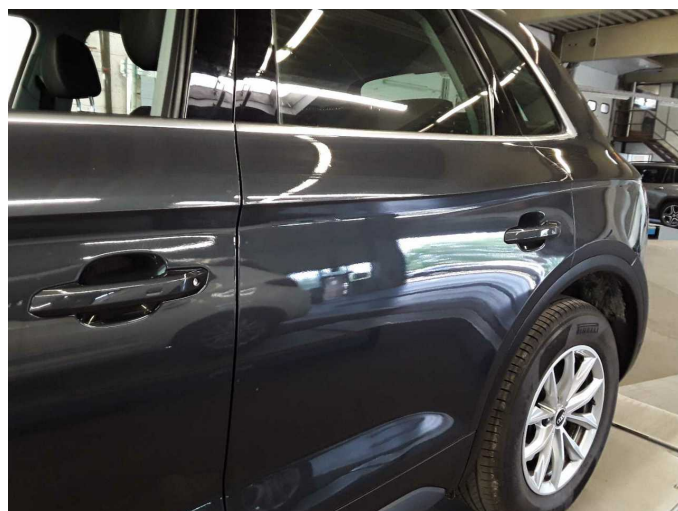

Repainting 1: Mudguard - right side, Side panel - rear left side, Door - rear left side, Door - front left side, Door - front right side



Repainting 1: Mudguard - right side, Side panel - rear left side, Door - rear left side, Door - front left side, Door - front right side



Repainting 1: Mudguard - right side, Side panel - rear left side, Door - rear left side, Door - front left side, Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF3M2095448
Hersteller / Modell: AUDI AUDI Q5 40 TDI quattro S tronic

Datum	KM-Stand	Beschreibung
27.02.2026	85.995	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Luftfiltereinsatz ern; Regelwartungsdienst
11.12.2025	82.748	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
12.08.2025	78.198	Reparatur Sonstiges
12.05.2025	75.521	Bremsflüssigkeit; Bremsflüssigkeit ern
11.11.2024	68.076	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
20.06.2024	62.000	HU + AU
26.03.2024	57.027	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Getriebeöl ern/prüfen; Kraftstofffilter ern; Regelwartungsdienst; Reparatur Sonstiges
03.01.2024	54.150	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
26.05.2023	40.915	Bremsflüssigkeit; Bremsflüssigkeit ern
15.02.2023	35.876	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
30.09.2022	29.126	Regelwartungsdienst
09.05.2022	17.403	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges