



Expertise

Protocol number: 46385404
Order No. / Reference: 26612076
Inspection date: 8 Jul 2026

Manufacturer: Volkswagen

Model: Multivan T7 2,0 TSI OPF KÜ Life

VIN: WV2ZZZST4PH012867



Vehicle details

Manufacturer / Type / Model / Equipment

Volkswagen Multivan T7 2,0 TSI OPF KÜ Life

Vehicle Identification number WV2ZZZST4PH012867
Mileage (Read) 101,370 km
First registration 16 May 2023
Number of holders 1
Next periodical technical inspection 04/2028
(Report on hand)

Power / Engine displacement 150 kw / 1,984 ccm
Fuel type / Cylinder Petrol / 4
Gearbox / Number of gears Automatic / 7
Type of drive Front drive
Type of vehicle Van

Colour / colour code Monosilber Metallic
Doors / Seats 5 / 7
Upholstery type Cloth
Colour of upholstery Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	18,300 km
Last service on / at	01/2026 at 90,510 km		
Key is / should be	4 / 4	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS572098
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CQG 00250		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,850 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R18 101V	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	235/50 R18 101V	Summer tyres on Light alloy	Continental	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R17 102H	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	215/60 R17 102H	Winter tyres on Light alloy	Dunlop	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartments: Various shelves and storage compartments
- Airbag: Side and head airbags for driver and front passenger (head airbags for the outer rear seats - center airbag in the front)
- Exterior mirror housings in high-gloss black
- LED turn signals, integrated into the side of the exterior mirrors
- third brake light
- Decorative inlays: Decorative inlays "Dark Silver Brushed"
- Three-phase generator 180 A
- Electronic Stability Program, ABS, ASR (with deactivation button), EDS (Hill Start Assist)
- Chassis: Suspension and damping, standard
- Electric windows, front
- Floor mats: Textile floor mats in the driver's cab
- Transmission: DSG (dual-clutch transmission), 7-speed automatic
- Tailgate: Power closing tailgate
- Instrument cluster (km/h) (displays for speed, total/trip distance, engine speed, fuel level and time)
- Air conditioning with manual control in the driver's cab, with additional heating for the cargo/passenger compartment
- LED headlights with LED daytime running lights
- Strip between the headlights painted in glossy black (with two chrome strips)
- Headlight range control
- Multi-collision brake
- Non-smoking version
- eCall emergency call system
- Particle filter: Gasoline particulate filter
- Radio: App-Connect incl. App-Connect Wireless (for Apple CarPlay and Android Auto)
- Radio accessories: 8 speakers (passive)
- Radio accessories: USB interface (2 USB-C ports at the front - 4 USB-C charging ports in the passenger compartment)
- Wheels/Tires: "Dundrod" alloy wheels 6.5 J x 17, in silver
- Wheels/Tire Accessories: Lockable wheel bolts
- Sliding door: Closing aid on both sides for sliding doors (sliding door left and right with closing aid)
- Drawers under the outer seats in the passenger compartment and 2 waste bins
- Automatically dimming interior safety mirror
- Seat covers: Bi-color seat covers in fabric, design "Ribella"
- Seats in the passenger compartment: 3 individual seats in the 3rd row (2 preparations for armrests on the inside of the 3rd row)
- Seats: Armrests for driver and front passenger seats, on both sides (with electric lumbar support and folding table)
- Sun visors with illuminated mirrors, ticket holder on the driver's side (with airbag label on sun visor and B-pillar)
- Telephone: Mobile phone interface
- First aid kit, warning triangle and high-visibility vest
- Lashing eyes (4 pieces) (2 fixed lashing eyes in the cargo area - 2 variable lashing eyes for the rail system)
- Airbag for driver and front passenger (with passenger airbag deactivation)
- Evasive steering assist and turn assist
- Exterior mirrors, electrically adjustable, heated and folding
- Exterior mirrors, left and right convex
- Reinforced battery (68 Ah/ 380 A)
- On-board tools and tire mobility set (in the storage compartments in the luggage compartment)
- Roof rails/roof load carrier: Mounting points for roof rack system (6 pieces)
- Parking assistance in the front and rear areas
- Chassis: 17" disc brakes at the front and 16" disc brakes at the rear
- Windows: Front pane made of laminated safety glass, heat and sound insulating
- Cruise control system with speed limiter (and "Intelligent Speed Assist")
- Glove compartment with light
- Rear window with wiper/washer system, heated
- Child seat anchorage ISOFIX and Top Tether (for each individual seat in the passenger compartment)
- Fuel-powered auxiliary heater
- Cargo space divider (load capacity 20 kg) with bag hooks and luggage net
- LED taillights
- Steering wheel: Multifunction leather steering wheel with paddle shifters
- Multifunction display: Digital Cockpit
- Fatigue detection
- Emergency braking assistant "Front Assist" (with pedestrian and cyclist detection)
- Radio: "Ready 2 Discover" with 25.4 cm (10 inch) color touchscreen including "Streaming & Internet"
- Radio: Digital radio reception (DAB+)
- Radio accessories: Voice control
- Wheels, tires: Covers for alloy wheels
- Wheels/Tires: 235/55 R 17 103 H xl, optimized for low rolling resistance
- Wheels/Tires: Tire pressure monitoring system
- Windscreen wiper intermittent control with rain sensor for the front windscreen wipers
- Keys for locking system: 2 vehicle keys
- Power steering
- Seat belt monitoring system (warning tone and light for unfastened seat belts front and rear)
- Seats in the passenger compartment: 2 individual seats facing forward in the 2nd row.
- Seats: Armrest(s) inside the seats (removable and repositionable) (in the 2nd row of seats)
- Seats: Left and right seats in the 1st row (with height adjustment - including 2-way headrest)



- Central locking with keyless start system "Keyless Start" without safe locking

- Lane keeping assistant "Lane Assist"
- Daytime running light function with auxiliary driving lights ("Coming home"/"Leaving home" function)
- Traffic sign recognition
- Electronic immobilizer
- Green thermal insulation glazing

Extra equipment

- Ambient lighting in 10 colors, including footwell lighting for the 2nd row of seats.
- Anti-theft alarm system with interior monitoring, backup horn and tow-away protection
- Windows: Sliding windows in the sliding door on the right and left (including privacy glass in the rear, - windows in the rear tinted)
- Glass roof: Panoramic glass roof, tinted, two-part
- Tailgate: Electric tailgate (opening/closing) (Tailgate with electric opening and closing - servo closing tailgate)
- Air conditioning: 3-zone "Air Care Climatronic" with additional control unit in the passenger compartment
- Light and visibility: IQ.Light - LED matrix headlights (Dynamic Light Assist high beam control for LED matrix headlights - IQ.Light LED matrix headlights with LED daytime running lights - Dynamic headlight range control with dynamic cornering lights - Bad weather lights including turning lights)
- Rear View reversing camera
- Heated seats for the driver's cab, left and right, separately adjustable
- Seating configuration - 1. Seat packages: 7-seater package with Vis-a-Vis = 2-2-3 (Approval for a maximum of 7 seats - 3 individual seats in the 3rd row - 2 individual seats facing the rear (Vis-a-Vis view) in the 2nd row - Without armrests in the 2nd row - Without armrests in the 3rd row)
- Partitions: Mesh partition

- Towbar, foldable (with electric release (including trailer stabilization))
- Display: Head-Up Display
- Driver assistance systems: "Travel Assist" and "Emergency Assist" (Driver assistance "Travel Assist" including lane keeping assist "Lane Assist" and "Emergency Assist" - Lane change assist "Side Assist" including "Blind Spot Detection", parking assist and exit warning - Adaptive Cruise Control ACC "stop & go" with speed limiter)
- Paint finish: Metallic
- Steering wheel: Multifunction leather steering wheel with paddle shifters (heated)
- Multifunctional display: Digital Cockpit Pro
- Navigation system "Discover Pro" (25.4 cm (10 inch) color touchscreen - streaming & internet)
- Wheels/Tires: "Halmstad" 8 J x 19 alloy wheels, in black, polished finish (tires 245/45 R 19 102 H xl, optimized for rolling resistance - wheel center cover for alloy wheels - lockable wheel bolts - 4 "Halmstad" 8 J x 19 alloy wheels, in black, polished finish)
- Auxiliary heater for windscreen defrosting and heating/ventilation of the driver's cab (with remote control)
- Telephone: Mobile phone interface "Comfort" (with inductive charging function)
- Table: Multifunctional table/center console with 3 cup holders (movable throughout the vehicle)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Instrument panel	Centre console - front - Scratch(es) - Loss in value
2	Door - rear right side	Door - dent(s) - Smooth repair work
3	Seat - front	Seat cover - left side - Worn - Smart repair
4	Interior	Interior - Odour - Ozone treatment



Wear and tear

No.	Component group	Description
1	Interior	Interior - Scratch(es) - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

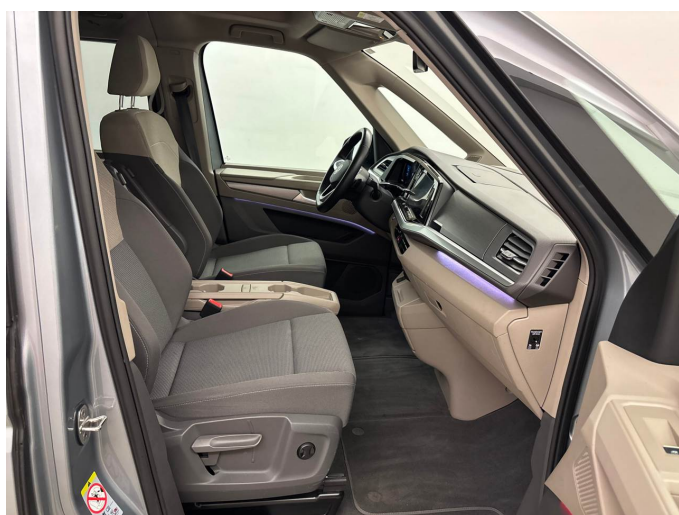


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

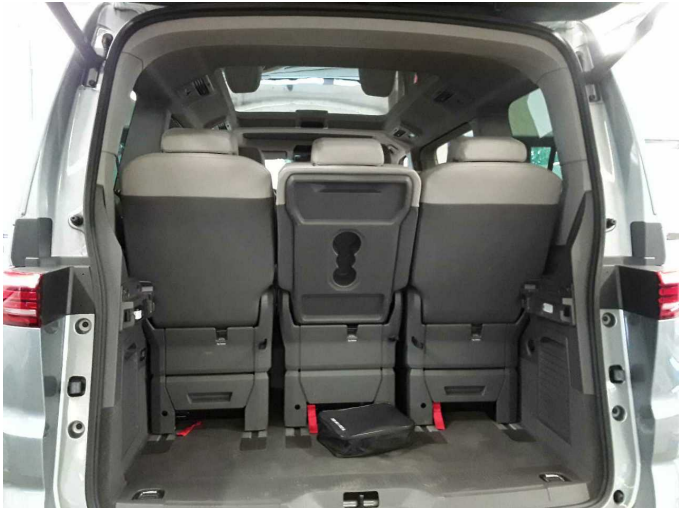


Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.




Figure 34: Misc.




Damage 1: Instrument panel: Centre console - front - Scratch(es) - Loss in value



Damage 1: Instrument panel: Centre console - front - Scratch(es) - Loss in value

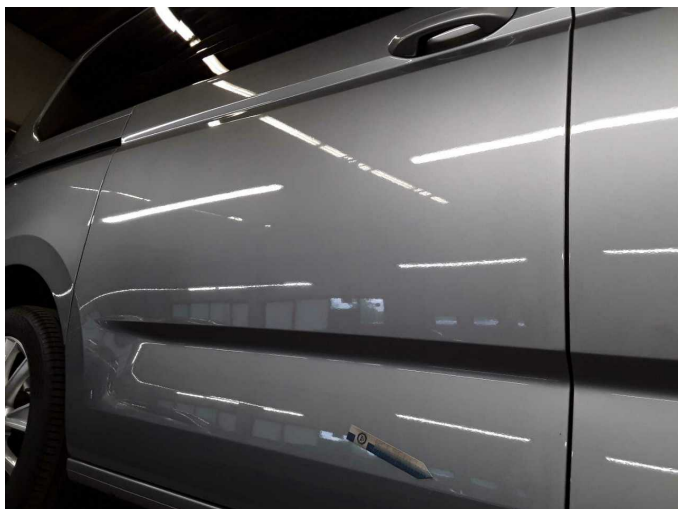


Damage 2: Door - rear right side: Door - dent(s) - Smooth repair work

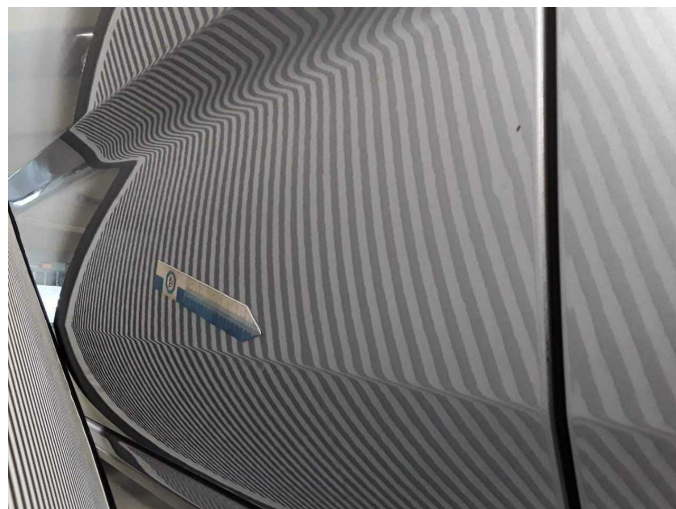


Damage 2: Door - rear right side: Door - dent(s) - Smooth repair work



Damage 3: Seat - front: Seat cover - left side - Worn - Smart repair

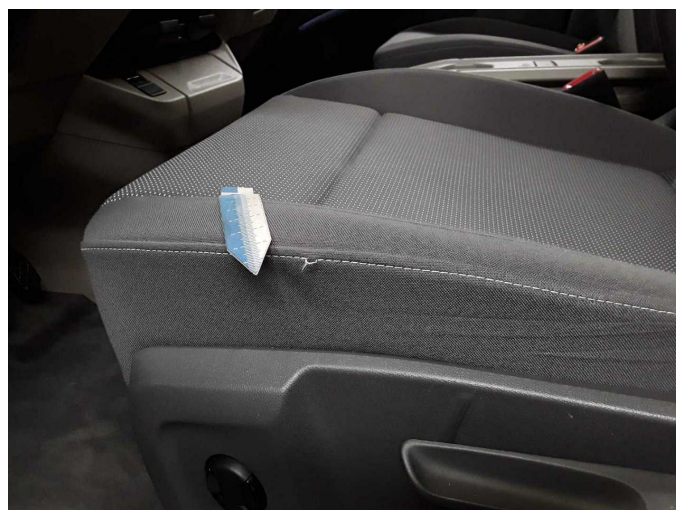

Damage 3: Seat - front: Seat cover - left side - Worn - Smart repair

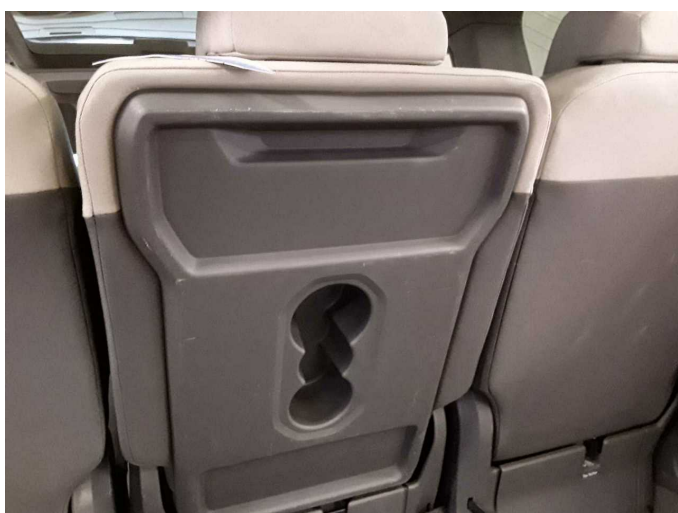

Wear and tear 1: Interior: Interior - Scratch(es) - No deduction



Wear and tear 1: Interior: Interior - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WV2ZZZST4PH012867

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Multivan T7 Kurz Life

Datum	KM-Stand	Beschreibung
29.04.2026	100.172	HU + AU
27.01.2026	90.510	Regelwartungsdienst
30.09.2025	79.499	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
14.04.2025	61.378	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Regelwartungsdienst; Zündkerzen ern
03.02.2025	55.020	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
13.03.2024	27.620	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges