



Expertise

Protocol number: 46461846
Order No. / Reference: MW3070635
Inspection date: 9 Jul 2026

Manufacturer: Opel

Model: Combo Cargo XL 1.5 D EHZ Edition

VIN: W0VEFYHZ2NJ541438



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Combo Cargo XL 1.5 D EHZ Edition	
Vehicle Identification number	W0VEFYHZ2NJ541438
Mileage (Read)	66,919 km
First registration	13 May 2022
Number of holders	1
Power / Engine displacement	96 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	TYPE HABILLAGE EXTERIEUR PLATE STANDARD
Doors / Seats	4 / 2
Upholstery type	Cloth
Colour of upholstery	Grey-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	3 Monat(e)
Key is / should be	2 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ629132
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AGY 00957		
Emission standard	EURO6;WLTP;AQ;PI/CI; N1 II	fine dust sticker	
Permitted total weight	2,380 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 98H	Summer tyres on Steel rim with wheel cover	Michelin	5mm / 5mm
2)	205/60 R16 98H	Summer tyres on Steel rim with wheel cover	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 98H	Winter tyres on Steel	Pirelli	6mm / 6mm
2)	205/60 R16 98H	Winter tyres on Steel	Pirelli	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments (edition)
- Driver's side airbag
- Automatic dipped headlights
- Exterior mirrors, electrically adjustable, heated and manually folding
- Hill Start Assist
- On-board computer
- Tachometer
- Third brake light
- Electric front windows
- Transmission: 6-speed transmission
- Heating and ventilation system with particle and odor filter, front
- Paint finish: Solid color paint
- Steering wheel remote control for BT radio
- Steering column, adjustable for reach and height
- Radio BT with Graphic Info Display
- Wheels: Tire repair kit
- Speed-sensitive power steering
- Seats: Driver's seat adjustable in 6 ways: length, height and backrest angle
- Daytime running light
- Partition wall, closed
- Doors: Sheet metal insert, driver's side
- Lashing eyes (6) in the cargo area
- Heat-insulating glazing, tinted
- Central locking: Ignition keys (2), one of which is foldable
- ABS including brake assist and adaptive brake light
- Anti-lock braking system (ABS) with cornering brake control and brake assist
- Exterior mirror housings in body color
- Battery discharge protection
- Floor covering: Cargo area floor, painted
- Diesel particulate filter, maintenance-free
- Three-point seat belts in all seats
- Electronic Stability Program (ESP Plus)
- Speed controller
- Rear wing doors, asymmetrically split, sheet metal, 180° opening angle
- Headrests (2), front, height adjustable
- Steering wheel: Comfort steering wheel (PU), flattened at the bottom with steering wheel remote control
- Upholstery: Cloth
- Wheels: Wheel cover, full surface
- Wheels: Steel wheels 6.5 J x 16
- Seats: Passenger seat adjustable in 4 ways
- Start/Stop System
- 12-volt power outlet in the center console
- Traction control with engine and brake intervention (TC Plus)
- Doors: Sliding door, passenger side, sheet metal
- Immobiliser
- Central locking with remote control

Extra equipment

- Driver and passenger side airbags
- Load securing (LED light in the cargo area - 4 additional load securing loops at half height (2 per side))
- Package: Comfort (Electric windows, front with one-touch function and anti-pinch protection as well as comfort closing function via remote control of the central locking system - Exterior mirrors, electrically adjustable, heated and folding - Parking pilot, front and rear)
- Tire pressure monitoring system
- Trailer hitch preparation
- Package: Cool & Sound 2 (Multimedia Navi Pro (navigation, Bluetooth, hands-free system, TMC, voice control, 8" color touchscreen display) - Dual-zone automatic climate control, front - Visibility package (rain sensor, high beam assist, instruments, 3.5" color driver information display, chrome surround, fog lights, with integrated cornering lights))
- Wheels: Steel wheels 6.5 J x 16 CWAN

Retrofitted equipment

- Retrofitting a towbar
- Bott installation



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Sill - left side	Sill - Scratch(es) - Smart repair
3	Equipment	Vehicle key - Broken / torn - Replace

Missing parts

Description

Trim / covers - Floor mats

Trim / covers - Floor mats

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

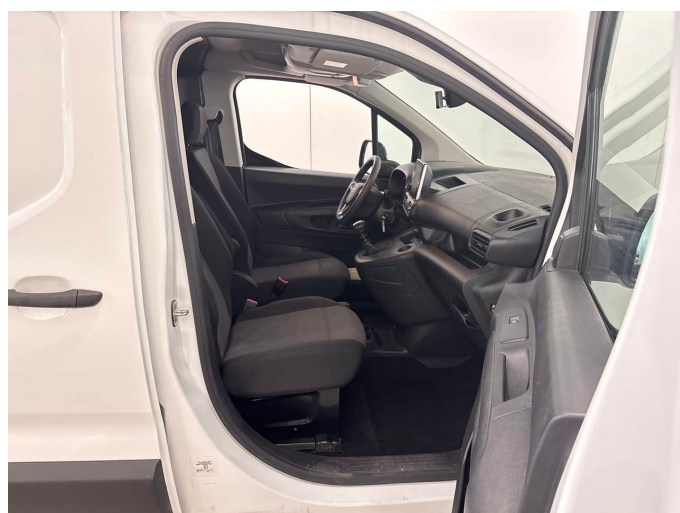


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

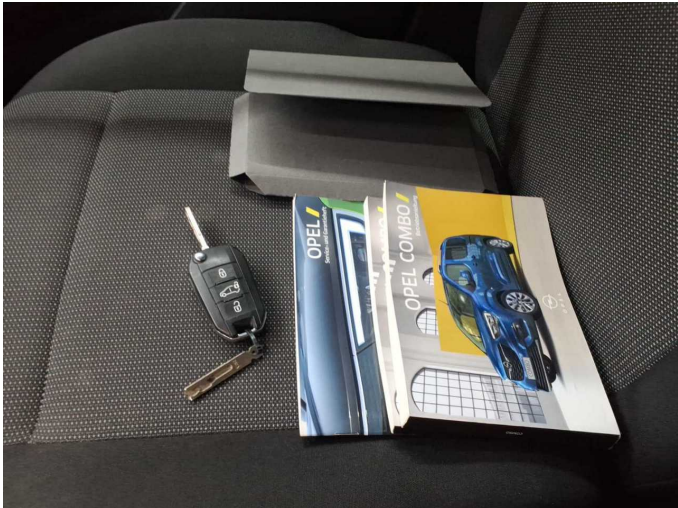


Figure 13: Documents

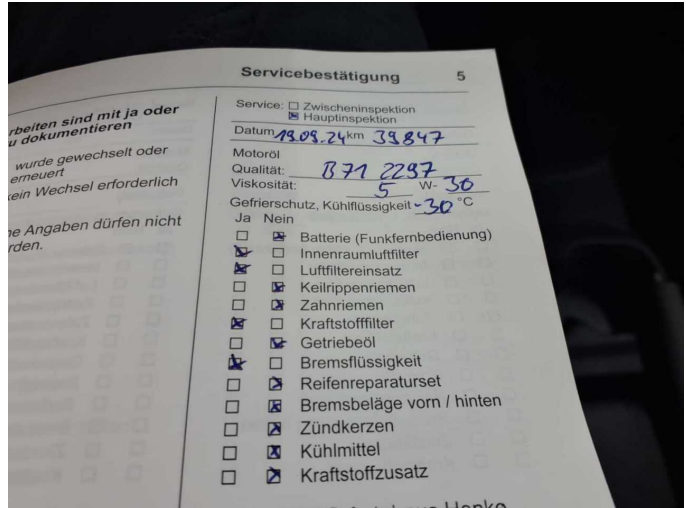


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

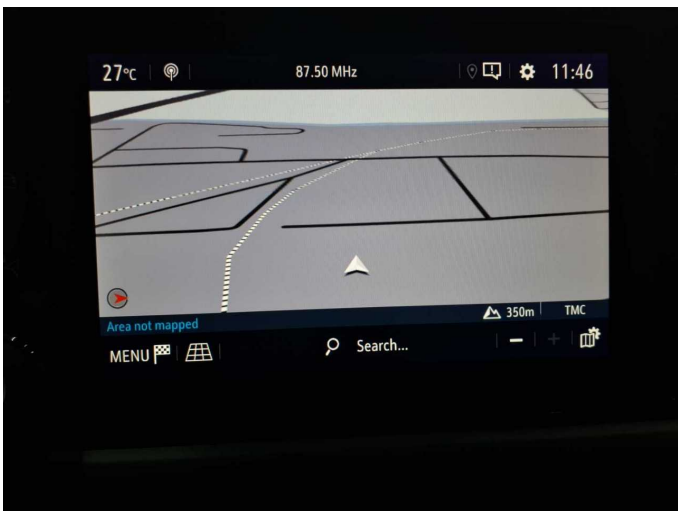


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.

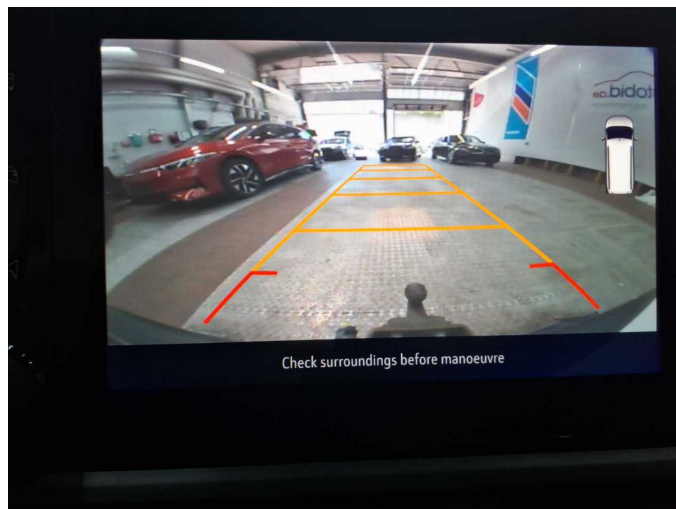


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

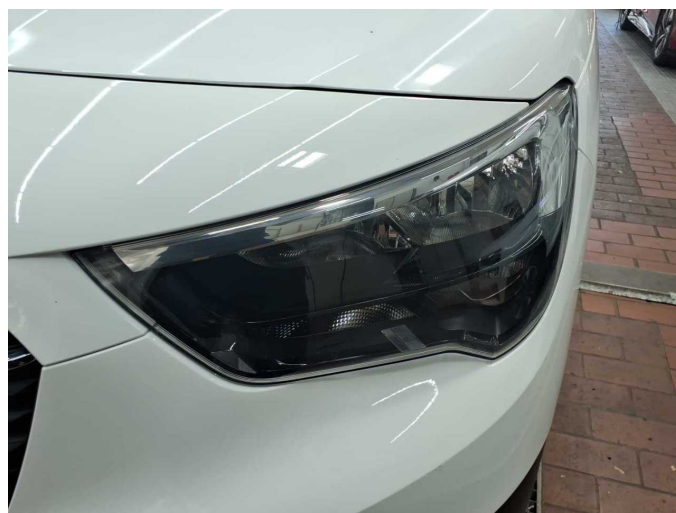


Figure 24: Misc.




Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

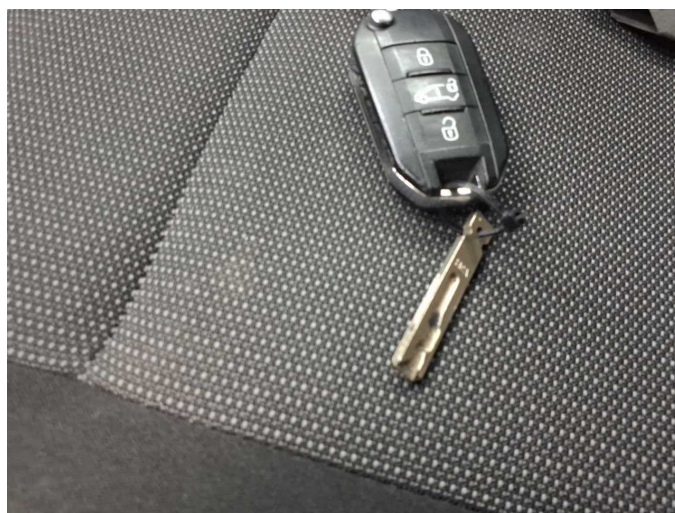

Damage 3: Equipment: Vehicle key - Broken / torn - Replace



Damage 3: Equipment: Vehicle key - Broken / torn - Replace



Damage 3: Equipment: Vehicle key - Broken / torn - Replace