



Peugeot 308 (UKL): 2CDW548

Vinnumber:	VR3FRHNSLNY555266	Versionname:	308 SW Allure Pack 1.2 PureTech S&S 130pk/cv 5p
First Registrationdate:	17/06/2022	Fiscalpower:	
Expertise Mileage:	59602	Power Kw:	96
Bodytype:		Type of rims (mounted)	Aluminium
Gearbox:	MAN 6 VIT		
Transmission:			
Fueltype:	Petrol		
Maintenance	OK		
Battery functioning	Yes		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Type of Tow bar	No Tow bar
GPS			
Type of Maintenance book	Digital maintenance		
Type of GPS storage	HD		

Tyres

	225/45/17/94 V			
Summer tyres:	Fr.L.	Bridgestone: 6 mm	Fr.R.	Bridgestone: 6 mm
	Re.L.	Bridgestone: 4 mm	Re.R.	Michelin: 4 mm
Tyre profile depth FL				6.0
Tyre profile depth FR				6.0
Tyre profile depth RL				4.0
Tyre profile depth RR				4.0
Tyre size FL				225/45 R 17 94 V
Tyre size FR				225/45 R 17 94 V
Tyre size RL				225/45 R 17 94 V
Tyre size RR				225/45 R 17 94 V
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				255
Tyre make FR				255
Tyre make RL				255
Tyre make RR				261

Assistance equipment

Repair kit	No
Door FL, Scratch(es), Repair and paint (complete)	



Outer door handle FL, Scratch(es), Acceptable



Door RL, Scratch(es), Acceptable




Internal boot lining R, Scratch(es), Smart repair



Internal boot lining L, Scratch(es), Acceptable



Boot lid covering R, Scratch(es), Smart repair

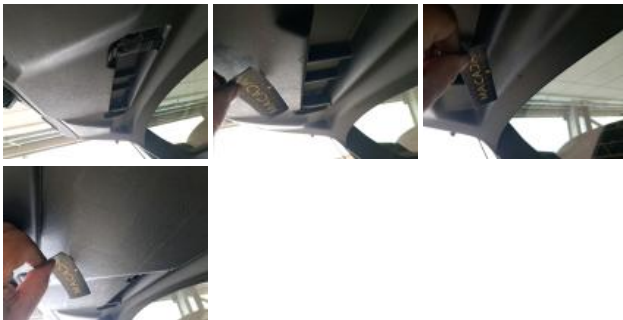

Bumper R, Scratch(es), Repair and paint (complete)



Bumper trim R, Dent(s) and scratch(es), Replace



Outside rear-view mirror housing R, Scratch(es), Acceptable



Alloy rim FR polished, Scratch(es), Acceptable



Kenteken	2CDW548
Merk Model	Peugeot 308 SW Allure Pack 1.2 PureTech S&S 130pk/cv 5p
Brandstofsoort	Benzine
Datum deel1	6/17/22

Datum reparatie	Kilometerstand	Reparatie omschrijving	Bewerking
3/19/26	53,682	sierlijst, sierplaat	
3/16/26	53,681	60000 km	Uitvoeren
3/16/26	53,681	bougie	Vervangen
3/16/26	53,681	diagnose	Uitvoeren
3/16/26	53,681	luchtfilter	Vervangen
3/16/26	53,681	luchtfilter interieur	Vervangen
3/16/26	53,681	oliezeef	Vervangen
3/16/26	53,681	remvloeistof	Vervangen
2/23/24	26,171	20000 km	Uitvoeren
2/23/24	26,171	luchtfilter interieur	Vervangen
2/23/24	26,171	oliezeef	Vervangen