



Expertise

Protocol number: 46812951
Order No. / Reference: 26732960
Inspection date: 30 Jul 2026

Manufacturer: Mercedes-Benz

Model: GLE-Coupe 350 de 4Matic 9G-TRONIC Exclusive

VIN: W1N1673171A610854



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLE-Coupe 350 de 4Matic 9G-TRONIC Exclusive	
Vehicle Identification number	W1N1673171A610854
Mileage (Read)	221,165 km
First registration	7 Feb 2022
Number of holders	1
Next periodical technical inspection	02/2027
(Report not on hand)	
Fuel type	Hybr.D/E ext.aufl
Engine displacement / Cylinder	1,950 ccm / 4
Power	143 kW
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Selenitgrau metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	227 Tag(e)
Last service on / at	09/2025 at 180,862 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF764072
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / ASN 00062		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	3,230 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	275/50 R20 113W	Summer tyres on Light alloy	Dunlop	6mm / 6mm
2)	275/50 R20 113W	Summer tyres on Light alloy	Dunlop	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	275/50 R20 113V	Winter tyres on Light alloy	Dunlop	6mm / 6mm
2)	275/50 R20 113V	Winter tyres on Light alloy	Dunlop	7mm / 7mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Exhaust system with 2 chrome-plated tailpipe trims
- Storage compartment in center console
- Adaptive Highbeam Assist Plus
- Airbag: Driver and passenger side
- Airbag: Sidebag for driver and front passenger (combined thorax/pelvisbag)
- Active Lane Keeping Assist
- 4MATIC permanent all-wheel drive
- Anti-lock braking system
- Foldable armrest for driver and front passenger
- ATTENTION ASSIST
- Electrically adjustable and heated exterior mirrors
- Cup holder
- Downhill Speed Regulation (DSR)
- Third brake light
- ECO start/stop function
- Front door sills with "Mercedes-Benz" lettering illuminated in white
- Chassis with steel springs and lowered suspension
- Electric windows, front and rear
- Velour floor mats
- Transmission: 9G-TRONIC
- Rear window heated
- Interior headliner fabric crystal grey
- KEYLESS-GO start function
- Mechanical child safety lock in the rear doors
- Communication module (LTE) for the use of Mercedes me connect services
- Paint finish: Solid
- Charging cable for wallboxes and public charging stations, 5m, smooth
- Steering wheel: Multifunction sports steering wheel in Nappa leather
- Mercedes-Benz emergency call system
- Navigation accessories: Extended MBUX functions
- Navigation accessories: Pre-installation for navigation services
- Package: Chrome
- Package: Parking package with reversing camera
- Package: Mirror Package
- PRE-SAFE system
- Radio accessories: 2 USB ports
- Radio accessories: Additional USB ports
- Remote Services Plus
- Power steering
- Seats: 4-way lumbar support for driver
- Seats: Comfort seats for driver and front passenger
- Seats: Rear seat backrests foldable
- Phone accessories: Wireless charging system for mobile devices
- High-visibility vest for drivers
- Widescreen Cockpit
- Central locking with interior switch
- Storage compartment in the doors
- ADAPTIVE BRAKE
- Adaptive brake light
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Brake Assist
- Acoustic environmental protection
- Ambient lighting
- Traction control (ASR)
- Rear armrest
- Automatic passenger airbag deactivation
- Brake Assist BAS
- Diesel particulate filter
- Tachometer
- EASY-Pack tailgate with electric operation for opening and closing
- Electronic Stability Program
- Electronic traction system for all-wheel drive (4ETS)
- Vehicle Setup
- electric parking brake
- Speed Limit Assistant
- Lockable, air-conditioned and illuminated glove compartment
- Instrument panel and door sills in ARTICO man-made leather
- Climate: THERMATIC automatic climate control
- Headrests 5-way
- Radiator grille with 2 chrome-plated louvers in SUV design
- Charging cable for household socket, 5m, smooth
- Foldable cargo cover with magnetic locking mechanism
- Charging system: AC on-board charger 7.4 kW
- Steering column mechanically adjustable lengthwise and heightwise.
- MULTIBEAM LED
- Navigation accessories: Pre-installation for Live Traffic Information
- Navigation: Hard disk navigation
- Package: Chrome Interior Package
- Package: Public Charging
- Upholstery: Leather
- Radio: MBUX multimedia system
- Radio accessories: Digital radio (DAB)
- Tire pressure monitoring system (TPMS)
- Windscreen wipers with rain sensor
- 3-point seat belts
- Seats: i-Size child seat attachment on the outer rear seats
- Seats: Heated seats for driver and front passenger seats
- 12V sockets
- Phone accessories: Smartphone integration
- Cruise control with variable speed limiter
- Immobiliser
- Heat-insulating glass, all around



Extra equipment

- AMG spoiler lip in body color
- Head-up display (lens and mirror system projects a virtual image into the driver's field of vision - full-color display that is easily readable even on sunny days and at night - depending on the equipment, display of, for example, navigation instructions, speed, speed limits or settings of cruise control or active distance assist DISTRONIC)
- Package: AMG Line Exterior (diamond grille with chrome pins, integrated Mercedes star and one louvre painted in matte iridium silver with chrome inserts - AMG Styling: AMG front apron with chrome trim strip, sporty and distinctive air intakes in the wheel arch trims, fender flares front and rear in body paint, AMG side sill trims, AMG rear apron with diffuser-look insert in black and chrome trim strip - AMG light-alloy wheels in 5-twin-spoke design, painted tremolite grey and polished with front axle 275/50 R 20 on 9 J x 20 ET 57, rear axle 275/50 R 20 on 9 J x 20 ET 44)
- Package: KEYLESS-GO Comfort Package (vehicle key with KEYLESS-GO functionality - KEYLESS-GO access and drive authorization system - start/stop button - comfort opening and closing - door handles with chrome inlay - HANDS-FREE ACCESS - handle recess lighting - remote trunk lid closing - EASY-PACK tailgate)
- Radio accessories: Burmester surround sound system (with 13 speakers and 590 watts system power. Experience enhanced performance and exclusivity with legendary Burmester sound. The high-performance speakers create a first-class surround sound experience. This can be specifically optimized for the front and rear seats, intensifying the listening experience. A quality that is also visible thanks to the high-quality Burmester logos.)
- Wheels: 50.8 cm (20") AMG light-alloy wheels in 5-twin-spoke design (painted black high-gloss and polished with front axle 275/50 R 20 on 9.0 J x 20 ET 57, rear axle 275/50 R 20 on 9.0 J x 20 ET 44)
- Heated windshield washer system (including washer fluid reservoir, washer nozzles and washer fluid hoses)
- 230V power outlet in the rear
- Telephone: Multifunctional telephony (wireless connection of a compatible mobile phone to the external antenna - wireless charging for compatible mobile phones - Bluetooth and WLAN pairing wirelessly via NFC (Near Field Communication) technology)
- Partition net for luggage compartment separation and occupant protection
- Heat-insulating dark tinted glass
- Decorative elements: Brushed aluminum with light longitudinal grain
- Fire extinguisher (mounted at the front of the driver's seat)
- Paint finish: Metallic
- Charging system: DC on-board charger (DC charging)
- Package: Acoustic Comfort Package (Laminated safety glass with infrared-reflecting film for the windshield - Laminated safety glass with infrared-absorbing film for the side windows - Additional soundproofing measures)
- Package: Driving Assistance Package (Active Distance Assist DISTRONIC, Active Speed Limit Assist, Extended Automatic Restart on Highways, Route-Based Speed Adjustment with Traffic Jam Definition, Active Steering Assist, Active Lane Change Assist, Active Emergency Stop Assist with SOS Function, Emergency Lane Radio, Active Brake Assist, Turning and Intersection Function, Traffic Jam Emergency Braking Function, Evasive Steering Assist, Active Lane Keeping Assist, Active Blind Spot Assist, Exit Warning Function, PRE-SAFE PLUS, Pedestrian Warning Function, Traffic Sign Assist)
- Package: Night (Diamond grille with chrome pins and high-gloss black louvre; AMG light-alloy wheels in 5-spoke design, front axle 275/50 R 20 on 9.0 x 20 ET 57, rear axle 275/50 R 20 on 9.0 x 20 ET 44; AMG front windshield with high-gloss black trim strip; AMG rear windshield with diffuser-look insert in high-gloss black and high-gloss black trim strip; optional underguard in high-gloss black; window line and beltline trim strip in high-gloss black; heat-insulating dark-tinted glass from the B-pillar; exterior mirror housings in high-gloss black; window line and beltline trim in black)
- Radio accessories: MBUX Interior Assistant (This innovative system detects and interprets your hand and arm movements. Selected functions can thus be activated literally in the blink of an eye. The system can distinguish between driver and front passenger so that you can access exactly the menus you want to use.)
- Seats: Multicontour seats for driver and front passenger (driver and front passenger seats fully electrically adjustable via the switches in the door control panel: - Seat cushion depth adjustment - Seat cushion tilt adjustment - Seat longitudinal adjustment - Seat height adjustment - Seat backrest tilt adjustment - Headrest adjustment (horizontal and vertical) - 4-way lumbar support - Comfort headrests - Active cushions with inflatable air chambers in the lower seat back and side bolsters - Hot stone massage effect in the lumbar region - Seat heating plus - Front seat ventilation)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - rear left side	Door - Scratch(es) - Cover / polish
2	Front bumper	Front bumper - Scratched - Smart repair
3	Sill - left side	Sill - dent(s) - Smooth repair work
4	Tail light	Tail lamp - right side - Scratched - Replace
5	Door - front left side	Door - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - dent(s) - No deduction
2	Door - front right side	Door edge - Scratched - No deduction
3	Rear bumper	Rear bumper - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

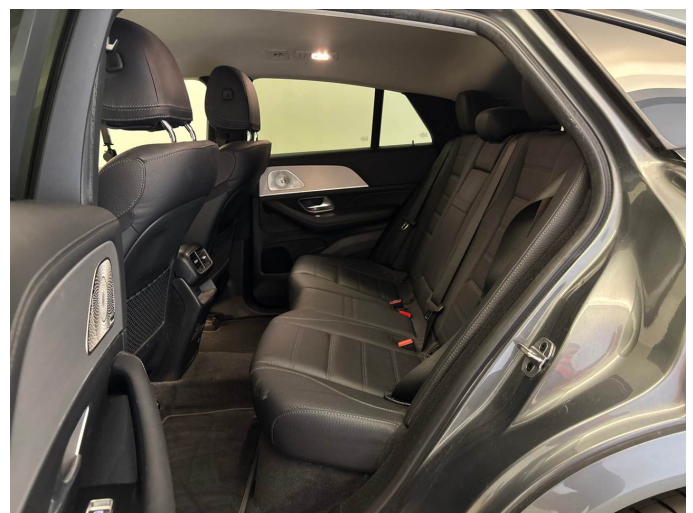


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

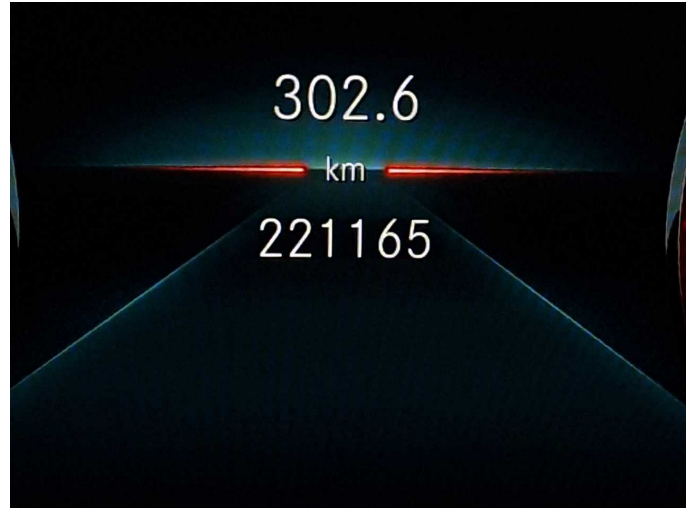


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

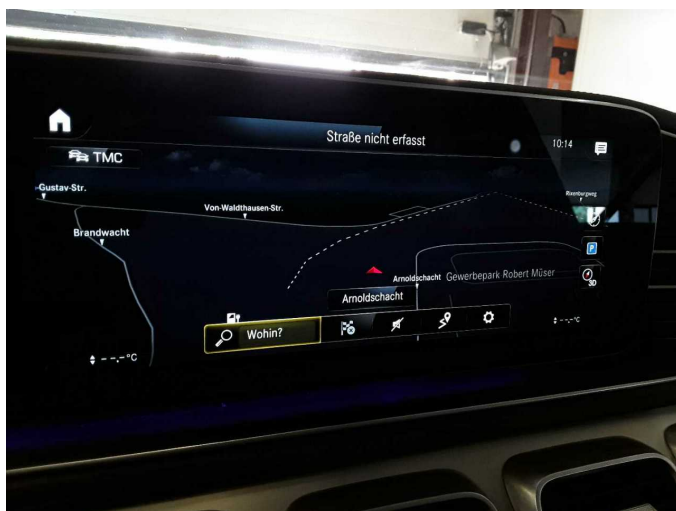


Figure 17: Navigation

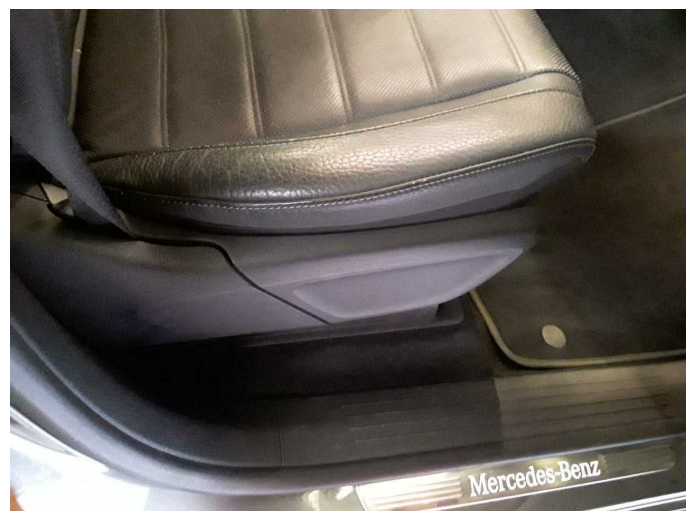


Figure 18: Misc.



Figure 19: Misc.

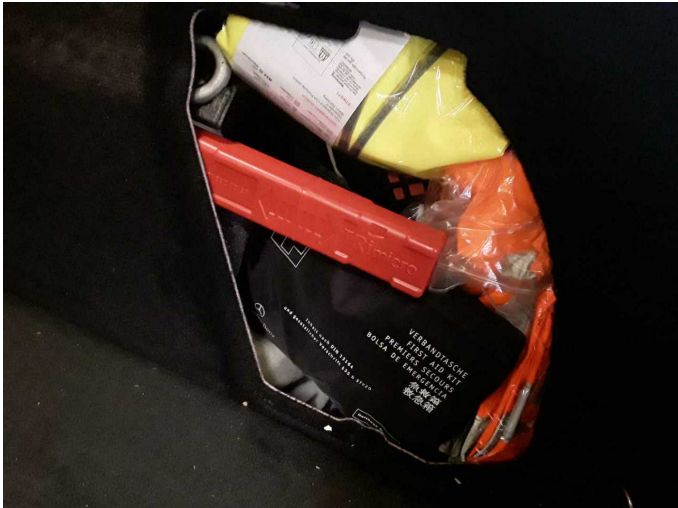


Figure 20: Misc.



Figure 21: Misc.

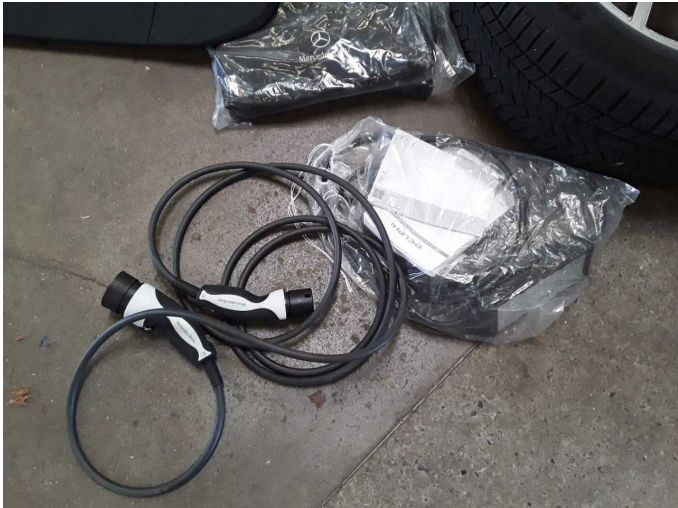


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

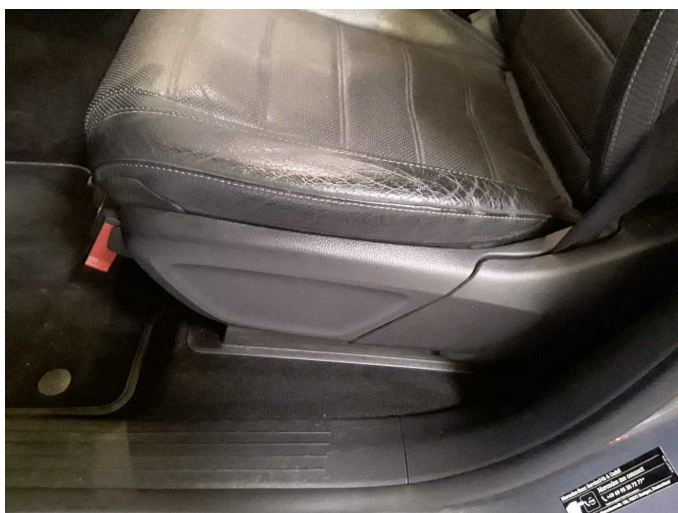


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Damage 1: Door - rear left side: Door - Scratch(es) - Cover / polish



Damage 1: Door - rear left side: Door - Scratch(es) - Cover / polish



Damage 2: Front bumper: Front bumper - Scratched - Smart repair




Damage 2: Front bumper: Front bumper - Scratched - Smart repair




Damage 3: Sill - left side: Sill - dent(s) - Smooth repair work




Damage 3: Sill - left side: Sill - dent(s) - Smooth repair work

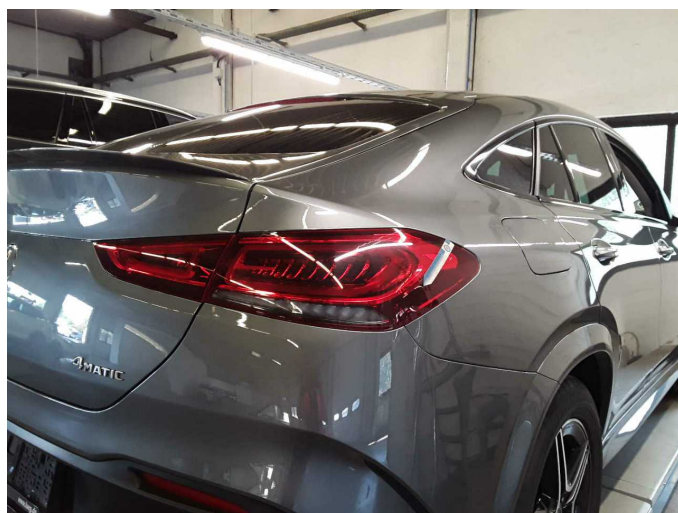


Damage 4: Tail light: Tail lamp - right side - Scratched - Replace

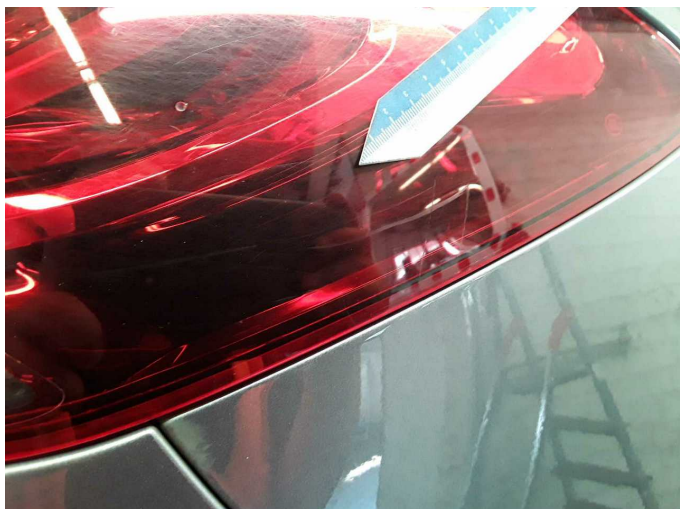

Damage 4: Tail light: Tail lamp - right side - Scratched - Replace

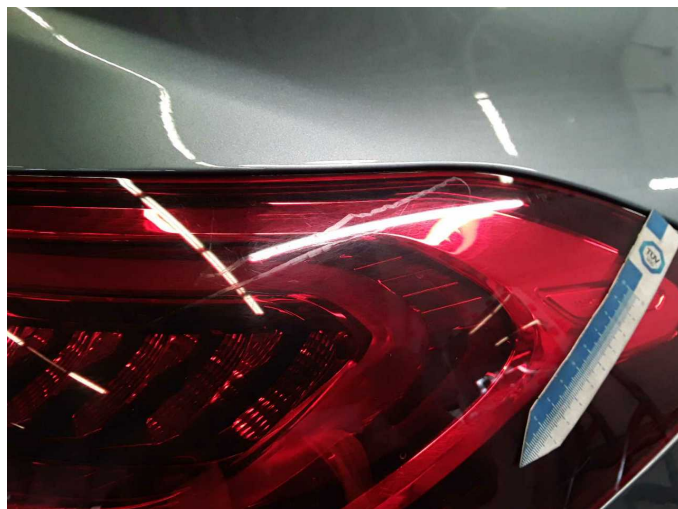

Damage 4: Tail light: Tail lamp - right side - Scratched - Replace

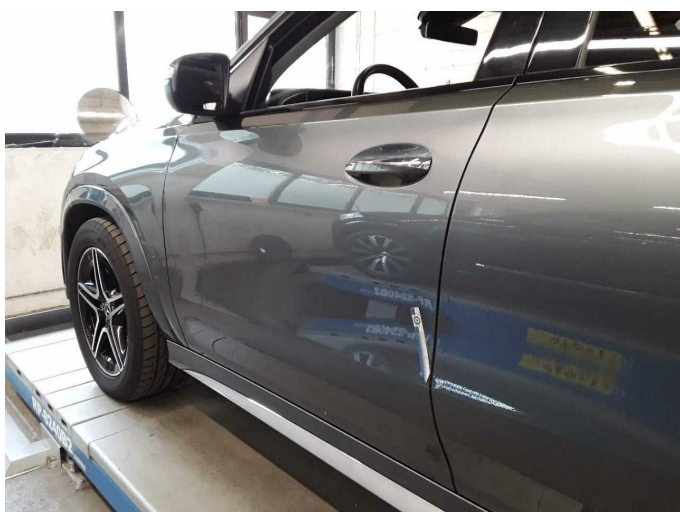

Damage 5: Door - front left side: Door - Scratched - Paint



Damage 5: Door - front left side: Door - Scratched - Paint



Damage 5: Door - front left side: Door - Scratched - Paint



Wear and tear 1: Bonnet: Bonnet - dent(s) - No deduction



Wear and tear 1: Bonnet: Bonnet - dent(s) - No deduction



Wear and tear 2: Door - front right side: Door edge - Scratched - No deduction



Wear and tear 2: Door - front right side: Door edge - Scratched - No deduction



Wear and tear 3: Rear bumper: Rear bumper - Scratch(es) - No deduction



Wear and tear 3: Rear bumper: Rear bumper - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N1673171A610854

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLE-Coupe 350 de 4Matic
9G-TRONIC Exclusive

Datum	KM-Stand	Beschreibung
22.09.2025	180.862	Regelwartungsdienst
17.06.2025	162.125	Regelwartungsdienst; Reparatur Sonstiges; Systemtest/Eigendiagnose
14.04.2025	153.478	Regelwartungsdienst
11.03.2025	146.210	Systemtest/Eigendiagnose
19.02.2025	143.328	HU + AU
15.10.2024	128.143	Regelwartungsdienst
15.04.2024	100.393	Regelwartungsdienst
03.11.2023	74.835	Regelwartungsdienst
12.04.2023	50.091	Regelwartungsdienst
17.10.2022	21.588	Regelwartungsdienst
26.09.2022	24.320	Motoröl b. Wartung; Motoröl b. Wartung; Regelwartungsdienst; Regelwartungsdienst