



Expertise

Protocol number: 46449702
Order No. / Reference: 26630936
Inspection date: 9 Jul 2026

Manufacturer: Audi

Model: A4 Avant 40 TDI S tronic advanced

VIN: WAUZZZF44MA029705



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A4 Avant 40 TDI S tronic advanced	
Vehicle Identification number	WAUZZZF44MA029705
Mileage (Read)	108,052 km
First registration	5 Feb 2021
Number of holders	1
Next periodical technical inspection	06/2028
(Report not on hand)	
Power / Engine displacement	150 kw / 1,968 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Brillantschwarz
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Dark grey
Re-import	no
readiness to drive	Roadworthy



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	12,000 km
Last service on / at	07/2025 at 90,833 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FX402368
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0588 / BWG 00014		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,175 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 98H	Winter tyres on Light alloy	Bridgestone	5mm / 5mm
2)	225/50 R17 98H	Winter tyres on Light alloy	Bridgestone	7mm / 7mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/40 R18 97Y	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	245/40 R18 97Y	Summer tyres on Light alloy	Pirelli	5mm / 5mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2024		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- AdBlue tank (12 liters) (tank for AdBlue solution for reducing nitrogen oxides in the exhaust gas using an SCR system)
- Accent surfaces in matte black (for dashboard, trim panels in door sills and center console insert)
- Traction control (ASR)
- Audi drive select (For individual vehicle tuning, with more dynamics or more comfort; allows the desired vehicle characteristics to be set in the available modes: - Auto - Comfort - Dynamic - Efficiency - Individual - Offroad (for Allroad quattro))
- Audi pre sense city (can detect vehicles and pedestrians within system limits at speeds up to approximately 85 km/h. If an impending collision is detected, the system warns the driver visually, audibly, and, if necessary, with a braking jolt, and can initiate full deceleration if required to reduce speed or, if necessary, avoid the collision.)
- third brake light, raised
- Black roof rails (for transport, stable and aerodynamically shaped, in aluminum)
- Diesel particulate filter (DPF)
- Door sill trims with aluminum inlay at the front
- Electronic Differential Lock (EDS)
- Electronic Stability Control (ESC)
- Driver Information System (with high-resolution 5" monochrome display - display content: speed, time, mileage, outside temperature, fuel warning with remaining range, gear shift indicator, current radio station or music track, radio and media lists, telephone menu (in conjunction with multifunction steering wheel), navigation information (if equipped). On-board computer with short- and long-term memory - including break recommendation)
- Front and rear floor mats (made of velour in black)
- Cruise control system including speed limiter (maintains the desired speed from approximately 20 km/h, provided the engine power or engine braking effect allows it; adjustable speed limiter allows individual limitation of the maximum speed, e.g. within built-up areas)
- Interior mirror dimming
- Child lock
- ISOFIX and Top Tether child seat attachments for the outer rear seats (standard mounting brackets for the convenient attachment of ISOFIX child seats - including an additional attachment point (Top Tether). Recommended child seats are available from your Audi dealer.)
- boot floor mat
- Headrests (5) (height adjustable front and rear)
- Manual cargo cover
- LED rear lights (indicator, brake, tail, reversing and rear license plate lights in LED technology. - Brake lights in LED technology enable earlier detection by following traffic due to faster activation)
- Airbag for driver and front passenger (with front passenger airbag deactivation)
- Airbag: Front side airbags and head airbag system
- Anti-lock braking system (ABS) (with electronic brake force distribution (EBD) and brake assist)
- Audi connect Emergency Call & Service with Audi connect Remote & Control (Audi connect Emergency Call: - Online breakdown call - Audi damage service - Audi service appointment online. The package includes the following services: - Parking position - Vehicle status - Remote locking and unlocking - Remote control of auxiliary heating - Anti-theft alarm notification)
- Electrically adjustable and heated exterior mirrors (with integrated LED turn signals, including heated windshield washer nozzles)
- Exterior mirror housings in body color
- On-board tools (in the luggage compartment)
- Headliner in fabric (depending on the chosen interior color, either titanium grey or atlas beige)
- Decorative inlays diamond lacquer silver grey
- Tachometer
- Electromechanical parking brake (includes parking brake function when stationary, starting aid by automatic release when starting and full deceleration while driving via all 4 wheels)
- Chassis: Standard chassis (for good driving dynamics with very good ride comfort; shock absorbers and coil springs on front and rear axles)
- Electric windows (front and rear)
- Window channel strips in black (rubber)
- Remote key, without SafeLock (locks and unlocks doors, luggage compartment and fuel filler flap - including Keyless-Go - including comfort closing/opening of windows)
- Transmission: S tronic 7-speed
- rear window wiper
- Top speed limited to 210 km/h
- Interior lighting (front and rear roof module including reading lights - capacitively operated at the front, ambient light on center console, glove box light, passive door warning lights, trunk light on the left, additionally on the right for the A4 Avant/S4 Avant, and tailgate lighting)
- Automatic climate control (single-zone automatic climate control - electronically regulates air temperature, volume and distribution, sun position-dependent control - air distribution can be set using 5 main positions - the 3 LEDs integrated into the seat heating and seat ventilation buttons provide feedback on the selected setting (optional) - buttons for defrosting the front and rear windows - manual recirculation control and particle filter - with key recognition and humidity sensor)
- LED headlights (low beam, high beam, daytime running lights and position lights in LED technology - turn signals in incandescent bulb technology)
- Steering column, manually adjustable in height and axis



- Steering wheel: Leather steering wheel in a 3-spoke design with multifunction controls (height and reach of the steering wheel are manually adjustable. For convenient operation of the extensive standard and optional infotainment features, the steering wheel is equipped with 6 multifunction buttons.)
- Mild hybrid (enables the integration of hybrid functions into conventional TFSI and TDI engines. A belt-driven starter generator (BSG) and an additional lithium-ion battery enable fuel consumption reduction/CO2 savings through increased recuperation and by switching off the combustion engine while driving below 160 km/h (coasting, only in conjunction with automatic transmissions).)
- Radio accessories: 8 speakers (passive) front and rear
- Radio accessories: Digital radio reception (DAB) (in addition to the analog station offerings, reception of digitally broadcast radio stations according to the DAB standard. Display of program-related information (e.g., artist and title) as well as additional information in the form of a slideshow (e.g., album art and weather). A second DAB tuner with a second DAB antenna continuously searches for alternative reception frequencies of the selected station. The station list is updated simultaneously.)
- Electromechanical power steering (maintenance-free rack and pinion steering with speed-dependent steering assistance; precise steering feel at high speeds, excellent support when parking.)
- Seats: Folding rear seat backrest (split in a 40:20:40 ratio or fully foldable - center armrest - including lashing eyes, 4 in the luggage compartment, for securing luggage and objects - attachment points for the luggage compartment net, with removable partition net; to be attached to the body or to the folded rear seat backrest; helpful whether the rear seat backrest is upright, folded down on one side, or folded down on both sides)
- Glazing: Windscreen in acoustic glazing (heat-insulating glazing with improved acoustic insulation value of the windscreen)
- Electronic immobilizer
- Reversible loading floor
- Light/rain sensor (for controlling the automatic headlight switching, the coming home/leaving home function and the automatic windshield wiper function)
- front center armrest
- Non-smoking version (one 12-volt socket each in the front in front of the cup holders and in the rear for the 2nd row of seats - no cigarette lighter)
- Wheel: Low rolling resistance tires, speed-limited (maximum permissible speed 210 km/h)
- Radio: MMI Radio plus (10.1" color display (1,540 × 720) including MMI touch operation - driver information system with 5" mono display - Bluetooth interface (hands-free calling and audio streaming) - Audi music interface with 1 USB-A and 1 USB-C port, each with data and charging function - passive speakers - AM/FM phase diversity - speed-dependent volume adjustment - voice control system with natural language for controlling infotainment and vehicle functions - WLAN hardware)
- Tire pressure monitoring system (visual and audible warning in case of pressure loss in one or more wheels, display in the driver information system)
- Tire repair kit (compressor and tire sealant, maximum permissible speed 80 km/h)
- Seat covers in Index fabric (seat center panels in Index fabric black or rock grey - seat side bolsters, headrests, center armrest in solid black or rock grey fabric)
- Seats: Front seats manually adjustable
- Start-stop system (helps reduce fuel consumption and CO2 emissions by switching off the engine during stationary phases, e.g. at traffic lights. For restarting, the starting process is initiated as soon as the foot brake is released. Can be deactivated at any time via a button.)
- First aid kit with warning triangle (warning triangle in the trunk - first aid kit in the trunk - 2 high-visibility vests in the door pockets)
- Glazing: Green tinted heat-insulating glazing (for rear window, door and side windows - rear window heated, with timer)
- Central locking "Keyless-Go" without safe locking (keyless engine start)



Extra equipment

- AdBlue tank (24 liters) (larger tank for AdBlue solution to reduce nitrogen oxides in the exhaust gas using an SCR system)
 - Interior mirror, automatically dimming, frameless
 - LED headlights and LED taillights with dynamic turn signals (daytime running lights, low beam, high beam, position lights, turn signals, cornering lights, all-weather lights, maneuvering lights, motorway lights (extended range from 110 km/h), static cornering lights, automatic dynamic headlight range control, intersection lights (in conjunction with MMI Navigation) - turn signals, brake lights, tail lights, reversing lights and rear license plate lights in LED technology. - brake lights in LED technology)
 - City Assistance Package (includes a selection of assistance systems specifically for city traffic - Parking aid plus - Reversing camera - Lane change warning - Audi Pre sense basic - Audi Pre sense rear - Exit warning and rear cross traffic assist)
 - Front sports seats (with manual adjustment of seat height, seat longitudinal position, seat tilt, backrest tilt, headrest and belt height; with pronounced seat side bolsters for better lateral support in curves, extendable thigh support)
- luggage compartment tray
 - Hold assist (holds the vehicle indefinitely after stopping on typical road inclines and declines. The system is activated by pressing a button and allows the driver to start off comfortably.)
 - Ambient Lighting Package (Interior lighting in the front roof module including capacitively switched reading lights, ambient lighting on the center console, illuminated vanity mirrors, glove compartment light, passive door warning lights, left/right trunk light, approach lighting in the exterior door handles, illuminated entry lights, illuminated front cupholders, front/rear footwell lighting, illuminated interior door handles, ambient door lighting, ambient lighting of the front center console)
 - Wheel: Alloy wheels, 10-spoke V (size 8 JX 18 with tires 245/40 R 18)
 - Front seat heating (heats seat and backrest center panels; with leather upholstery, sport seats and S sport seats also seat side bolsters - individually adjustable in multiple stages for driver and front passenger side via the climate control unit)
 - Glazing: Privacy glazing (tinted windows) (rear window, rear door and side windows tinted)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.



Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance (1. und 5. Wartung überzogen)
2	Equipment	Tirefit filler - Expired - Replace
3	Roof	Roof - dent(s) - Smooth repair work
4	Trim / covers	Door trim - front right side - Scratch(es) - Smart repair
5	Door - rear right side	Door - Dent / paintcoat damage - Smart repair
6	Rear bumper	Spoiler - Scratch(es) - Replace
7	Sill - left side	Trim - Scratch(es) - Replace
8	Front bumper	Front bumper - Scratch(es) - Paint
9	Rear bumper	Rear bumper - Scratch(es) - Paint
10	Side panel - rear right side	Side panel - Scratch(es) - Paint
11	Side panel - rear left side	Side panel - Scratch(es) - Paint
12	2nd wheel set	1 alloy rim - Scratch(es) - Replace
13	Bonnet	Bonnet - Paint defect - Repair and paint
14	Vehicle glazing	Windscreen - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	Mudguard - right side	Mudguard - right side - dent(s) - No deduction
2	Boot lid / rear door	Boot lid - Scratch(es) - No deduction
3	Multimedia system	Navigation data storage (keine Lizenz) - Missing - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Für den montierten Radsatz wurde kein Nachweis erbracht.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

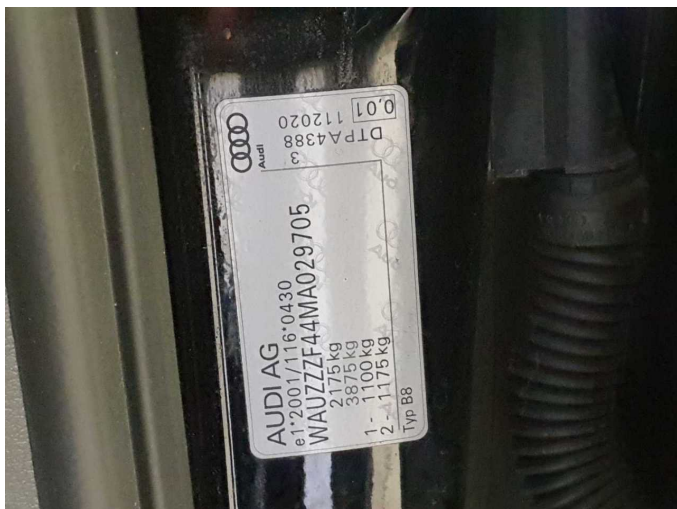


Figure 11: VIN



Figure 12: Mounted tyres

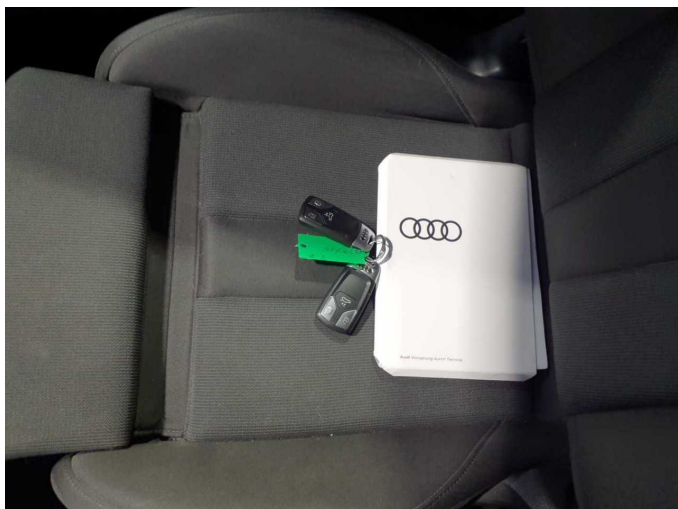


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres

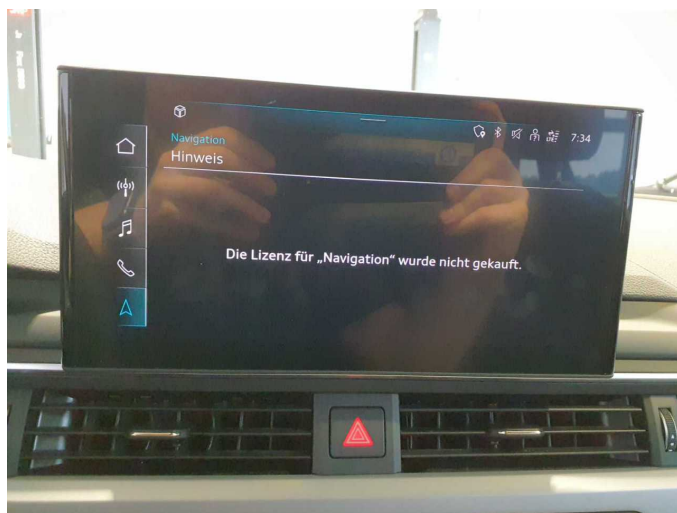


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

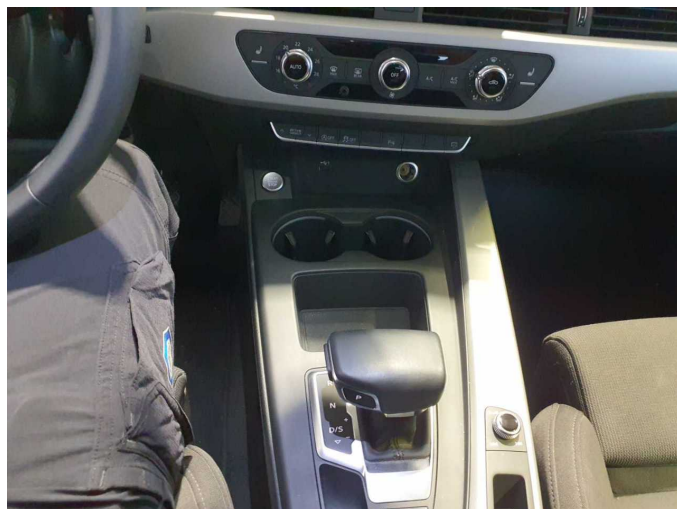


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

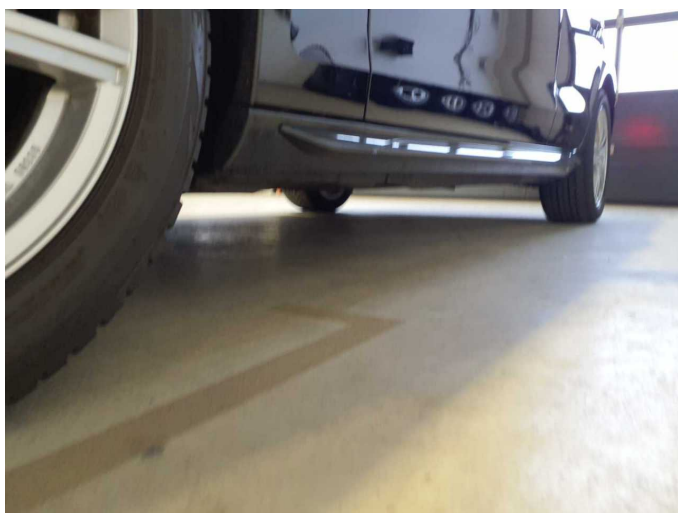


Figure 23: Misc.

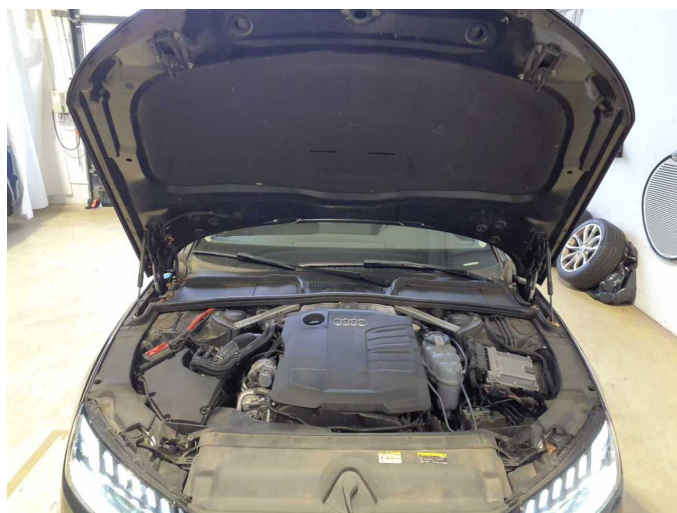


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

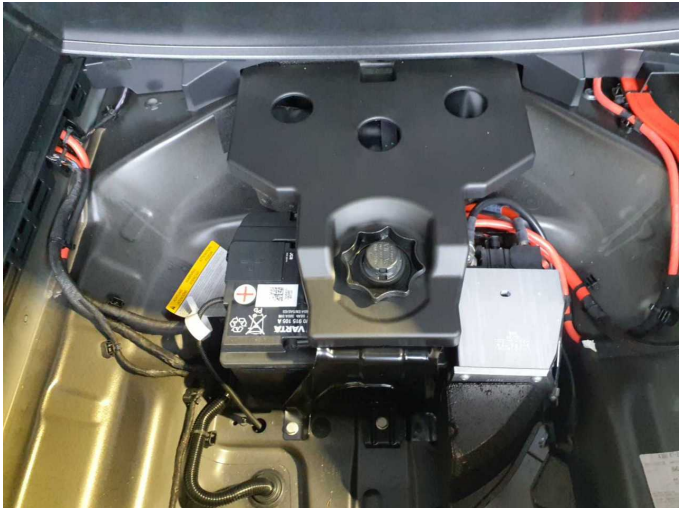


Figure 28: Misc.

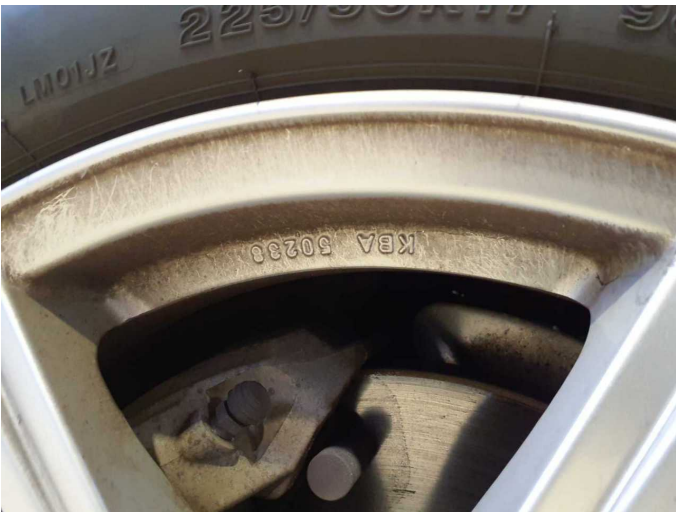



Figure 29: Misc.



Damage 2: Equipment: Tirefit filler - Expired - Replace



Damage 3: Roof: Roof - dent(s) - Smooth repair work

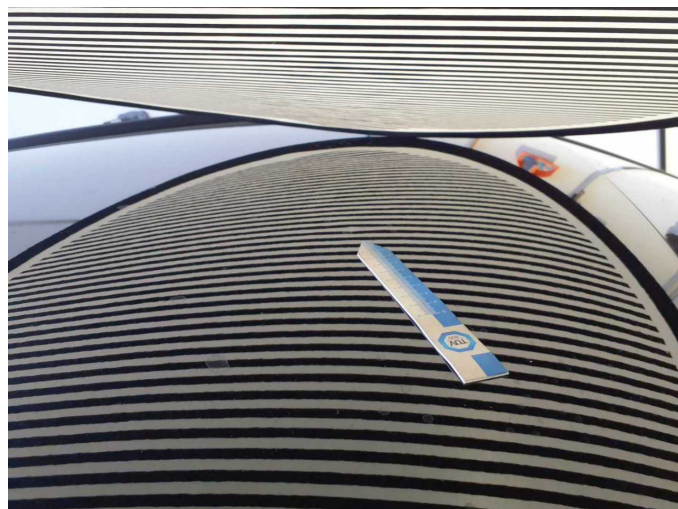

Damage 3: Roof: Roof - dent(s) - Smooth repair work




Damage 4: Trim / covers: Door trim - front right side - Scratch(es) - Smart repair




Damage 4: Trim / covers: Door trim - front right side - Scratch(es) - Smart repair



Damage 5: Door - rear right side: Door - Dent / paintcoat damage - Smart repair

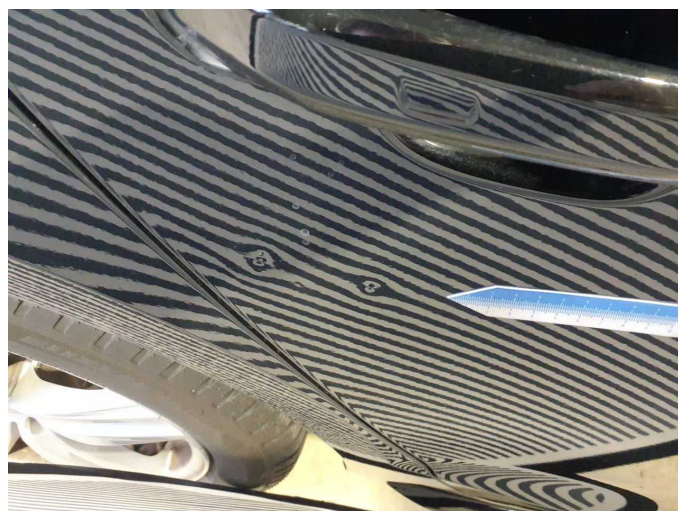


Damage 5: Door - rear right side: Door - Dent / paintcoat damage - Smart repair

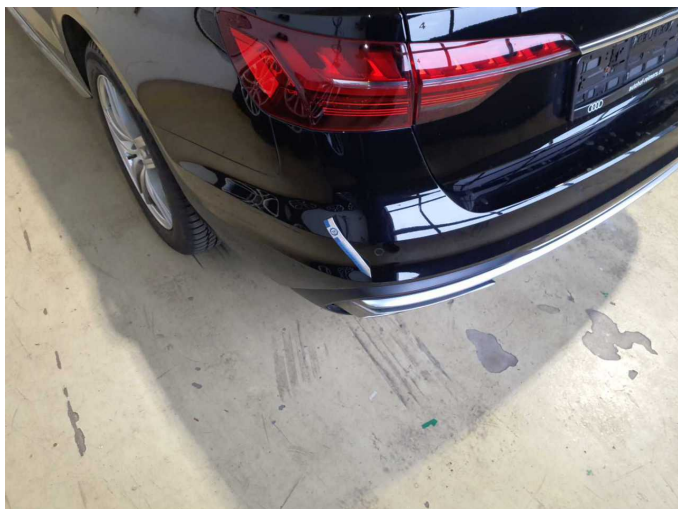

Damage 6: Rear bumper: Spoiler - Scratch(es) - Replace



Damage 6: Rear bumper: Spoiler - Scratch(es) - Replace

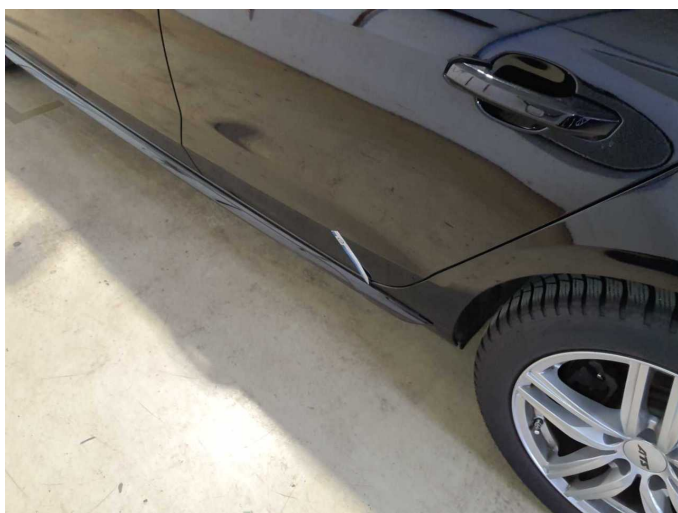


Damage 7: Sill - left side: Trim - Scratch(es) - Replace



Damage 7: Sill - left side: Trim - Scratch(es) - Replace



Damage 7: Sill - left side: Trim - Scratch(es) - Replace

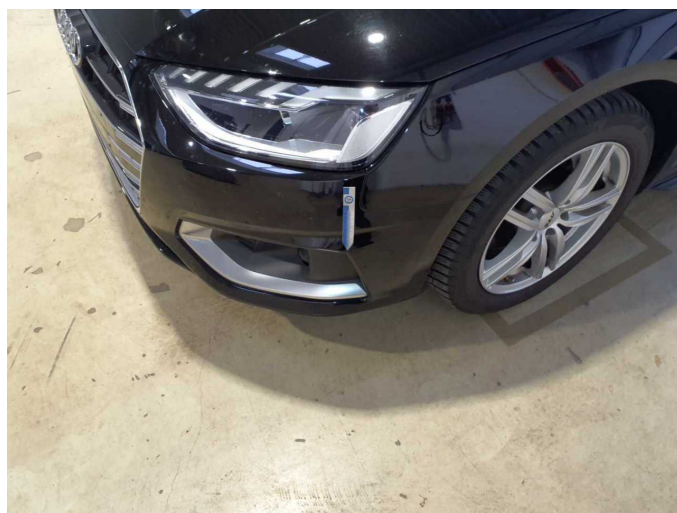


Damage 8: Front bumper: Front bumper - Scratch(es) - Paint




Damage 8: Front bumper: Front bumper - Scratch(es) - Paint



Damage 8: Front bumper: Front bumper - Scratch(es) - Paint

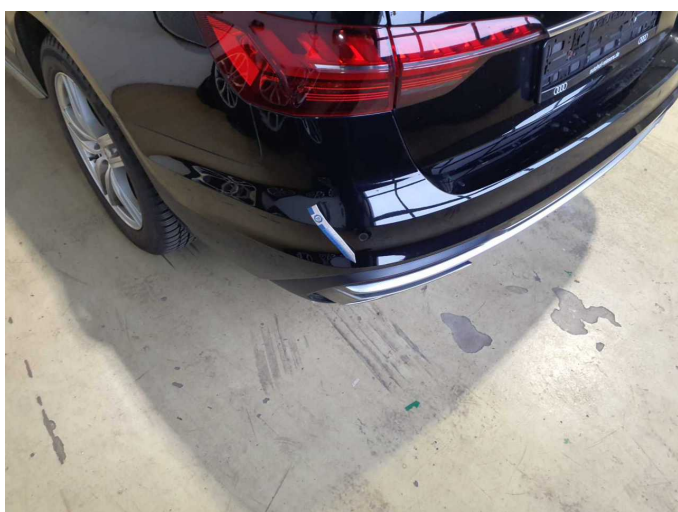


Damage 9: Rear bumper: Rear bumper - Scratch(es) - Paint

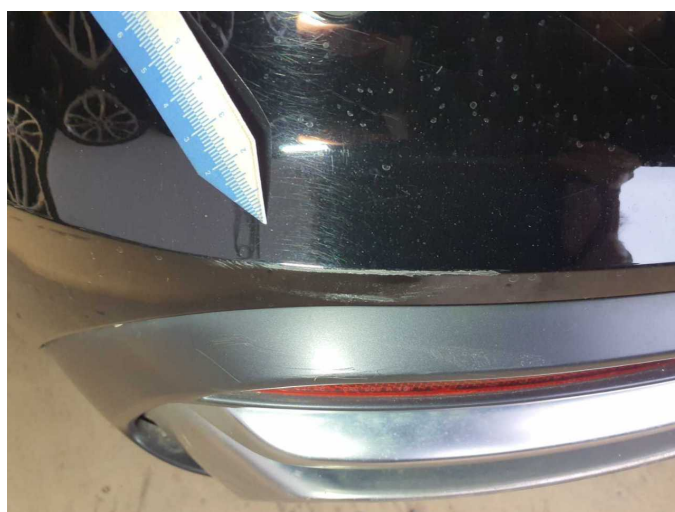

Damage 9: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 9: Rear bumper: Rear bumper - Scratch(es) - Paint

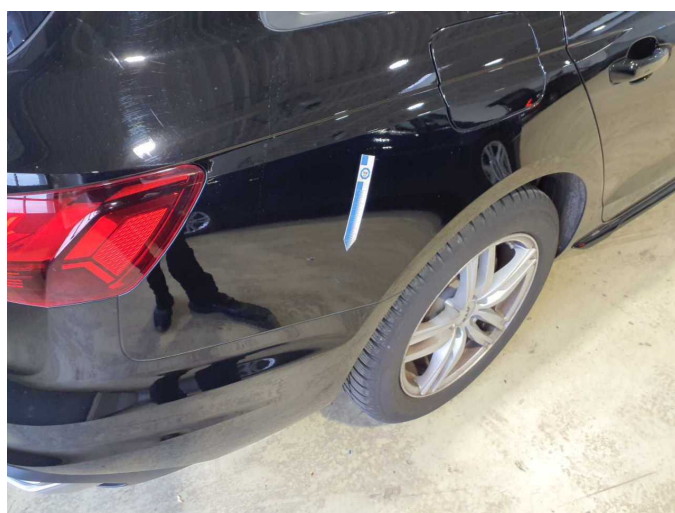

Damage 10: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 10: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 11: Side panel - rear left side: Side panel - Scratch(es) - Paint



Damage 11: Side panel - rear left side: Side panel - Scratch(es) - Paint



Damage 11: Side panel - rear left side: Side panel - Scratch(es) - Paint




Damage 11: Side panel - rear left side: Side panel - Scratch(es) - Paint




Damage 12: 2nd wheel set: 1 alloy rim - Scratch(es) - Replace




Damage 12: 2nd wheel set: 1 alloy rim - Scratch(es) - Replace

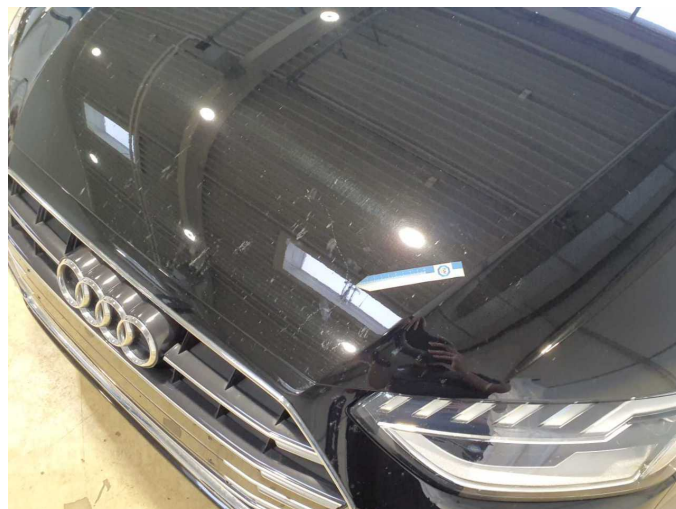


Damage 13: Bonnet: Bonnet - Paint defect - Repair and paint

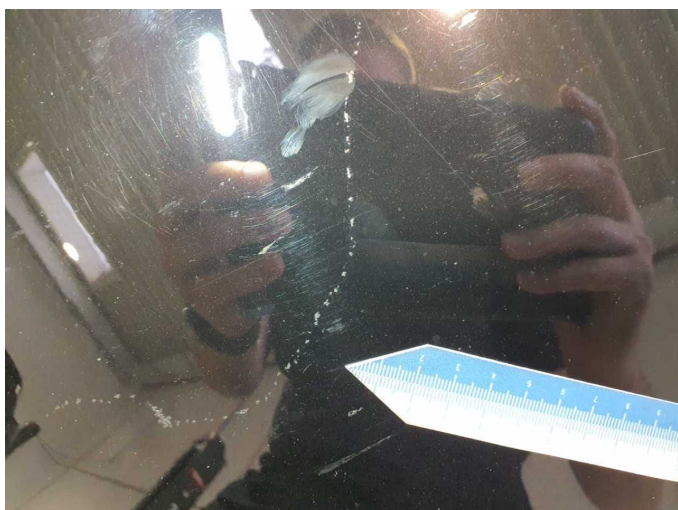


Damage 13: Bonnet: Bonnet - Paint defect - Repair and paint

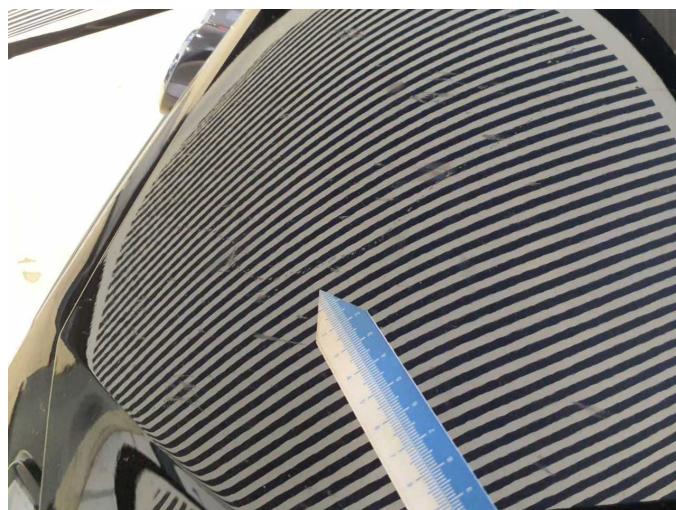


Damage 13: Bonnet: Bonnet - Paint defect - Repair and paint

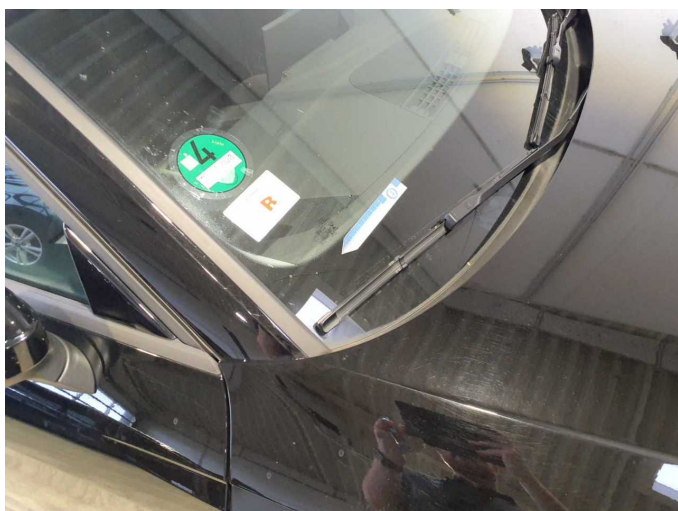


Damage 14: Vehicle glazing: Windscreen - Broken / torn - Replace

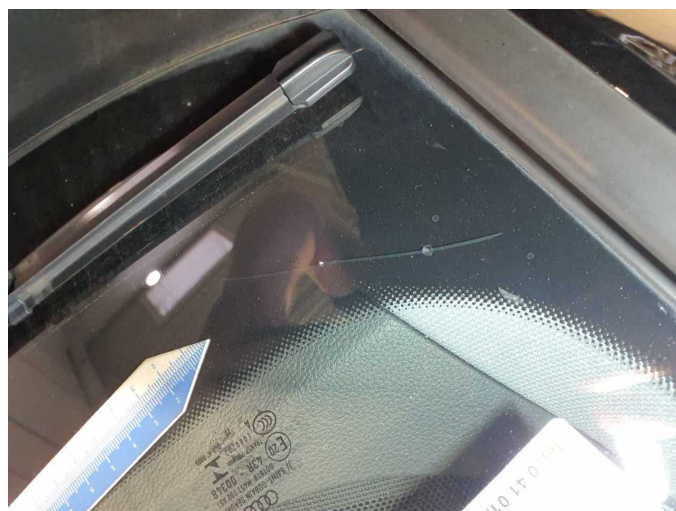

Damage 14: Vehicle glazing: Windscreen - Broken / torn - Replace

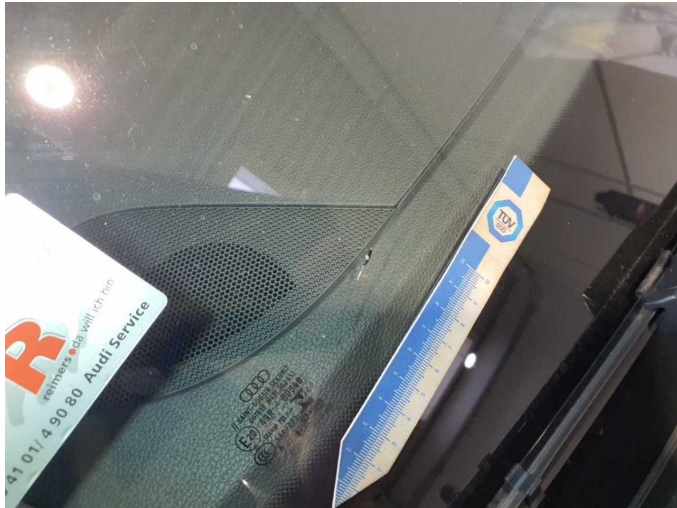

Damage 14: Vehicle glazing: Windscreen - Broken / torn - Replace

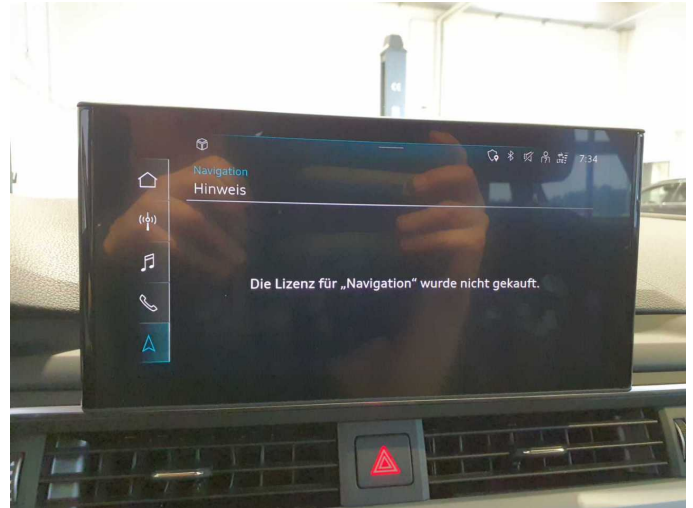

Wear and tear 3: Multimedia system: Navigation data storage (keine Lizenz) - Missing - No deduction