DEKRA

DEKRA Automotive Solutions

Appraisal Report

Vehicle details

VIN	VXKFCYHZ3 R1048664	Registration date	24/07/2024	Exterior Color	Unknown
Brand	OPEL	Licence Plate	HN-KW 940	Odometer	75 803 km
Model	ASTRA ST 1.5 Diesel 96kW Enjoy Auto				

Inspection Details

Arrival Date	12/08/2026	Inspection ID	7121976	Inspection date	19/08/2026
Assign Date	12/08/2026	Fleet owner	Leasys Privat Leasing	Inspection loc.	Leasys AKB Kitzingen



Generic equipment

Removable element

Spare wheel kit	✔
Hook /Hicth ball	✔


Technical Document

User manual	✔
Warranty booklet	✔
Log books	✔
Spare key	✔
Key	✔
Remote key	✔
Service	✔

Tyres

Goodyear 205/55/16 V All seasons
6.0 mm

Goodyear 205/55/16 V All seasons
6.0 mm

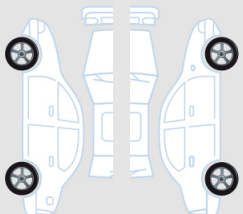

Goodyear 205/55/16 V All seasons
6.0 mm



Goodyear 205/55/16 V All seasons
6.0 mm

Exception / Damage

DEKRA

DEKRA Automotive Solutions

Appraisal Report

1

Part	Bumper	Repair Time	-	Part Cost	-
Position	Front	Repair Cost	-	Gross Cost	-
Damages	Worn out	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	For info	Flat Rate	-	**Net Cost**	**-**

2



Part	Bonnet	Repair Time	2.50	Part Cost	-
Position	-	Repair Cost	350.00€	Gross Cost	350.00€
Damages	Dented	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	Smart Repair	Flat Rate	350.00€	**Net Cost**	**350.00€**

3

Part	Windscreen	Repair Time	-	Part Cost	-
Position	Front	Repair Cost	-	Gross Cost	-
Damages	Worn out	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	For info	Flat Rate	-	**Net Cost**	**-**

4



Part	Bumper	Repair Time	1.70	Part Cost	-
Position	Back	Repair Cost	238.00€	Gross Cost	613.00€
Damages	Scratched	Paint Time	2.50	Depreciation %	-
Severity	-	Paint cost	375.00€	Depreciation	-
Repair mode	Repair	Flat Rate	-	**Net Cost**	**613.00€**

5



Part	Wing	Repair Time	1.20	Part Cost	-
Position	Back right	Repair Cost	168.00€	Gross Cost	408.00€
Damages	Scratched	Paint Time	1.60	Depreciation %	-
Severity	-	Paint cost	240.00€	Depreciation	-
Repair mode	Repair	Flat Rate	-	**Net Cost**	**408.00€**

6



Part	Door	Repair Time	2.40	Part Cost	-
Position	Front right	Repair Cost	336.00€	Gross Cost	576.00€
Damages	Scratched	Paint Time	1.60	Depreciation %	-
Severity	-	Paint cost	240.00€	Depreciation	-
Repair mode	Repair	Flat Rate	-	**Net Cost**	**576.00€**

7



Part	Diamond Cut rim 16"	Repair Time	0.50	Part Cost	256.88€
Position	Front left	Repair Cost	70.00€	Gross Cost	326.88€
Damages	Broken	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	Replace	Flat Rate	-	**Net Cost**	**326.88€**

8

Part	Paint preparation	Repair Time	-	Part Cost	-
Position	-	Repair Cost	-	Gross Cost	195.00€
Damages	-	Paint Time	1.30	Depreciation %	-
Severity	-	Paint cost	195.00€	Depreciation	-
Repair mode	Paintworks	Flat Rate	-	**Net Cost**	**195.00€**

DEKRA Automotive Solutions

Summary Inspection

Gross Price	2,468.88€	Depreciation	-	Net Price	2,468.88€

Labor cost summary

	Hourly Rate	Time	Gross Price	Depreciation %	Depreciation	Net Price
Bodywork	140.00€	8.30	1,162.00€	-	-	1,162.00€
Paintwork	150.00€	5.70	855.00€	-	-	855.00€
Paint preparation	150.00€	1.30	195.00€	-	-	195.00€

Miscellaneous

	Gross Price	Depreciation %	Depreciation	Net Price
Small parts / disposal charge	0.00€	-	-	0.00€
Part Cost	256.88€	-	-	256.88€
Flat Rate	0.00€	-	-	0.00€