



VSSZZZKL8RR072483

Angaben zum Fahrzeug

Halter		Besichtigungszustand	ausreichend
Kennzeichen		Laufleistung (abgelesen)	43.821 km
Hersteller	CUPRA	Restlauf bis Service	18.700 km
Typ/Modell	LEON	HU (Abgelesen aus ZBI)	06/2027
Fahrgestellnummer	VSSZZZKL8RR072483	Leistung / Hubraum	140 kW / 1.984 ccm
Erstzulassung	07.06.2024	Polster/Farbe	Stoff/Leder Kombination / Schwarz-Braun
Letzte Wartung		Lackierung	Grau
Kraftstoffart	Benzin	Getriebe	Automatik

Zustandsbericht

Wertmindernde Faktoren

Nr.	Bauteilgruppe	Beschreibung
1	Seitenwand links	Seitenwand - Delle(n) - sanft instandsetzen
2	Sonstiges	Inspektion/Wartung (20.000km Wartung fehlt -> 2 Jahre/20.000km) - kein Nachweis
3	Sonstiges	Inspektion/Wartung (40.000km Wartung fehlt -> 2 Jahre/20.000km) - kein Nachweis
4	Rad/Reifen	Leichtmetallfelge vorn rechts (Materialabrieb) - verkratzt / verschürft - erneuern

Gebrauchsspuren

Nr.	Bauteilgruppe	Beschreibung
1	Tür vorn links	Tür - Steinschlag - kein Abzug
2	Tür hinten links	Tür - Steinschlag

Fehlteile

Fehlteil

Festgestellte Nachlackierungen

Nr.	Ort
Keine feststellbar	

Hauptbereifung

Achse	Reifengröße	Hersteller	Reifentyp	Profiltiefe	Verktgl.	Zul.
1	225/40 R18 92Y	Continental	Ganzjahresreifen	4mm - 4mm	i.O.	i.O.
2	225/40 R18 92Y	Continental	Ganzjahresreifen	6mm - 6mm	i.O.	i.O.

Ersatz

Typ	Reifengröße	Hersteller	Reifentyp	Profiltiefe	Ablaufdatum
Notrad	125/70 R18 99M	Sonstige	Sommerreifen	5	

TÜV SÜD Auto Partner GmbH
Gutenbergstraße 13
70771 Leinfelden-Echterdingen

Besichtigungsort
TÜV SÜD Service-Center
Amberg
Dieselstraße 6
92224 Amberg

Besichtigungsdatum: 07.07.2026
Protokollnummer: **46411899**
Erstellt durch: Paula Kube
Besichtigt durch: Paula Kube



Der Verschleißzustand sowie evtl. Schäden an der Bereifung sind wertmäßig berücksichtigt.

TÜV SÜD Auto Partner GmbH
Gutenbergstraße 13
70771 Leinfelden-Echterdingen

Besichtigungsort
TÜV SÜD Service-Center
Amberg
Dieselstraße 6
92224 Amberg

Besichtigungsdatum: 07.07.2026
Protokollnummer: 46411899
Erstellt durch: Paula Kube
Besichtigt durch: Paula Kube



Angaben zum Fahrzeug

Hersteller	CUPRA	Besichtigungszustand	ausreichend
Typ/Modell	LEON	Laufleistung (abgelesen)	43.821 km
Fahrgestellnummer	VSSZZZKL8RR072483	Erstzulassung	07.06.2024

Angaben zum Auftrag:

Auftragsgemäß erfolgte die Fahrzeugzustandsbewertung in demontagefreien Zustand.

Grundlage dieses Produktes stellt der Leitfaden für Fahrzeugrücknahmen und Bewertungen gemäß des Schadengrenzmusterkatalog des Auftraggebers dar. Die expliziten Feststellungen im Einzelfall trifft der Sachverständige objektiv im Rahmen der vorgegebenen Standards aufgrund eigener Sachkunde.

Fahrzeug-Identifizierung:

Die Fahrzeug-Identifizierungsnummer (FIN) wurde am Fahrzeug abgelesen und die Übereinstimmung im Verlauf der Besichtigung durch den Unterzeichner mit den vorgelegten Unterlagen festgestellt.

Besichtigungsbedingungen:

Die Besichtigungsbedingungen waren zur Beurteilung des Fahrzeuges ausreichend.

Allgemeinzustand:

Das Fahrzeug weist dem Alter und Einsatzzweck entsprechende Gebrauchsspuren auf.

Unterschrift Sachverständiger (Paula Kube)

Vorliegendes Druckexemplar wurde auf elektronischem Wege erzeugt. Der benannte Sachverständige versichert, dass der Inhalt die von ihm getroffenen Feststellungen korrekt wiedergibt. Es ist ohne Originalunterschrift gültig.

Übersichtsfotos



Abbildung 1: FIN



Abbildung 2: Schräg vorne



Abbildung 3: Schräg vorne



Abbildung 4: Schräg hinten



Abbildung 5: Schräg hinten



Abbildung 6: Montierte Bereifung

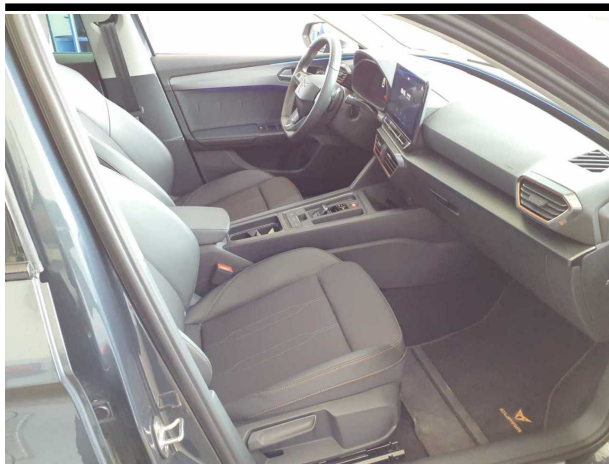


Abbildung 7: Innenraum vorne



Abbildung 8: Laderaum



Abbildung 9: Laderaum



Abbildung 10: Kombiinstrument

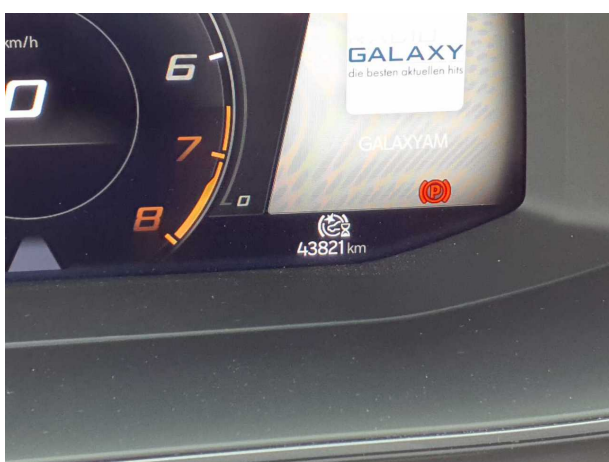


Abbildung 11: Kombiinstrument



Abbildung 12: Instrumententafel

TÜV SÜD Auto Partner GmbH
Gutenbergstraße 13
70771 Leinfelden-Echterdingen

Besichtigungsort
TÜV SÜD Service-Center
Amberg
Dieselstraße 6
92224 Amberg

Besichtigungsdatum: 07.07.2026
Protokollnummer: 46411899
Erstellt durch: Paula Kube
Besichtigt durch: Paula Kube



Abbildung 13: Instrumententafel

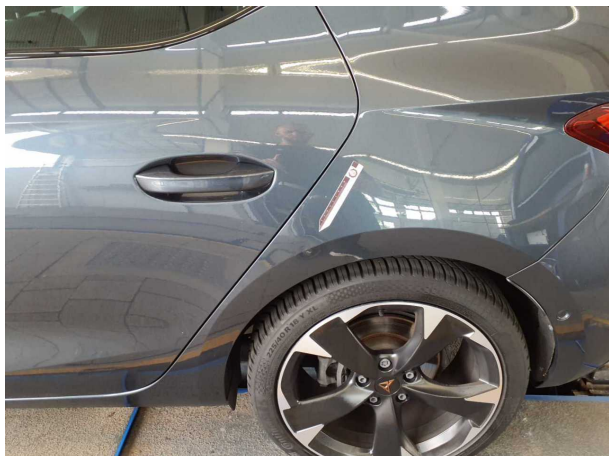


Abbildung 14: Dokumente



Abbildung 15: Dokumente

Beschädigungsfotos



Beschädigung #1: Seitenwand links: Seitenwand - Delle(n) - sanft instandsetzen




Beschädigung #1: Seitenwand links: Seitenwand - Delle(n) - sanft instandsetzen



Beschädigung #4: Rad/Reifen: Leichtmetallfelge vorn rechts (Materialabrieb) - verkratzt / verschürft - erneuern



Beschädigung #4: Rad/Reifen: Leichtmetallfelge vorn rechts (Materialabrieb) - verkratzt / verschürft - erneuern

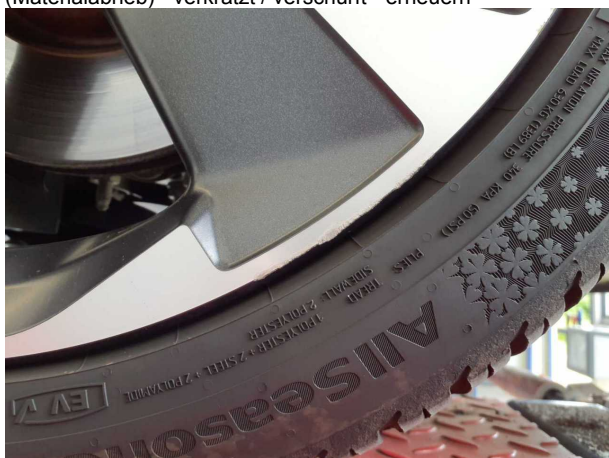

Beschädigung #4: Rad/Reifen: Leichtmetallfelge vorn rechts (Materialabrieb) - verkratzt / verschürft - erneuern

49. CO₂ emissions/fuel consumption/electric energy consumption:

1. All powertrains, except OVC hybrid electric vehicles (if applicable):

WLTP values	CO ₂ emissions			Fuel consumption (/100 km)			Electric Consumption (Wh/km)
	Petrol/ Diesel (g/km)	Gas: CNG/LPG (g/km)	Other: (g/km)	Petrol/ Diesel: (L)	Gas: CNG/LPG (L/m ³)	Others: (L)	
Low:	212	---	---	9.3	---	---	---
Medium:	158	---	---	7.0	---	---	---
High:	132	---	---	5.8	---	---	---
Extra High:	150	---	---	6.6	---	---	---
Combined:	155	---	---	6.8	---	---	---

2. Electric range of pure electric vehicles (if applicable):

Electric range [km]:	---	Electric range city [km]:	---
----------------------	-----	---------------------------	-----

3. Vehicle fitted with eco-innovation(s):

yes

3.1. General code of the eco-innovation(s):

e9 29 37

3.2. Total CO₂ emissions savings due to the eco-innovation(s):

3.2.2. WLTP savings (if applicable) [g/km]: Petrol/Diesel: 1.91 Gas (CNG/LPG): --- Others: ---

4. OVC hybrid electric vehicles (if applicable):

WLTP values (CO ₂ and fuel consumption sustaining, if not otherwise mentioned)	CO ₂ emissions			Fuel consumption: (/100 km)			Electric Consumption (Wh/km)
	Petrol/ Diesel: (g/km)	Gas: CNG/LPG (g/km)	Others: (g/km)	Petrol/ Diesel: (L)	Gas: CNG / LPG (m ³)/(L)	Other: (L)	
Low	---	---	---	---	---	---	---
Medium	---	---	---	---	---	---	---
High	---	---	---	---	---	---	---
Extra High	---	---	---	---	---	---	---
City	---	---	---	---	---	---	---
Combined (sustaining)	---	---	---	---	---	---	---
Combined (depleting)	---	---	---	---	---	---	---
Weighted, combined	---	---	---	---	---	---	---

5. Electric range of OVC hybrid electric vehicles (if applicable):

Equivalent All Electric Range [km]:	(EAER):	(EAER city):
All Electric Range [km]:	(AER):	(AER city):

51. For special purpose vehicles: Designation in accordance with CR (CE) 2018/858 annex I part A point 5:

52. Remarks:

NO 16.2.: with trailer axle 2+20 kg##NO 35.: alt. to pos 35 with deviating val.

in pos 49: 225/40 R18 92Y XL#7.5JX18 ET46##205/50 R17 93H M+S#7.5JX17 ET46##

Certificate of Conformity

Complete vehicles

The undersigned hereby certify that the vehicle:

0.1.	Make (Trade name of manufacturer):	CUPRA
0.2.	Type:	Variant:
	KL	CBDNNAX0
		FD7SFD7GC0034BIM11CAD18
0.2.1.	Commercial name:	CUPRA LEON
0.2.2.1.	Allowed Parameter Values for multistage type approval to use the base vehicle emission values	
	Final Vehicle actual mass [kg]:	---
	Final Vehicle technically permissible maximum laden mass[kg]:	---
	Frontal area for final vehicle [cm ²]:	---
	Rolling resistance [kg/t]:	---
	Cross-sectional area of air entrance of the front grille [cm ²]:	---
0.2.3.1.	Interpolation family's identifier:	IP-MQB37WZ_A0_0387-VSS-1T
0.2.3.2.	ATCT family's identifier:	AT-5Q0_0V_0413_000-VSS-1
0.2.3.3.	PEMS family's identifier:	09-VSS-715W_KL_DNNA_FD7_A-000
0.2.3.4.	Roadload family's identifier:	RL-DQ381_7F_19_001-WWW-1
0.2.3.5.	Roadload matrix family's identifier (if applicable):	---
0.2.3.6.	Periodic regeneration family's identifier:	PR-AU_00108_00_000-WWW-1
0.2.3.7.	Evaporative test family's identifier:	EV-CD_APW_D_AVAAXX-WWW-1
0.4.	Vehicle category:	M1
0.5.	Company name and address of manufacturer:	SEAT, S.A., Autovía A-2, Km. 585, ES-08760 Martorell
0.6.	Location and method of attachment of the statutory plates:	On the right A-pillar glued or bonded
	Location of the vehicle identification number:	In the engine compartment, right
0.9.	Name and address of the manufacturer's representative:	---
0.10.	Vehicle identification number:	VSSZZZKL8RR072483
0.11.	Date of manufacture of the vehicle:	2024-02-01

conforms in all respects to the type described in approval e9*2007/46*3167*27 granted on 2023-10-17 and can be permanently registered in Member States having right hand traffic and using metric units for the speedometer and metric units for the odometer.


Martorell, 2024-02-01

Martorell, 2024-02-01

Daniel Cortina Munuera
Director Quality Assurance

Robin Christoph Bräutigam
Head of Technical Conformity

Internal Manufacturer's data VSSZZZKL8RR072483



CoC Version: 1

54. Vehicle fitted with advanced vehicle systems:

eCall, ESS, TPMS

55. Vehicle certified in accordance with UN-R No 155:

no

56. Vehicle certified in accordance with UN-R No 156:

no

Für dieses Dokument wurde eine Zulassungsbescheinigung Teil II (GY964733) ausgegeben. Landratsamt München

SEAT, S.A. Sdad. Unipersonal Dom. Soc.; Autovía A-2, km. 585 - 08760 Martorell / (VAT) NIF (ES) A28049161

1.

Number of axles / wheels:

2 / 4

3.

Powered axles (number, position):

1, Axle 1

3.1.

Interconnection of powered axles:

4.

Wheelbase[mm]:

2679

4.1.

Axle spacing [mm]:

2679

5.

Length [mm]:

4398

6.

Width [mm]:

1799

7.

Height [mm]:

1442

13.

Mass in running order [kg]:

1471

13.2.

Actual mass of the vehicle [kg]:

1506

16.

Technically permissible maximum masses:

16.1.

Technically permissible maximum laden mass [kg]:

1960

16.2.

Technically permissible mass on each axle (1./2.) [kg]:

1060 / 950

16.4.

Technically permissible maximum mass of the combination [kg]:

3560

18.

Technically permissible maximum towable mass in case of:

18.1.

Drawbar trailer [kg]:

18.3.

Centre-axle trailer [kg]:

1600

18.4.

Unbraked trailer [kg]:

730

19.

Technically permissible maximum static vertical mass at the coupling point [kg]:

80

20.

Manufacturer of the engine:

Audi AG

21.

Engine code as marked on the engine:

DNN

22.

Working principle:

Positive ignition / 4 stroke

23.

Pure electric:

no

23.1.

Class of Hybrid (electric) vehicle:

24.

Number and arrangement of cylinders:

4; in Line

25.

Engine capacity [cm³]:

1984

26.

Fuel:

petrol

26.1.

Mono fuel/BI fuel/Flex fuel/Dual fuel:

mono fuel vehicle

26.2.

Type of dual fuel engine:

27.

Maximum power

27.1.

Maximum net power [kW at min⁻¹] (internal combustion engine):

140.00 / 4200

27.3.

Maximum net power [kW] (electric motor):

27.4.

Maximum 30 minutes power [kW] (electric motor):

28.

Gearbox (type):

automatic

28.1.

Gear

28.1.2.

Gearbox ratios:

28.1.2.

Final drive ratio:

29.

Maximum speed [km/h]:

227

30.

Axle(s) track (1./2.) [mm]:

1560 / 1526

35.

Fitted tyre/wheel combination/energyefficiency class of RRC/type category used for CO₂ determination:

36.

Axle 1:

225/40 R18 92Y XL / 7.5JX18 ET46 / C / C1

36.

Axle 2:

225/40 R18 92Y XL / 7.5JX18 ET46 / C / C1

36.

Trailer brake connections:

38.

Code for bodywork:

AC

40.

Colour of vehicle:

GREY

41.

Number and configuration of doors:

5 / le. 2, ri. 2, ba. 1

42.

Number of seating positions (including the driver):

5

42.1.

Seat(s) designated for use only when the vehicle is stationary:

42.3.

Number of wheelchair user accessible position:

46.

Sound level

46.

Stationary [dB(A) at min⁻¹]:

75.00 / 3750

46.

Drive-by [dB(A)]:

69.00

47.

Exhaust emission level:

EURO 6 AP

47.1.

Parameters for emission testing of V_{ind}:

47.1.1.

Test mass [kg]:

1583

47.1.2.

Frontal area [m²]:

47.1.3.

Road load coefficients

47.1.3.0. f0 [N]	47.1.3.1. f1 [N/(km/h)]	47.1.3.2. f2: [N/(km/h)²]
137.8	0.252	0.03428

47.2.

Driving cycle:

47.2.1.

Driving cycle class:

3b

47.2.2.

Downscaling factor (f_{dis}):

47.2.3.

Capped speed:

no

48.

Exhaust emissions:

715/2007*2018/1832AP

1.2.

Test procedure: Type 1 (WLTP highest values) [mg/km] or WHSC (EURO VI) [mg/kWh]

Petrol / Diesel	CO	THC	NMHC	NO _x	THC + NO _x	NH ₃ [ppm]	Particulates	Particles #
	192.5	23.0	19.1	13.9	---	---	0.6200	0.10E11
LPG/CNG	---	---	---	---	---	---	---	---
Other	---	---	---	---	---	---	---	---

2.2.

Test procedure: WHTC (EURO VI) [mg/kWh]

Petrol / Diesel	CO	THC	NMHC	CH ₄	NO _x	NH ₃	Particulates	Particles #
	---	---	---	---	---	---	---	---
LPG/CNG	---	---	---	---	---	---	---	---
Other	---	---	---	---	---	---	---	---

48.1.

Smoke corrected absorption coefficient [m⁻¹]:

48.2.

Declared maximum RDE values (if applicable): NO_x [mg/km] Particles (number) with exponent (#/km)

48.

Complete RDE trip:

60.0

48.

Urban RDE trip:

60.0

3