



Expertise

Protocol number: 46667763
Order No. / Reference: 26678440
Inspection date: 20 Jul 2026

Manufacturer: Mercedes-Benz

Model: GLE 300 d 4Matic 9G-TRONIC

VIN: W1N1671091A673411



Vehicle details

Manufacturer / Type / Model / Equipment

Mercedes-Benz GLE 300 d 4Matic 9G-TRONIC

Vehicle Identification number	W1N1671091A673411
Mileage (Read)	136,430 km
First registration	26 Apr 2022
Number of holders	1
Next periodical technical inspection	05/2027
(Report on hand)	

Fuel type	Hybrid Diesel / E
Engine displacement / Cylinder	1,993 ccm / 4
Power	200 kW
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Obsidianschwarz metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	179 Tag(e)
Last service on / at	01/2026 at 122,782 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ438442
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / AXT 00072		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	3,000 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	275/45 R21 107Y	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	315/40 R21 111Y	Summer tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Exhaust system with 2 chrome-plated tailpipe trims
- Adaptive Highbeam Assist
- Airbag: Driver and passenger side
- Airbag: Sidebag for driver and front passenger (combined thorax/pelvisbag)
- Active Lane Keeping Assist
- Ambient lighting
- Traction control (ASR)
- Rear armrest
- Automatic passenger airbag deactivation
- Brake Assist BAS
- Diesel particulate filter
- Tachometer
- EASY-Pack tailgate with electric operation for opening and closing
- Front door sills with "Mercedes-Benz" lettering illuminated in white
- Chassis with steel springs and lowered suspension
- electric parking brake
- Speed Limit Assistant
- Lockable, air-conditioned and illuminated glove compartment
- Interior headliner fabric crystal grey
- Mechanical child safety lock in the rear doors
- Communication module (LTE) for the use of Mercedes me connect services
- LED High Performance Headlights
- Steering column mechanically adjustable lengthwise and heightwise.
- Navigation accessories: Extended MBUX functions
- Navigation: Hard disk navigation
- Package: Chrome
- Package: Mirror Package
- Radio accessories: Digital radio (DAB)
- Tire pressure monitoring system (TPMS)
- Rear view camera
- Power steering
- Seats: 4-way lumbar support for driver and front passenger
- Seats: Heated seats for driver and front passenger seats
- Seats: Front seats electrically adjustable
- Cruise control with variable speed limiter
- Immobiliser
- Heat-insulating glass, all around
- ADAPTIVE BRAKE
- Adaptive brake light
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Brake Assist
- 4MATIC permanent all-wheel drive
- Anti-lock braking system
- Foldable armrest for driver and front passenger
- ATTENTION ASSIST
- Electrically adjustable and heated exterior mirrors
- Roof rails in aluminum look
- Downhill Speed Regulation (DSR)
- Third brake light
- EASY-Pack cargo cover (removable)
- ECO start/stop function
- Electronic Stability Program
- Electronic traction system for all-wheel drive (4ETS)
- Electric windows, front and rear
- Velour floor mats
- Transmission: 9G-TRONIC
- Rear window heated
- Rear window wiper with intermittent function
- KEYLESS-GO start function
- Climate: THERMATIC automatic climate control
- Headrests 5-way
- Radiator grille with 2 chrome-plated louvers in SUV design
- Steering wheel: Multifunction sports steering wheel in Nappa leather
- Mercedes-Benz emergency call system
- Navigation accessories: Pre-installation for navigation services
- Package: Parking package with reversing camera
- PRE-SAFE system
- Radio accessories: Additional USB ports
- Remote Services Plus
- Windscreen wipers with rain sensor
- 3-point seat belts
- Seats: Comfort seats
- Seats: Rear seat backrests foldable
- Phone accessories: Smartphone integration
- High-visibility vest for drivers
- Widescreen Cockpit
- Central locking with interior switch



Extra equipment

- Airbag: Sidebags in the rear, left and right
- Cargo area cover (with additional partition net).
- Decorative elements: Linden wood, anthracite glossy
- Fire extinguisher (mounted at the front of the driver's seat)
- Fuel tank with larger volume (85 l)
- Heat-insulating dark tinted glass
- Instrument panel and door sills in ARTICO leatherette (Instrument panel in ARTICO leatherette - Door sills in ARTICO leatherette)
- Package: AMG Line Exterior (diamond grille with chrome pins, integrated Mercedes star and 1 louvre painted in matte iridium silver with chrome inserts - AMG Styling: AMG front apron with chrome trim strip, sporty and distinctive air intakes in the wheel arch trims, fender flares front and rear in body paint, AMG side sill trims, AMG rear apron with diffuser-look insert in black and chrome trim strip)
- Package: Memory Package (driver and front passenger seat, steering column and exterior mirrors electrically adjustable and storable - seat longitudinal position and headrest height additionally electrically adjustable - 4-way lumbar support for driver and front passenger - seat cushion depth adjustment with gapless cushion - PRE-SAFE positioning function for the front passenger seat - front passenger seat operation for driver)
- Paint finish: Metallic
- Seats: Multicontour seats for driver and front passenger (driver and front passenger seats fully electrically adjustable via the switches in the door control panel: - Seat cushion depth adjustment - Seat cushion tilt adjustment - Seat longitudinal adjustment - Seat height adjustment - Seat backrest tilt adjustment - Headrest adjustment (horizontal and vertical) - 4-way lumbar support - Comfort headrests - Active cushions with inflatable air chambers in the lower seat back and side bolsters - Hot stone massage effect in the lumbar region - Seat heating plus - Front seat ventilation)
- Towbar with ESP trailer stabilization
- Type designation removed from luggage compartment lid
- Upholstery: Leather
- Wheels: 53.3 cm (21") AMG multi-spoke light-alloy wheels (painted Himalayan grey and polished with front axle 275/45 R 21 on 10 J x 21 ET 54, rear axle 315/40 R 21 on 11 J x 21 ET 49)
- Head-up display (lens and mirror system projects a virtual image into the driver's field of vision - full-color display that is easily readable even on sunny days and at night - depending on the equipment, display of, for example, navigation instructions, speed, speed limits or settings of cruise control or active distance assist DISTRONIC)
- Heated windshield washer system (including washer fluid reservoir, washer nozzles and washer fluid hoses)
- Package: Acoustic Comfort Package (Laminated safety glass with infrared-reflecting film for the windshield - Laminated safety glass with infrared-absorbing film for the side windows - Additional soundproofing measures)
- Package: Driving Assistance Package (Active Distance Assist DISTRONIC - Active Steering Assist - Active Brake Assist - Evasive Steering Assist - Active Lane Keeping Assist - Active Blind Spot Assist - PRE-SAFE PLUS)
- Package: Parking Package with 360° camera (12 sensors: four front, four rear, two on the sides in the front/rear bumper; detects parking spaces up to 35 km/h; steering control; in conjunction with automatic transmission, assists with acceleration, braking, and gear changes; 360° camera; visual/audible warning of detected obstacles in front of/behind the vehicle up to approx. 10 km/h; Rear Cross Traffic Alert warns of detected cross traffic; Drive Away Assist (only in conjunction with automatic transmission); button on the center console or on the control panel for the assistance systems)
- Partition net for luggage compartment separation and occupant protection
- Telephone: Multifunctional telephony (wireless connection of a compatible mobile phone to the external antenna - wireless charging for compatible mobile phones - Bluetooth and WLAN pairing wirelessly via NFC (Near Field Communication) technology)
- TIREFIT with tire inflation compressor
- URBAN GUARD Vehicle Protection Plus (burglar and theft alarm system - tow-away protection with visual and audible warning in case of detected change in position - alarm siren - interior monitoring (triggers upon movement inside the vehicle) - assistance with vehicle theft (theft assistance), free of charge for 3 years from activation - emergency key deactivation, free of charge for 3 years from activation - theft and parking collision detection, free of charge for 3 years from activation - URBAN GUARD label on the front side windows)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front left side	Door edge - Scratched - Smart repair
2	Sill - right side	Trim - Scratched - Smart repair
3	Side panel - rear left side	Sill - Scratch(es) - Smart repair
4	Front bumper	Front bumper - Scratched - Smart repair
5	Front bumper	Bumper with Parktronic - Malposition - Set / adjust
6	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work
7	Wheel / tyres	Alloy rim - rear left side - Scratched - Loss in value
8	Door - rear right side	Door - Scratched - Paint
9	Side panel - rear right side	Side panel - Scratched - Paint
10	Side panel - rear left side	Side panel - Scratched - Paint
11	Door - rear left side	Door - Dent / paintcoat damage - Repair and paint
12	Door - front right side	Door - Dent / paintcoat damage - Repair and paint
13	Bonnet	Bonnet - Scratched - Paint
14	Wheel / tyres	Alloy rim - front left side (Materialabtrag) - Scratched - Replace

Wear and tear

No.	Component group	Description
1	Rear bumper	Rear bumper - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 11 Dec 2024	2.764,09 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

Das Fahrzeug befand sich zum Besichtigungszeitpunkt in beschädigtem, nicht demontiertem Zustand.
Schadenausweitung möglich, Zusatzkosten können entstehen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

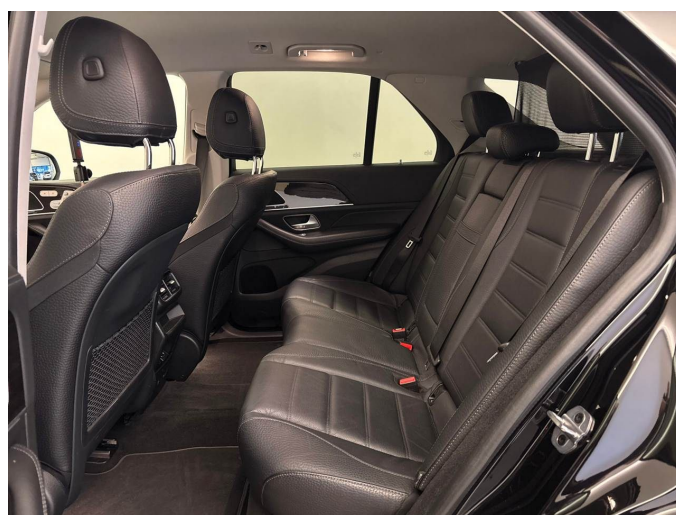


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

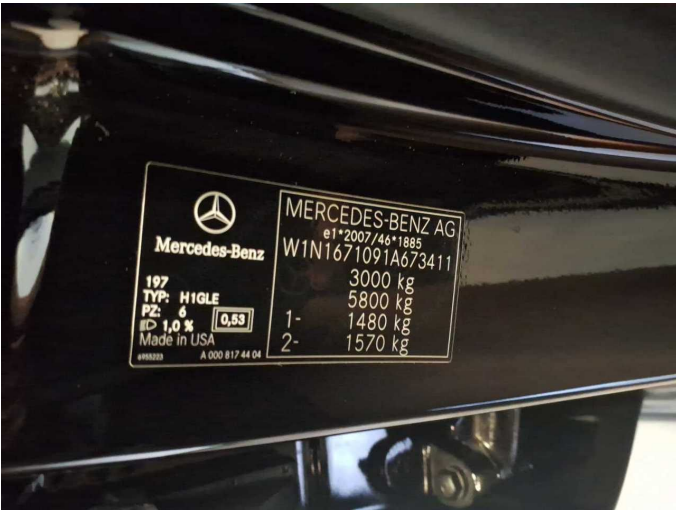


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Documents

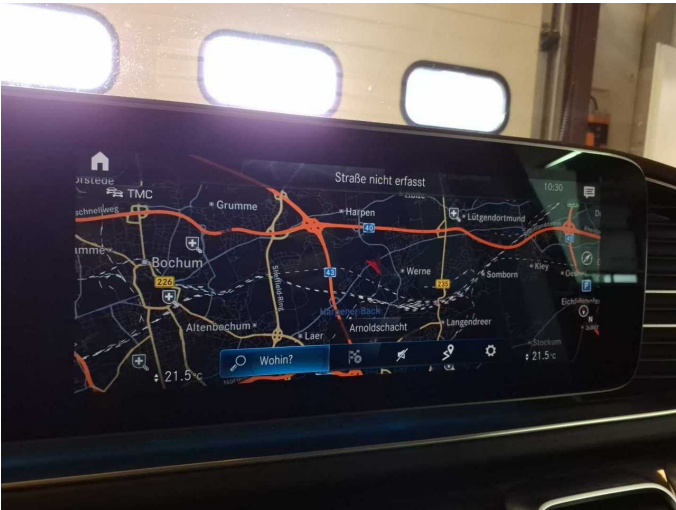


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

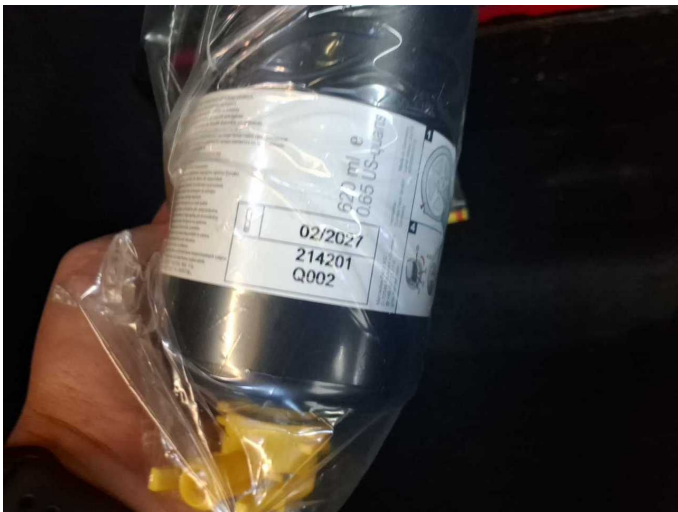


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

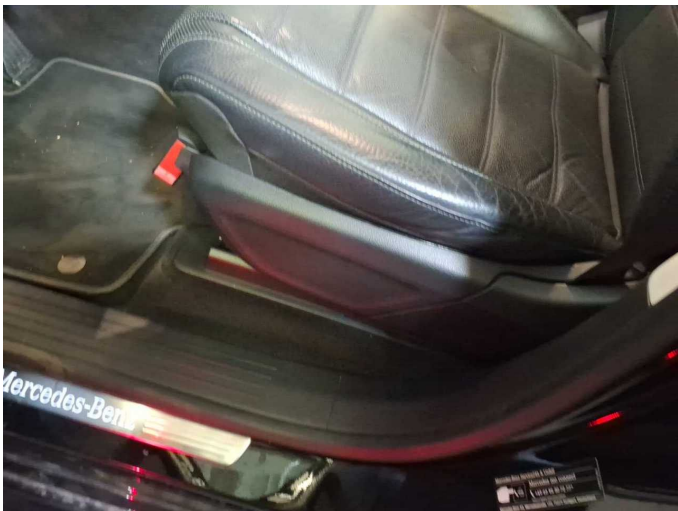


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

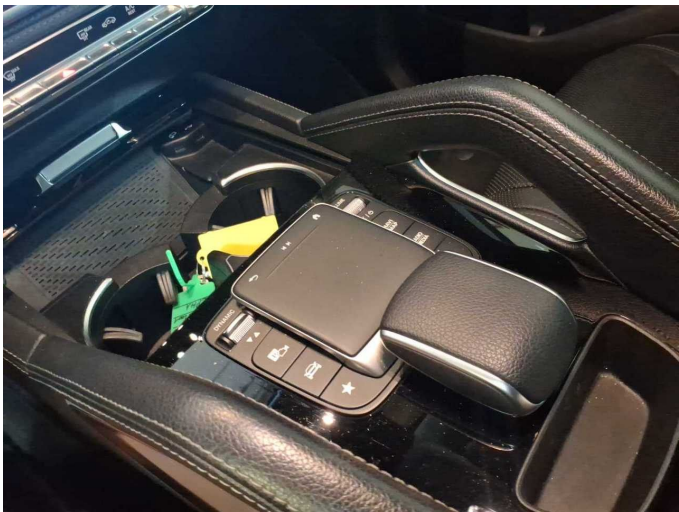


Figure 30: Misc.

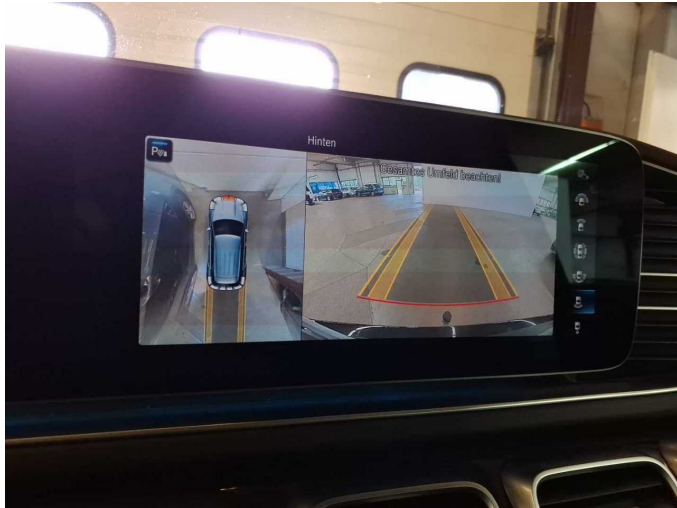


Figure 31: Misc.



Figure 32: Misc.

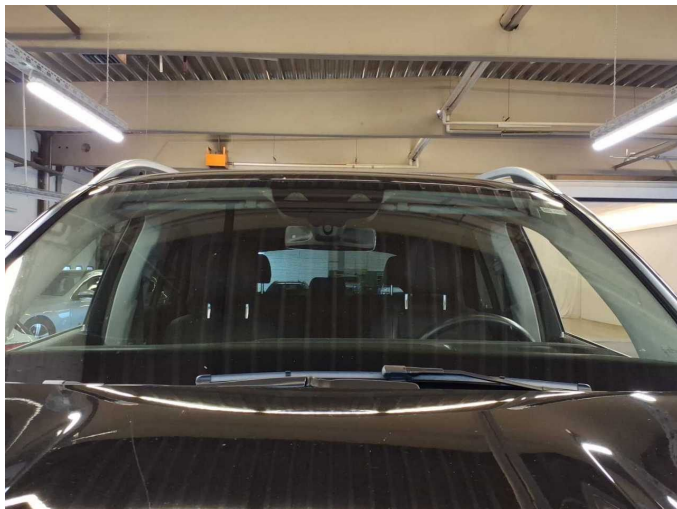


Figure 33: Misc.



Figure 34: Misc.

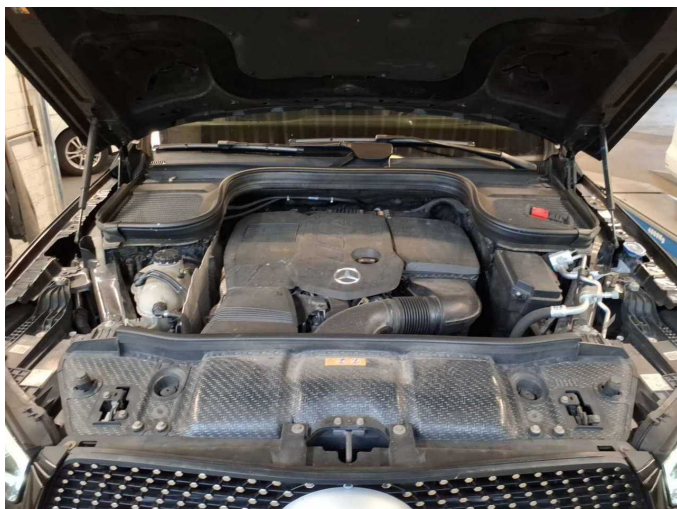


Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Figure 38: Misc.



Damage 1: Door - front left side: Door edge - Scratched - Smart repair



Damage 1: Door - front left side: Door edge - Scratched - Smart repair



Damage 1: Door - front left side: Door edge - Scratched - Smart repair



Damage 1: Door - front left side: Door edge - Scratched - Smart repair



Damage 2: Sill - right side: Trim - Scratched - Smart repair




Damage 2: Sill - right side: Trim - Scratched - Smart repair




Damage 3: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 3: Side panel - rear left side: Sill - Scratch(es) - Smart repair

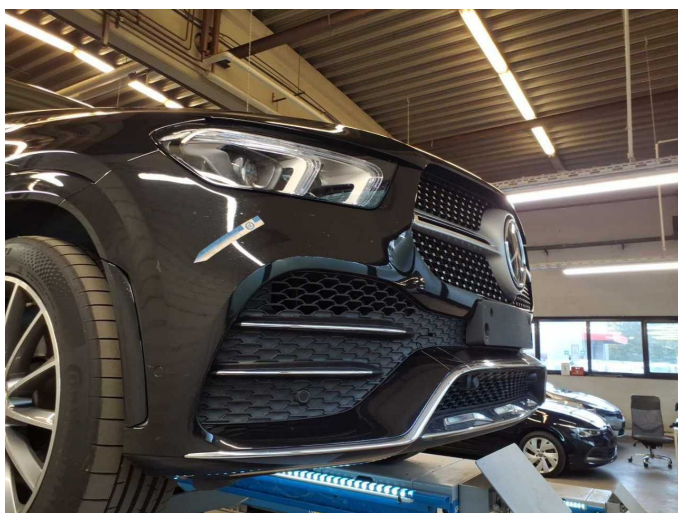


Damage 4: Front bumper: Front bumper - Scratched - Smart repair

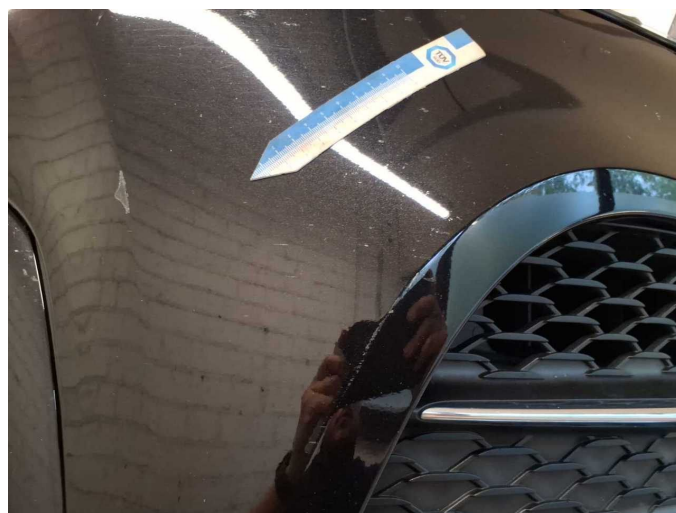


Damage 4: Front bumper: Front bumper - Scratched - Smart repair




Damage 4: Front bumper: Front bumper - Scratched - Smart repair

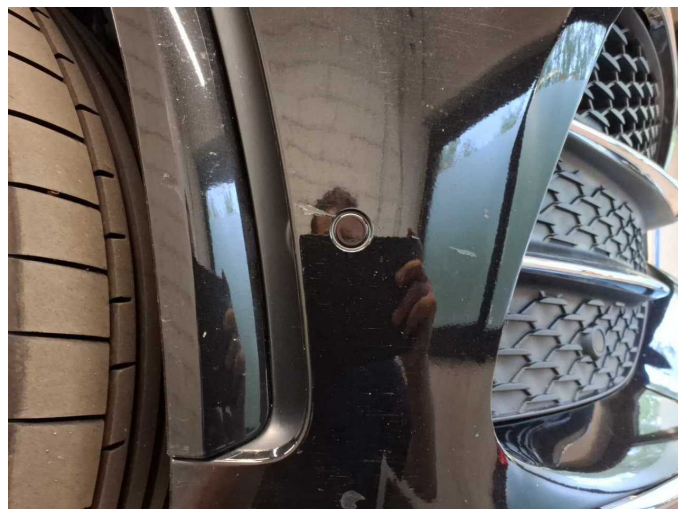


Damage 4: Front bumper: Front bumper - Scratched - Smart repair

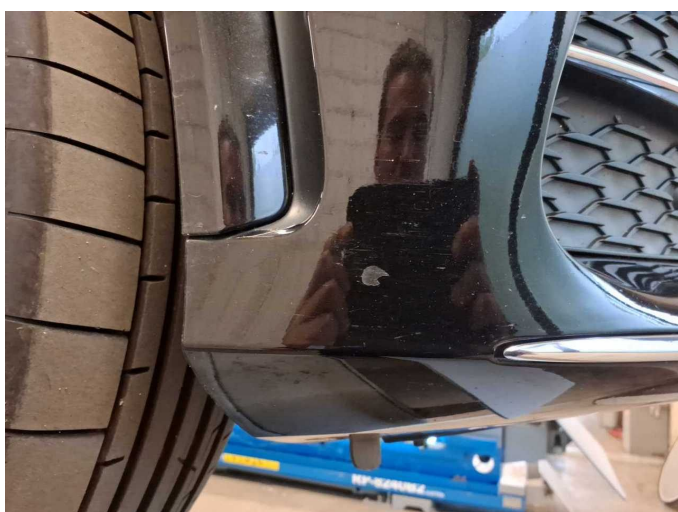

Damage 4: Front bumper: Front bumper - Scratched - Smart repair

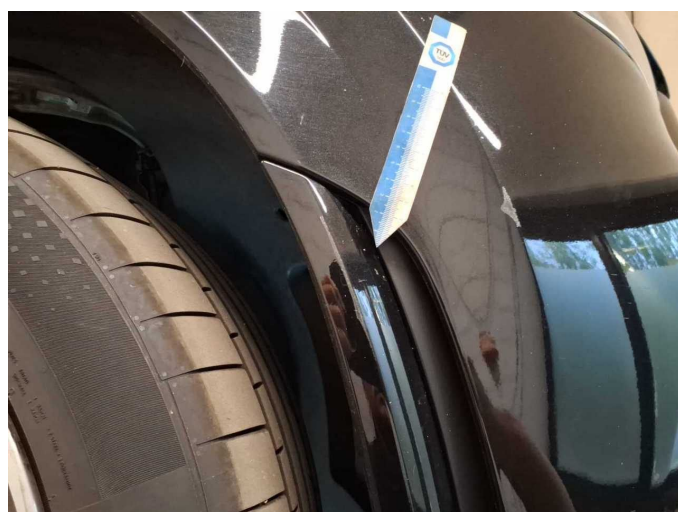

Damage 4: Front bumper: Front bumper - Scratched - Smart repair

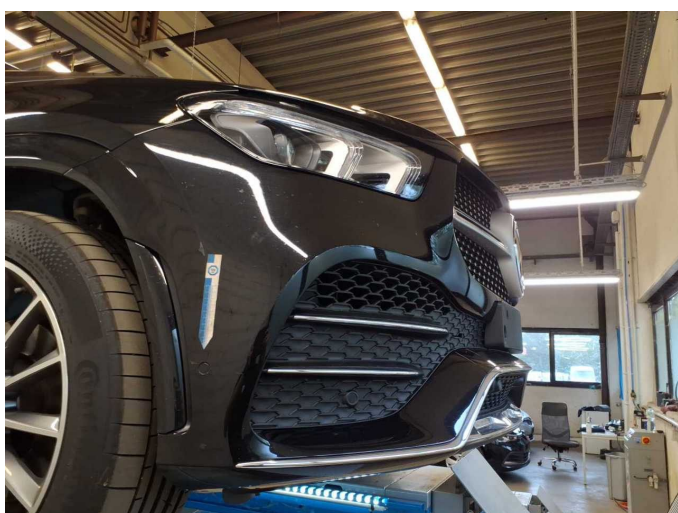


Damage 5: Front bumper: Bumper with Parktronic - Malposition - Set / adjust




Damage 5: Front bumper: Bumper with Parktronic - Malposition - Set / adjust



Damage 5: Front bumper: Bumper with Parktronic - Malposition - Set / adjust

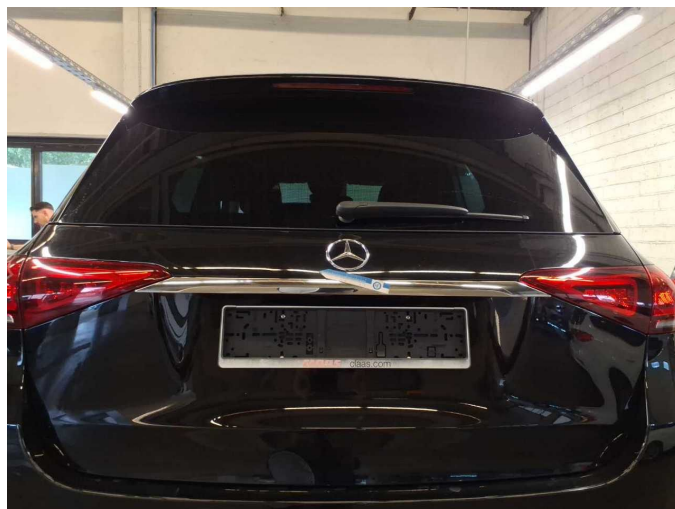

Damage 6: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

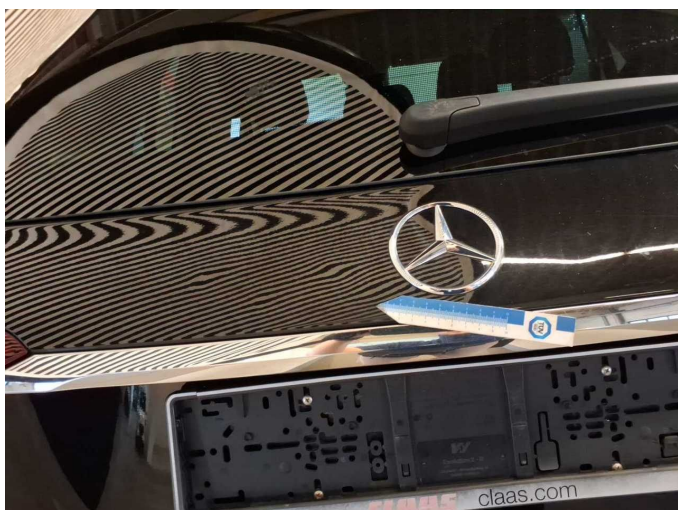

Damage 6: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 6: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 7: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value




Damage 7: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value




Damage 7: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



Damage 8: Door - rear right side: Door - Scratched - Paint

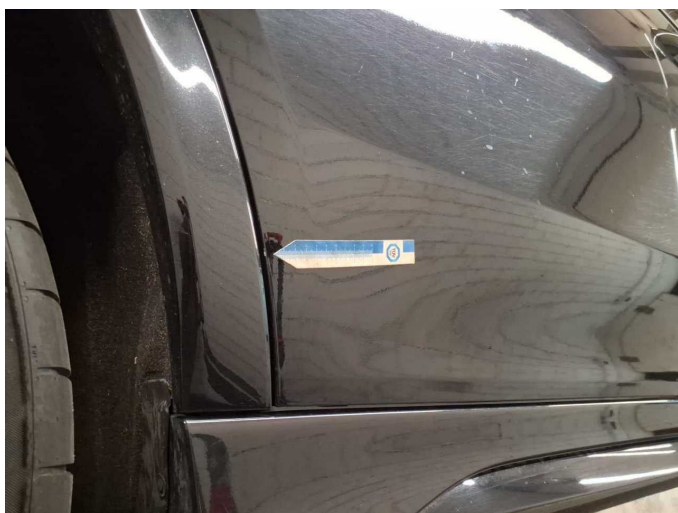

Damage 8: Door - rear right side: Door - Scratched - Paint

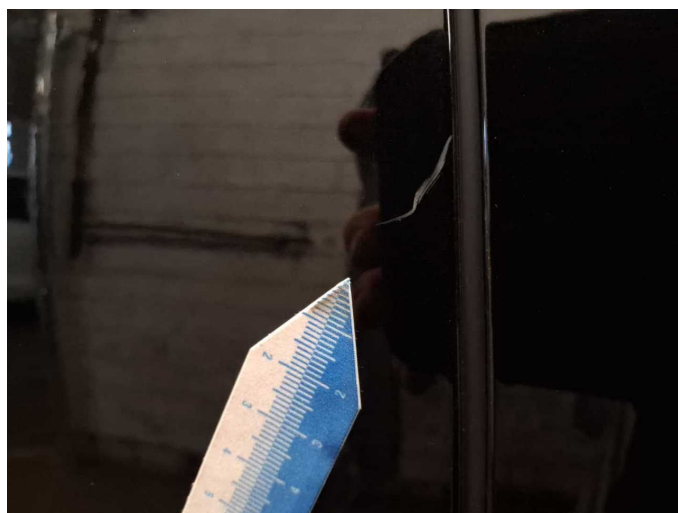

Damage 8: Door - rear right side: Door - Scratched - Paint



Damage 8: Door - rear right side: Door - Scratched - Paint



Damage 8: Door - rear right side: Door - Scratched - Paint




Damage 8: Door - rear right side: Door - Scratched - Paint




Damage 9: Side panel - rear right side: Side panel - Scratched - Paint



Damage 9: Side panel - rear right side: Side panel - Scratched - Paint

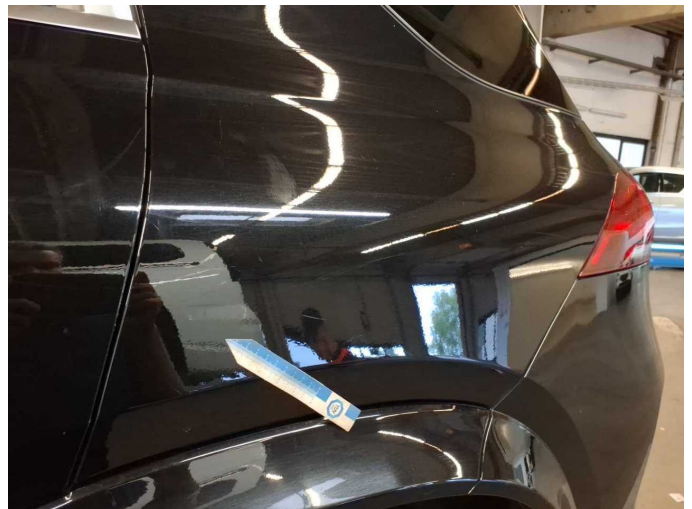


Damage 10: Side panel - rear left side: Side panel - Scratched - Paint

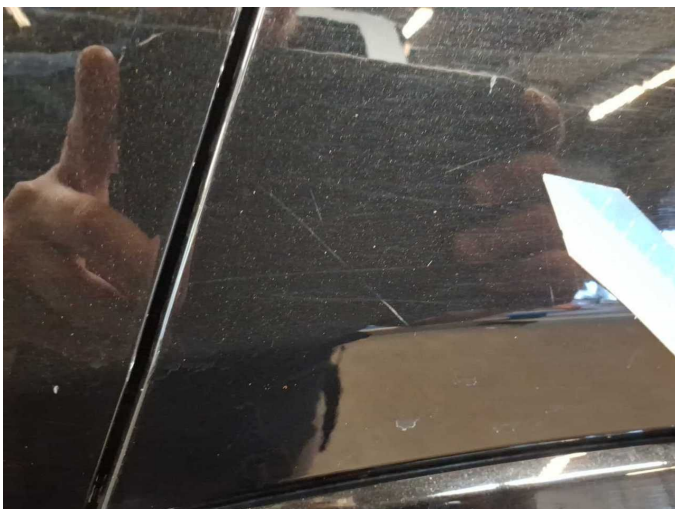


Damage 10: Side panel - rear left side: Side panel - Scratched - Paint



Damage 10: Side panel - rear left side: Side panel - Scratched - Paint

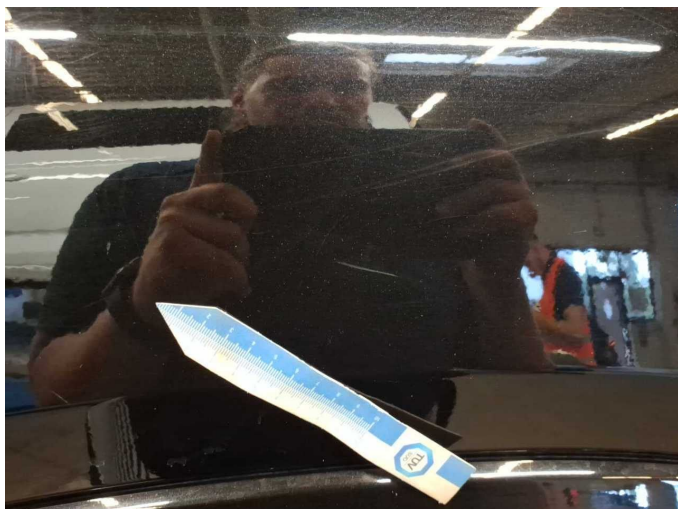

Damage 10: Side panel - rear left side: Side panel - Scratched - Paint

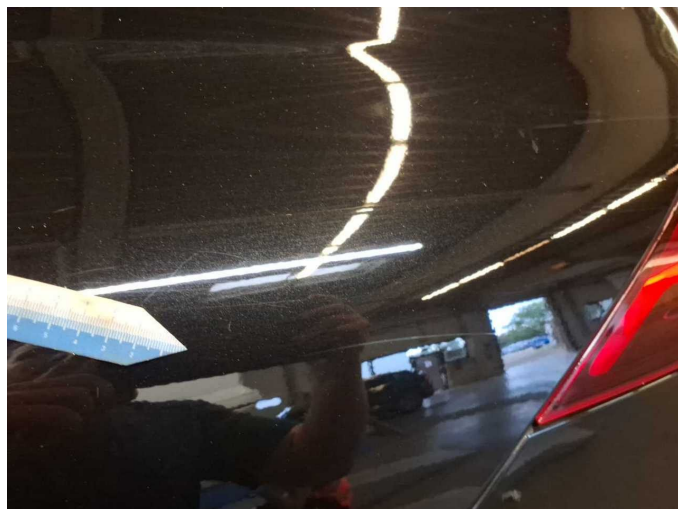


Damage 10: Side panel - rear left side: Side panel - Scratched - Paint




Damage 11: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint




Damage 11: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

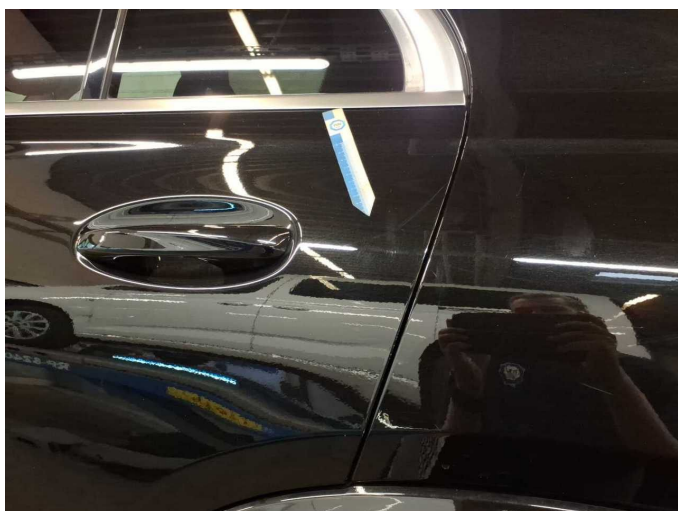

Damage 11: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

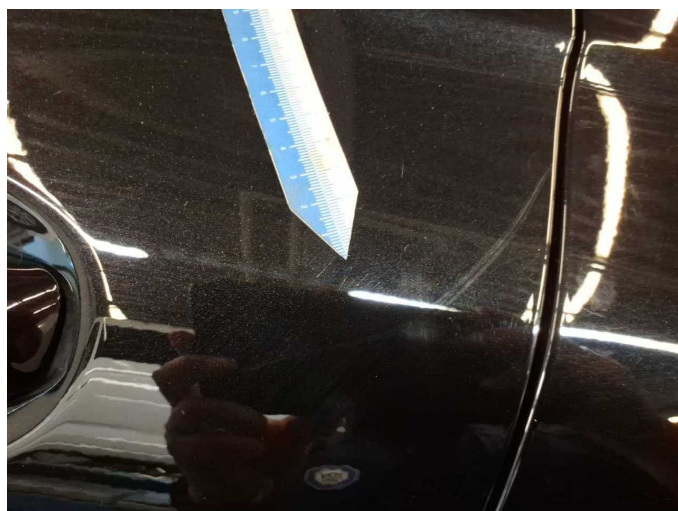


Damage 11: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

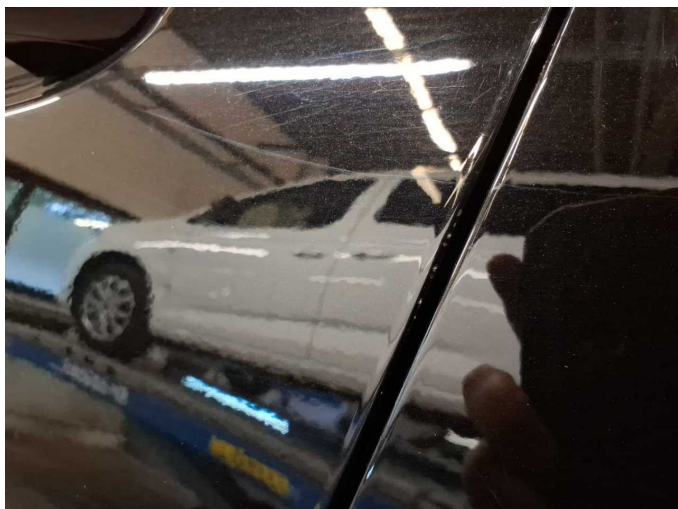

Damage 11: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 12: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

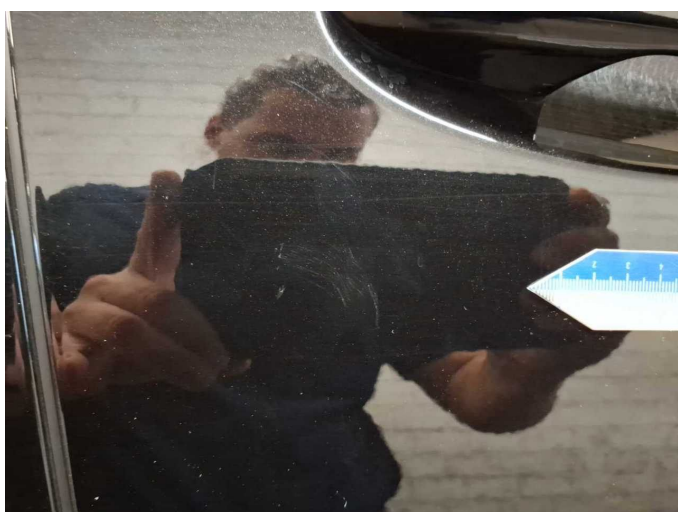

Damage 12: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 12: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 13: Bonnet: Bonnet - Scratched - Paint



Damage 13: Bonnet: Bonnet - Scratched - Paint



Damage 13: Bonnet: Bonnet - Scratched - Paint



Damage 13: Bonnet: Bonnet - Scratched - Paint



Damage 14: Wheel / tyres: Alloy rim - front left side (Materialabtrag) - Scratched - Replace




Damage 14: Wheel / tyres: Alloy rim - front left side (Materialabtrag) - Scratched - Replace




Damage 14: Wheel / tyres: Alloy rim - front left side (Materialabtrag) - Scratched - Replace



Wear and tear 1: Rear bumper: Rear bumper - Scratch(es) - No deduction

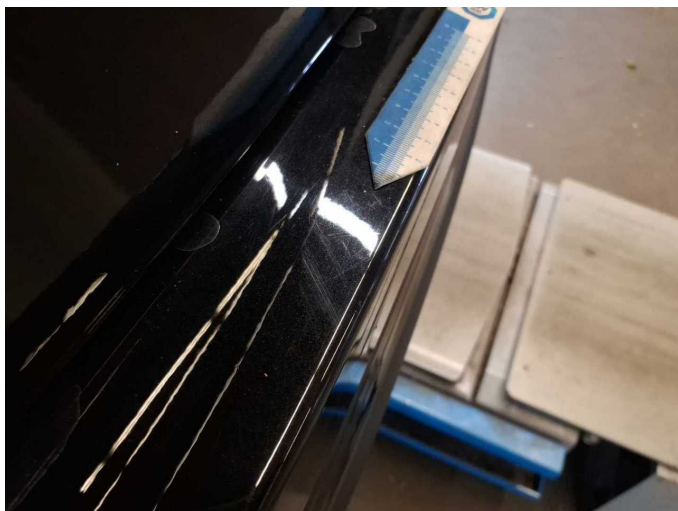

Wear and tear 1: Rear bumper: Rear bumper - Scratch(es) - No deduction

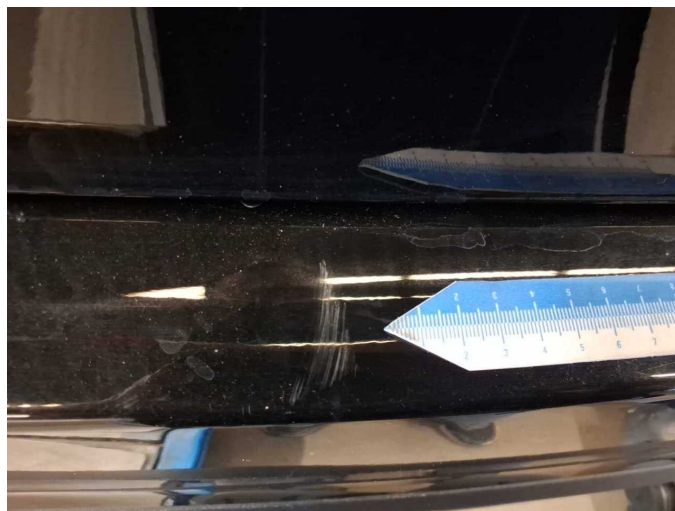

Wear and tear 1: Rear bumper: Rear bumper - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N1671091A673411

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLE 300 d 4Matic 9G-TRONIC

Datum	KM-Stand	Beschreibung
09.01.2026	122.782	Regelwartungsdienst
29.10.2025	116.274	Reparatur Sonstiges
19.05.2025	97.785	AU; Regelwartungsdienst; Systemtest/Eigendiagnose
10.12.2024	80.544	Systemtest/Eigendiagnose
20.09.2024	75.203	Bremsklötze vorne; Regelwartungsdienst
17.11.2023	50.104	Regelwartungsdienst
20.01.2023	24.810	Regelwartungsdienst