



Volvo V 40:

Vinnumber:	YV1XZL4VDM2599704	Versionname:	
First Registrationdate:	15/05/2021	Fiscalpower:	
Expertise Mileage:	92910	Power Kw:	
Bodytype:		Body colour	Black
Gearbox:	Automatic	Type of rims (mounted)	Aluminium
Transmission:		Parking lot	1226
Fueltype:	Petrol		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Sun Roof electric	
Cruise Control		Panoramic roof	
Steering wheel multifunctional		Luggage cover	
Seats F heated		Rear parking sensors	
Radio multimedia		Type of Tow bar	No Tow bar
Type of headlighting	Headlighting LED		
Type of GPS	GPS big screen color		
Type of Lining	Lining artificial leather		
Type of climate control	Autom climate control		

Limited Technical Inspection


Tyres

225/55/18/92 H				
Summer tyres:	Fr.L.	Continental: 5 mm	Fr.R.	Continental: 5 mm
	Re.L.	Continental: 5 mm	Re.R.	Continental: 5 mm
Tyre profile depth FL				5.0
Tyre profile depth FR				5.0
Tyre profile depth RL				5.0
Tyre profile depth RR				5.0
Tyre size FL				225/55 R 18 92 H
Tyre size FR				225/55 R 18 92 H
Tyre size RL				225/55 R 18 92 H
Tyre size RR				225/55 R 18 92 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				256
Tyre make FR				256
Tyre make RL				256
Tyre make RR				256

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1379,83
Bumper F, Scratch(es), Acceptable	0,00

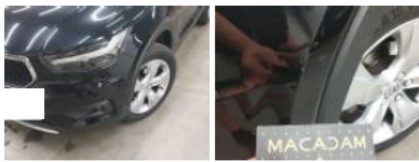

Bonnet, Chemical polution, Repair and paint (complete)	406,19
--	--------




Wing RL, Scratch(es), Acceptable	0,00
----------------------------------	------




Door RL, Scratch(es), Acceptable	0,00
----------------------------------	------



Door FL, Scratch(es), Acceptable	0,00
----------------------------------	------

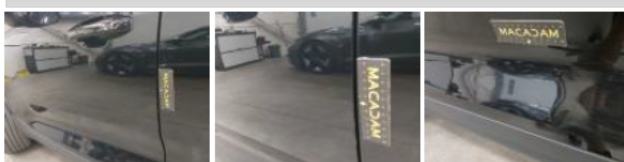


Wing FL, Dent(s) and scratch(es), Repair and paint (complete)	427,34
---	--------

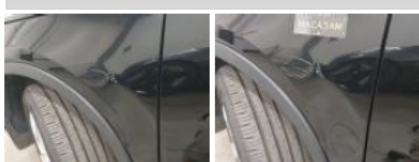


Alloy rim FL, Scratch(es), Repair and paint (complete)	133,03
--	--------



Wing trim FL, Scratch(es), Acceptable	0,00
---------------------------------------	------

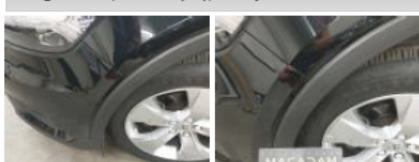

Bumper R, Scratch(es), Repair and paint (complete)	296,58
--	--------

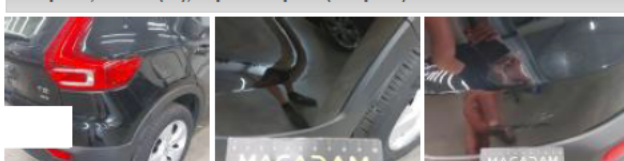

Bumper trim R, Scratch(es), Smart repair	116,69
--	--------



Tailgate / Boot, Scratch(es), Acceptable	0,00
--	------



Bumper moulding R, Scratch(es), Acceptable	0,00
--	------



Door trim FR, Chemical polution, Polish	0,00
---	------



Door RR, Dent(s), Acceptable	0,00
------------------------------	------



Alloy rim RR, Scratch(es), Acceptable	0,00
---------------------------------------	------



Wing RR, Scratch(es), Acceptable	0,00
----------------------------------	------



Roof, Scratch(es), Acceptable	0,00
-------------------------------	------

