



Expertise

Protocol number: 46626838
Order No. / Reference: 26528916
Inspection date: 15 Jul 2026

Manufacturer: Opel	Model: Insignia Sports Tourer 2.0 Diesel Aut. Business
VIN: W0VZT8GP6N1043085	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Insignia Sports Tourer 2.0 Diesel Aut. Business	
Vehicle Identification number	W0VZT8GP6N1043085
Mileage (Read)	114,625 km
First registration	5 Dec 2022
Number of holders	1
Next periodical technical inspection	12/2027
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,995 ccm / 4
Power	128 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Nautic Blau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Grey



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	
Last service on / at	04/2026 at 114,625 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ322274
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	Conditional: Light/moisture/dirt	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Not possible
Manufacturer key number/ type code number	1844 / AMC 00298		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,245 kg	Empty weight	

Tyres			
Mounted tyres			
#	Tyre size	Type of tyre	Tread depth
1)	245/45 R18 100Y	Summer tyres on Light alloy	5mm / 5mm
2)	245/45 R18 100Y	Summer tyres on Light alloy	5mm / 5mm

Replacement			
Typ	Tyre size	Type of tyre	Tread depth
	Tirefit	Expiration date 09/2026	

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments
- Airbag: Front airbags and side airbags, driver and front passenger
- Anti-lock braking system (ABS)
- Hill Start Assist
- third brake light
- Roof rails, silver anodized
- Diesel particulate filter
- Electronic brake force distribution (EBD)
- Electric windows front and rear
- Pedestrian protection including active hood
- luggage compartment cover
- Speed controller
- Back window, heater
- Child safety lock in the rear doors, manual
- Front headrests
- LED headlights
- LED daytime running lights including LED indicators, front and LED taillights
- Center armrest, front
- Electric parking brake
- Quickheat rapid heating system
- Radio: Multimedia Navi Pro with 8" color touchscreen display
- Rear seat backrest folds forward in a 60:40 split
- Seat belts: Three-point seat belts in all seats
- Visibility equipment
- Lane Keeping Assist
- Bumpers painted in body color
- Traffic sign assistant
- Immobiliser
- Central locking with remote control
- Adaptive brake light
- Airbag: Front and rear outer head airbags
- Ambient lighting
- Electrically adjustable and heated exterior mirrors for driver and passenger side
- Glasses compartment in the headliner
- Decorative strip hexagon
- Tachometer
- Electronic Stability Program (ESP Plus)
- Front collision warning system with pedestrian detection and automatic emergency braking
- Noise-reducing, laminated front side windows
- Transmission: 8-speed automatic transmission
- rear window wiper
- Automatic climate control, two zones
- Rear headrests (3 pieces)
- LED fog lights
- Steering column adjustable for height and reach
- Illuminated makeup mirrors in both sun visors
- Package: Winter 1
- Parkpilot, front and rear parking aid
- Radio: Digital radio reception DAB+
- Tire repair kit
- Tire pressure gauge
- Power steering
- safety net
- Seats: Ergonomic active seat (AGR) driver
- Start/Stop System
- Traction Control (TC) Plus
- Pre-installation for child seat mounting system "ISOFIX"
- Thermal insulation glazing, green tinted



Extra equipment

- Airbag: Side airbags, rear outer (seatbelt warning for unfastened seatbelts, rear (child seat attachment system remains activated))
- Package: Innovations 2 (automatic transmission) (Head-up display - Adaptive cruise control (Generation 3), Stop & Go function - Forward collision warning with pedestrian detection and automatic emergency braking, active from 4 km/h, range 150 m. In case of risk of collision, the braking system is prepared and, if necessary, emergency braking / automatic emergency braking is initiated - Traffic sign recognition)
- Package: Sound (Bose sound system)
- Paint finish: Metallic
- Swiveling trailer hitch (including trailer stability program)
- Wheels: 8.5 J x 18 alloy wheels in high-gloss black (multi-spoke) (with 245/45 R 18 tires)
- Package: Business Premium (Easy Access Package: Keyless locking and starting system, sensor-controlled tailgate, electric loading sill protection, stainless steel - Charging Package: Wireless charging, 2 USB ports, rear center console - Park & Go: Digital reversing camera, reversing assistant, lane change assistant, blind spot warning in both exterior mirrors - Innovation Package 1: IntelliLux LED Pixel headlights, traffic sign assistant - Solar Protect heat-insulating glass, heavily tinted, in the rear)
- Upholstery: Monita fabric/Premium leather look including Winter Package 2 (Ergonomic active seat, certified by the Campaign for Healthy Backs (AGR), front/front seat heating, multi-stage, front/front heated leather steering wheel, heated ThermoTec windshield, Seat Comfort Equipment 1: 8-way electrically adjustable driver's seat, electro-pneumatically adjustable lumbar support, memory function - driver and exterior mirrors, massage function, front exterior mirrors, electrically adjustable, heated, folding rear seat backrest with FlexFold function, 40:20:40 split, Charging Package: Wireless charging, 2 USB ports)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	A proper visual inspection of the paintwork and bodywork was only possible to a limited extent due to insufficient lighting conditions/dampness or dirt. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run could not be performed. This is due to the following reason.: Motorschaden

Value reducing factors

No.	Component group	Description
1	Side panel - rear right side	Side panel - dent(s) - Smooth repair work
2	Interior	Interior - Soiled - Paint
3	Side panel - rear left side	Side panel - Dent / paintcoat damage - Smart repair
4	Engine	Engine - Defective - repair according to calculation

Missing parts

Description

Multimedia system - Navigation data storage



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

Keine Besichtigung des Unterbodens, Begutachtung Fahrwerk/Achsen/Aggregate nur bedingt möglich, Zusatzkosten können entstehen.

Fahrzeugzugang eingeschränkt

Fahrzeug zur Besichtigung verschmutzt. Mehrkosten möglich



Figure 1: Diagonal front (left)

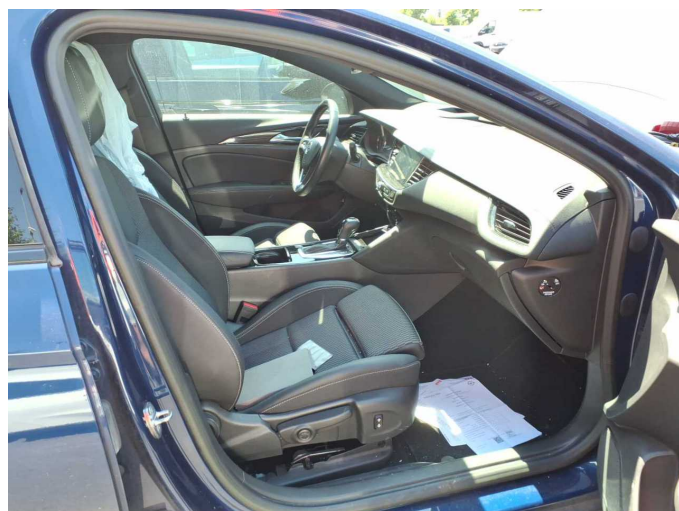


Figure 2: Interior - front



Figure 3: Interior - rear



Figure 4: Instrument cluster

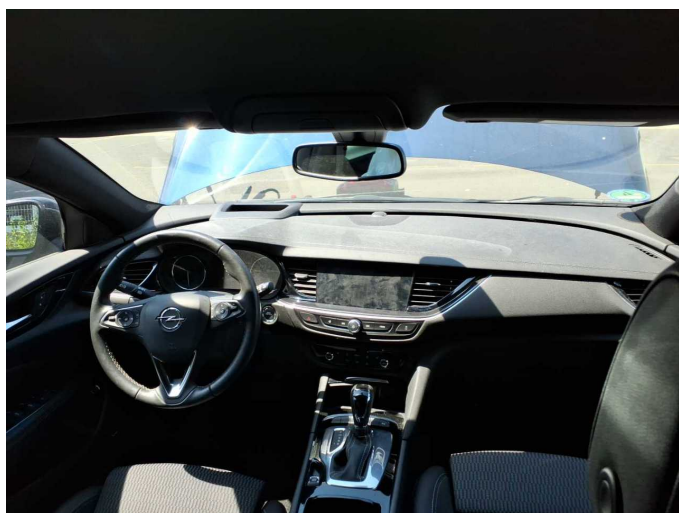


Figure 5: Instrument panel



Figure 6: Interior 360° view



Figure 7: Cargo area



Figure 8: VIN



Figure 9: Mounted tyres

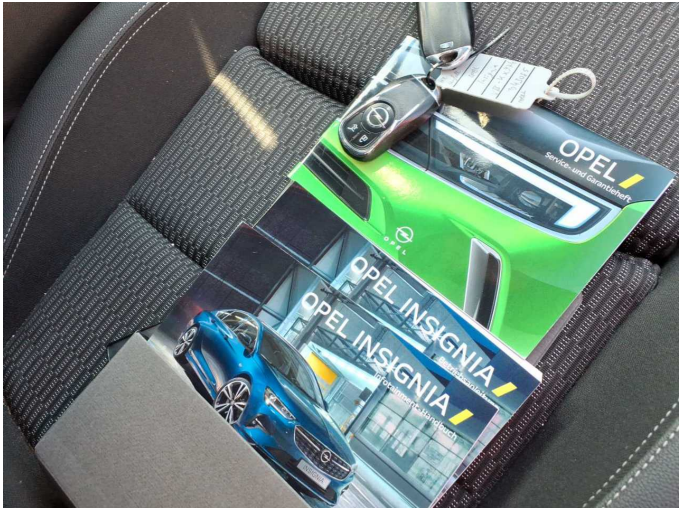


Figure 10: Documents

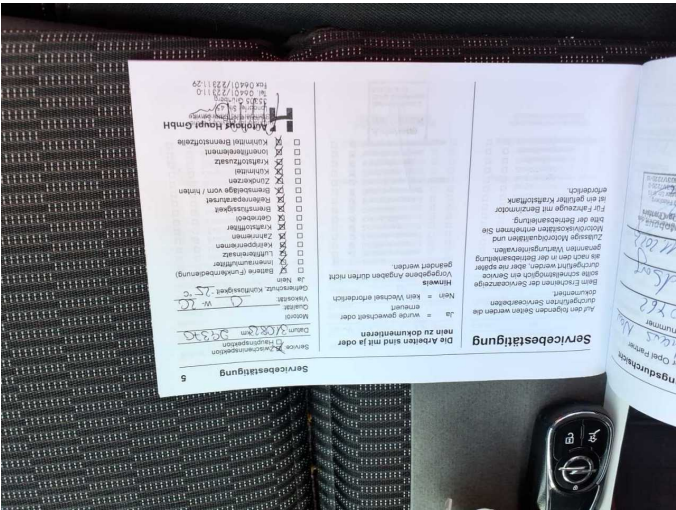


Figure 11: Documents

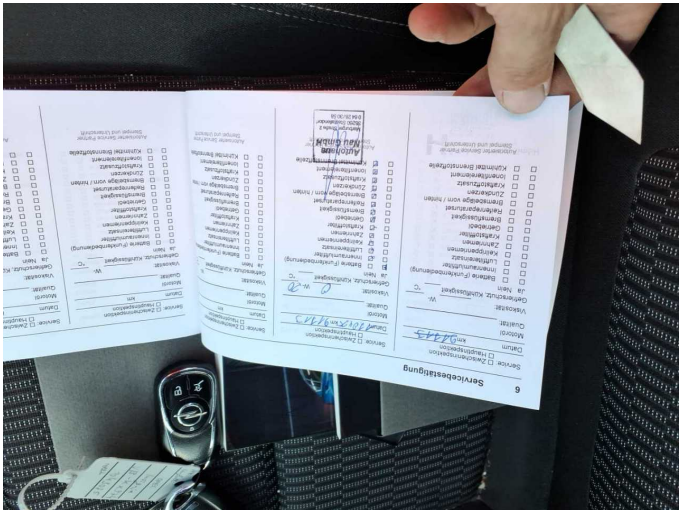


Figure 12: Documents

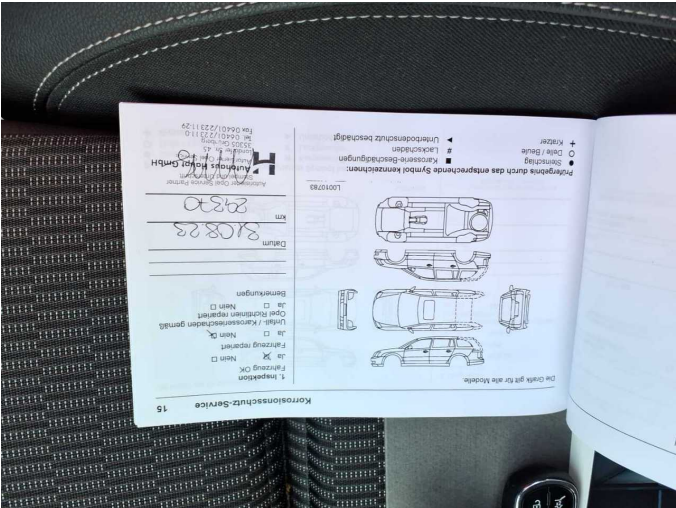


Figure 13: Documents



Figure 14: Documents

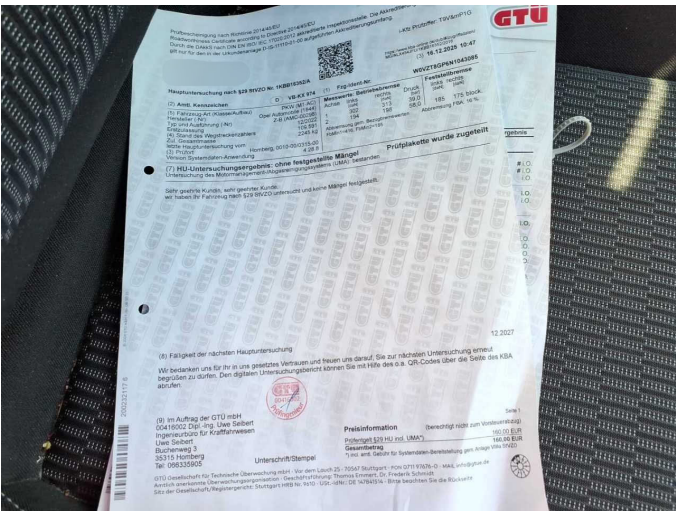


Figure 15: Documents

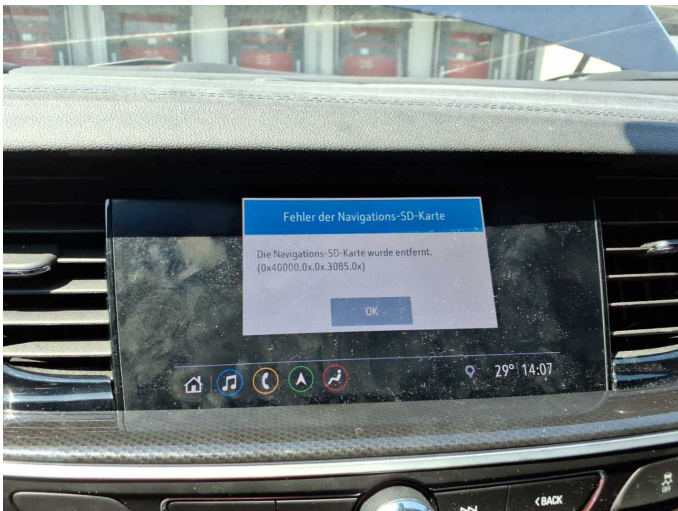


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.

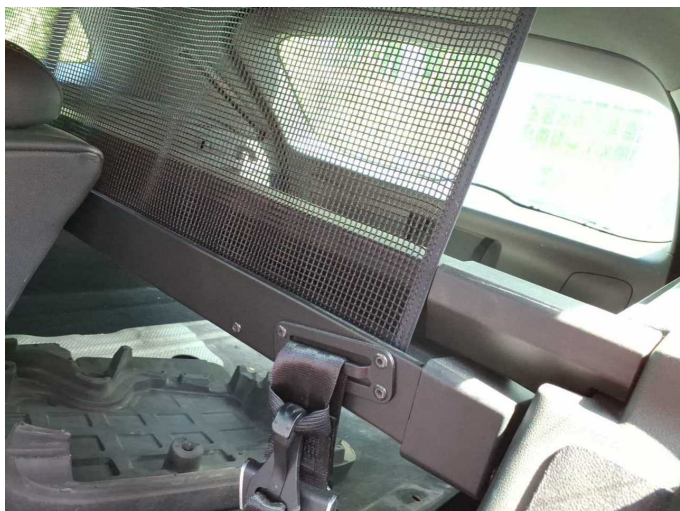


Figure 19: Misc.

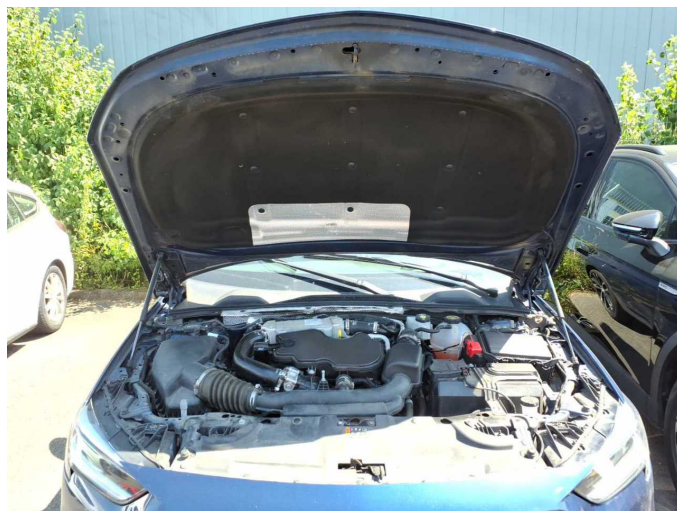


Figure 20: Misc.

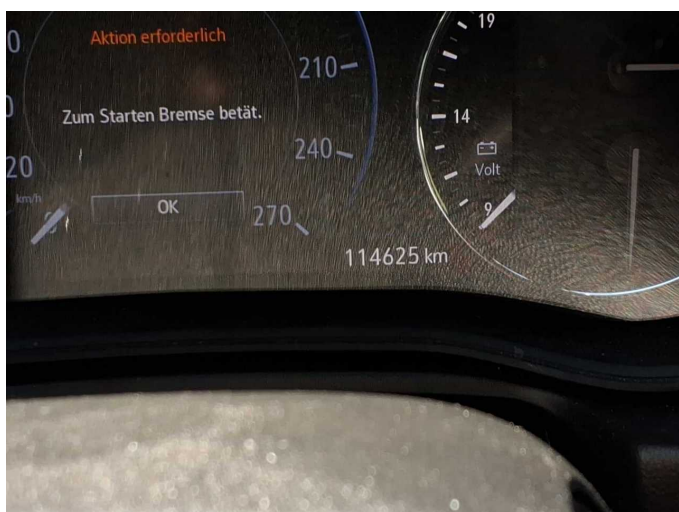


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

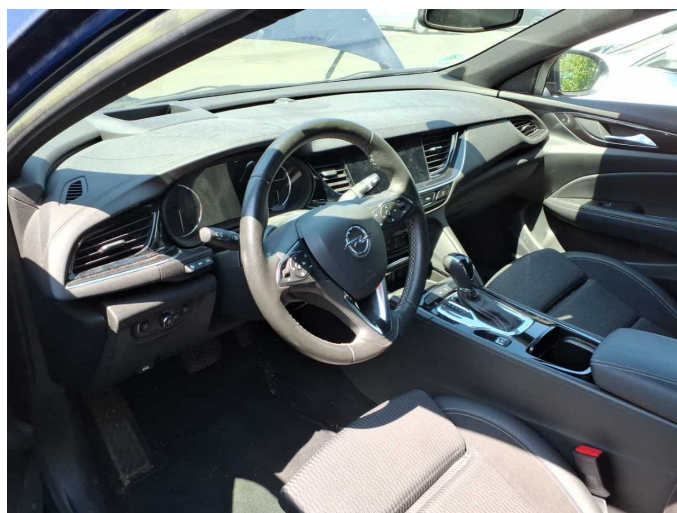


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.




Figure 27: Misc.



Figure 28: Misc.



Damage 1: Side panel - rear right side: Side panel - dent(s) - Smooth repair work

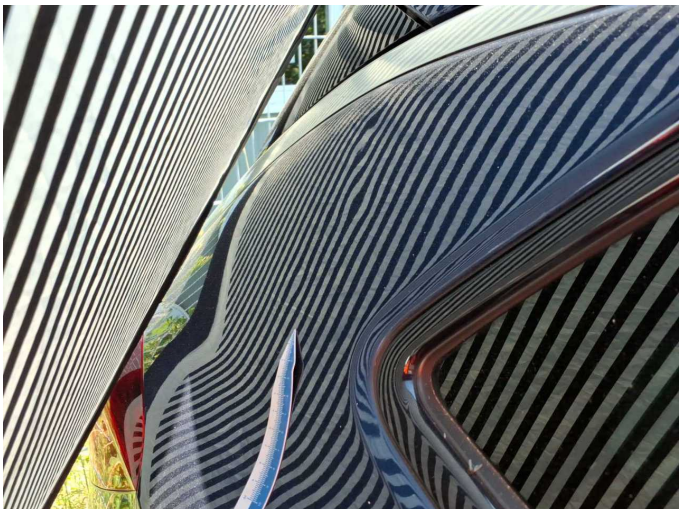


Damage 1: Side panel - rear right side: Side panel - dent(s) - Smooth repair work




Damage 2: Interior: Interior - Soiled - Paint



Damage 2: Interior: Interior - Soiled - Paint

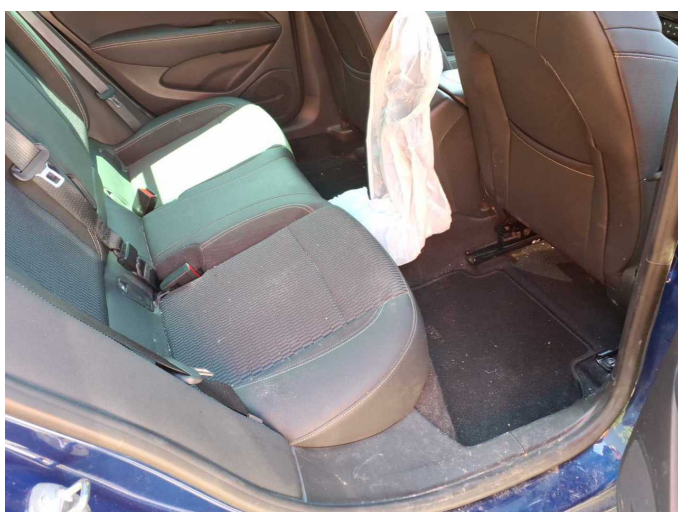


Damage 2: Interior: Interior - Soiled - Paint

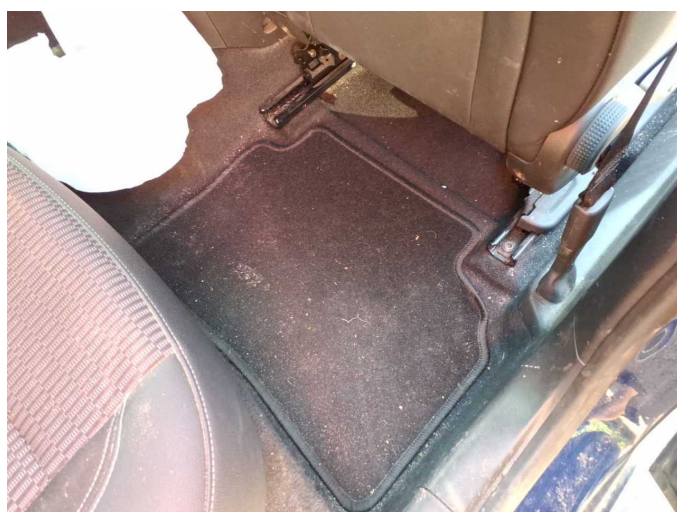

Damage 2: Interior: Interior - Soiled - Paint



Damage 3: Side panel - rear left side: Side panel - Dent / paintcoat damage - Smart repair

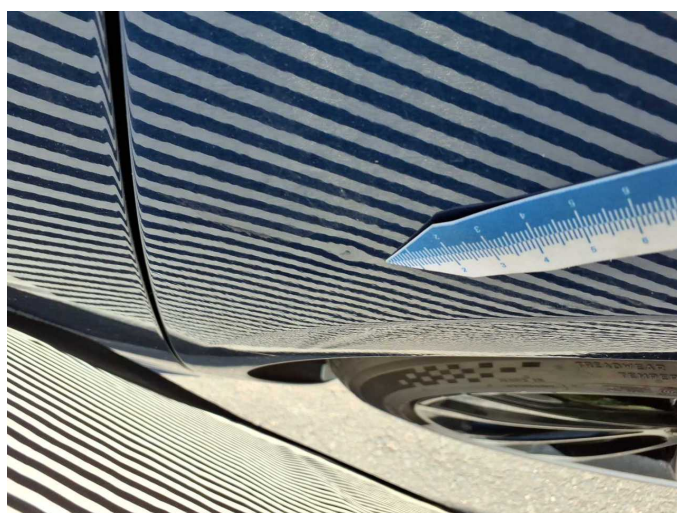

Damage 3: Side panel - rear left side: Side panel - Dent / paintcoat damage - Smart repair



Damage 4: Engine: Engine - Defective - repair according to calculation



Damage 4: Engine: Engine - Defective - repair according to calculation




Damage 4: Engine: Engine - Defective - repair according to calculation



Damage 4: Engine: Engine - Defective - repair according to calculation



Missing part 1: Multimedia system: Navigation data storage - Missing - Replace

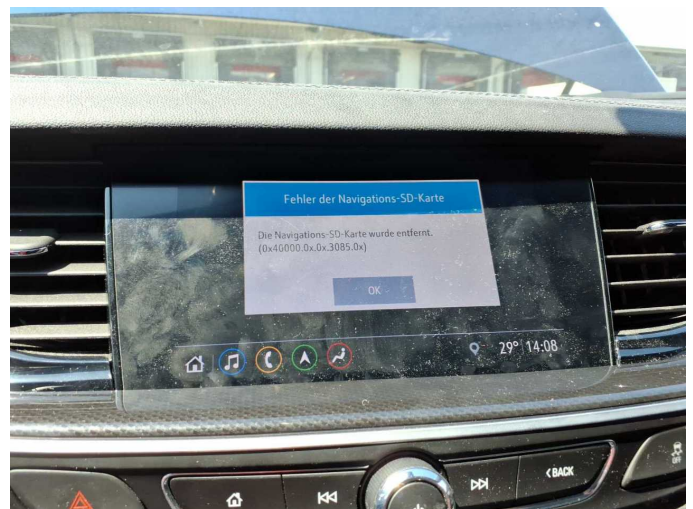

Missing part 1: Multimedia system: Navigation data storage - Missing - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VZT8GP6N1043085

Hersteller / Modell: OPEL OPEL Insignia Sports Tourer 2.0 Diesel Aut. Business

Datum	KM-Stand	Beschreibung
27.04.2026	114.625	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Reparatur Sonstiges; Systemtest/Eigendiagnose; Turbolader ern; Wartung Sonstiges
16.12.2025	0	HU + AU
17.04.2025	91.713	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
19.07.2024	59.507	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Wartung Sonstiges
31.08.2023	29.370	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges