



Expertise

Protocol number: 46583478
Order No. / Reference: 26733410
Inspection date: 16 Jul 2026

Manufacturer: Skoda
VIN: TMBJR7NU8PC205721

Model: Karoq 1.5 TSI DSG Style



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Karoq 1.5 TSI DSG Style	
Vehicle Identification number	TMBJR7NU8PC205721
Mileage (Read)	138,178 km
First registration	5 Jan 2023
Number of holders	2
Next periodical technical inspection	01/2028
(Report on hand)	
Fuel type	Petrol
Engine displacement / Cylinder	1,498 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Black Magic Pearlescent (F9R)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	11,200 km
Last service on / at	02/2026 at 119,320 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GN429550
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / ASO 03324		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,930 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/50 R18 92W	Summer tyres on Light alloy	Bridgestone	5mm / 5mm
2)	215/50 R18 92W	Summer tyres on Light alloy	Pirelli	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 99H	Winter tyres on Light alloy	Goodyear	6mm / 6mm
2)	215/60 R16 99H	Winter tyres on Light alloy	Goodyear	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
Tirefit		Expiration date 08/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments
- Airbag, driver and passenger
- Airbag, head airbags
- Allergen filter
- Traction control (ASR)
- Electrically folding exterior mirrors including interior and exterior mirrors with automatic dimming.
- Exterior mirrors and door handles painted in body color
- Hill start assist
- Care Connect: Proactive services (10-year term)
- Roof rails, black
- Digital Cockpit Plus (10")
- eCall
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor
- Front radar assistant including city emergency braking function with pedestrian detection
- Transmission: 7-speed dual-clutch transmission (DSG)
- Green tec (start/stop system and brake energy recuperation)
- Automatic interior mirror dimming
- Trunk cover, fixed
- Paint finish: Solid
- LED headlights with daytime running lights
- LED fog lights
- Steering wheel: Heated steering wheel
- Rear center armrest with cup holders and pass-through option
- Multi-collision brake
- Otto particulate filter
- Package: Comfort PLUS
- Package: Winter BASIC
- Wheel arch cover
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Wireless SmartLink
- Tire Mobility Kit
- Wheels: 18" Procyon alloy wheels, Aero, matte black
- Gear shift indicator
- Seat belts
- Seats: Height-adjustable front seats
- Sun visor on driver and passenger side with illuminated vanity mirror
- 12V socket - in the center console
- Lashing eyes in the trunk
- Central locking with remote control
- front aero windshield wipers
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Dashboard in black / black, door trim in black
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Illuminated trunk
- Hydraulic brake assist (HBA)
- Grey headliner
- Decorative inlay style
- Easy Start (start-stop button)
- Electronic parking brake including auto-hold function
- ESC Electronic Stability Control
- Electric windows front and rear
- Closed storage compartment on the dashboard
- Cruise control
- Tinted windows
- Heated rear window
- Rear window wiper/washer system
- ISOFIX preparation on the outer rear seats
- Front and rear headrests are height-adjustable.
- LED brake light in the rear spoiler
- LED taillights in crystal glass look
- LED headlights with daytime running lights
- Reading lights at the front of the headliner
- Front center armrest, including storage compartment
- Engine drag torque control (MSR)
- Fatigue detection
- Package: Bolero infotainment package
- Package: Parking BASIC
- Upholstery: Cloth
- Radio accessories: 8 speakers
- Radio accessories: USB port in the center console (Type-C)
- Tire pressure monitoring
- Rear seat backrest split 60:40, foldable
- Electromechanical power steering
- Seats: Adjustable lumbar support in the front seats
- Skoda Care Connect
- Speed limiter
- 12V socket - in the trunk
- Bumpers partially painted in body color
- Immobiliser



Extra equipment

- Swiveling trailer hitch with electric release (including trailer stabilization)
- Package: Amundsen Infotainment Package (Amundsen Dynamic Radio Navigation System - 8" Capacitive Color Display - Digital Cockpit Plus - Wireless SmartLink - Voice Control - Phonebox with inductive charging function (connection via external antenna) - Infotainment Online (3-year term) - Mapcare navigation data update)
- Wheels: 18" Procyon alloy wheels, Aero black
- Variable loading floor in the trunk
- Luggage net partition
- Paint finish: Pearl effect
- Package: Light & Visibility
- Package: Parking PLUS (Parking Assist - Front and rear parking sensors - 360° AreaView surround view camera including reversing camera)
- Package: Traveller BASIC
- Package: Winter PLUS (Heated front and outer rear seats - Heated windshield washer nozzles - Headlight cleaning system - Heated windshield)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Bonnet	Bonnet - Soiled - Conditioning
2	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
3	Front bumper	Spoiler - Scratched - Replace
4	Rear bumper	Rear bumper - Scratch(es) - Paint
5	Front bumper	Front bumper - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Mudguard - right side	Mudguard - right side - Stone chips - No deduction
2	Door - front right side	Door - Dent / paintcoat damage - No deduction
3	Door - rear right side	Door - Dent / paintcoat damage - No deduction
4	Door - front left side	Door - Scratch(es) - No deduction
5	Door - rear left side	Door - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

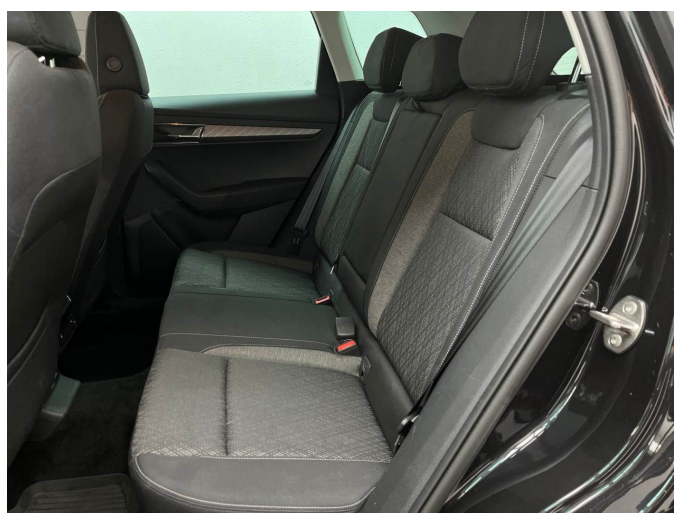


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

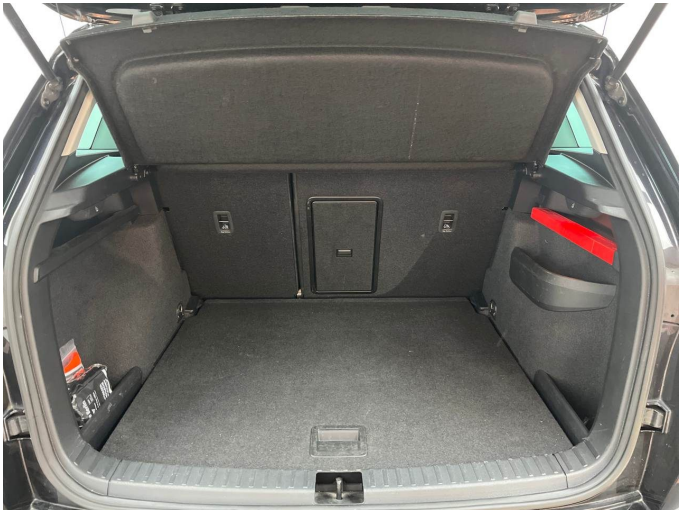


Figure 10: Cargo area

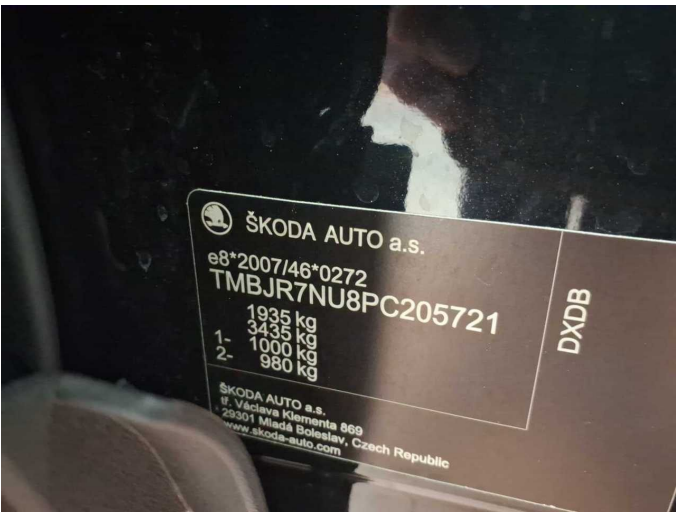


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

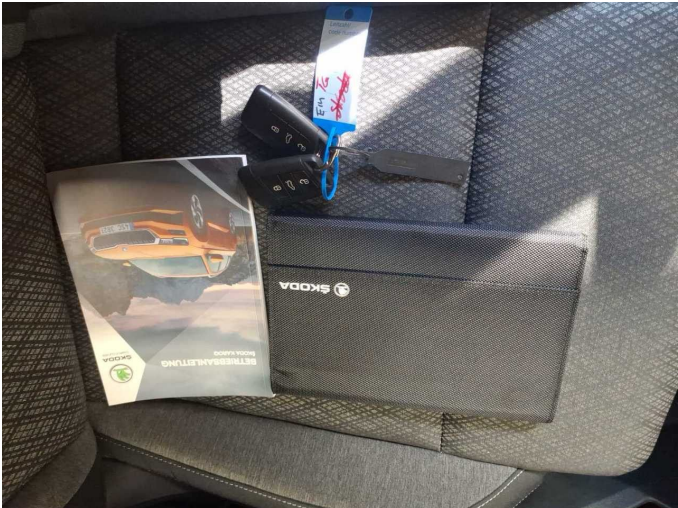


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

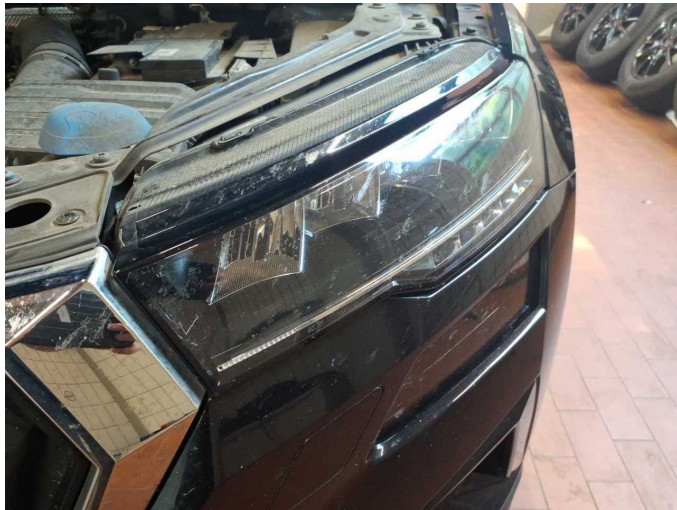


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

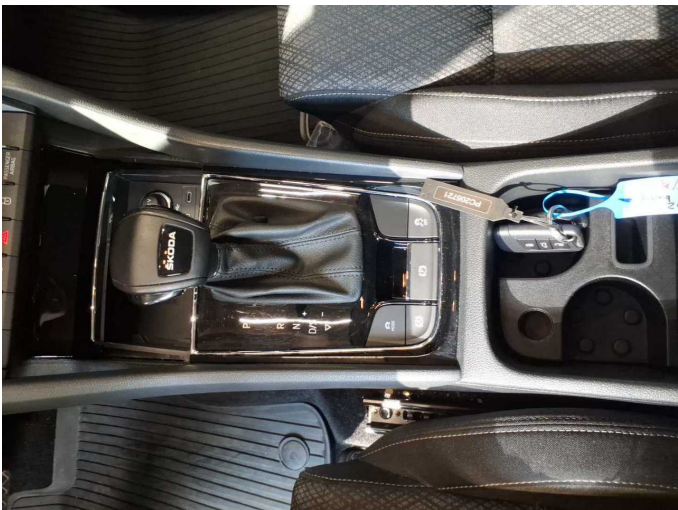


Figure 30: Misc.



Figure 31: Misc.




Figure 32: Misc.



Figure 33: Misc.




Figure 34: Misc.

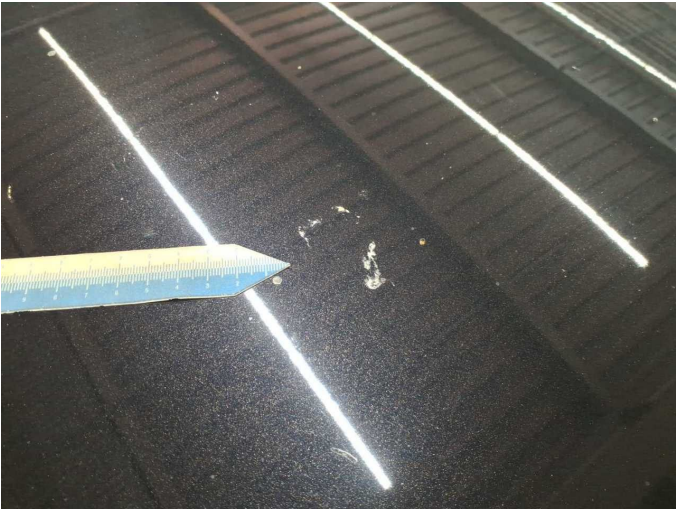

Damage 1: Bonnet: Bonnet - Soiled - Conditioning



Damage 1: Bonnet: Bonnet - Soiled - Conditioning

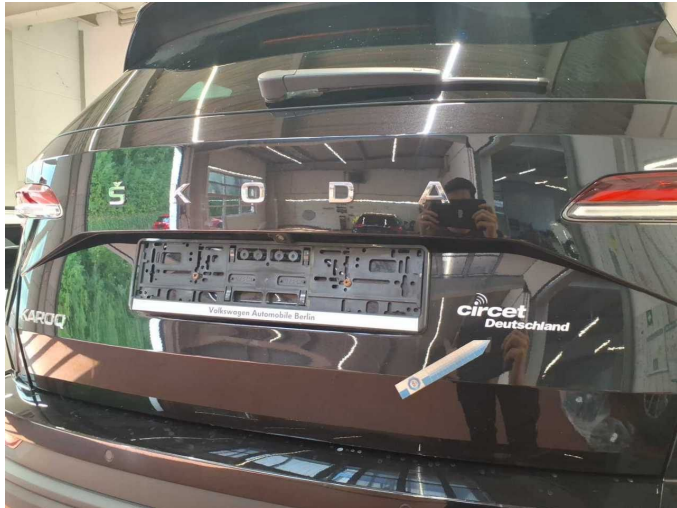

Damage 2: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage 2: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage 3: Front bumper: Spoiler - Scratched - Replace



Damage 3: Front bumper: Spoiler - Scratched - Replace



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 5: Front bumper: Front bumper - Scratched - Paint




Damage 5: Front bumper: Front bumper - Scratched - Paint




Damage 5: Front bumper: Front bumper - Scratched - Paint




Wear and tear 2: Door - front right side: Door - Dent / paintcoat damage - No deduction

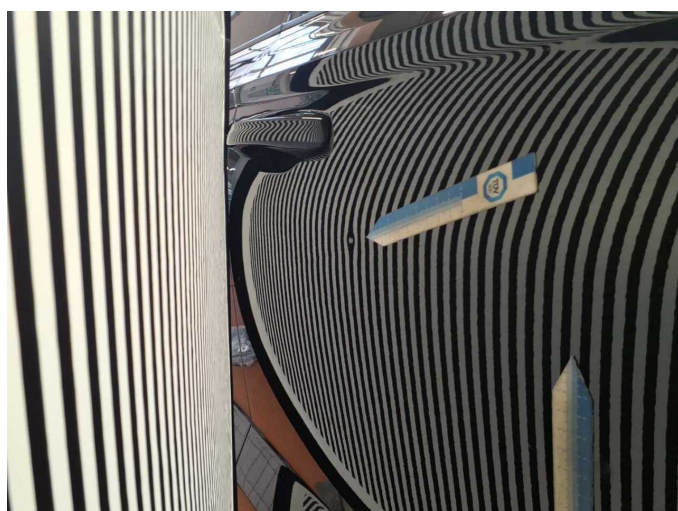

Wear and tear 2: Door - front right side: Door - Dent / paintcoat damage - No deduction

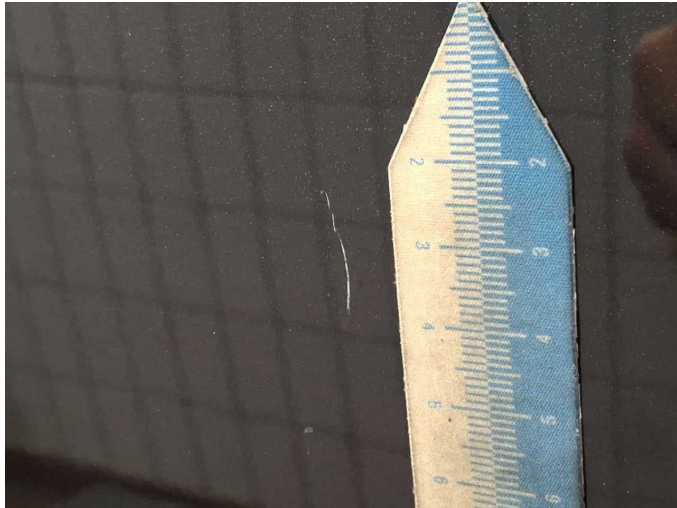

Wear and tear 2: Door - front right side: Door - Dent / paintcoat damage - No deduction

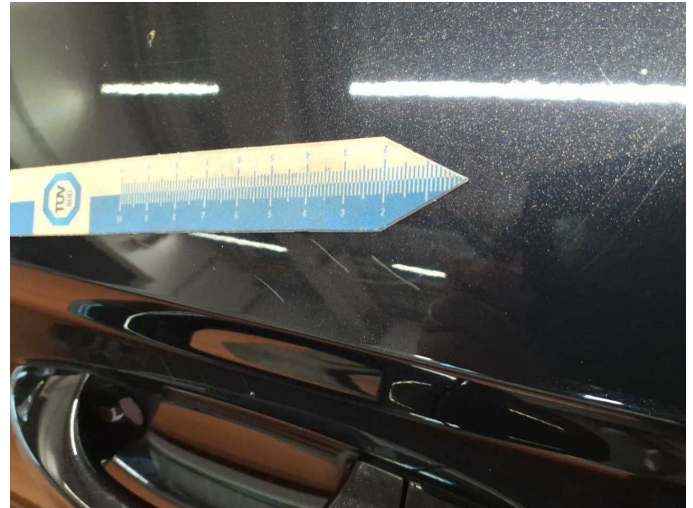

Wear and tear 4: Door - front left side: Door - Scratch(es) - No deduction



Wear and tear 4: Door - front left side: Door - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJR7NU8PC205721
Hersteller / Modell: SKODA SKODA Karoq 1.5 TSI DSG Style

Datum	KM-Stand	Beschreibung
09.06.2026	133.222	Reparatur Sonstiges; Systemtest/Eigendiagnose
19.02.2026	119.320	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
15.01.2026	115.212	AU; Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten
26.05.2025	89.699	Bremsflüssigkeit; Bremsflüssigkeit ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
26.08.2024	58.769	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
19.12.2023	29.903	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges