



Expertise

Protocol number: 46653717
Order No. / Reference: 26628489
Inspection date: 22 Jul 2026

Manufacturer: Mercedes-Benz

Model: GLC 300 d 4Matic 9G-TRONIC AMG Line

VIN: W1N2539191V321068



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLC 300 d 4Matic 9G-TRONIC AMG Line	
Vehicle Identification number	W1N2539191V321068
Mileage (Read)	143,175 km
First registration	28 Mar 2022
Number of holders	1
Next periodical technical inspection	03/2027
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,950 ccm / 4
Power	180 kW
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Schwarz
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	206 Tag(e)
Last service on / at	02/2026 at 128,390 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF696215
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / AKC 00133		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,510 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R20 105Y	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	225/45 R20 105Y	Summer tyres on Light alloy	Continental	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 107H	Winter tyres on Light alloy	Continental	7mm / 7mm
2)	235/60 R18 107H	Winter tyres on Light alloy	Continental	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- Anti-lock braking system (ABS)
- Automatic passenger airbag deactivation
- On-board computer
- Roof rails in polished aluminum
- Tachometer
- DYNAMIC SELECT
- Electronic Stability Program (ESP)
- Electric windows (4-way)
- Black floor mats with AMG lettering
- Rear window heated
- Interior headliner fabric crystal grey
- Climate: THERMATIC automatic climate control with 2 climate zones
- Communication module (LTE) for the use of Mercedes me connect services
- Paint finish: Solid
- Steering wheel: Multifunction sports steering wheel in 3-spoke design in black Nappa leather
- Steering: Sport direct steering
- Navigation accessories: Extended MBUX functions
- Package: Interior light
- Radio: MBUX multimedia system
- Radio accessories: Touchpad
- Remote Services Plus
- Power steering
- Seats: Rear seat backrests foldable
- Seats: Front seats electrically adjustable
- High-visibility vest for drivers
- Central locking
- Airbag: Kneebag for driver
- Airbag: Windowbags
- 4MATIC all-wheel drive
- ATTENTION ASSIST
- Heated exterior mirrors (left and right), electrically adjustable from inside
- Diesel particulate filter
- Third brake light in LED technology
- EASY-Pack cargo cover (removable)
- Driving light assistant
- electric parking brake
- Transmission: 9G-TRONIC
- rear window wiper
- KEYLESS-GO start function
- Remote trunk lid release
- Instrument cluster with 2 tubular round instruments, 13.97 cm (5.5") multifunction display
- Headrests 5-way
- LED High Performance Headlights
- Steering column mechanically adjustable in height and length
- Mercedes-Benz emergency call system
- Package: Storage
- Upholstery: ARTICO leatherette/DINAMICA microfiber
- Radio accessories: Digital radio
- Tire pressure monitoring system (TPMS)
- Windscreen wipers with rain sensor
- Seat: Front sports seats
- Seats: i-Size child restraint system on the outer rear seats
- Cruise control
- Immobiliser
- Decorative elements: black piano lacquer finish/light longitudinally brushed aluminum



Extra equipment

- Chassis: AGILITY CONTROL chassis (with selective damping system)
- Package: Advanced Park (Parking package with reversing camera, active parking assistant with PARKTRONIC)
- Package: AMG Line Exterior (AMG Styling, consisting of AMG front apron with sporty air intakes and chrome trim element, AMG rear apron in diffuser look with insert in black, diamond grille with pins in chrome, integrated Mercedes star and louvre in iridium silver matt with chrome insert, 2 visible tailpipe trims permanently integrated into the bumper)
- Package: Comfort (Seat heating for driver and front passenger, electric and manual adjustment options for driver and front passenger seats, electro-pneumatic 4-way lumbar support and lateral support adjustment with control element on the seat, electric seat cushion tilt adjustment, electric height adjustment, electric backrest adjustment, mechanical seat cushion depth adjustment by 6 cm with leg rest pad, mechanical longitudinal adjustment, mechanical headrest adjustment)
- Wheels: 50.8 cm (20") AMG light-alloy wheels, 4-spoke design (high-gloss black painted and polished with 255/45 R20 tires on 8.5 J x20 ET 40 rims)
- Auxiliary heating including auxiliary ventilation in summer
- Type designation removed from tailgate
- Decorative elements: Open-pore anthracite oak wood
- Paint finish: Special paint finish, solid color
- Navigation accessories: Pre-installation for Live Traffic Information (With Live Traffic Information, your navigation system receives real-time traffic data and optimizes dynamic route guidance. Thanks to precise and up-to-date information on traffic jams, stop-and-go traffic, and more, you are supported in reducing travel times.)
- Package: Business (Advanced Parking Package: Active Parking Assist PARKTRONIC with reversing camera; Advanced Infotainment Package: Media display with touch operation, smartphone integration - Apple CarPlay and Android Auto, connectivity package navigation, traffic sign assist; Comfort Package: Heated seats for driver and front passenger, seat comfort package - electric and manual adjustment options for the front seats; larger fuel tank capacity)
- Package: Night for AMG Line Exterior (radiator grille with diamond-shaped pins and louvre in high-gloss black, roof rails in black, front and rear underguards painted black, exterior mirror housings painted in high-gloss black, beltline trim strip and window surrounds in high-gloss black, heat-insulating dark tinted glass at the rear from the B-pillar)
- Partition net for luggage compartment separation (and occupant protection)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Interior	Cigarette lighter (Abdeckung) - Broken / torn - Replace
2	Front bumper	Bumper - front right side (Zierleiste) - Scratched - Replace
3	Side panel - rear right side	Side panel - dent(s) - Smart repair
4	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
5	Rear bumper	Rear bumper - Scratch(es) - Smart repair
6	Mudguard - right side	Wheel arch - Scratched - Replace
7	Front bumper	Front bumper - Scratch(es) - Paint
8	Door - rear right side	Door - Dent / paintcoat damage - Paint
9	Door - front left side	Door edge - Scratch(es) - Paint



Wear and tear

No.	Component group	Description
-----	-----------------	-------------

1	Bonnet	Bonnet - Stone chips - No deduction
---	--------	-------------------------------------

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
-----	-----------------	------------------------

1	Rear, Provided by user / customer, from 5 Mar 2024	4.139,76 €
---	--	------------

Repainting

No.	Repainting
-----	------------

1	Boot lid / rear door, Professionally carried out, Invoice of repair done Non-existent
---	---

Paint coat thickness measurement

Boot lid / rear door	221 µm
----------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.
- Der beiliegende Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

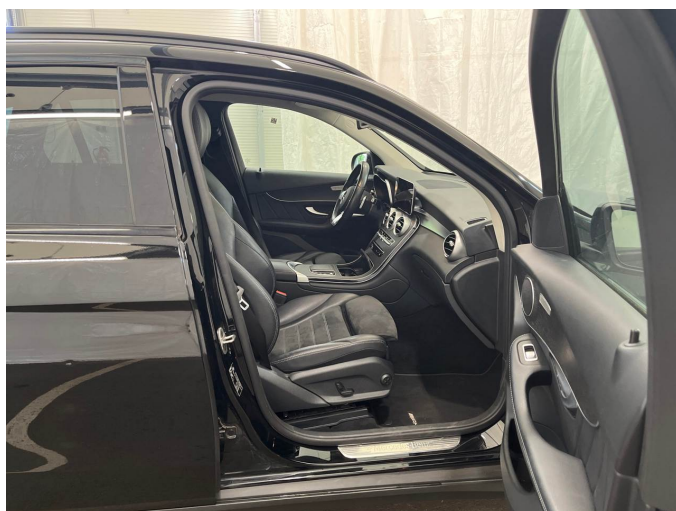


Figure 5: Interior - front

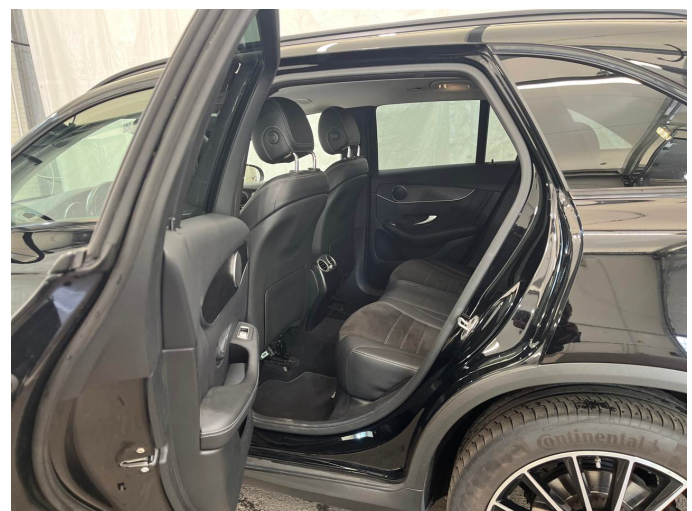


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

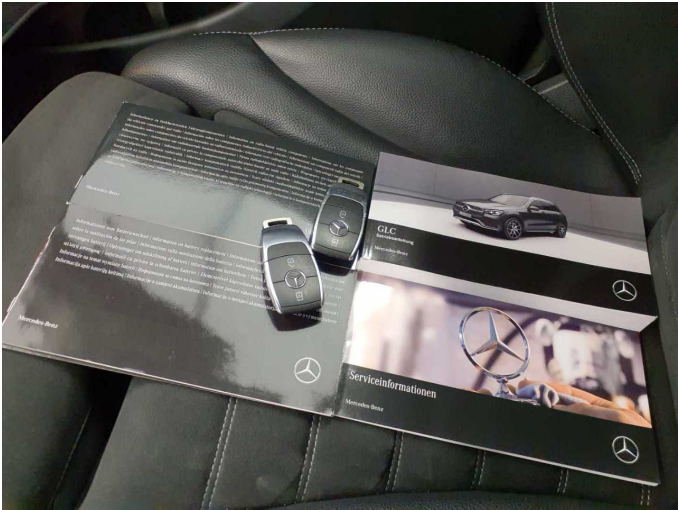


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.


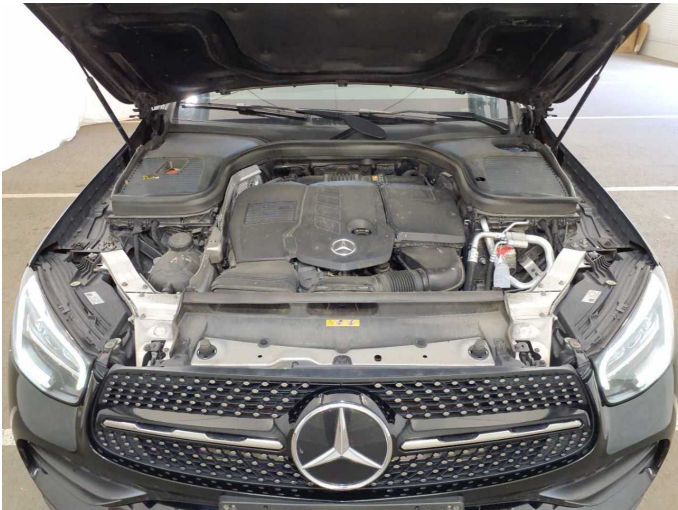



Figure 30: Misc.




Damage 1: Interior: Cigarette lighter (Abdeckung) - Broken / torn - Replace

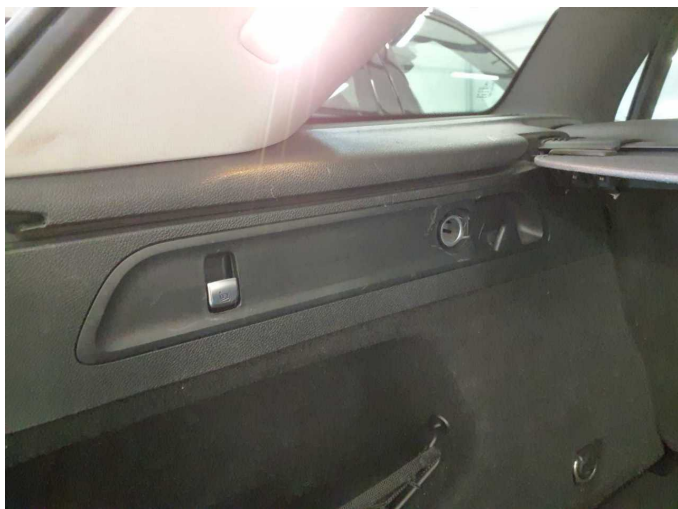

Damage 1: Interior: Cigarette lighter (Abdeckung) - Broken / torn - Replace

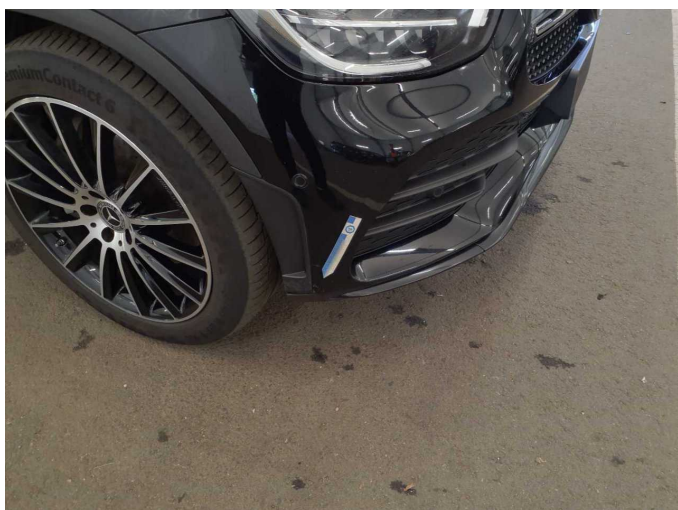

Damage 2: Front bumper: Bumper - front right side (Zierleiste) - Scratched - Replace

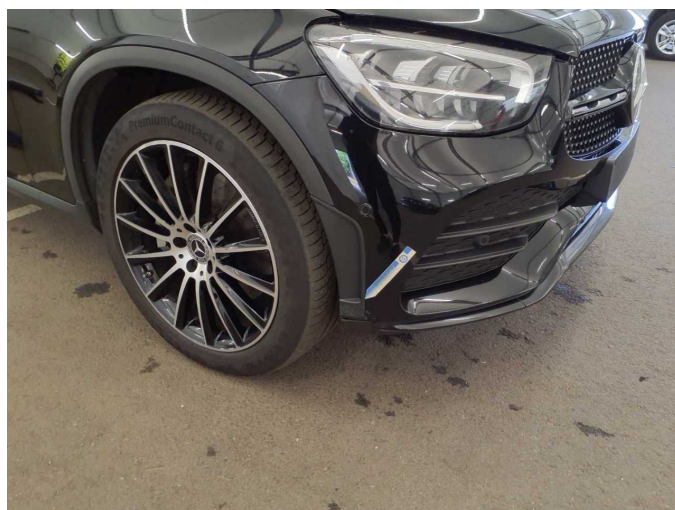


Damage 2: Front bumper: Bumper - front right side (Zierleiste) - Scratched - Replace




Damage 2: Front bumper: Bumper - front right side (Zierleiste) - Scratched - Replace




Damage 3: Side panel - rear right side: Side panel - dent(s) - Smart repair

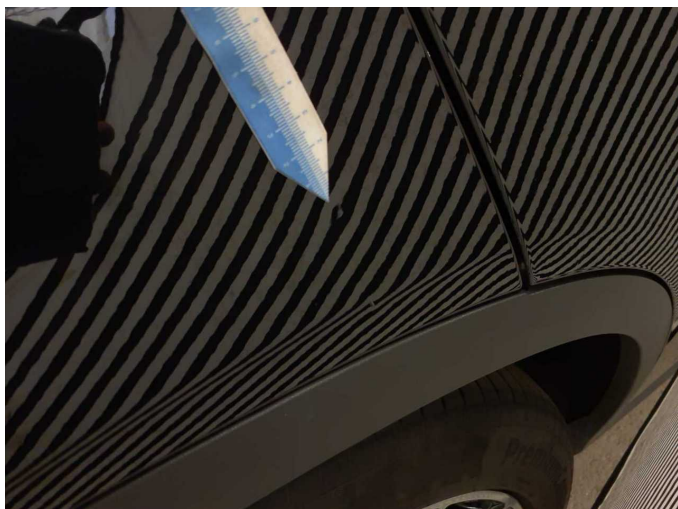


Damage 3: Side panel - rear right side: Side panel - dent(s) - Smart repair

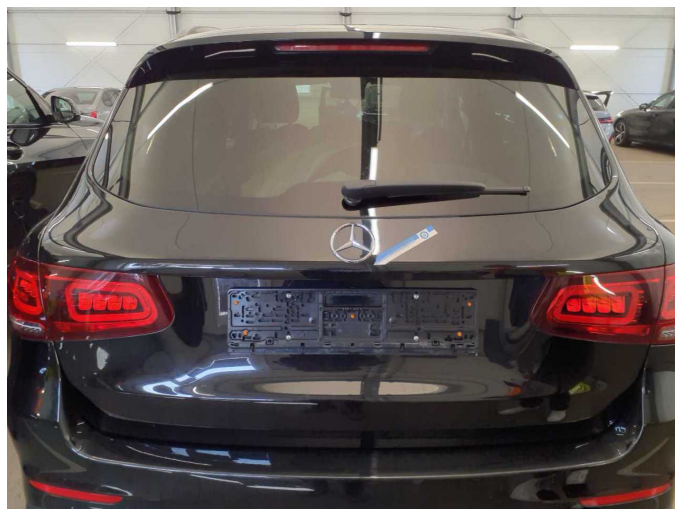

Damage 4: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

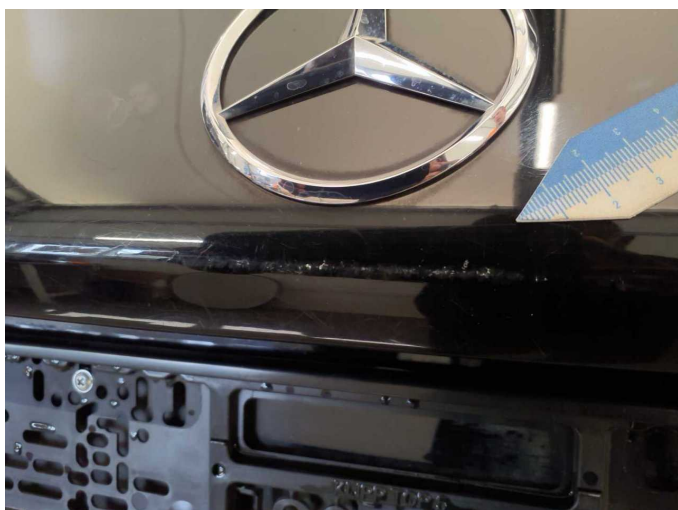


Damage 4: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

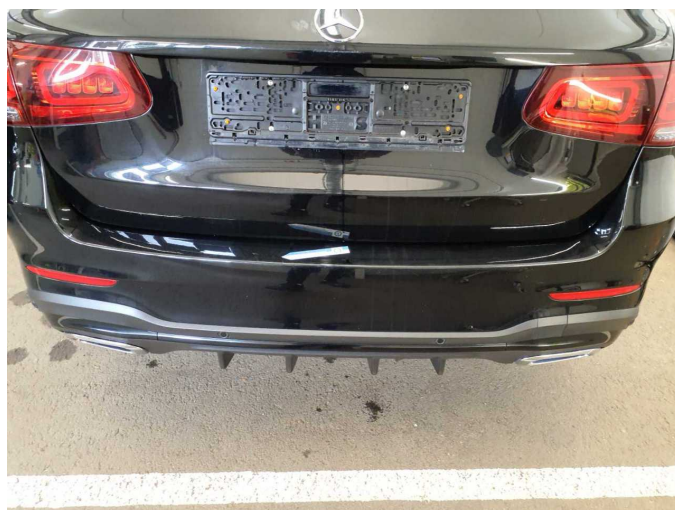

Damage 5: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Smart repair

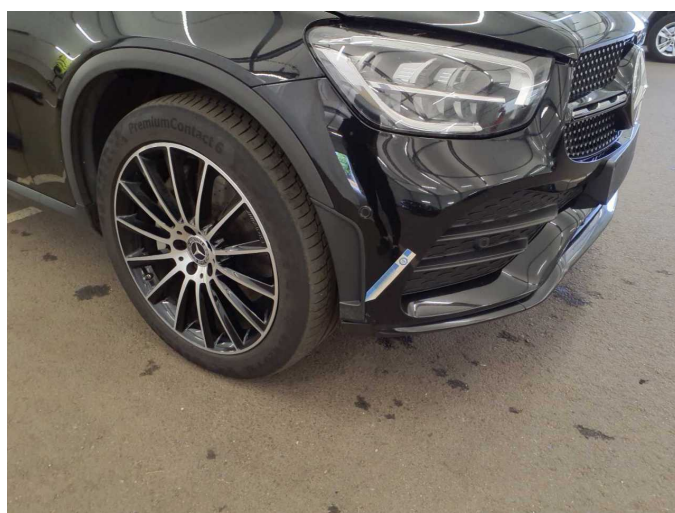

Damage 6: Mudguard - right side: Wheel arch - Scratched - Replace



Damage 6: Mudguard - right side: Wheel arch - Scratched - Replace




Damage 7: Front bumper: Front bumper - Scratch(es) - Paint




Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 8: Door - rear right side: Door - Dent / paintcoat damage - Paint

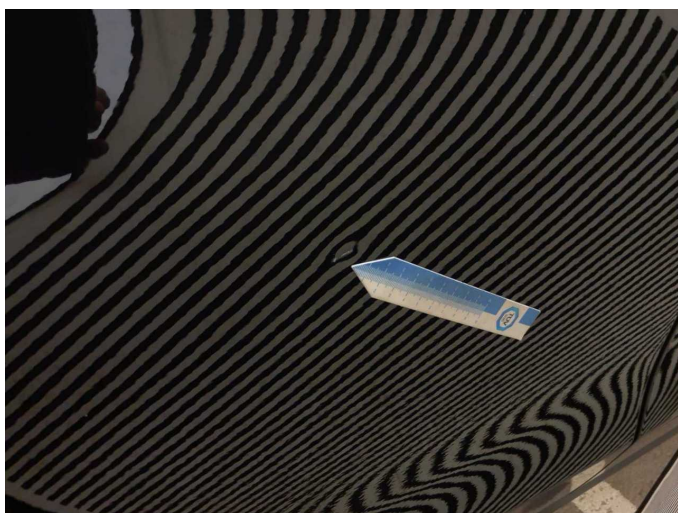

Damage 8: Door - rear right side: Door - Dent / paintcoat damage - Paint

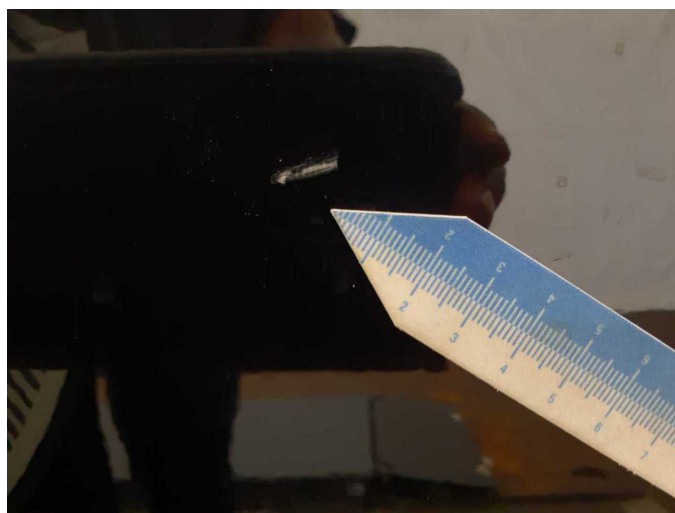

Damage 8: Door - rear right side: Door - Dent / paintcoat damage - Paint



Damage 9: Door - front left side: Door edge - Scratch(es) - Paint



Damage 9: Door - front left side: Door edge - Scratch(es) - Paint



Damage 9: Door - front left side: Door edge - Scratch(es) - Paint



Damage 9: Door - front left side: Door edge - Scratch(es) - Paint



Repainting 1: Boot lid / rear door



Repainting 1: Boot lid / rear door



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N2539191V321068

Hersteller / Modell: MERCEDES-BENZ MB GLC 300 d 4Matic 9G-TRONIC AMG Line

Datum	KM-Stand	Beschreibung
05.02.2026	128.390	Regelwartungsdienst
30.07.2025	102.435	Regelwartungsdienst
03.03.2025	87.097	AU
29.10.2024	77.094	Bremsinspektion vo + hi
04.10.2024	75.508	Regelwartungsdienst
24.09.2024	73.490	Reparatur Sonstiges; Reparatur Sonstiges; Systemtest/Eigendiagnose
26.01.2024	52.764	Regelwartungsdienst
24.01.2023	25.624	Regelwartungsdienst