



CITROËN BERLINGO: FR-095-LC

Vinnumber:	VR7EFYHWCLN518418	Versionname:	CITROËN BERLINGO Taille M 1000kg BlueHDi 75 S&S BVM Club VU [4P] bvm 5-75CH-5cv (fourgonnettesimple cabine)
First Registrationdate:	17/07/2020	Fiscalpower:	55
Expertise Mileage:	163117	Power Kw:	White
Bodytype:	Transporter	Body colour:	Opaque
Gearbox:	MAN 5 VIT	Paint type:	Grey
Transmission:	Front	Interior colour:	Steel
Fueltype:	Diesel	Type of rims (mounted):	Black
Engine functioning:	Yes	Dashboard color:	
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	3		
Number head rests:	3		
Type of rims (mounted):	Steel		
Category:	Light Commercial Vehicle		

Options

Number of keys total	1	Radio	
Number keys remote	1	Rear parking sensors	
Windows electric F		Sliding door right-side	
Cruise Control		Seat cover lining	Lining Other
Type of climate control	Manual climate control		

Tyres


215/65/16/102 V			
Summer tyres:	Fr.L.	Hankook: 50%	Fr.R.
	Re.L.	Hankook: 50%	Re.R.
Tyre profile depth FL			5.0
Tyre profile depth FR			5.0
Tyre profile depth RL			5.0
Tyre profile depth RR			5.0
Tyre size FL			215/65 R 16 102 V
Tyre size FR			215/65 R 16 102 V
Tyre size RL			215/65 R 16 102 V
Tyre size RR			215/65 R 16 102 V
Tyre type FL			All seasons
Tyre type FR			All Seasons
Tyre type RL			All seasons
Tyre type RR			All Seasons
Tyre make FL			260
Tyre make FR			260
Tyre make RL			260
Tyre make RR			260

Assistance equipment

Spare wheel	Yes	Jack	Yes
Remote ignition key, Missing, Repair/replace (lump sum)			



Steering wheel, Worn, Replace

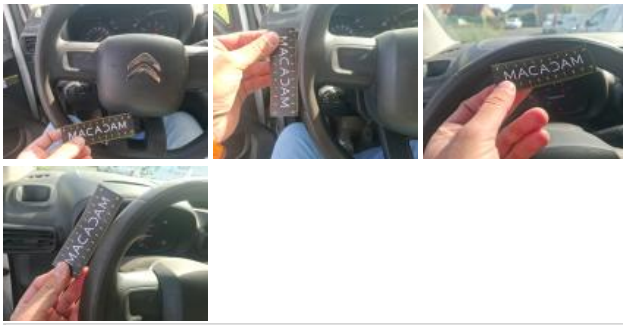

Interior, Dirty, Chemical cleaning



Air vent, mid-dashboard, Broken, Replace



Air vent, mid-dashboard, Broken, Replace



Wheel cover FR, Missing, Replace



Outer sill L, Dent(s) and scratch(es), Repair and paint (complete)



Side wall RL, Dent(s), Repair and paint (complete)



Door FL, Dent(s) and scratch(es), Repair and paint (complete)



Bumper F, Scratch(es), Repair and paint (complete)



Windscreen, Broken, Replace



Windscreen glue kit, Required to install glazing, Repair/replace (lump sum)



Outer sill R, Dent(s) and scratch(es), Repair and paint (complete)



Outer door handle RR, Incomplete, Replace



Historique Maintenance

Immatriculation: FR-095-LC Date de 1ère immatriculation: 17/07/2020

Modèle: Citroen BERLINGO Taille M 1000kg BlueHDi 75 S&S BVM Club VU [4P] bvm 5-75CH-5cv (fourgonnettesimple cabine)

Date	Kilométrage	Fournisseur	Descriptif
02/10/2025	146.215	SOC REPAR AUTO ALIZON FRERES	FAP RPLT
	0		RECYCLAGE
	0		ESSAI
	0		INJECTEUR ADBLUE RPLT
	0		CAPTEURS DIVERS RPLT
21/07/2025	141.326	SOC REPAR AUTO ALIZON FRERES	DIAG
	0		DEBITEMTRE AIR RPLT
29/04/2025	140.618	SOC REPAR AUTO ALIZON FRERES	BARRE STABILISATRICE RPLT
	0		FERMETURE DOSSIER TECHNIQUE
	0		KIT DISTRIBUTION RPLT
	0		POMPE A EAU RPLT
	0		KIT ACCESSOIRES RPLT
08/01/2025	133.813		COURROIE ACCESSOIRES RPLT
	0		REVISION ET CLIM ET AIR ET CARBURANT
10/12/2024	131.494	ACO SECURITE	CONTRE VISITE CT
03/12/2024	131.010		PLAQUETTES AV RPLT
	0		RESERVOIR ADBLUE RPLT
	0		INJECTEUR ADBLUE RPLT
28/10/2024	128.195	ACO SECURITE	CONTROLE TECHNIQUE
28/04/2023	78.823	CARTEN POITOU BY AUTOSPHERE	RECYCLAGE
	0		DISQUES PLAQUETTES AV RPLT
	0		DISQUES PLAQUETTES AR RPLT
21/04/2022	49.533		REVISION ET CLIM ET AIR ET CARBURANT
	0		LIQUIDE DE FREIN