



Expertise

Protocol number: 46551342
Order No. / Reference: 26695140
Inspection date: 16 Jul 2026

Manufacturer: Mercedes-Benz

Model: E 220 d 4Matic T 9G-TRONIC Avantgarde

VIN: W1K2132051B070871



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz E 220 d 4Matic T 9G-TRONIC Avantgarde	
Vehicle Identification number	W1K2132051B070871
Mileage (Read)	63,340 km
First registration	21 Apr 2022
Number of holders	2
Next periodical technical inspection	04/2027
(Report not on hand)	
Power / Engine displacement	147 kw / 1,993 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	Station wagon
Colour / colour code	GRAPHITGRAU - METALLICLACK
Doors / Seats	5 / 5
Upholstery type	Artificial leather
Colour of upholstery	Black-Grey
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	12 Tag(e)
Last service on / at	07/2025 at 51,433 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ451217
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	2222 / BEH 00037		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,590 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R18 100V	Winter tyres on Light alloy	Goodyear	7mm / 7mm
2)	245/45 R18 100V	Winter tyres on Light alloy	Goodyear	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R18 100Y	Summer tyres on Light alloy	Goodyear	5mm / 5mm
2)	245/45 R18 100Y	Summer tyres on Light alloy	Goodyear	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ADAPTIVE BRAKE with hill start assist, pre-filling and drying braking in wet conditions
- Airbag: Automatic passenger airbag deactivation
- Airbag: Side airbag for driver and front passenger
- 4MATIC all-wheel drive
- AMG sports pedal assembly made of brushed stainless steel with rubber studs
- Foldable armrest for driver and front passenger
- Left and right exterior mirrors, heated and electrically adjustable, painted in body color
- Brake assist, active
- Tachometer
- DYNAMIC SELECT
- EASY-PACK tailgate
- Chassis: AGILITY CONTROL chassis with selective damping system and lowered suspension
- Velour floor mats
- Transmission: 9-speed automatic, 9G-TRONIC
- rear window wiper
- KEYLESS START
- Headrests 5-way adjustable for driver and front passenger, 4-way adjustable, and 2-way adjustable in the rear.
- Steering column mechanically adjustable in height and length
- Center console piano black finish
- Navigation accessories: Pre-installation for Live Traffic Information
- Package: AVANTGARDE Exterior
- Upholstery: ARTICO leatherette/Norwich fabric
- Radio: Extended MBUX functions
- Radio accessories: Digital radio
- Tire pressure monitoring system
- Remote Services Plus
- Power steering
- Seats: Rear seat backrests foldable, 40/20/40 split
- Touchpad
- Electronic immobilizer
- Central locking
- AdBlue tank with a capacity of 23.5 liters
- Airbag for driver and front passenger
- Airbag: Kneebag for driver
- Airbag: Windowbags left/right
- Premium ambient lighting with 64 colors and 3 color zones
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Attention Assist
- Basic services
- On-board computer
- Diesel particulate filter
- Third brake light
- EASY-PACK cargo cover including EASY-PACK safety net
- Electronic Stability Program (ESP)
- Chassis: Air suspension on the rear axle with level control
- Electric window regulator with comfort operation and anti-pinch protection, 4-way
- Heated rear window with timer
- Interior headliner in nevagrau fabric
- THERMATIC automatic climate control
- Paint finish: Solid
- LED High Performance Headlights
- Steering wheel: Multifunction steering wheel in Nappa leather in a 3-spoke design
- Mercedes-Benz emergency call system
- Center console with on-the-fly storage compartment
- Navigation: Hard disk navigation
- Package: Storage
- Package: Seating comfort
- PRE-SAFE system
- Radio: MBUX multimedia system
- Radio accessories: Communication module (LTE) for using Mercedes me connect services
- Windscreen wipers with rain sensor
- Seats: i-Size child seat attachment
- Power outlet: 12V socket in the cargo area
- High-visibility vest for drivers
- Green, heat-insulating glass all around
- Decorative elements: aluminum with longitudinal brushing, light finish



Extra equipment

- Suspension: AIR BODY CONTROL
- Fuel tank with larger volume 66 l
- Paint finish: Metallic
- Package: Acoustic Comfort Package (windshield and front side windows in laminated safety glass with special film and reflective coating: noise and heat insulating, infrared and UV absorbing, burglar-resistant - further sound insulation measures: reinforced fleece in the doors, reinforced rear floor carpet, insulated chassis components)
- Package: Business (without MBUX Augmented Reality)
- Package: Driving Assistance Package Plus (Active Distance Assist DISTRONIC incl. Active Speed Limit Assist, Extended Automatic Restart on Motorways, Route-Based Speed Adaptation with Traffic Jam Function (only when Parking Packages are selected), Active Steering Assist incl. Active Emergency Stop Assist with SOS Function, Emergency Lane Radio, Active Brake Assist incl. Turn and Intersection Radio, Traffic Jam Emergency Brake Radio, Evasive Steering Assist, Active Lane Keeping Assist, Active Blind Spot Assist incl. Exit Warning, Pedestrian Warning Radio, PRE-SAFE Impulse Side, Active Traffic Jam Assist)
- Package: Memory (driver and front passenger seats, steering column and exterior mirrors electrically adjustable and storable - seat longitudinal position and headrest height additionally electrically adjustable - distribution of the heated areas of the seat cushion and seat backrest storable - position of the optional head-up display adjustable and storable - 4-way lumbar support for driver and front passenger - seat cushion depth adjustment with gapless cushion - PRE-SAFE positioning function for the front passenger seat)
- Radio accessories: MBUX Interior Assistant (3D camera in the overhead control unit - the system detects and interprets hand movements and distinguishes between driver and front passenger - highlights or enlarges specific elements in the media display (media/radio, seat settings, navigation or Active Parking Assistant) - activate reading light - move hand up and down below the interior mirror - activate searchlight - extend hand to the unoccupied front passenger seat - call up personal favorites)
- Wheels: Complete winter wheel sets fitted at the factory
- Type designation removed from trunk lid
- Head-up display (lens and mirror system projects a virtual image into the driver's field of vision - full-color display that is easily readable even on sunny days and at night - depending on the equipment, display of, for example, navigation instructions, speed, speed limits or settings of cruise control or active distance assist DISTRONIC)
- Package: Business (MBUX High-End Package - Connectivity Package Navigation - Traffic Sign Assist - Smartphone Integration (Apple CarPlay and Android Auto) - Preparation for Digital Key Handover - Widescreen Cockpit - Wireless Charging System for Mobile Devices - MBUX Augmented Reality for Navigation - Heated Seats for Driver and Front Passenger - Parking Package with Rearview Camera - Fuel Tank with 66 Liter Capacity (916) (60l for Diesel Plug-in Hybrids).)
- Package: MBUX High-End Package (MBUX Augmented Reality for Navigation - Traffic Sign Assist - Connectivity Package Navigation: Hard drive navigation, Extended navigation services, Destination input via touch function or voice control, Near Field Communication (NFC) - Widescreen Cockpit with 12.3 inches - Wireless charging system for mobile devices - Smartphone integration: merges the mobile phone with the media system via Apple CarPlay and Android Auto - Preparation for digital key handover)
- Package: Parking package with reversing camera
- Package: Mirror
- Package: Warmth and Comfort
- Radio accessories: Burmester surround sound system (13 high-performance speakers - 9-channel DSP amplifier with a total output of 590 W - Frontbass technology with woofers integrated into the body shell for powerful bass reproduction - Sound optimization for the front and rear seats - Noise cancellation (VNC) - Sound preset: Surround function to generate a virtual surround sound - Multi-channel format support for true surround sound)
- Wheels: 45.7 cm (18") alloy wheels, 4-piece set in 5-twin-spoke design, painted tremolite grey (gloss-turned front axle: 8 J x 18 ET 43, tire size 245/45 R 18 rear axle: 9 J x 18 ET 53, tire size 275/40 R 18)
- Wheels: Complete summer wheel sets fitted at the factory
- Wheels: Winter complete set of wheels M+S 4x 45.7 cm (18") light alloy wheels 5-spoke design (black painted and gloss turned 245/45 R 18 on 8 J x 18 ET 43)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Seat - rear	Armrest - centre - Deformed - Smart repair
2	Tail light	Tail lamp - left side - Broken / torn - Replace
3	Rear bumper	Bumper with Parktronic - Scratched - Paint
4	Vehicle glazing	Windscreen - Broken / torn - Replace

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side - left, Side right, Provided by user / customer, from 2 Dec 2022	23.115,04 €

Repainting

No.	Repainting
1	Roof rail - left side, Roof rail - right side, Mudguard - right side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front right side

Paint coat thickness measurement

Roof rail - left side	187 µm	Roof rail - right side	182 µm
Mudguard - right side	246 µm	Bonnet	271 µm
Side panel - rear left side	220 µm	Side panel - rear right side	407 µm
Door - rear left side	224 µm	Door - rear right side	194 µm
Door - front right side	256 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

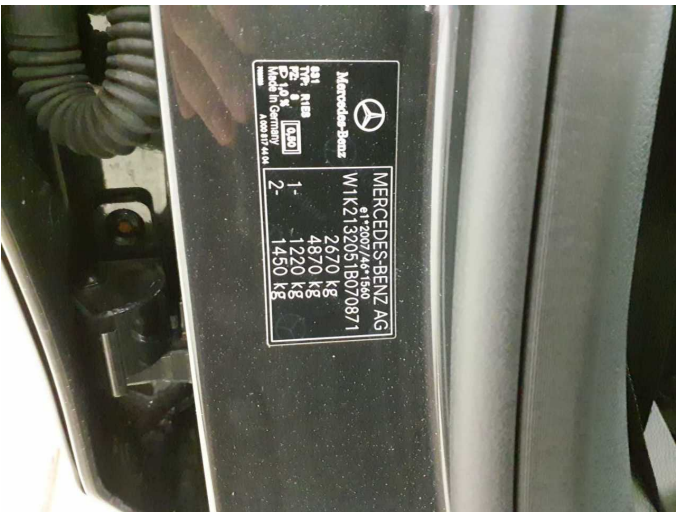


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.




Figure 21: Misc.




Figure 22: Misc.




Figure 23: Misc.

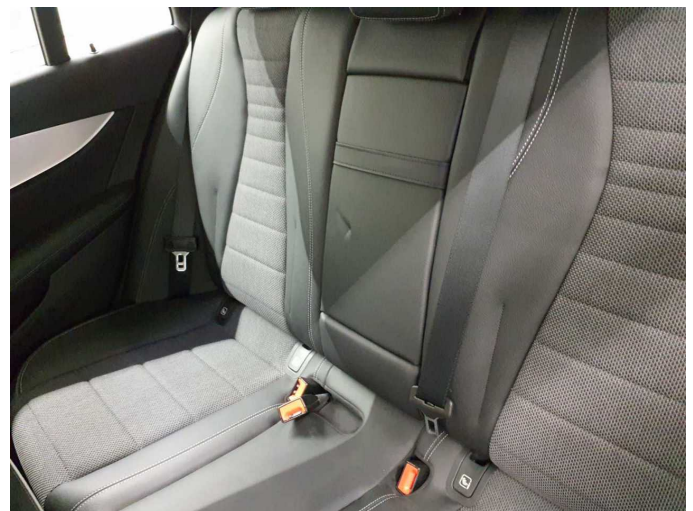


Damage 1: Seat - rear: Armrest - centre - Deformed - Smart repair

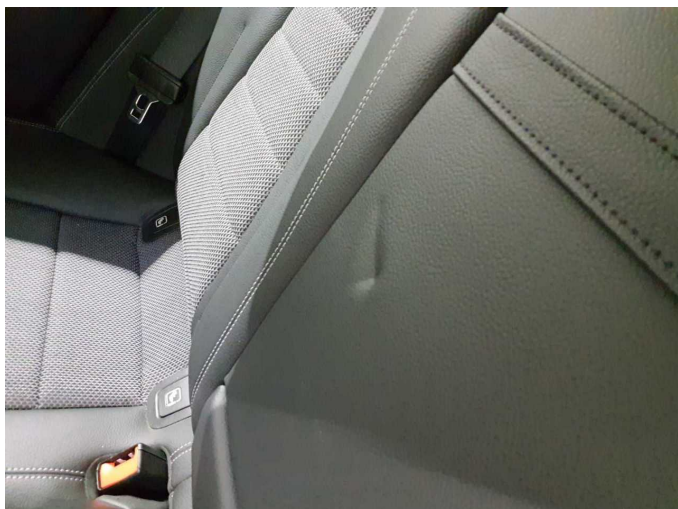


Damage 1: Seat - rear: Armrest - centre - Deformed - Smart repair

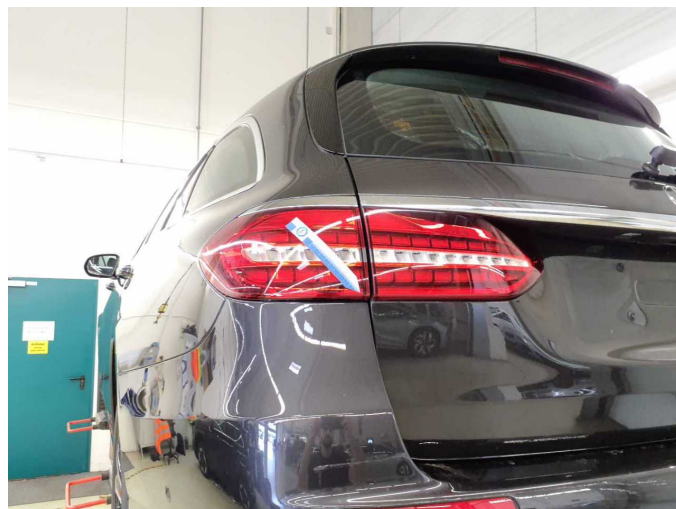

Damage 2: Tail light: Tail lamp - left side - Broken / torn - Replace

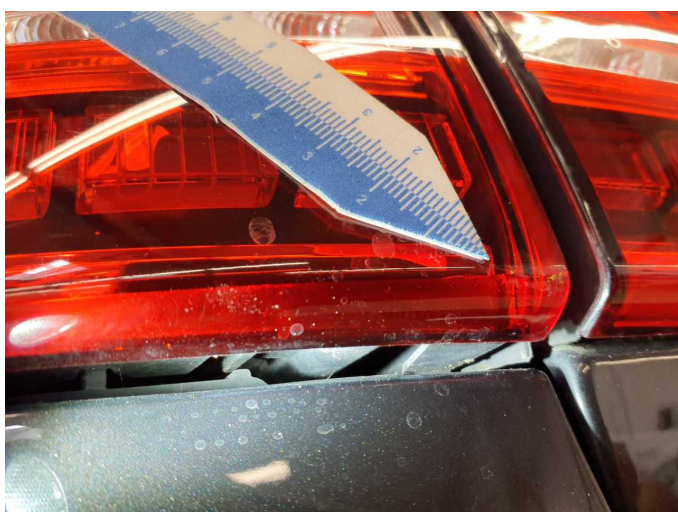


Damage 2: Tail light: Tail lamp - left side - Broken / torn - Replace

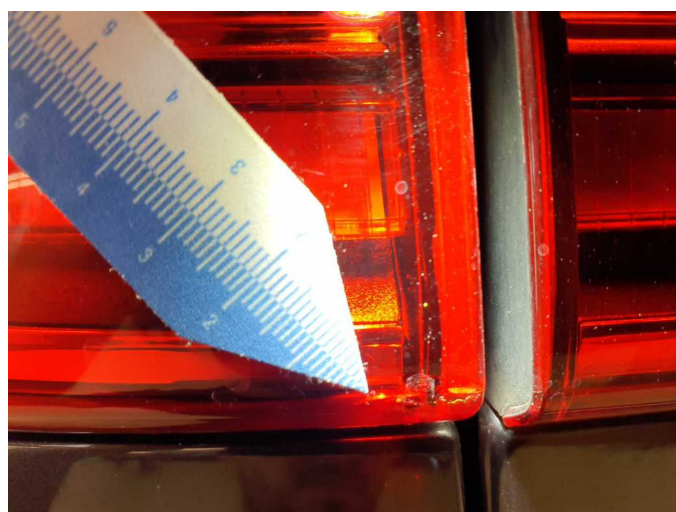

Damage 2: Tail light: Tail lamp - left side - Broken / torn - Replace



Damage 3: Rear bumper: Bumper with Parktronic - Scratched - Paint

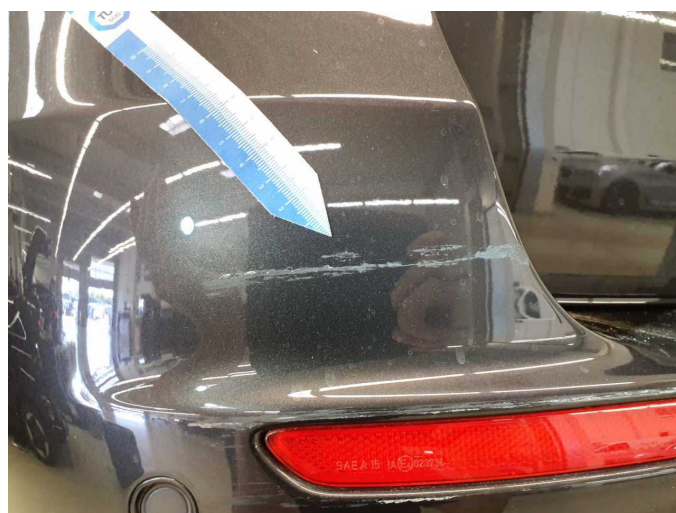

Damage 3: Rear bumper: Bumper with Parktronic - Scratched - Paint




Damage 3: Rear bumper: Bumper with Parktronic - Scratched - Paint



Damage 3: Rear bumper: Bumper with Parktronic - Scratched - Paint



Damage 3: Rear bumper: Bumper with Parktronic - Scratched - Paint

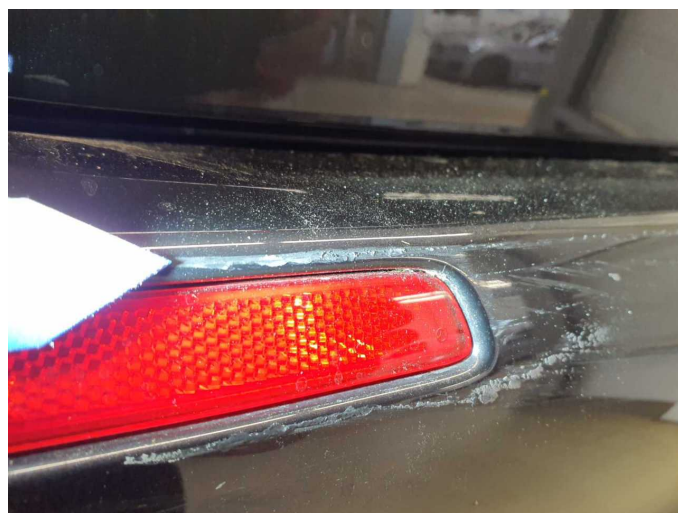


Damage 3: Rear bumper: Bumper with Parktronic - Scratched - Paint




Damage 3: Rear bumper: Bumper with Parktronic - Scratched - Paint



Damage 4: Vehicle glazing: Windscreen - Broken / torn - Replace

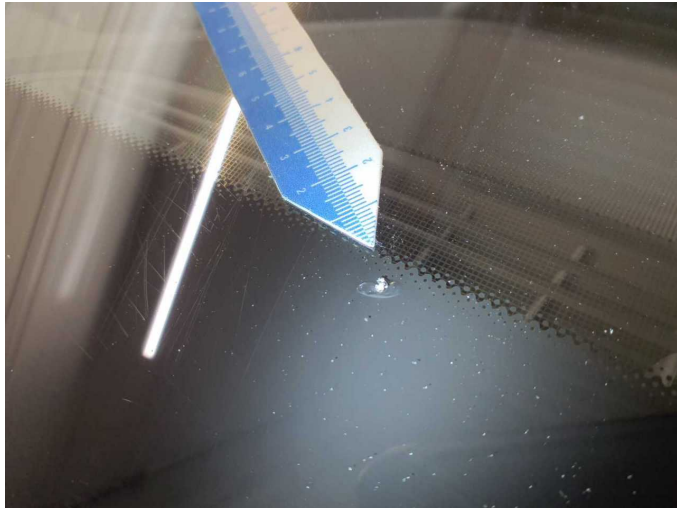

Damage 4: Vehicle glazing: Windscreen - Broken / torn - Replace

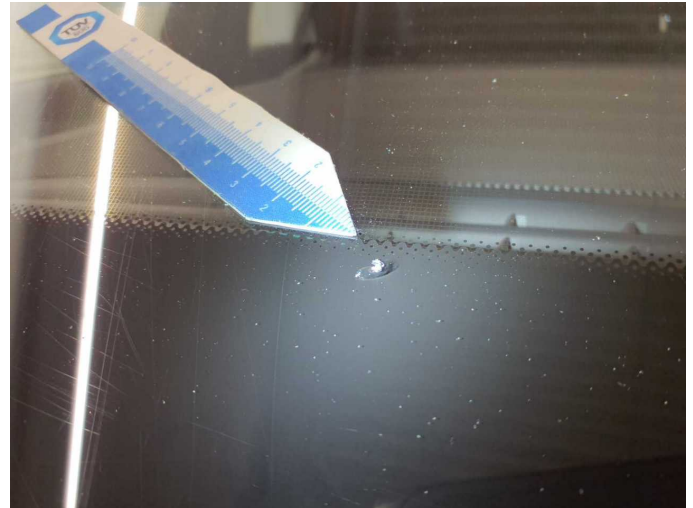

Damage 4: Vehicle glazing: Windscreen - Broken / torn - Replace



Roof rail - left side: 187 µm



Roof rail - right side: 182 µm



Mudguard - right side: 246 µm



Bonnet: 271 µm



Side panel - rear left side: 220 µm



Side panel - rear right side: 407 µm



Door - rear left side: 224 µm



Door - rear right side: 194 µm



Door - front right side: 256 µm