



Expertise

Protocol number: 46533569
Order No. / Reference: 26637620
Inspection date: 13 Jul 2026

Manufacturer: Volvo

Model: XC40 T5 Recharge DKG RDesign

VIN: YV1XZBBVFN2756602



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo XC40 T5 Recharge DKG RDesign	
Vehicle Identification number	YV1XZBBVFN2756602
Mileage (Read)	114,443 km
First registration	31 Mar 2022
Number of holders	1
Next periodical technical inspection	03/2027
(Report on hand)	
Power / Engine displacement	132 kw / 1,477 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufl / 3
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Thunder Grey Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Anthracite-Black
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	319 Tag(e)
Last service on / at	06/2026 at 111,071 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF849891
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	9101 / BOD 00026		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,290 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 103V	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	235/50 R19 103V	Summer tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 07/2029		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 12-volt power outlet in the luggage compartment
- Acoustic Vehicle Alerting System (AVAS) (Acoustic pedestrian/cyclist protection through artificially generated driving noises in the speed range up to 20 km/h)
- Ambient lighting (Extended interior lighting with: - Ambient lighting (multicoloured) front and rear - Exit lights front - Illuminated door pockets front - Illuminated decorative inserts (in dashboard and front doors) - Reading lights rear - Work light on the tailgate)
- Anthracite headliner
- Automatic climate control with 2-zone temperature control (including separate temperature control for driver and front passenger, automatic blower control and air distribution including CleanZone air quality system with activated carbon filter with pre-ventilation and reheating of the interior when the engine is switched off via Volvo On Call smartphone app or menu)
- Automatic emergency braking (locking the vehicle after the airbags or seatbelt pretensioners have been deployed to prevent secondary accidents.)
- Automatic tailgate (electric)
- Chassis: Dynamically designed
- Connected Safety (Cloud-based warning of slippery road conditions and vehicles with hazard warning lights activated)
- Digital instrumentation (12.3" full graphic display (31.2 cm diagonal) with two variable round instruments and information display (e.g. for navigation map view))
- Driver Alert - Attention Warning
- Electric parking brake
- Electrically adjustable exterior mirrors (driver and passenger side with wide-angle optics)
- Electronic differential lock
- First aid kit and warning triangle
- Glazing: Colored glazing
- Hill start assist
- Intelligent driver information system (delays incoming calls or vehicle information in dangerous situations)
- Interior and exterior mirrors automatically dimming
- ISOFIX mounting for the outer rear seats
- Keyless Drive (electronic access system) with sensor-controlled tailgate, illuminated door handles and puddle lights
- Navigation: Sensus navigation system (3D navigation - Dynamic route guidance with real-time traffic information - Local search (search for surroundings using keywords with information, ratings and photos) - Send-to-car (route planning via smartphone) - Volvo Lifetime MapCare (free map updates) - Destination input via natural voice control)
- Optical underbody protection front and rear in high-gloss black
- Otto particulate filter
- Pass-through hatch behind the center armrest in the rear
- Radio accessories: Two USB ports in the front center console
- 12-volt socket at the front
- Active safety belts with belt tensioners
- Airbags (driver and front passenger airbags with two-stage deployment system - driver's knee airbag - driver and front passenger side airbags - head/shoulder airbags (IC) for all occupants)
- Aluminum door sill plates with Recharge lettering, front
- Aluminum insert Cutting Edge
- Anti-lock braking system (ABS) with electronic brake force distribution
- Central locking with two remote controls and integrated emergency key (including automatic locking of the doors while driving (can be deactivated))
- Child safety lock (manual for the rear doors)
- City Safety (Automatic emergency braking system with detection of vehicles, cyclists, pedestrians and large animals, including intersection braking assistant and emergency braking assistant for oncoming traffic)
- Cruise control
- Deactivation of the high-voltage battery (in case of a collision)
- Drive Mode (driving mode settings for engine, transmission, steering and brakes)
- Electric windows front and rear (with auto-down and auto-up function)
- Electrically folding exterior mirrors
- Electronic stability control
- Emergency brake lights (brake lights flash rapidly during heavy deceleration; hazard warning lights are automatically activated below 10 km/h)
- Fog light
- Fold-out (bag) hook on the glove compartment
- Front center armrest with integrated storage compartment
- Front headrests
- Front seat belt height adjustment
- Heated exterior mirrors and rear window
- Heated windshield washer nozzles
- Hill descent control
- Immobiliser
- Interior lighting, extended (ambient lighting (white) in the front, illuminated make-up mirrors on driver and passenger side, floor lighting in the front, luggage compartment lighting on both sides, glove compartment lighting.)
- Keyless Start (electronic engine start system)
- Lane Keeping Aid (LKA) (Active Lane Keeping Assistant)
- Lashing eyes (four) in the luggage compartment
- LED headlights "Thor's Hammer" (with high beam assist, automatic headlight range control and integrated LED daytime running lights)
- LED turn signals integrated into the exterior mirrors



- Rain sensor
- Rear center armrest with two integrated cup holders
- Rear parking assist
- Recharge emblem on the C-pillar
- Road Edge Detection (system to protect against unintentional leaving of the roadway through steering and braking interventions)
- Roof rails in high-gloss black (integrated)
- Seats: Lumbar support (4-way adjustable) for driver and front passenger seats
- Seats: Whiplash protection system WHIPS (including immersion protection on all seats and energy-absorbing seat cushions in the front)
- Sensus Connect infotainment system (9" touchscreen (22.9 cm diagonal) - Bluetooth hands-free system incl. audio streaming - Digital vehicle owner's manual - Digital radio reception (DAB+) - Internet access incl. internet radio and apps (via paired smartphone) - Voice control)
- Sport pedals
- Steering wheel adjustable for height and reach
- Steering wheel: Multifunction buttons on the steering wheel
- Textile floor mats: Sport textile floor mats front and rear
- third brake light
- Transmission: 7-speed dual-clutch transmission
- Upholstery: Nubuck textile/partially Nappa leather (including rear center armrest with two integrated cup holders and pass-through hatch behind the center armrest in the rear)
- Volvo On Call with Wi-Fi hotspot and private car sharing function (including integrated modem, external antenna and Wi-Fi hotspot for mobile devices). Volvo On Call features: automatic emergency call function with transmission of vehicle position and data, as well as alerting the Volvo On Call service center at the touch of a button (10-year usage period). Additionally, various convenience services are available via the smartphone app, such as Send to Car, trip log, and locking/unlocking the vehicle.
- Wheels: 19" 5-spoke R-Design alloy wheels, diamond cut/high-gloss black (7.5 x 19 with 235/50 R19 tires, tire class A)
- Wheels: Tire sealant (Incl. 12-volt compressor, maximum speed 80 km/h)
- Oncoming Lane Mitigation (preventive protection system when crossing the center line and approaching oncoming traffic including active steering intervention towards one's own lane)
- Package: Winter Package (front seat heating - steering wheel heating)
- Paint finish: Contrasting roof in Black Stone
- Paint finish: Solid
- Passenger side airbag can be deactivated
- Radio accessories: Smartphone integration Apple CarPlay and Android Auto (integration of Apple iPhones and Android smartphones into the Sensus operating system)
- Radio accessories: Two USB-C ports on the back of the center console
- Radio: Audio system High Performance Sound (250 Watt power - 8 speakers - Air Woofer Technology)
- Rear headrests fixed
- rear window wiper
- Road Sign Information - Traffic Sign Recognition
- Roof edge spoiler
- Run-off Road Protection (preventive protection system in case of unintentional leaving the road or impending rollovers including emergency call via Volvo On Call and door unlocking)
- Seats: Adjustable (manual) leg rest for driver and front passenger seats
- Seats: Driver's seat height and length adjustable including tilt adjustment
- Seats: Passenger seat adjustable in height and length
- Seats: Rear seats in a 40/60 split or fully foldable
- Side window trim in high-gloss black (bottom)
- Speed limit (variable)
- Speed-sensitive power steering
- Sport exterior mirrors in high-gloss black
- Sport front grille with horizontal struts and grille surround in high-gloss black
- Start/Stop technology
- Steering wheel: Sports steering wheel
- Tachometer
- Tire pressure monitoring system (with tire-specific pressure loss warning)
- Trailer Stability Assist (TSA) (Preparation for trailer stability control)
- Warning tone/indicator when seat belts are not fastened (for all seats)



Extra equipment

- Towbar (semi-electric)
- Paint finish: Metallic paint
- Package: Parking Assistance Package (front and rear parking aid - reversing camera)
- Package: Seat Comfort Package (Electrically adjustable front passenger seat - Electrically adjustable driver's seat with memory function for driver's seat and exterior mirror settings (stored in the remote control) - Folding headrests of the 2nd row of seats (electrically) - Adjustable leg support (manually) for driver and front passenger seats)
- Upholstery: Leather/imitation leather (including rear center armrest with two integrated cup holders and pass-through hatch behind the center armrest in the rear)
- Luggage compartment partition net
- Charging cable Type 2 / Type 2 (Mode 3) (7 m length, single-phase, 16A (for connection to a charging station with Type 2 connector))
- Park Assist Pilot (intelligent parking assistant) in conjunction with Parking Assistance Package and Lagom Edition-P (including front and rear parking aid for parallel and perpendicular parking spaces (left and right) as well as exiting parallel parking spaces. Steering is automatic, acceleration and braking are controlled by the driver. The parking space must be at least 1.2 times the length of the vehicle.)
- Auxiliary heater with timer (fuel-operated) (remote activation via Volvo On Call app possible)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Side panel - rear left side	Sill - Scratch(es) - Smart repair
2	Wheel / tyres	Alloy rim - front right side - Scratched - Loss in value
3	Door - rear right side	Door - Dent / paintcoat damage - Repair and paint
4	Bonnet	Bonnet - Scratch(es) - Paint
5	Front bumper	Front bumper - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Front bumper	Spoiler - Scratch(es) - No deduction
2	Mudguard - right side	Wheel well extension - Scratch(es) - No deduction
3	Rear bumper	Bumper - rear right side - Scratch(es) - No deduction
4	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 7 Oct 2025	6.099,43 €



Repainting

No. Repainting

- 1 Boot lid / rear door, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Boot lid / rear door 198 µm |

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

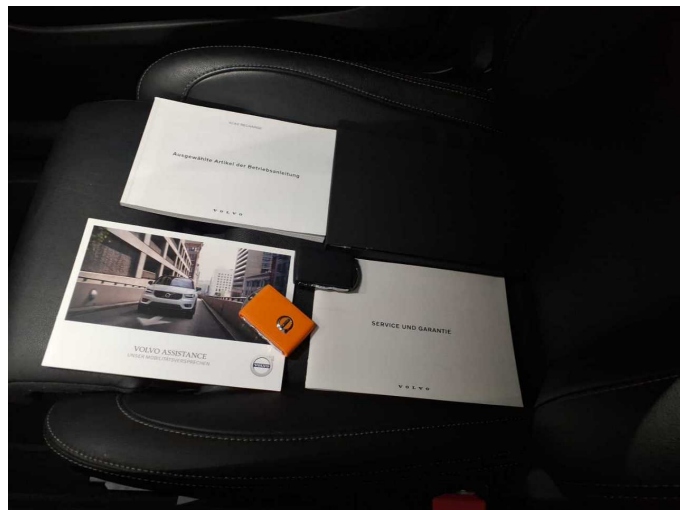


Figure 13: Documents

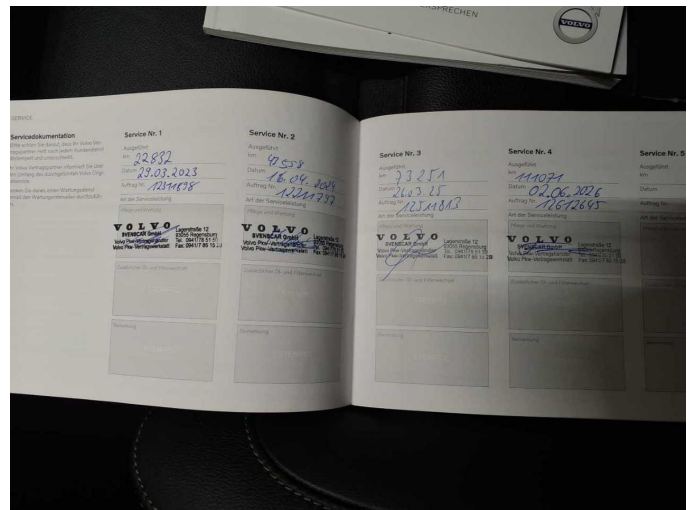


Figure 14: Documents



Figure 15: Documents

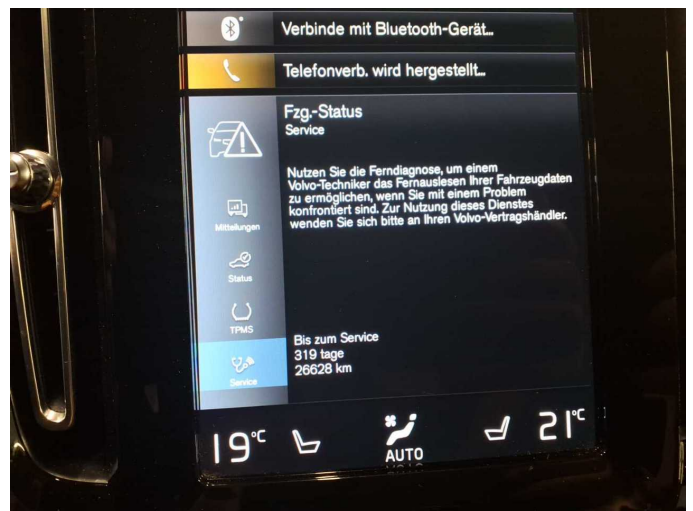


Figure 16: Documents

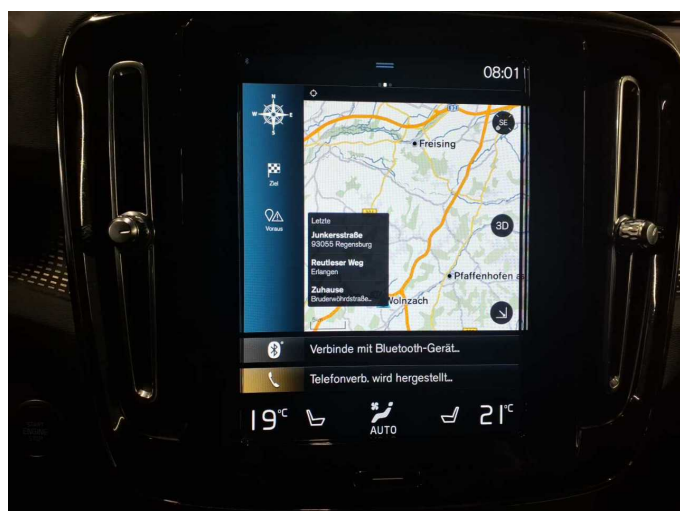


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

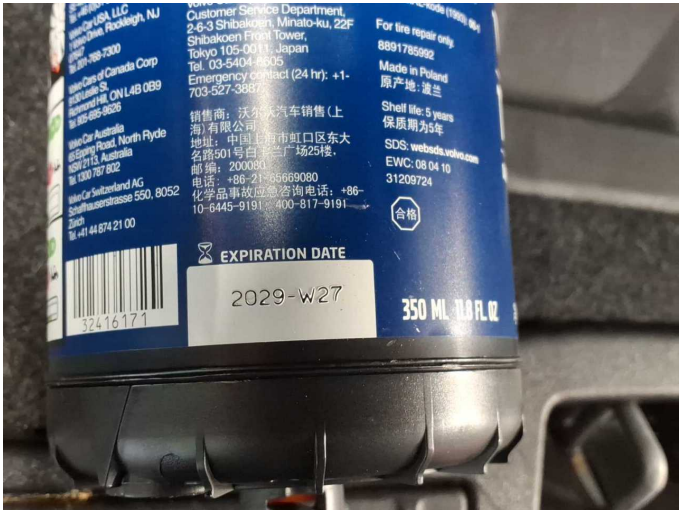


Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.




Figure 32: Misc.



Figure 33: Misc.



Damage 1: Side panel - rear left side: Sill - Scratch(es) - Smart repair

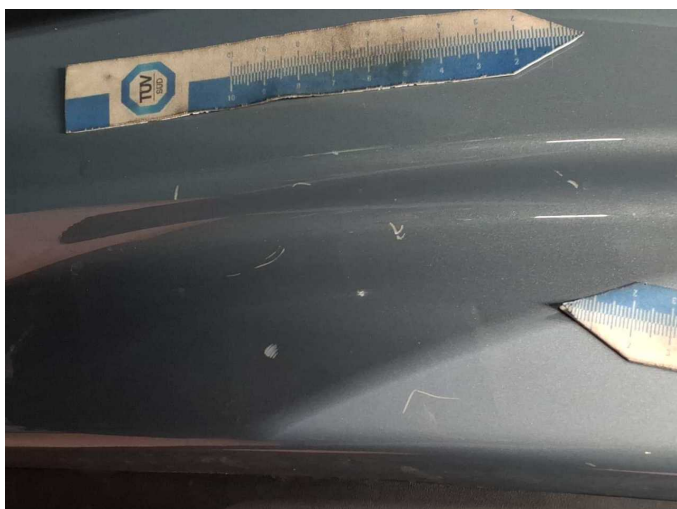

Damage 1: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 2: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 2: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 2: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 3: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage 3: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage 3: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage 3: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage 3: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage 4: Bonnet: Bonnet - Scratch(es) - Paint




Damage 4: Bonnet: Bonnet - Scratch(es) - Paint



Damage 4: Bonnet: Bonnet - Scratch(es) - Paint



Damage 4: Bonnet: Bonnet - Scratch(es) - Paint

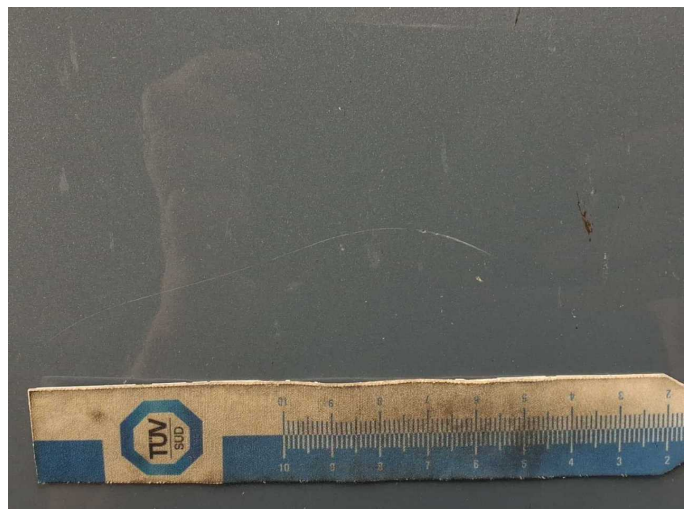

Damage 4: Bonnet: Bonnet - Scratch(es) - Paint



Damage 5: Front bumper: Front bumper - Scratched - Paint



Damage 5: Front bumper: Front bumper - Scratched - Paint



Damage 5: Front bumper: Front bumper - Scratched - Paint



Damage 5: Front bumper: Front bumper - Scratched - Paint



Damage 5: Front bumper: Front bumper - Scratched - Paint



Repainting 1: Boot lid / rear door



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: YV1XZBBVFN2756602

Hersteller / Modell: VOLVO VOLVO XC40 T5 Recharge DKG RDesign

Datum	KM-Stand	Beschreibung
02.06.2026	111.071	Getriebeöl ern/prüfen; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges; Zündkerzen ern
27.03.2025	73.245	AU; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
16.04.2024	43.558	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
29.03.2023	22.836	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges