



Expertise

Protocol number: 46179455
Order No. / Reference: 26461395
Inspection date: 24 Jun 2026

Manufacturer: Volkswagen
VIN: WVVZZZCD7PW305129

Model: Golf 1.4 eHybrid OPF DSG GTE



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Golf 1.4 eHybrid OPF DSG GTE	
Vehicle Identification number	WVVZZZCD7PW305129
Mileage (Read)	104,135 km
First registration	2 Nov 2022
Number of holders	1
Next periodical technical inspection	11/2027
(Report not on hand)	
Power / Engine displacement	110 kw / 1,395 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufll / 4
Gearbox / Number of gears	Automatic / 6
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Reflexsilber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Blue-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	9,000 km
Last service on / at	04/2026 at 102,851 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GM783202
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CLC 00050		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,040 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R17 91W	Summer tyres on Light alloy	Michelin	5mm / 5mm
2)	225/45 R17 91W	Summer tyres on Light alloy	Michelin	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/50 R17 93V	Winter tyres on Light alloy	Goodyear	6mm / 6mm
2)	205/50 R17 93V	Winter tyres on Light alloy	Goodyear	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 08/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 2 USB-C ports on the front
- Turning brake function and evasive steering support
- Airbag: Head airbag system for front and rear passengers including front side airbags
- Exterior mirror housings and door handles in body color
- Vehicle tool kit
- third brake light
- Headliner in Soul Black
- Digital Cockpit Pro, multicolor
- Electronic differential lock XDS
- Electronic stability program and electromechanical brake booster
- Driving profile selection
- Electric windows, front and rear
- Pedestrian protection measures expanded
- luggage compartment cover
- Rear window heated
- Rear spoiler
- Air conditioning system "Air Care Climatronic"
- Front headrests
- LED light in the front footwell, selectable light color
- LED taillights
- Steering wheel: Multifunction sports steering wheel in leather, with touch controls and paddle shifters
- Illuminated makeup mirrors in the sun visors
- Fatigue detection
- Non-smoking version
- Emergency call service
- Otto particulate filter
- Brushed stainless steel pedals
- Tire pressure monitoring system (passive)
- Wheels: Tire Mobility Set
- Keyless start system without safe locking
- Seat belts: Three-point automatic seat belt for the middle rear seat
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Top sports seats in the front
- Start-stop system
- Bumpers in body color
- Textile floor mats front and rear
- First aid kit, warning triangle and high-visibility vest
- Warning tone and light for unfastened seat belts front and rear
- Central locking without safe locking, with remote control and 2 remote folding keys
- 2 USB charging ports on the rear of the center console
- Airbag for driver and front passenger
- 30-color ambient lighting
- Electrically adjustable and heated exterior mirrors with memory function and passenger-side mirror lowering function.
- Car2X
- Decorative inlays "Black Metal Chrome"
- Parking assistance
- Electronic parking brake including auto-hold function
- Automatic headlight control, with LED daytime running lights
- Chassis: Sport chassis
- Windscreen made of laminated safety glass, heat and sound insulating
- Transmission: 6-speed DSG
- Rear window wiper with intermittent function
- ISOFIX mounting points
- rear headrests
- LED reading lights at the front (2) and 2 at the rear
- LED Plus headlights
- Illuminated strip between headlights and door handle recesses
- Dynamic headlight range control
- Front center armrest adjustable in height and length
- Mains charging cable for household sockets
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection
- Package: Seat Comfort Package
- Progressive steering
- Wheels: Alloy wheels (4) "Richmond" 7.5 J x 17
- Rear bench seat undivided, backrest asymmetrically split and foldable with center armrest
- Seat belts: Three-point automatic seat belts for the outer rear seats
- Seat covers in fabric
- Seats: Lumbar support in the front
- Lane keeping assistant "Lane Assist"
- 12-volt power outlet in the luggage compartment
- Telephone interface with inductive charging function
- Ambient lighting with logo projection
- Prepared for "We Connect" and "We Connect Plus"
- Electronic immobilizer
- Green thermal insulation glazing, sides and rear



Extra equipment

- "Comfort" telephone interface with inductive charging function (hands-free system)
- Anti-theft alarm system (anti-theft alarm system with interior monitoring, backup horn and tow-away protection - keyless start system with safe locking)
- Package: IQ.DRIVE package including "Emergency Assist" (Adaptive Cruise Control ACC "stop & go", with speed limiter - Electrically folding/adjustable exterior mirrors with memory function, separately heated - Driving assistant "Travel Assist", lane keeping assistant "Lane Assist" and "Emergency Assist" - Multifunction camera - Parking assistant "Park Assist" including parking aid - Lane change assistant "Side Assist")
- Paint finish: Metallic
- Proactive occupant protection system in conjunction with "Front Assist" and "Side Assist" (detects critical traffic situations with increased accident potential - prepares vehicle occupants and the vehicle for a possible accident by tightening the front, fastened seat belts and securing the driver and front passenger, and closing open windows and the sunroof to a gap)
- Keyless locking system
- Lane change assistant "Side Assist", parking assistant and exit warning (alerts the driver with visual signals in the respective exterior mirror to vehicles that could pose a danger when changing lanes - Parking assistant: monitors the area behind and beside the vehicle when reversing out of a parking space, issues visual and acoustic warning signals if a vehicle is detected crossing the parking space path, can initiate emergency braking to reduce the severity of a collision or to prevent a collision altogether)
- Mode 3 Type 2 3 16A charging cable
- Navigation system "Discover Media" incl. "Streaming & Internet" (6+1 speakers - App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto - Multifunction camera - Navigation system "Discover Media" incl. "Streaming & Internet" - Radio - Traffic sign recognition)
- Package: Winter (DSG) (R-Line) (Multifunction sports steering wheel in leather, heated, with touch controls and shift paddles - Automatically heated front windscreen washer nozzles - Heated front seats)
- Rear side windows and rear window tinted
- Rear View reversing camera

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Rear bumper	Rear bumper - Scratched - Smart repair
2	Side panel - rear right side	Side panel - Scratch(es) - Smart repair
3	Body	Body - Glued / labelled - De-glue / neutralise
4	Bonnet	Insulation lining - Damage caused by marten / rodent - Replace

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Interior	Interior - Soiled - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.
- Der angegebene Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.
- Ein Nachweis über die Zulässigkeit des beiliegenden Radsatzes wurde nicht erbracht.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

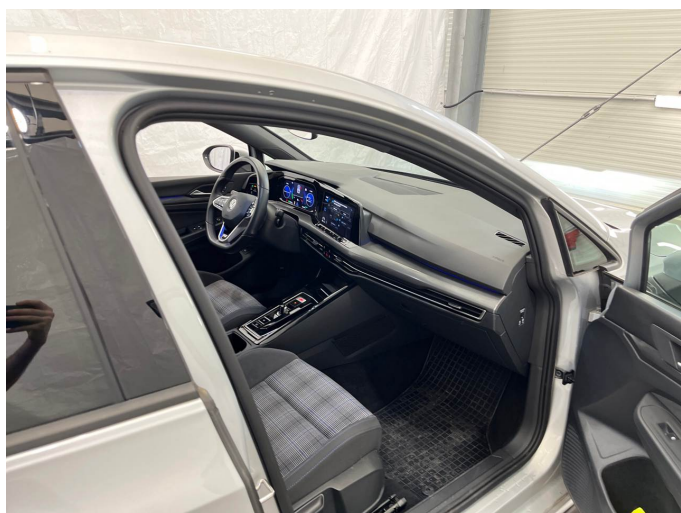


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

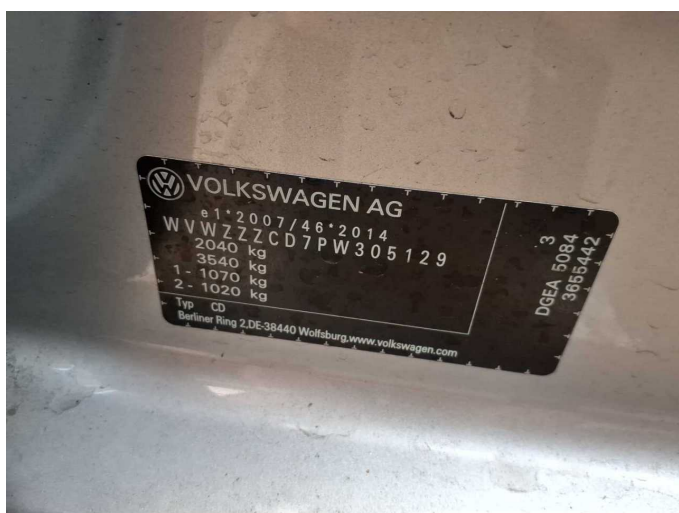


Figure 11: VIN

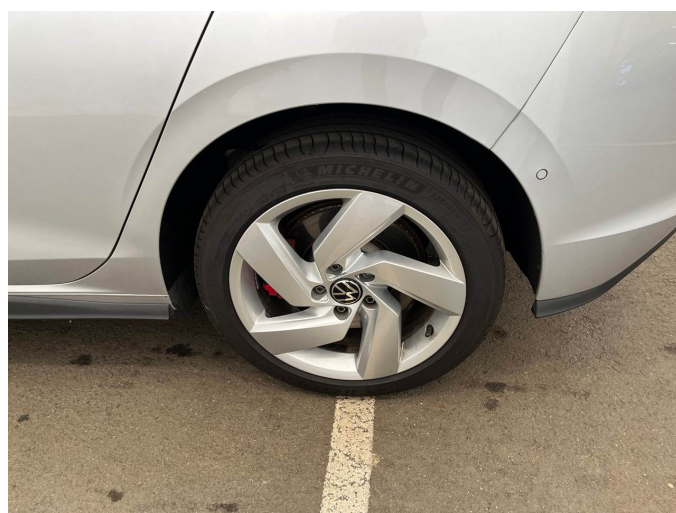


Figure 12: Mounted tyres

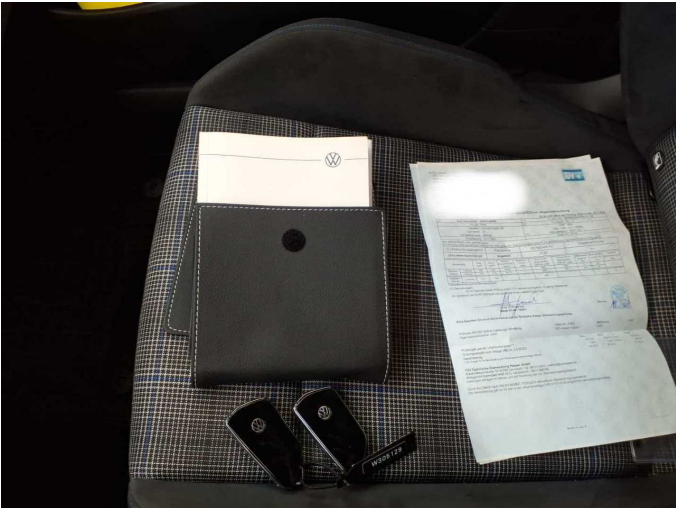


Figure 13: Documents



Figure 14: Documents

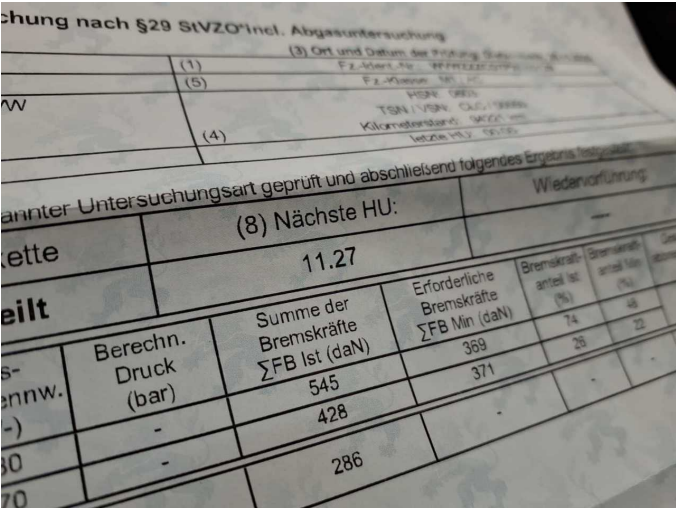


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

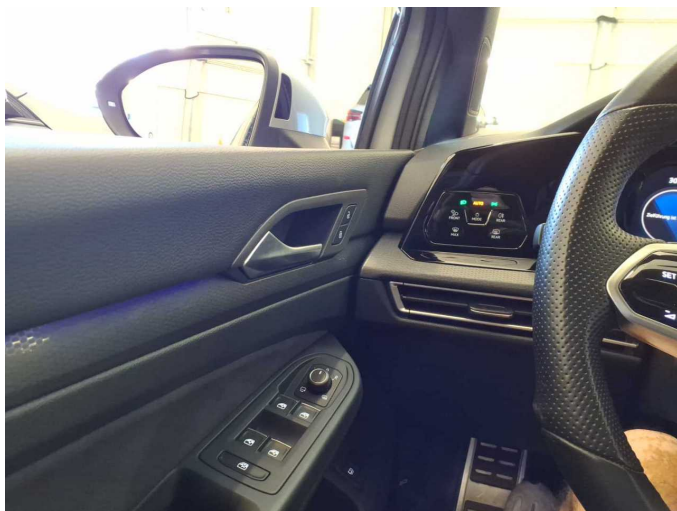


Figure 21: Misc.



Figure 22: Misc.

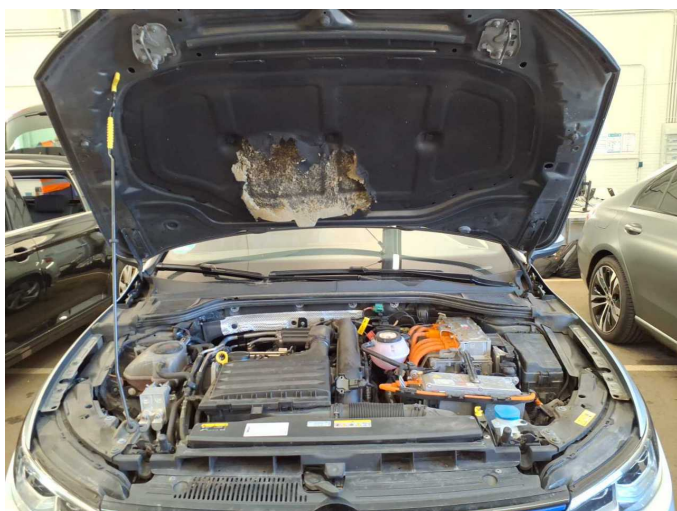


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

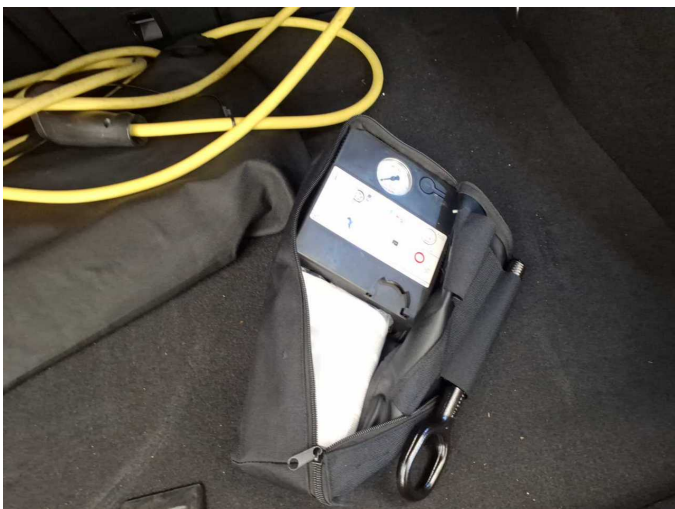


Figure 29: Misc.

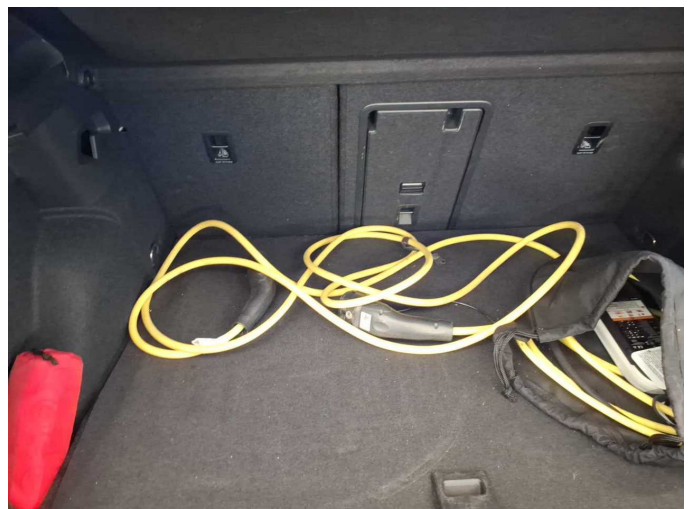


Figure 30: Misc.



Figure 31: Misc.



Damage 1: Rear bumper: Rear bumper - Scratched - Smart repair



Damage 1: Rear bumper: Rear bumper - Scratched - Smart repair



Damage 2: Side panel - rear right side: Side panel - Scratch(es) - Smart repair



Damage 2: Side panel - rear right side: Side panel - Scratch(es) - Smart repair



Damage 2: Side panel - rear right side: Side panel - Scratch(es) - Smart repair



Damage 3: Body: Body - Glued / labelled - De-glue / neutralise



Damage 3: Body: Body - Glued / labelled - De-glue / neutralise



Damage 3: Body: Body - Glued / labelled - De-glue / neutralise



Damage 4: Bonnet: Insulation lining - Damage caused by marten / rodent
- Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVVZZZCD7PW305129

Hersteller / Modell: VOLKSWAGEN VW Golf 1.4 eHybrid OPF DSG GTE

Datum	KM-Stand	Beschreibung
08.04.2026	102.851	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
20.11.2025	94.221	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; HU + AU
24.10.2024	66.703	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges; Zündkerzen ern
06.09.2024	58.054	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
26.04.2024	53.409	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
28.06.2023	17.468	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges