



Expertise

Protocol number: 46712766
Order No. / Reference: 26512528
Inspection date: 17 Jul 2026

Manufacturer: Volvo

Model: XC90 B5 D AWD Plus Dark

VIN: YV1LFK2VXP1903075



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo XC90 B5 D AWD Plus Dark	
Vehicle Identification number	YV1LFK2VXP1903075
Mileage (Read)	100,584 km
First registration	3 Jan 2023
Number of holders	1
Next periodical technical inspection	03/2028
(Report on hand)	
Fuel type	Hybrid Diesel / E
Engine displacement / Cylinder	1,969 ccm / 4
Power	173 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Onyx Black Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	29,151 km
Last service on / at	02/2026 at 99,736 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ551155
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	9101 / BPR 00094		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,670 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 107H	Winter tyres on Light alloy	Dunlop	6mm / 6mm
2)	235/60 R18 107H	Winter tyres on Light alloy	Dunlop	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	275/40 R21 107V	Summer tyres on Light alloy	Pirelli	4mm / 4mm
2)	275/40 R21 107V	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- ABS - Anti-lock Braking System
- Passenger side airbag can be deactivated
- Airbag, driver's knee airbag
- Active safety belts with belt tensioners
- All-wheel drive (AWD)
- Ambient lighting
- Android infotainment system
- Dashboard and door trim in leather look with contrasting stitching
- Electrically folding exterior mirrors
- Heated exterior mirrors and rear window (automatic)
- Attachment system for carrier bags in the luggage compartment
- Fog sensor for automatic activation of the defroster function
- On-board computer
- third brake light
- Roof rails in high-gloss black (integrated)
- Digital services including Google Maps navigation system
- Tachometer
- Driver Awareness
- Aluminum door sill plates with Volvo lettering at the front and rear
- Advanced air purification system with fine dust filtration according to air quality standard PM2.5
- Automatic emergency braking
- Sport front grille with horizontal struts and grille surround in high-gloss black
- Seat belt height adjustment front and rear (2nd row of seats)
- Interior and exterior mirrors automatically dimming
- Intelligent driver information system
- Keyless Drive (electronic access system)
- Child safety lock for the rear doors (electric)
- Comfort opening/closing of the side windows via radio remote control
- Front headrests
- Charging box under the cargo floor
- LED fog lights
- Steering wheel adjustable for height and reach
- Steering wheel: Steering wheel heating
- Illuminated makeup mirror for driver and front passenger
- Model and engine emblem on the rear
- Package: Seat Comfort Package
- Parking ticket holder
- Upholstery: Leather/leatherette comfort seats
- Radio accessories: Two USB-C ports on the back of the center console
- Tire pressure monitoring system
- Wheels: Tire sealant
- Rear bench seat of the 2nd row in a 40/20/40 ratio or completely foldable
- Safety braking system with disc brakes all around (internally ventilated)
- Seats: Heated rear seats (outer seats of the 2nd row)
- Seats: Heated front seats
- Driver and passenger side airbags with two-stage deployment system
- Airbag, side airbags for driver and front passenger and head/shoulder airbags for all occupants
- Aluminum loading sill protector in the luggage compartment
- Applications in the front bumper in high-gloss black
- Armrests with integrated storage compartment and cup holders for the 3rd row of seats (left and right)
- Electrically adjustable exterior mirrors
- Outdoor temperature display
- Hill Descent Control (HDC)
- Hill Start Assist (HSA)
- LED turn signals integrated into the exterior mirrors
- Brake energy recuperation
- Roof edge spoiler
- Diesel particulate filter
- Digital Instrumentation 2nd Gen.
- Driver Assistance
- Parking assistance, front and rear
- Electronic differential lock
- Electronic stability control
- Electric windows front and rear
- Window surround in high-gloss black
- Bottle holder in the luggage compartment
- Luggage compartment partition net
- Transmission: 8-speed automatic transmission
- Automatic tailgate
- Rear window wiper with intermittent function
- Interior lighting
- ISOFIX mounting for the outer rear seats
- Keyless Start
- Automatic climate control with separate temperature control for driver and front passenger
- Headrests of the 2nd row of seats can be folded down (electrically)
- Cargo area roller blind (semi-automatic)
- LED headlights "Thor's Hammer" with high beam assist and integrated LED daytime running lights
- Steering wheel: Multifunction buttons on the steering wheel
- Front center armrest including cup holder
- Emergency brake lights
- Electric parking brake
- Pollen filter
- Radio: High Performance Sound Pro audio system by Harman/Kardon
- Rain sensor
- Run-off Road Protection
- Rear view camera
- Safety Assistance
- Speed-sensitive power steering
- Seats: Third row of seats (7-seater)



- Sport front and rear apron
- Start/Stop technology
- Phone: Inductive smartphone charging system
- Premium textile floor mats, front and rear
- Glazing: Colored glazing
- Volvo On Call
- Warning tone/indicator when seat belts are not fastened (for all seats)
- Central locking system with two remote controls and integrated emergency key

Extra equipment

- Towbar (semi-electric)
- Paint finish: Metallic paint
- Package: Lighting Package (LED fog lights (integrated into the front spoiler) - headlight cleaning system - full LED headlights "Thor's Hammer" Active High Beam with extended high beam, dynamic cornering lights, intelligent high beam assist with adaptive headlight range control and integrated LED daytime running lights)
- Parking camera with 360° surround view (including front, side and rear parking aid with automatic braking intervention (rear))
- Glazing: Side and rear windows tinted (from the B-pillar back)

- Seats: Child seat integrated in the middle rear seat (2nd row).
- Sun blinds for the rear side windows (integrated)
- Sport exterior mirrors in high-gloss black
- Power socket
- Textile floor mat for the 3rd row of seats
- First aid kit and warning triangle
- Lashing eyes in the luggage compartment (foldable)
- Preparation for Trailer Stability Assist (TSA)
- Immobiliser
- WHIPS whiplash protection system

- Chassis: Adaptive air suspension with Four-C technology (Continuously Controlled Chassis Concept) with adjustable modes Comfort, Eco, Dynamic, Off Road including automatic leveling and entry/rear lowering (4/5 cm)
- Panoramic glass sliding sunroof with lifting function (electric) (with integrated, continuously adjustable sunshade)
- Wheels: 21" alloy wheels, 5-V-spoke design, diamond cut/high-gloss black (tires 275/40 R21; rims 9 x 21")
- Auxiliary heater with timer (fuel-operated)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Sill - right side	Sill - Scratch(es) - Smart repair
3	Door - rear right side	Door - dent(s) - Smart repair
4	Side panel - rear right side	Wheel well extension - Stone chips - Smart repair
5	Door - rear left side	Door - Stone chips - Smart repair
6	Door - front left side	Door edge - Scratch(es) - Smart repair
7	Trim / covers	Brightware / decorative strip - Paint defect - Replace
8	Front axle	Axles / undercarriage (wegen der beschädigten Felgen) - Specify findings - Measure
9	2nd wheel set	1 tyre - Broken / torn - Replace
10	2nd wheel set	1 alloy rim - Scratched - Loss in value
11	2nd wheel set	1 alloy rim - Scratched - Loss in value
12	2nd wheel set	1 alloy rim - Scratched - Loss in value
13	2nd wheel set	1 alloy rim - Scratched - Loss in value



Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 7 Nov 2023	2.374,29 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.

Die Felgen wurden aufgrund der Laufleistung gemindert.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

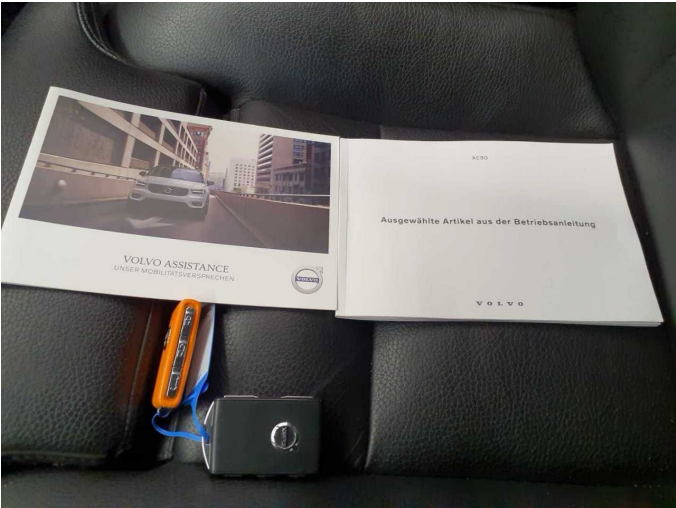


Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

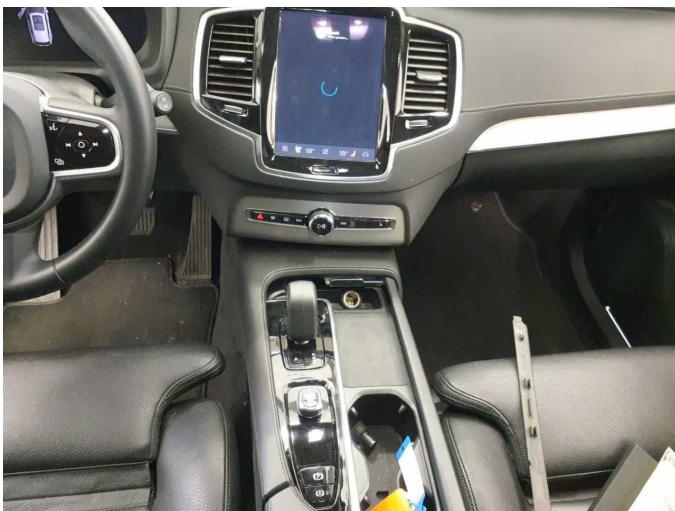


Figure 23: Misc.

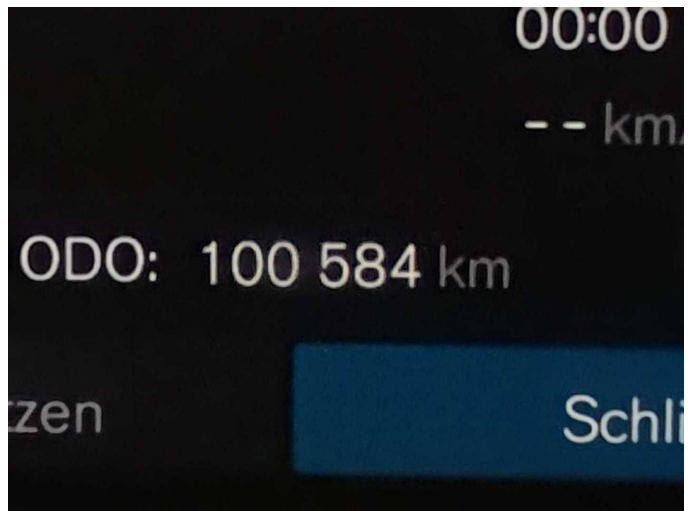


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

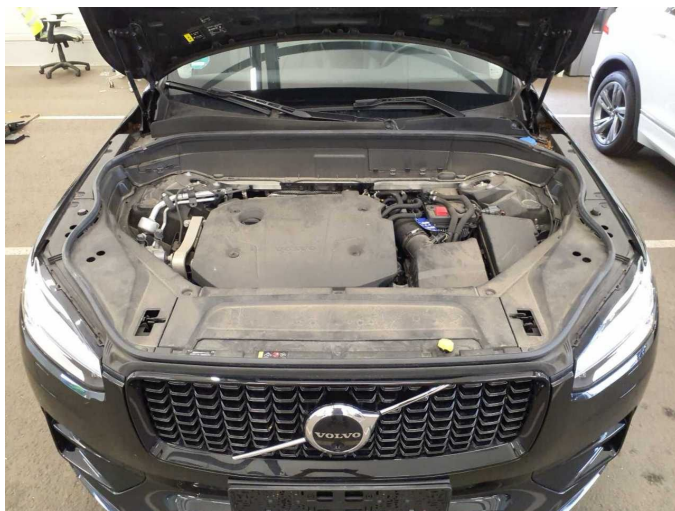


Figure 27: Misc.



Figure 28: Misc.

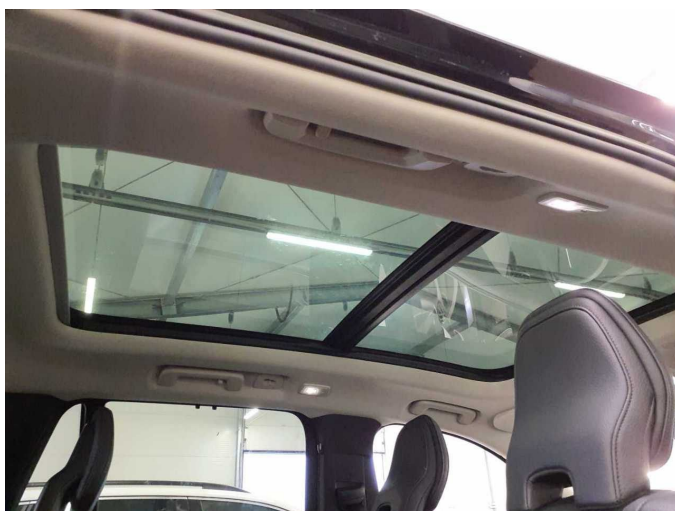


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.

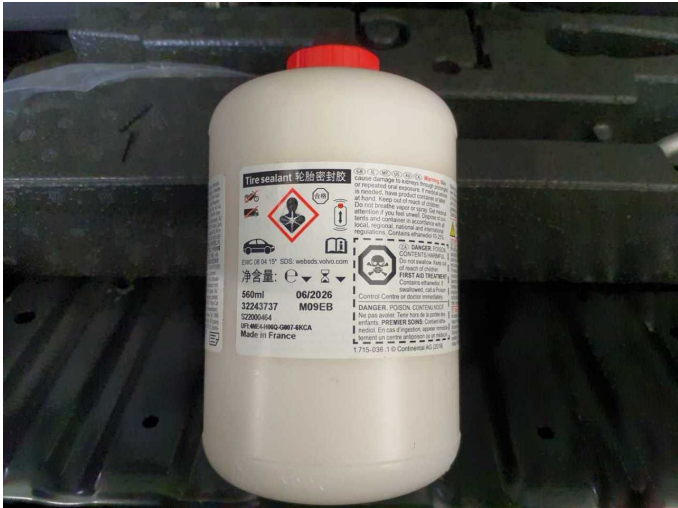


Figure 34: Misc.




Figure 35: Misc.




Damage 1: Equipment: Tirefit filler - Expired - Replace




Damage 2: Sill - right side: Sill - Scratch(es) - Smart repair

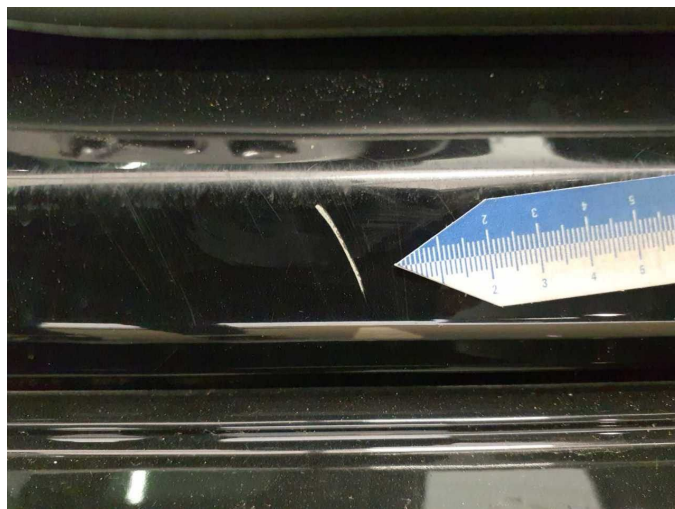

Damage 2: Sill - right side: Sill - Scratch(es) - Smart repair

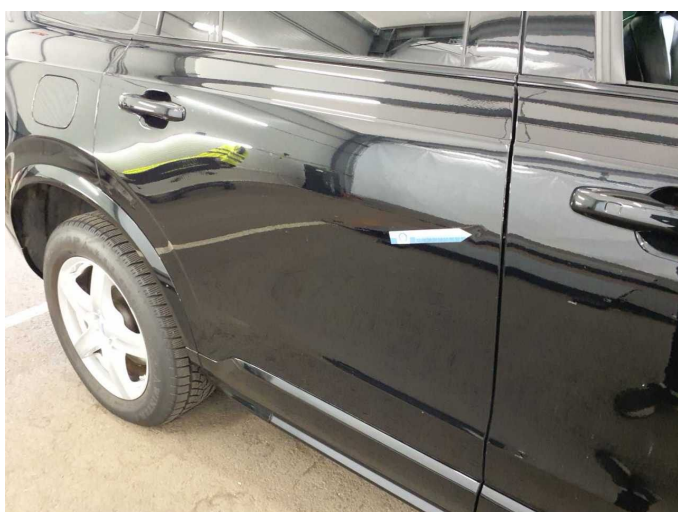

Damage 3: Door - rear right side: Door - dent(s) - Smart repair

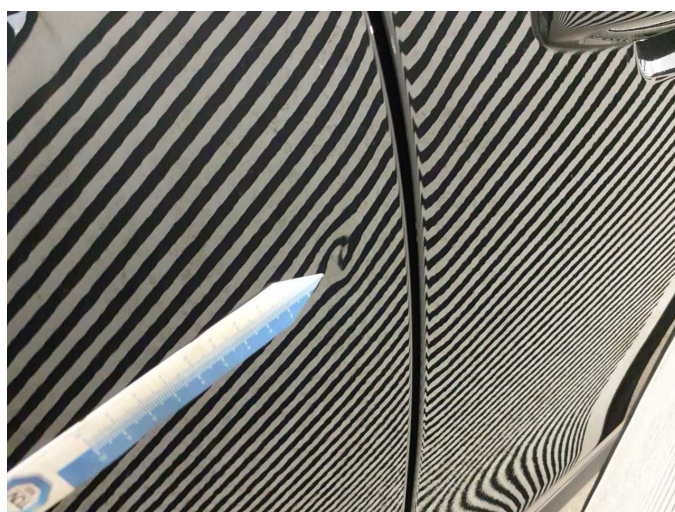

Damage 3: Door - rear right side: Door - dent(s) - Smart repair




Damage 4: Side panel - rear right side: Wheel well extension - Stone chips - Smart repair




Damage 4: Side panel - rear right side: Wheel well extension - Stone chips - Smart repair



Damage 4: Side panel - rear right side: Wheel well extension - Stone chips - Smart repair

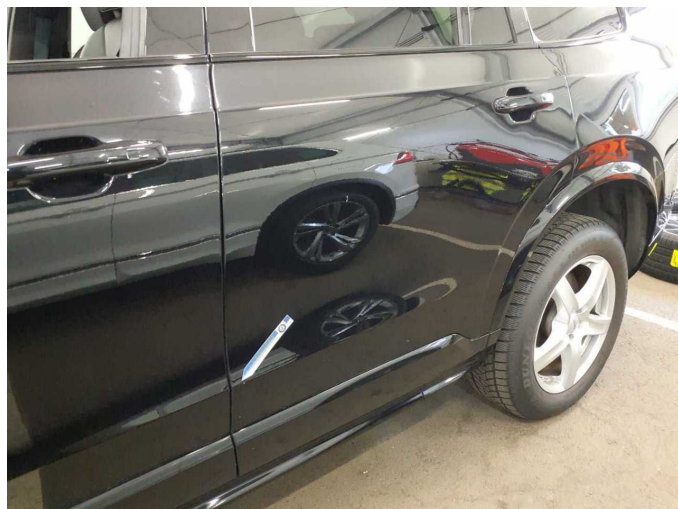

Damage 5: Door - rear left side: Door - Stone chips - Smart repair

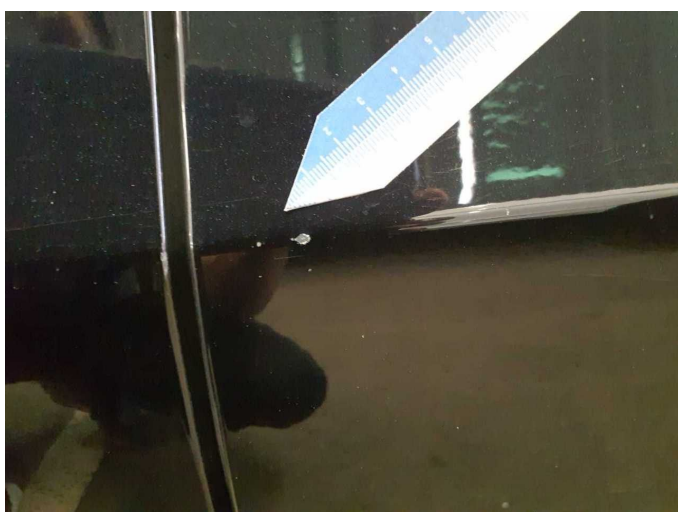


Damage 5: Door - rear left side: Door - Stone chips - Smart repair



Damage 6: Door - front left side: Door edge - Scratch(es) - Smart repair




Damage 6: Door - front left side: Door edge - Scratch(es) - Smart repair

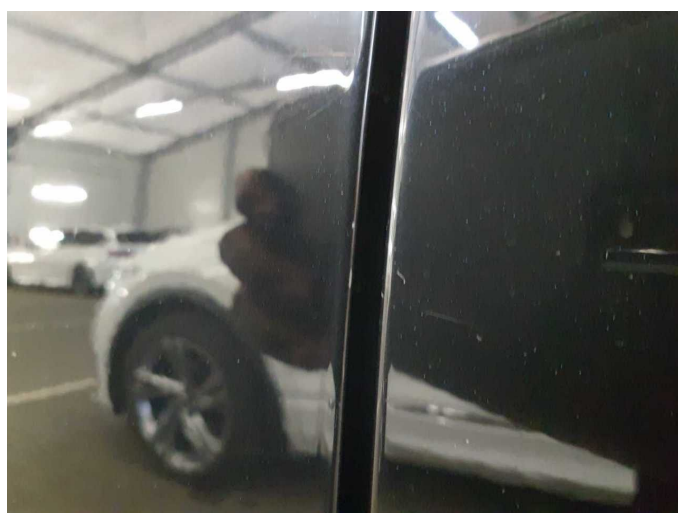

Damage 6: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 7: Trim / covers: Brightware / decorative strip - Paint defect - Replace

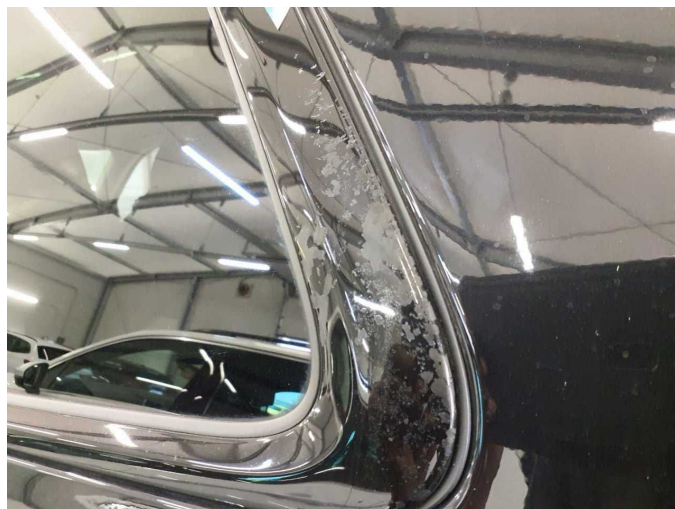


Damage 7: Trim / covers: Brightware / decorative strip - Paint defect - Replace



Damage 9: 2nd wheel set: 1 tyre - Broken / torn - Replace



Damage 9: 2nd wheel set: 1 tyre - Broken / torn - Replace

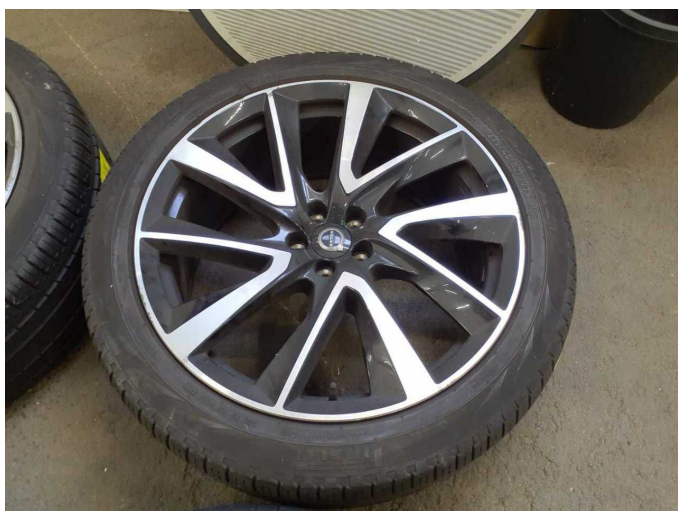

Damage 10: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 10: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 10: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 11: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 11: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 11: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 12: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 12: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 12: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 13: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 13: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 13: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 13: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: YV1LFK2VXP1903075

Hersteller / Modell: VOLVO VOLVO XC90 B5 D AWD Plus Dark

Datum	KM-Stand	Beschreibung
24.03.2026	100.357	AU; Ölwechsel - Hinterachse; Reparatur Sonstiges
12.02.2026	99.736	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
03.02.2025	67.468	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
15.01.2024	39.221	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges