



PEUGEOT 208: GB-847-KS

Vinnumber:	VR3UPHNEKM5850946	Versionname:	PEUGEOT 208 PureTech 100 S&S Allure Business VP [5P] bvm 6-100CH-5cv (bi-corps)
First Registrationdate:	26/08/2021	Fiscalpower:	
Expertise Mileage:	140148	Power Kw:	75
Bodytype:	Berline	Body colour:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Interior colour:	Grey
Fueltype:	Petrol	Type of rims (mounted):	Aluminium
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Category:	Passenger Car		

Options


Number of keys total	1	Radio	
Number keys remote	1	Central consol F	
GPS big screen color		Luggage cover	
GPS storage		Headlights Xenon/LED/Laser	
Windows electric F		Rear parking sensors	
Windows electric R		Rear view camera	
Cruise Control		Seat cover lining	Lining Other
Steering wheel multifunctional			Lining Leather
Steering wheel leather			
Type of climate control	Autom climate control		

Tyres


	195/55/16/91 V			
Summer tyres:	Fr.L.	Hankook: 35%	Fr.R.	Hankook: 45%
	Re.L.	Continental: 70%	Re.R.	Continental: 75%
Tyre profile depth FL				6.0
Tyre profile depth FR				5.2
Tyre profile depth RL				3.6
Tyre profile depth RR				3.2
Tyre size FL				195/55 R 16 91 V
Tyre size FR				195/55 R 16 91 V
Tyre size RL				195/55 R 16 91 H
Tyre size RR				195/55 R 16 91 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				All seasons
Tyre type RR				All Seasons
Tyre make FL				260
Tyre make FR				260
Tyre make RL				256
Tyre make RR				256

Assistance equipment

Spare wheel	Yes	Jack	Yes
Remote ignition key (no insert), Missing, Repair/replace (lump sum)			

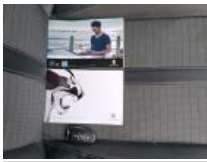


Interior, Stain, Cleaning

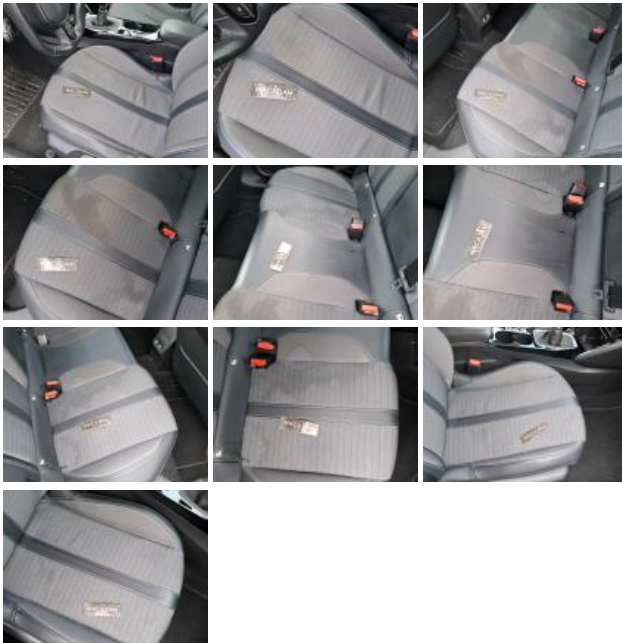

Alloy rim FL bitone/polychrome, Scratch(es), Repair/replace (lump sum)




Tyre RL, Out of tolerance, Replace

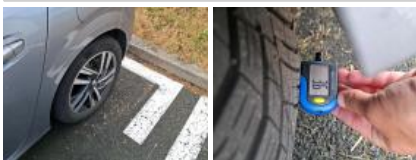

Alloy rim RL bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Tyre RR, Out of tolerance, Replace

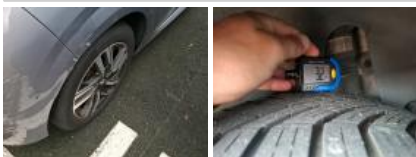

Alloy rim RR bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Alloy rim FR bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Wing FL, Dent(s), Repair and paint (complete)



Door FL, Dent(s), Repair and paint (complete)



Door RL, Dent(s), Repair and paint (complete)



Outer sill L, Dent(s) and scratch(es), Replace and paint



Outside rear-view mirror housing L, Scratch(es), Polish



Bumper F, Scratch(es), Repair and paint (complete)



Grille, Broken, Replace



Bumper grille, Unclasp(ed), Dismount/Mount



Headlight R, Scratch(es), Polish



Windscreen glue kit, Required to install glazing, Repair/replace (lump sum)



Windscreen, Stone chip(s), Replace




Wing RR, Dent(s) and scratch(es), Repair and paint (complete)



Door RR, Dent(s) and scratch(es), Acceptable



Door FR, Dent(s) and scratch(es), Repair and paint (complete)

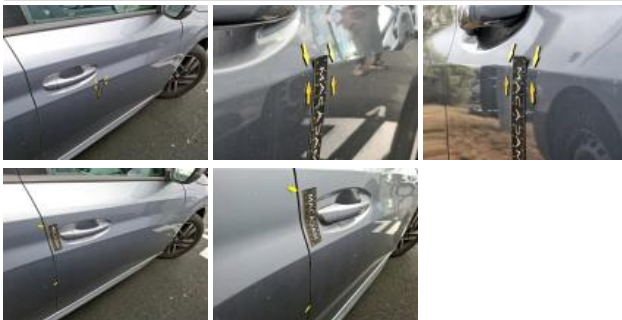

Wing FR, Dent(s) and scratch(es), Repair and paint (complete)



Outside rear-view mirror housing R, Scratch(es), Polish



Side repeater R, Scratch(es), Acceptable




Bumper R, Scratch(es), Paint



Bumper spoiler Rear, Scratch(es), Acceptable



Roof, Hail damage, Repair and paint (complete)

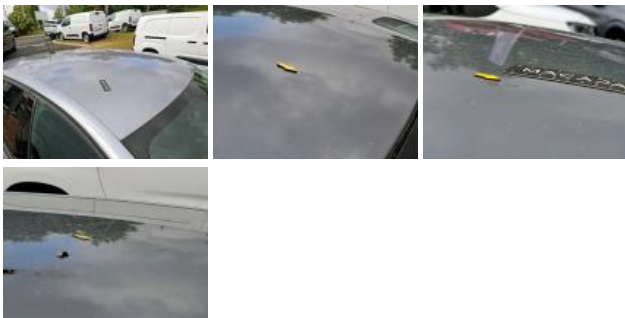

Historique Maintenance

Immatriculation: **GB-847-KS** Date de 1ère immatriculation: **26/08/2021**

Modèle: **Peugeot 208 PureTech 100 S&S Allure Business VP [5P] bvm 6-100CH-5cv (bi-corps)**

Date	Kilométrage	Fournisseur	Descriptif
10/04/2026	138.879	DEKRA AUTOMOTIVE TRAPPES	CONTROLE TECHNIQUE
16/03/2026	136.719	CONTITRADE FRANCE	REPLACEMENT PNEUS ETE
	0		REPLACEMENT PNEUS ETE
11/02/2026	133.443	ABCIS PYRENEES BY AUTOSPHERE	REVISION
	0		DIVERS CLIM
	0		FILTRE A AIR RPLT
	0		FILTRE CLIM RPLT
	0		BOITIER D ALLUMAGE RPLT
08/08/2025	117.954	CONTITRADE FRANCE	REPLACEMENT PNEUS ETE
18/07/2025	115.101	CONTITRADE FRANCE	REPLACEMENT PNEUS ETE
23/06/2025	114.962	ABCIS PYRENEES BY AUTOSPHERE	LIQUIDE DE FREIN
	0		BALAIS ESSUIE GLACE AV
	0		FILTRE CLIM RPLT
	0		REVISION
17/09/2024	93.147	ABCIS PYRENEES BY AUTOSPHERE	APPOINT D HUILE
	0		MOTEUR RPLT
10/07/2024	87.821	ABCIS PYRENEES BY AUTOSPHERE	FILTRE CLIM RPLT
	0		REVISION
	0		FILTRE A AIR RPLT
	0		BOITIER D ALLUMAGE RPLT
	0		BALAI ESSUIE GLACE AR
	0		BALAIS ESSUIE GLACE AV
	0		DISQUES PLAQUETTES AV RPLT
	0		DIVERS FREIN
01/02/2024	71.081	CONTITRADE FRANCE	REPLACEMENT PNEUS ETE
16/12/2023	67.132	CONTITRADE FRANCE	GEOMETRIE CTRL
16/12/2023	67.132	CONTITRADE FRANCE	REPLACEMENT PNEUS 4 SAISONS
24/02/2023	45.535	ABCIS PYRENEES BY AUTOSPHERE	BALAIS ESSUIE GLACE AV
	0		FILTRE A AIR RPLT
	0		REVISION
	0		RECYCLAGE

Historique Maintenance

Immatriculation: **GB-847-KS**

Date de 1ère immatriculation: **26/08/2021**

Modèle: **Peugeot 208 PureTech 100 S&S Allure Business VP [5P] bvm 6-100CH-5cv (bi-corps)**

Date	Kilométrage	Fournisseur	Descriptif
	0		FILTRE CLIM RPLT
	0		BOITIER D ALLUMAGE RPLT
27/10/2022	32.981	CONTITRADE FRANCE	REPLACEMENT PNEUS HIVER
13/06/2022	22.017	ABCIS PYRENEES BY AUTOSPHERE	RECYCLAGE
	0		REVISION ET CLIM
	0		REVISION ET CLIM