



Expertise

Protocol number: 46055186
Order No. / Reference: 26501026
Inspection date: 17 Jun 2026

Manufacturer: Audi
VIN: WAUZZZF44NA002506

Model: A4 Avant 35 TDI S tronic advanced



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A4 Avant 35 TDI S tronic advanced	
Vehicle Identification number	WAUZZZF44NA002506
Mileage (Read)	84,252 km
First registration	3 Aug 2021
Number of holders	1
Power / Engine displacement	120 kw / 1,968 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Mythossschwarz Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
readiness to drive	Roadworthy



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	5,900 km
Last service on / at	04/2026 at 84,048 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GC426105
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0588 / BPK 00597		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,165 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92H	Winter tyres on Steel rim with wheel cover	Dunlop	3mm / 3mm
2)	205/60 R16 92H	Winter tyres on Steel rim with wheel cover	Dunlop	6mm / 6mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 94Y	Summer tyres on Light alloy	Bridgestone	6mm / 6mm
2)	225/50 R17 94H	Summer tyres on Light alloy	Pirelli	6mm / 6mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- AdBlue tank (12 liters)
- Airbag: Front side airbags and head airbag system
- Anti-lock braking system (ABS)
- Audi connect emergency call & service with Audi connect Remote & Control
- Exterior mirror housings in body color
- third brake light, raised
- Black roof rails
- Diesel particulate filter (DPF)
- Door sill trims with aluminum inlay at the front
- Electronic Differential Lock (EDS)
- Driver Information System
- electric window regulator
- Windscreen with acoustic glazing
- front and rear floor mats
- Transmission: S tronic 7-speed
- Top speed limited to 210 km/h
- Interior mirror dimming
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- Headrests (5)
- LED taillights
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction
- Mild hybrid
- Non-smoking version
- Wheel: Tires optimized for rolling resistance, speed-limited
- Radio accessories: 8 speakers (passive) front and rear
- Tire pressure monitoring system
- Electromechanical power steering
- Seats: Standard front seats
- Seats: Front seats manually adjustable
- First aid kit with warning triangle
- Electronic immobilizer
- Reversible loading floor
- Airbag for driver and front passenger
- Accent areas matte black
- Traction control (ASR)
- Audi pre sense city
- Electrically adjustable and heated exterior mirrors
- Vehicle tool kit
- Fabric headliner
- Decorative inlays diamond lacquer silver grey
- Tachometer
- Electromechanical parking brake
- Electronic Stability Control (ESC)
- Chassis: Standard chassis
- Window channel strips in black (rubber)
- Remote key, without SafeLock
- Cruise control system including speed limiter
- rear window wiper
- Interior lighting
- Child lock
- Automatic air conditioning
- boot floor mat
- Manual cargo cover
- LED headlights
- Steering column, manually adjustable in height and axis
- Light/rain sensor
- front center armrest
- Wheel: Alloy wheels, 5-arm dynamic
- Radio: MMI Radio plus
- Radio accessories: Digital radio reception (DAB)
- Tire repair kit
- Fabric seat covers Index
- Seats: Rear seat backrest foldable
- Start-stop system
- Glazing: Windscreen in heat-insulating and acoustic glazing
- Central locking "Keyless-Go" without deadbolt



Extra equipment

- AdBlue tank (24 liters) (larger tank for AdBlue solution to reduce nitrogen oxides in the exhaust gas using an SCR system)
- Business Package (MMI Navigation plus with MMI touch (including driver information system with color display) - Audi phone box - Leather steering wheel in 3-spoke design with multifunction plus - Heated front seats - Automatically dimming, frameless interior mirror - Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides - Rear parking aid - High-beam assistant - Manual sunshade for the rear door windows)
- Front seat heating
- LED matrix headlights, LED taillights and headlight cleaning system (Matrix LED technology combines a camera system with LED light sources and precise optics for highly adaptive light distribution. In addition to the matrix LED function, the headlights offer the following features: - visually enhanced daytime running lights - low beam - high beam - position lights - dynamic turn signals - cornering lights - all-weather lights - static cornering lights - motorway lights - automatic dynamic headlight range control - coming home/leaving home function)
- Paint finish: Metallic
- Assistance package Tour in conjunction with package Business (adaptive cruise control incl. Stop&Go function - traffic jam assistant - predictive efficiency assistant - Audi pre sense city (standard) - Audi pre sense front - swerve assistant - left turn assistant - camera-based traffic sign recognition - high beam assistant - Audi active lane assist)
- City Assistance Package (includes a selection of assistance systems specifically for city traffic - Parking aid plus - Reversing camera - Lane change warning - Audi Pre sense basic - Audi Pre sense rear - Exit warning and rear cross traffic assist)
- Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides
- Front sports seats (with manual adjustment of seat height, seat longitudinal position, seat tilt, backrest tilt, headrest and belt height; with pronounced seat side bolsters for better lateral support in curves, extendable thigh support)
- Radio accessories: Audi sound system (10 speakers including center speaker and subwoofer - 6-channel amplifier - total output of 180 watts)
- Seat covers in fabric system
- Seats: 4-way lumbar support
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction plus

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Door - front left side	Door edge - Scratched - Smart repair
3	Steering system	Steering wheel - Scratched - Smart repair
4	Body	A-pillar - left side - Stone chips - Smart repair
5	Vehicle glazing	Windscreen with lane departure assistant - Stone chips - Smart repair
6	Front bumper	Front bumper - Scratch(es) - Smart repair
7	Mudguard - left side	Mudguard - left side - dent(s) - Repair and paint
8	Bonnet	Bonnet - Corrosion - Repair and paint



Wear and tear

No.	Component group	Description
1	Rear bumper	Rear bumper - Scratch(es) - No deduction
2	Wheel / tyres	Tyre - front (Kein Teil der Ausstattung) - Does not meet the leasing specifications - No deduction
3	Roof	Roof (polierbar) - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Unknown, Provided by user / customer, from 26 Jul 2023	745,66 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

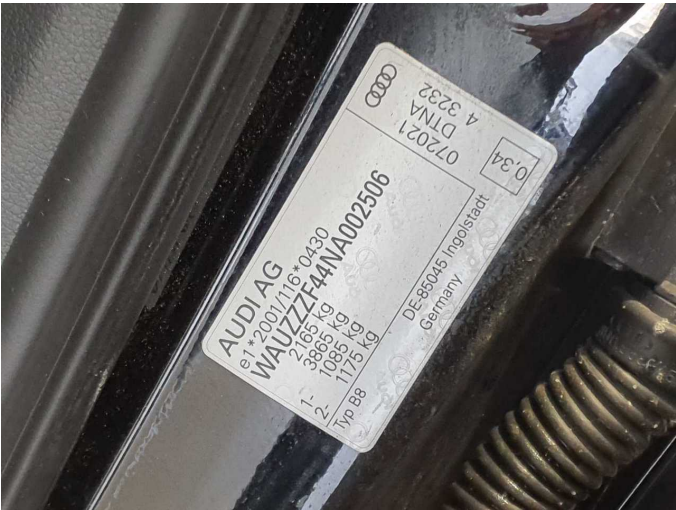


Figure 11: VIN



Figure 12: Mounted tyres

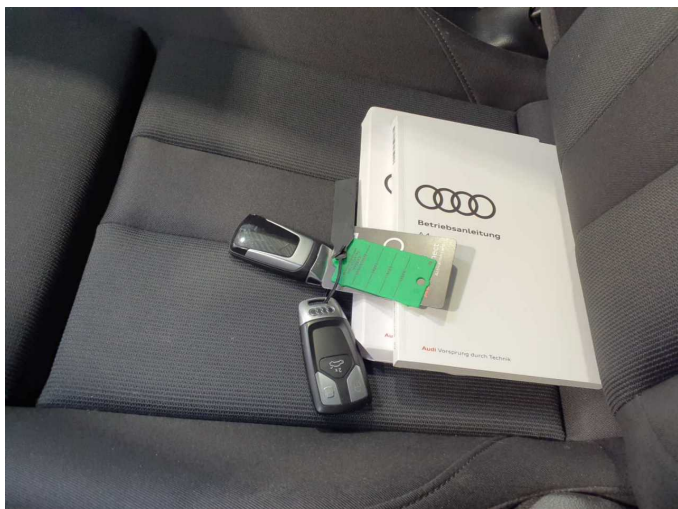


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.

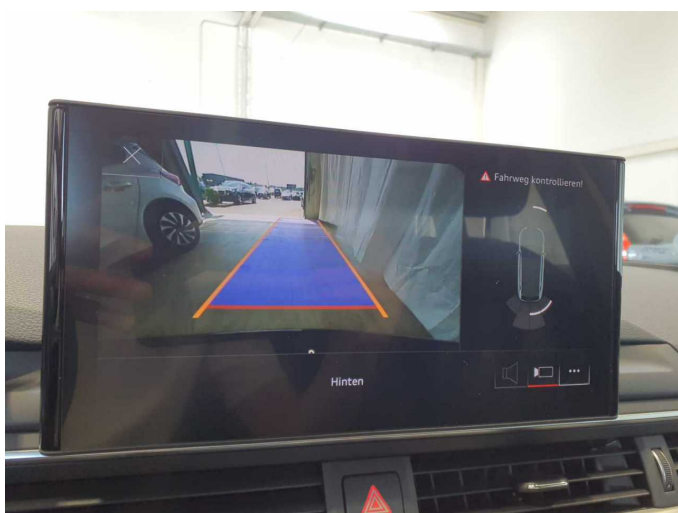


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

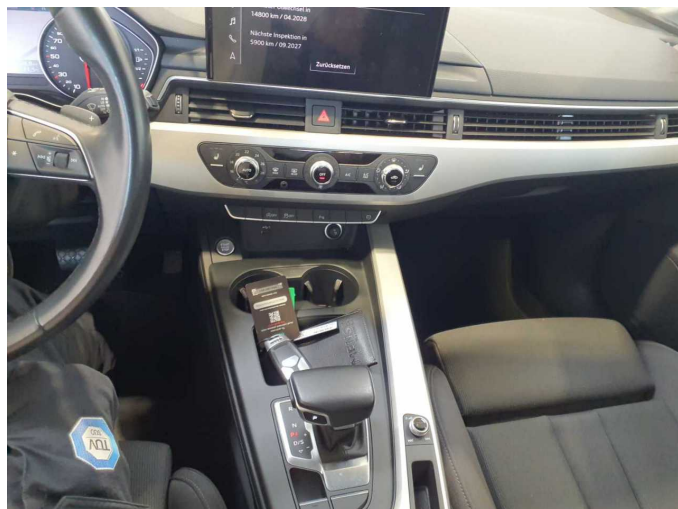


Figure 20: Misc.



Figure 21: Misc.

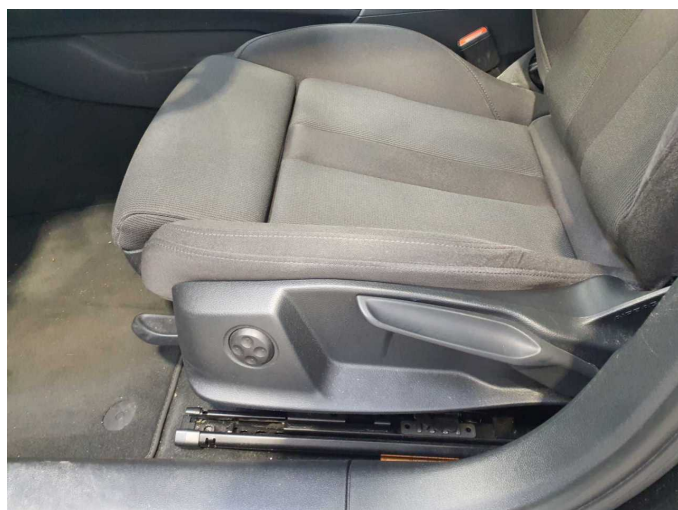


Figure 22: Misc.



Figure 23: Misc.

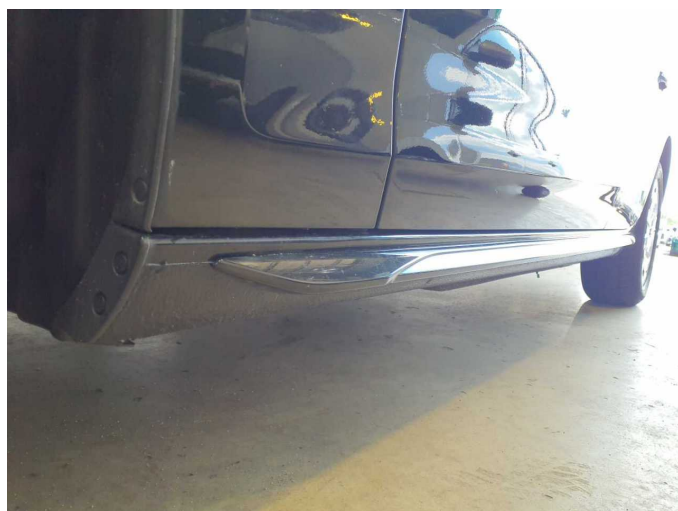


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.




Figure 28: Misc.



Figure 29: Misc.




Damage 1: Equipment: Tirefit filler - Expired - Replace

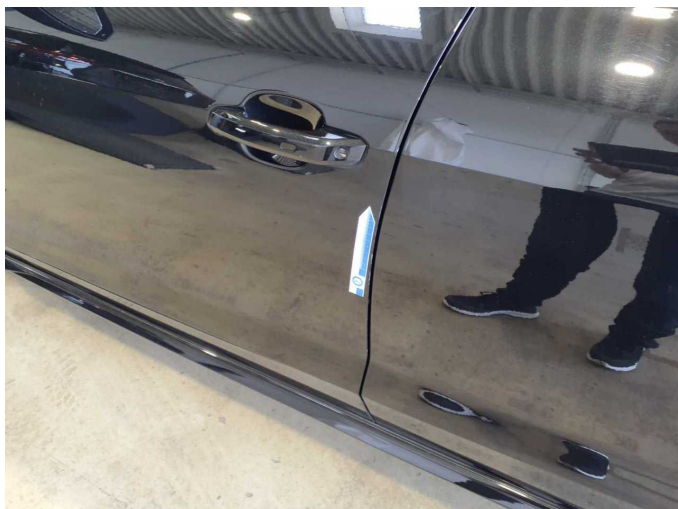

Damage 2: Door - front left side: Door edge - Scratched - Smart repair




Damage 2: Door - front left side: Door edge - Scratched - Smart repair

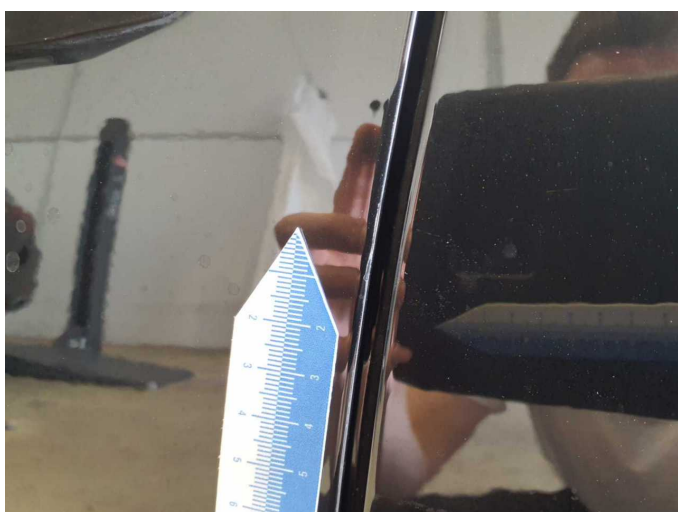

Damage 2: Door - front left side: Door edge - Scratched - Smart repair



Damage 3: Steering system: Steering wheel - Scratched - Smart repair

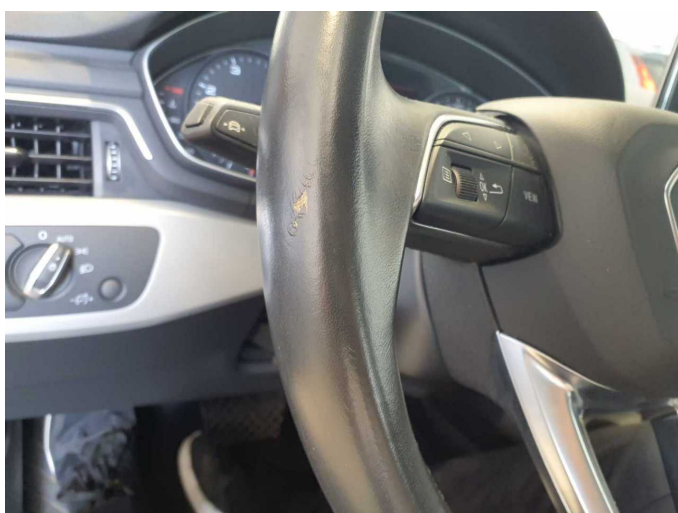


Damage 3: Steering system: Steering wheel - Scratched - Smart repair



Damage 4: Body: A-pillar - left side - Stone chips - Smart repair



Damage 4: Body: A-pillar - left side - Stone chips - Smart repair

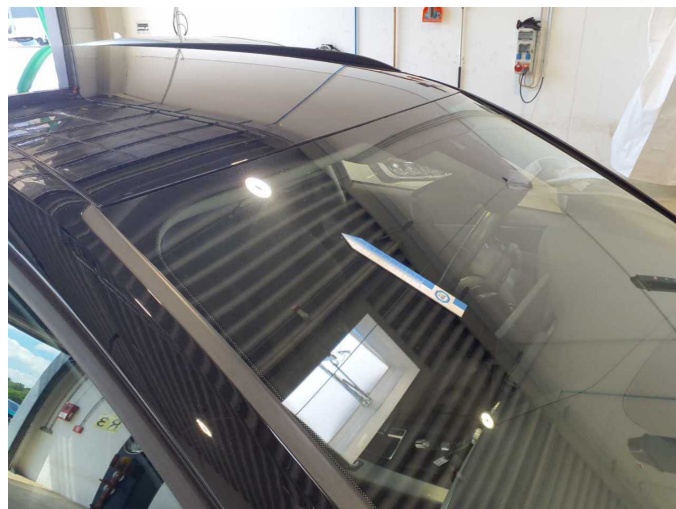

Damage 5: Vehicle glazing: Windscreen with lane departure assistant - Stone chips - Smart repair




Damage 5: Vehicle glazing: Windscreen with lane departure assistant - Stone chips - Smart repair




Damage 6: Front bumper: Front bumper - Scratch(es) - Smart repair




Damage 6: Front bumper: Front bumper - Scratch(es) - Smart repair

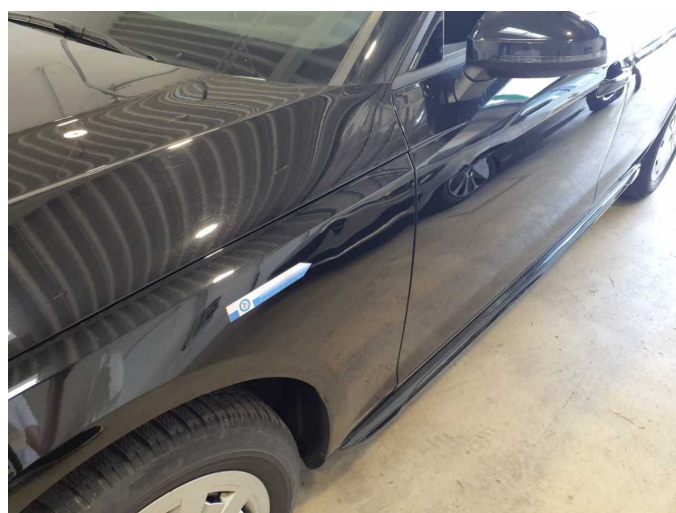


Damage 7: Mudguard - left side: Mudguard - left side - dent(s) - Repair and paint

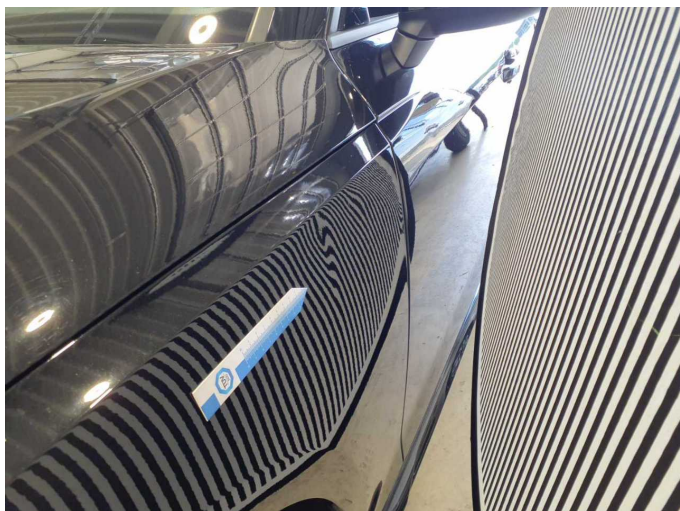

Damage 7: Mudguard - left side: Mudguard - left side - dent(s) - Repair and paint

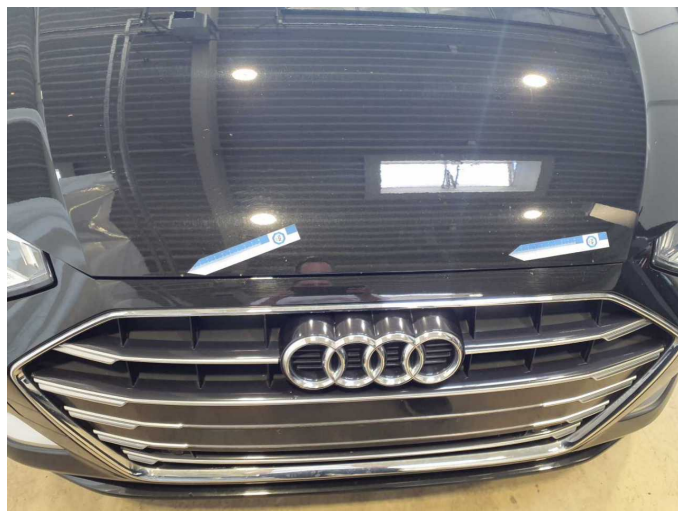

Damage 8: Bonnet: Bonnet - Corrosion - Repair and paint

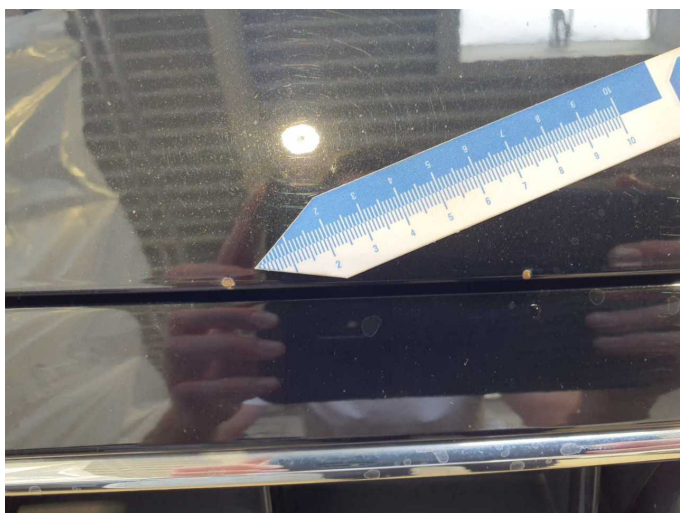


Damage 8: Bonnet: Bonnet - Corrosion - Repair and paint



Damage 8: Bonnet: Bonnet - Corrosion - Repair and paint




Wear and tear 2: Wheel / tyres: Tyre - front (Kein Teil der Ausstattung) - Does not meet the leasing specifications - No deduction

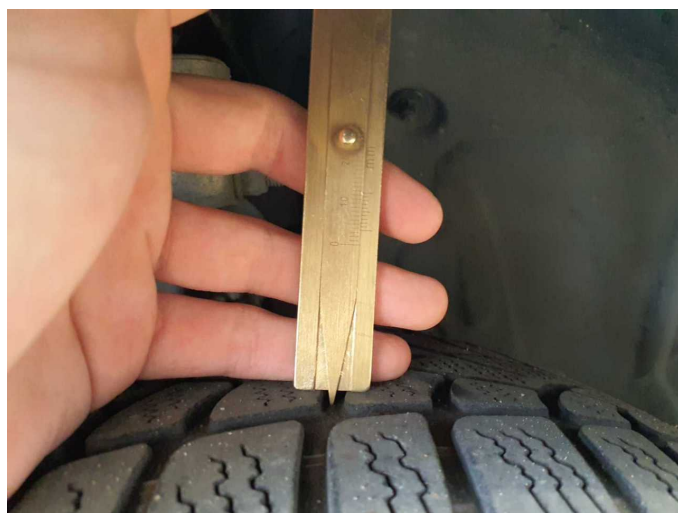


Wear and tear 2: Wheel / tyres: Tyre - front (Kein Teil der Ausstattung) - Does not meet the leasing specifications - No deduction



Wear and tear 2: Wheel / tyres: Tyre - front (Kein Teil der Ausstattung) - Does not meet the leasing specifications - No deduction

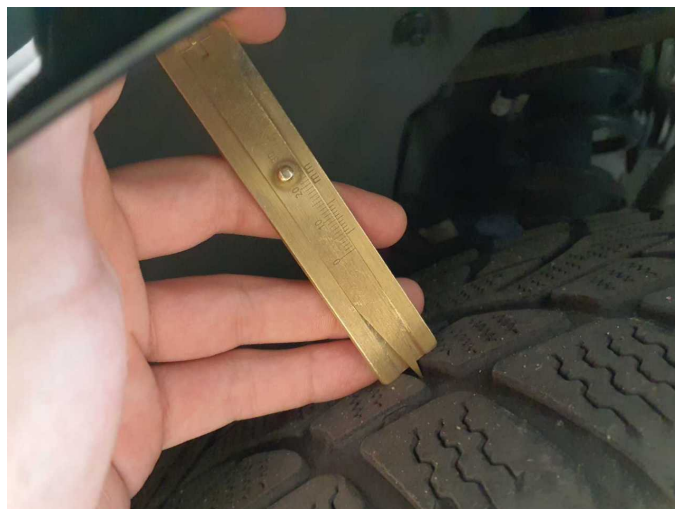

Wear and tear 2: Wheel / tyres: Tyre - front (Kein Teil der Ausstattung) - Does not meet the leasing specifications - No deduction

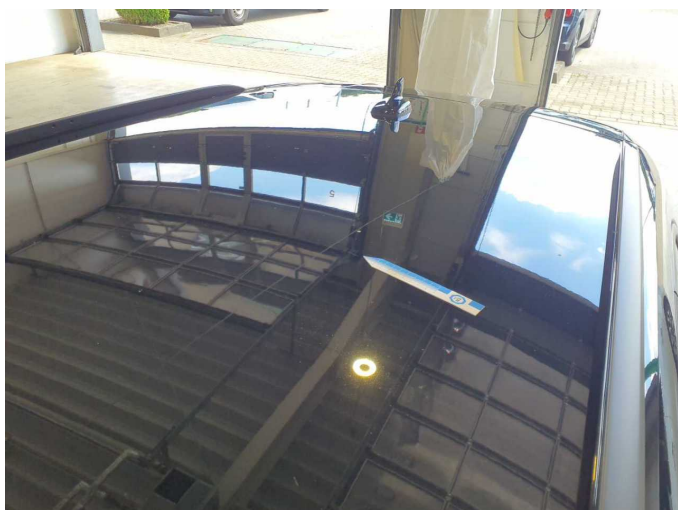

Wear and tear 3: Roof: Roof (polierbar) - Scratch(es) - No deduction



Wear and tear 3: Roof: Roof (polierbar) - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF44NA002506
Hersteller / Modell: AUDI AUDI A4 Avant 35 TDI S tronic advanced

Datum	KM-Stand	Beschreibung
09.04.2026	84.048	Batterie ern; Lichtmaschine ern/inst; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Reparatur Sonstiges; Systemtest/Eigendiagnose; Wartung Sonstiges
30.09.2025	78.192	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst
20.03.2025	69.358	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges
28.08.2024	57.189	AU; Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Getriebeöl ern/prüfen; Kraftstofffilter ern; Reparatur Sonstiges; Wartung Sonstiges
25.06.2024	54.204	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
25.09.2023	39.744	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
07.08.2023	37.107	AU; Bremsflüssigkeit; Bremsflüssigkeit ern; Systemtest/Eigendiagnose; Wartung Sonstiges
04.01.2023	24.228	Systemtest/Eigendiagnose
06.12.2022	23.848	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges