



Expertise

Protocol number: 46599085
Order No. / Reference: 26621397
Inspection date: 17 Jul 2026

Manufacturer: Ford	Model: Tourneo Lang 230L2 Connect 1.5 EcoBlue Start-Stop Titanium
VIN: WF0UXXWPGUNY75064	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Tourneo Lang 230L2 Connect 1.5 EcoBlue Start-Stop Titanium	
Vehicle Identification number	WF0UXXWPGUNY75064
Mileage (Read)	77,201 km
First registration	11 Apr 2022
Number of holders	1
Next periodical technical inspection	05/2027
(Report not on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,499 ccm / 4
Power	88 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Frozen White
Doors / Seats	5 / 7
Upholstery type	Cloth
Colour of upholstery	Anthracite-Black



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	40 %
Last service on / at	05/2025 at 59,973 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GH426647
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BLK 00420		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,445 kg	Empty weight	

Tyres			
Mounted tyres			
#	Tyre size	Type of tyre	Tread depth
1)	205/60 R16 96H	Summer tyres on Light alloy	4mm / 4mm
2)	205/60 R16 96H	Summer tyres on Light alloy	4mm / 4mm

Replacement			
Typ	Tyre size	Type of tyre	Tread depth
	Tirefit	Expiration date 02/2026	

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage: Door armrest, padded, with fabric cover
- Exterior mirrors, electrically adjustable, heated and foldable
- Tires: 6.5 J x 16 alloy wheels (4) with 205/60 R 16 tires
- On-board computer
- Roof rails, aluminum, without crossbars
- Third brake light
- Lane keeping assist including lane keeping assist and driver fatigue warning
- Ford EcoSelect: a selectable driving mode
- Ford Power Start function
- Heated windshield
- Removable luggage compartment cover
- Transmission: 6-speed manual transmission
- Rear swing door including heated rear window and wiper/washer system
- Interior mirror automatically dimming
- Intelligent security system
- Air conditioning with automatic temperature control
- Headrests 2 front, height adjustable
- Paint finish: Solid
- Leather gear knob
- Adjustable steering column
- Armrest - centre, rear
- Fog light
- Package: Seat Package 29
- Rear parking pilot system
- Pollen filter and dust filter
- Radio equipment: Ford Audio System 154
- Tire pressure monitoring system
- Headlight assistant with day/night sensor
- Side protection strips, painted in vehicle color
- Safety Brake Assist (EBA)
- Sun visor with mirror on driver and passenger side (for drivers with ticket holder)
- Concealed storage compartment on dashboard
- Power outlet: 12-volt connection on the center console, front and rear
- Front bumper painted in body color
- Carpet floor mats for the front (2-piece set)
- Traffic sign recognition system
- Immobilizer EPATS
- Heat-insulating glazing, tinted (from the B-pillar)
- Central locking with remote control (door lock only on driver's door)
- Anti-lock braking system (ABS) with electronic brake force distribution (EBD)
- Exterior mirror caps painted in car color
- Hill start assist
- Front overhead storage compartment
- Diesel particulate filter (DPF)
- Electronic Safety and Stability Program (ESP)
- Rear power windows, right and left, electric
- Front electric windows with quick-up/down and all-around closing function
- FordPass Connect including live traffic information and Wi-Fi hotspot
- Cruise control
- Glove compartment with lid
- Interior lighting for passenger/cargo compartment
- Interior lighting front and rear with delay function
- Intelligent battery management system
- Isofix bracket
- Rear headrests (3)
- Radiator grille with 5 crossbars, black plastic and chrome trim
- Steering wheel: Multifunction leather steering wheel, 4 spokes
- Front center console "Premium"
- Emergency brake light
- Panoramic roof
- Pollen and dust filter
- Pre-Collision Assist
- Tire repair kit, space and weight saving
- Windscreen wipers with rain sensor
- Sliding door, right and left
- Electromechanical power steering
- Bench seat (in the 2nd row, 3 seats). 60:40 split, foldable.
- Front spoiler lip
- Start-stop system
- 12-volt socket in storage compartment on dashboard (driver's side)
- Rear bumper painted in body color
- Daytime running light
- Child safety lock on sliding doors
- Warning system for unfastened driver and front passenger seat belts
- Heat-insulating glazing, lightly tinted
- Central locking: 2nd remote control key for central locking



Extra equipment

- High beam assist (including windscreen wipers with rain sensor and automatically dimming interior mirror)
- Navigation: Ford Audio System 9 navigation systems, including Ford SYNC 3 with AppLink, touchscreen, and reversing camera (Ford SYNC 3 communication and entertainment system with voice control, 6" color touchscreen, high resolution, 15.2 cm screen diagonal, radio (FM/AM), 2 USB ports, 6 speakers, audio remote control on the steering wheel, Bluetooth hands-free system and audio streaming, emergency call assistant, premium center console, reversing camera including rear parking assist system, phase-differentiated antenna, DAB/DAB+, voice control for audio and telephone, support for Android Auto and Apple CarPlay, dynamic navigation TMCpro, live traffic, 3D display)
- Seats: 3rd row of seats with 2 single seats BYCAJ
- Blind Spot Assist (narrow mirror format) incl. Cross Traffic Alert (incl. electric windows front and rear, with quick-up/down function)
- Ford Power Start function with Ford Key Free system (keyless starting and locking/unlocking - exterior door handles painted in body color)
- Panoramic roof and two crossbars (with "Solar Reflect" heat protection and electric sunshade including roof rails, aluminum in the roof storage gallery including glasses storage compartment and fold-out additional mirror for eye contact with rear passengers)
- Parking assistant with parking and exiting function (Active Park Assist) (for perpendicular and parallel parking spaces as well as with exiting assistant and parking pilot system front and rear)
- Radio accessory: CD player (for storage compartment on the Ford audio or navigation system)
- Crosswind Assist and Rollover Protection ((RSC Roll Stability Control))
- Dividing net, 2nd row

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Sliding door - left side	Sliding door with glass panel (Dichtung ab) - Loose - Replace

Wear and tear

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Wing mirror - left side	Cap - Abrasion - No deduction
4	Rear bumper	Rear bumper - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Trim / covers - Floor mats



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

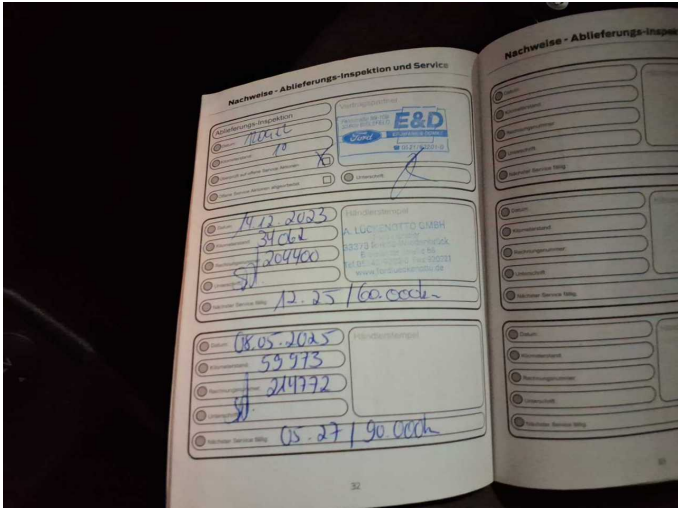


Figure 14: Documents

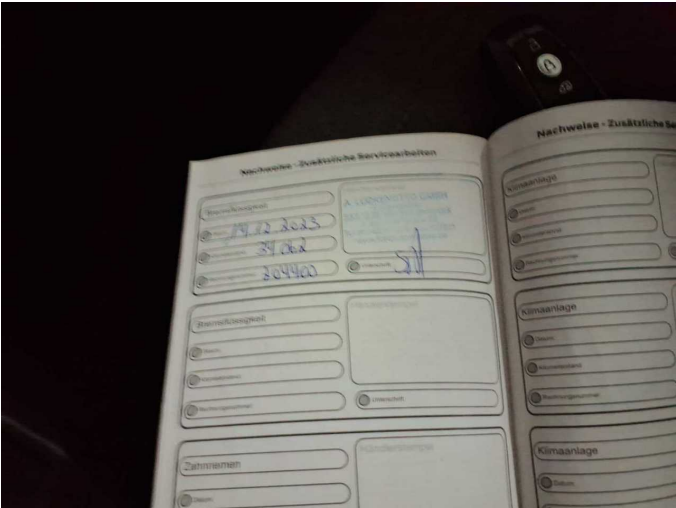


Figure 15: Documents

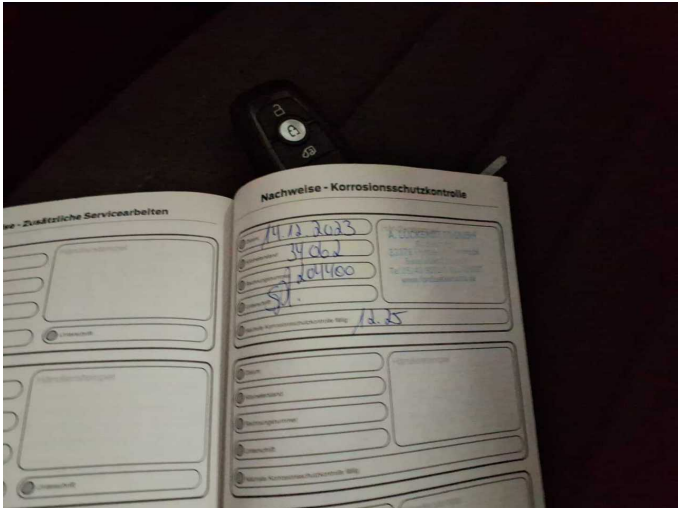


Figure 16: Documents

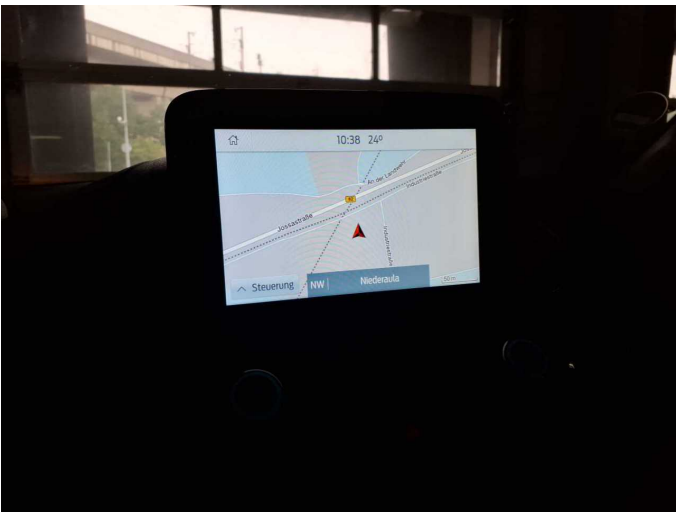


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

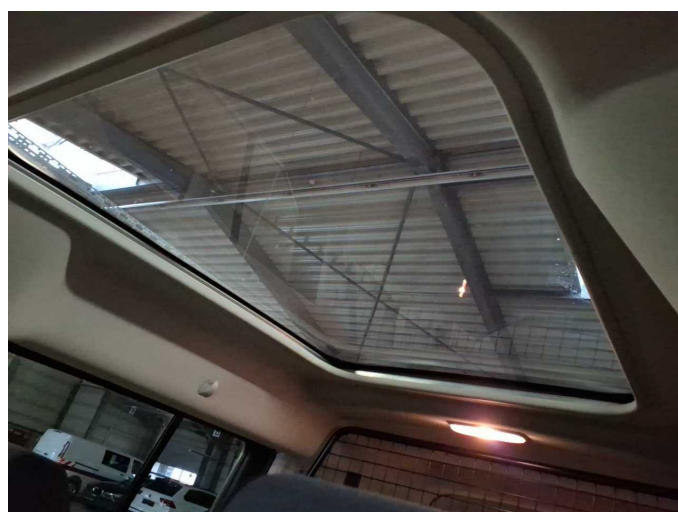


Figure 22: Misc.



Figure 23: Misc.

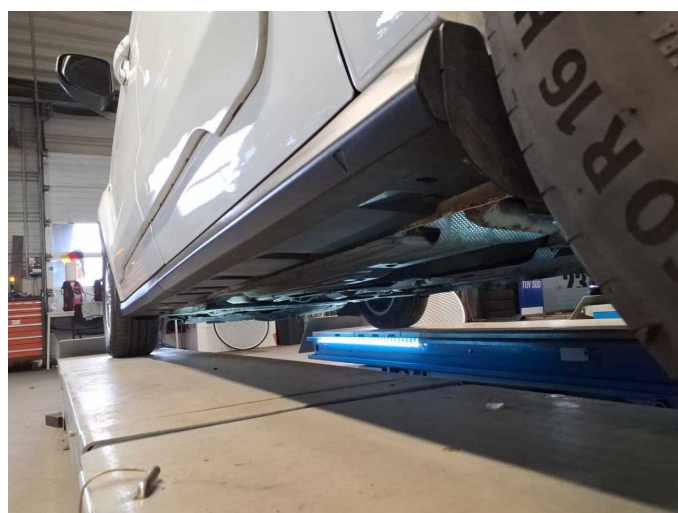


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

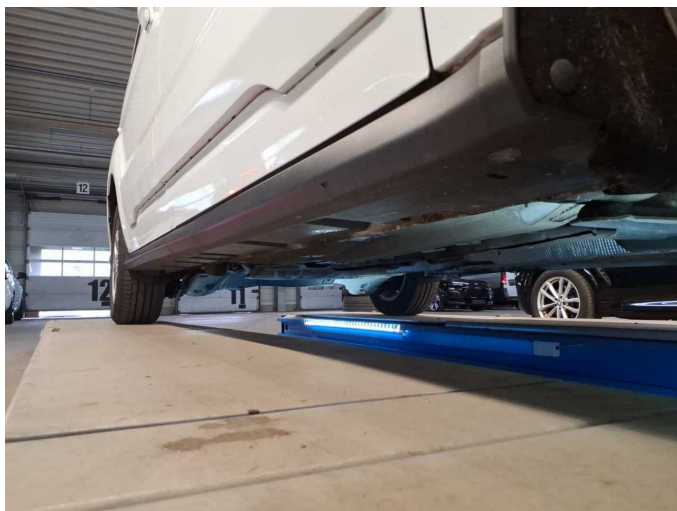


Figure 27: Misc.



Figure 28: Misc.

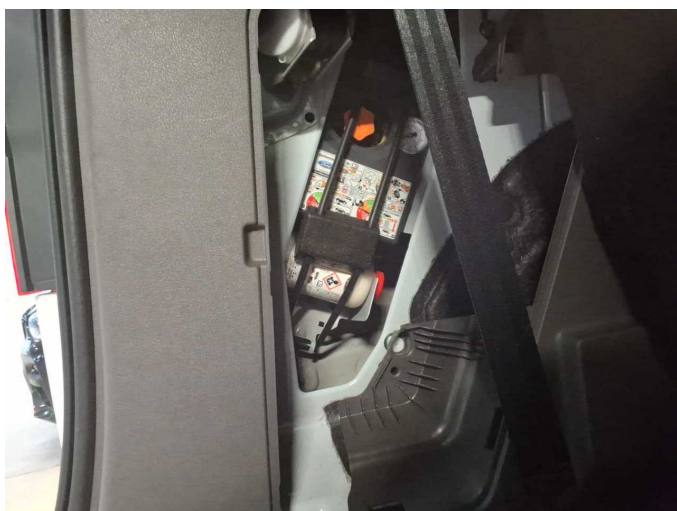


Figure 29: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Sliding door - left side: Sliding door with glass panel (Dichtung ab) - Loose - Replace




Damage 2: Sliding door - left side: Sliding door with glass panel (Dichtung ab) - Loose - Replace



Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction

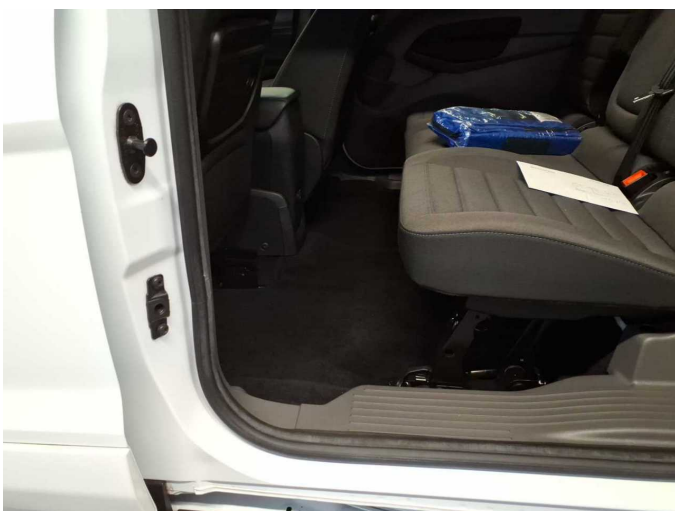

Missing part 1: Trim / covers: Floor mats - Missing - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0UXXWPGUNY75064

Hersteller / Modell: FORD FORD Grand Tourneo Connect 1.5 EcoBlue Start/Stop
Titanium

Datum	KM-Stand	Beschreibung
09.05.2025	59.973	Bremsflüssigkeit; Bremsflüssigkeit ern; HU + AU; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
14.12.2023	34.062	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges