



Expertise

Protocol number: 46519150
Order No. / Reference: 26489891
Inspection date: 8 Jul 2026

Manufacturer: Mercedes-Benz
VIN: W1KAF5EBXPR119678

Model: C 300 e 9G-TRONIC Avantgarde



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz C 300 e 9G-TRONIC Avantgarde	
Vehicle Identification number	W1KAF5EBXPR119678
Mileage (Read)	34,485 km
First registration	24 May 2023
Number of holders	1
Next periodical technical inspection	04/2028
(Report on hand)	
Power / Engine displacement	150 kw / 1,999 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufll / 4
Gearbox / Number of gears	Automatic / 9
Type of drive	Rear drive
Type of vehicle	Saloon car
Colour / colour code	Selenitgrau Metallic
Doors / Seats	4 / 5
Upholstery type	Leather
Colour of upholstery	Black
readiness to drive	Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	175 Tag(e)
Last service on / at	11/2025 at 26,323 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV669232
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	2222 / BCX 00071		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,615 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 95Y	Summer tyres on Light alloy	Michelin	5mm / 5mm
2)	255/40 R18 99Y	Summer tyres on Light alloy	Michelin	3mm / 3mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 98H	Winter tyres on Light alloy	Michelin	6mm / 6mm
2)	245/45 R17 99H	Winter tyres on Light alloy	Michelin	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag for driver and front passenger
- Airbag: Center airbag
- Airbag: Windowbag for driver and front passenger
- Ambient lighting with 64 light colors
- Basic services
- Brake assist, active
- DYNAMIC SELECT
- Electronic Stability Program (ESP)
- Electric windows (4-way)
- Speed Limit Assistant
- Rear bumper in body color
- Instrument panel upper section in black
- ISOFIX child seat attachment with top tether in the rear
- KEYLESS-GO start function
- THERMATIC automatic climate control with 2 climate zones
- Front headrests
- Charging system: AC charging system 11kW
- Steering wheel: Multifunction sports steering wheel in leather
- Mercedes-Benz emergency call system
- Center console in high-gloss black
- Package: Storage
- Package: Interior lighting package
- Radio: Extended MBUX functions
- Radio accessories: Digital radio (DAB)
- Radio accessories: Central display
- Tire pressure monitoring system (TPMS)
- Windscreen wipers with rain sensor
- Lane Keeping Assist, active
- High-visibility vest for drivers
- Central locking with remote control
- Airbag: Automatic passenger airbag deactivation
- Airbag: Side airbag for driver and front passenger
- Acoustic environmental protection
- Left and right exterior mirrors are heated and electrically adjustable
- Double cup holder at the front
- ECO start/stop function
- Chassis: Comfort chassis
- Velour floor mats
- Transmission: 9-speed automatic, 9G-TRONIC
- Interior headliner fabric crystal grey
- Lower section of the instrument panel in black or macchiato beige with contrasting decorative stitching
- Mechanical child safety lock for the rear doors
- Rear headrests (3)
- Charging cable for household socket, 5m, smooth (This charging cable, also called Mode 2 cable, allows you to charge the vehicle battery at the household socket with up to 1.8 kW (230 V, 1-phase, 8A) and fits sockets of type E/F CEE 7/7)
- Otto particulate filter
- Package: AVANTGARDE Exterior (300e)
- Package: Park
- Radio: MBUX
- Radio accessories: Communication module (LTE) for using Mercedes me connect services
- Remote Services Plus
- Seats: Rear seat backrests foldable
- Cruise control
- Electronic immobilizer
- Decorative elements in diamond pattern, silver-grey



Extra equipment

- Head-up display
- Comfort closing of the trunk lid (Convenient operation at the touch of a button: You can easily open and close the trunk lid by pressing a button in the driver's door, on the trunk lid or on the vehicle key.)
- Charging system: Direct current charging system (DC charging) (For optimal charging speed with a maximum of 55 kW and therefore high convenience. Fast charging stations such as IONITY supply the direct current required for your high-voltage battery. Thus, the direct current charging system provides the best possible electric range in the shortest possible time.)
- Package: Advanced Light Package (DIGITAL LIGHT: -HD system with projection module (more than 1.3 million pixels per headlight) and MULTIBEAM LED background module -Adaptive Highbeam Assist Plus -ULTRA RANGE high beam with a range of more than 600 m -Topography compensation -Cornering light with roundabout and intersection function -Active curve light with predictive control -Extended fog light, city light, country road light, motorway light, motorway high beam and bad weather light)
- Package: AVANTGARDE Interior P14
- Package: Driving Assistance Package Plus (Active Distance Assist DISTRONIC, Active Speed Limit Assist, Extended Automatic Restart on Highways, Route-Based Speed Adaptation with Traffic Jam End Function, Active Traffic Jam Assist, Active Steering Assist, Active Lane Change Assist, Active Emergency Stop Assist, Emergency Lane Function, Active Brake Assist with Vehicle, Bicycle and Pedestrian Detection; Intersection Function, Turn Function, Traffic Jam End Emergency Braking Function, Evasive Steering Assist, Active Lane Keeping Assist, Active Blind Spot Assist, PRE-SAFE Impulse Side)
- Package: Public Charging (charging cable for wallbox and public charging stations, 5m, smooth (charging the vehicle battery at the wallbox or at public charging stations with up to 11 kW (Type 2, 3-phase, 16 A)) - Remote and Charging Services Plus)
- Upholstery: Leather
- Remote and Charging Services Plus (The Remote and Charging Services Plus package connects you to the vehicle. You can locate it if desired and remotely control selected functions. With Mercedes me Charge, you can charge your vehicle at many public charging stations with maximum cost transparency. You only need to register once and receive a single, centralized bill.)
- Wheels: Winter complete set of M+S wheels, 4-piece set, 43.2 cm (17") alloy wheels, 5-spoke design (gloss-turned front axle 225/50 R17 on 7 J x 17 ET44.5, rear axle 245/45 R17 on 8 J x 17 ET49.5)
- Black fabric headliner
- Paint finish: Metallic
- Charging cable for wallbox and public charging station, 5m, smooth 11kW (This charging cable, also called Mode 3 cable, allows you to charge the vehicle battery at the wallbox or at public charging stations with up to 11 kW (Type 2, 3-phase, 16 A).)
- Center console diamond pattern silver grey
- Package: Advanced Comfort Package (Heated seats for driver and front passenger - Seat Comfort Package: - Numerous electric and manual adjustment options for the front seats to adapt to the specific body and comfort requirements of the driver and front passenger - Electro-pneumatic 4-way lumbar support and lateral support adjustment with control element on the seat - Electric seat cushion tilt adjustment - Electric height adjustment - Electric backrest adjustment - Electric seat cushion depth adjustment - Mechanical longitudinal adjustment - Mechanical headrest adjustment)
- Package: Advanced Parking Package (12 ultrasonic sensors - 360° camera - Active Parking Assist with PARKTRONIC: detects free parking spaces, assisted parking, visual and acoustic warning, display of camera and ultrasonic data in the media display - Cross traffic warning: can provide visual and acoustic warnings when reversing out of a parking space and, if necessary, automatically initiate emergency braking - Reverse maneuvering brake: can trigger a braking process - Drive-away assist)
- Package: High-End Infotainment Package (MBUX Navigation Premium (hard drive navigation, pre-installation for Live Traffic Information), Traffic Sign Assist, Smartphone Integration (connects the mobile phone wirelessly to the multimedia system via Apple CarPlay and Android Auto), Wireless charging system for mobile devices in the front, Driver display - 31.2 cm (12.3") color LCD display, Central display - 30.2 cm (11.9") touch display, MBUX Augmented Reality for navigation.)
- Package: Mirror package (both exterior mirrors electrically folding (button in the driver's door control panel) - interior mirror and exterior mirror on the driver's side automatically dimming continuously - ambient lighting of the exterior mirror to illuminate the entry area with projection of the Mercedes-Benz logo)
- Wheels: 45.7 cm (18") light alloy wheels in 5-twin-spoke design (black painted and polished with front axle 225/45 R 18 on 7.5 J x 18 ET 40, rear axle 255/40 R 18 on 9 J x 18 ET 58)
- Wheels: Complete winter wheel sets fitted at the factory
- Sunroof: Electric panoramic sunroof
- Seats: Comfort seats



- Telephone accessories: Multifunctional telephony (Connect your mobile phone and the external antenna to work together – and benefit from improved reception. Simply place your inductively chargeable phone in the charging pad. An integrated antenna then transmits the signals to the outside. The vehicle's speakers handle the voice output. - Wireless connection of a compatible mobile phone to the external antenna - Bluetooth and Wi-Fi pairing wirelessly via NFC (Near Field Communication) technology)
- Heat and noise insulating acoustic glass (for windshield and front doors)
- URBAN GUARD Vehicle Protection Plus (Anti-theft alarm system - Towing protection with visual and audible warning in case of detected change in position - Alarm horn - Interior monitoring (triggers upon movement inside the vehicle) - Assistance with vehicle theft (theft assistance), free of charge for 3 years from activation - Emergency key deactivation, free of charge for 3 years from activation - Collision detection, free of charge for 3 years from activation - URBAN GUARD label on the front side windows)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.

Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Tyre - front left side (Flankenbeschädigung) - Damaged - Replace
2	Measurement	Undercarriage (Vermessung nach Felgen/Reifen Beschädigungen Vorderachse) - Measure
3	2nd wheel set	1 alloy rim - Scratched - Loss in value
4	2nd wheel set	1 alloy rim (Mit Materialabtrag) - Scratched - Replace
5	2nd wheel set	1 alloy rim (Mit Materialabtrag) - Scratched - Replace
6	Wheel / tyres	Alloy rim - front left side (Mit Materialabtrag) - Scratch(es) - Replace
7	Wheel / tyres	Alloy rim - front right side (Mit Materialabtrag) - Scratch(es) - Replace
8	Wheel / tyres	Alloy rim - rear right side (Großflächig verkratzt) - Scratched - Replace
9	Rear bumper	Rear bumper - Scratch(es) - Paint
10	Front bumper	Front bumper (& Lackschaden) - Deformed - Repair and paint

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side right, Provided by user / customer, from 20 Dec 2023	4.056,97 €



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

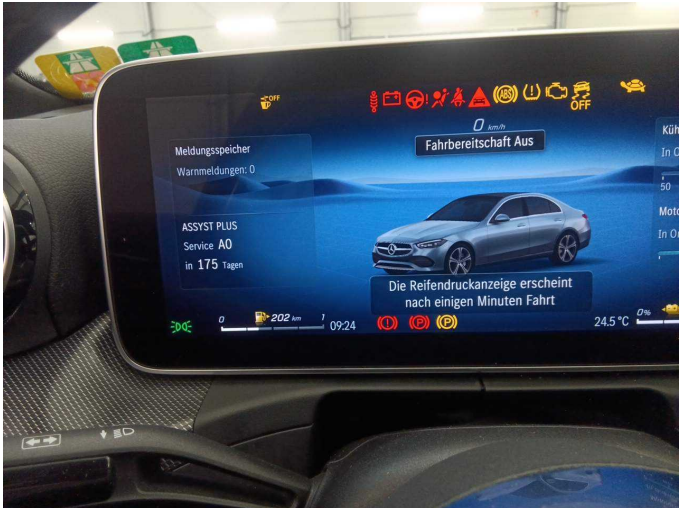


Figure 14: Documents

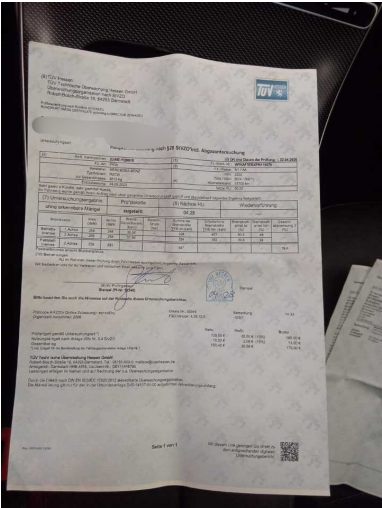


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

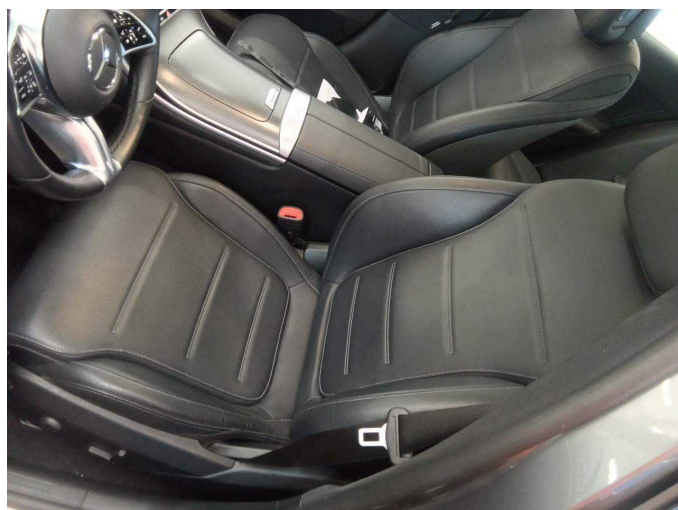


Figure 28: Misc.

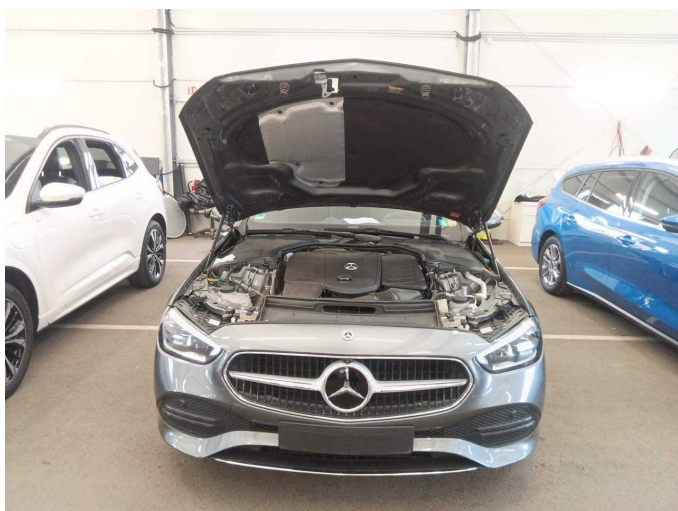


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Damage 1: Wheel / tyres: Tyre - front left side (Flankenbeschädigung) - Damaged - Replace



Damage 1: Wheel / tyres: Tyre - front left side (Flankenbeschädigung) - Damaged - Replace



Damage 3: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 3: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 3: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 4: 2nd wheel set: 1 alloy rim (Mit Materialabtrag) - Scratched - Replace



Damage 4: 2nd wheel set: 1 alloy rim (Mit Materialabtrag) - Scratched - Replace



Damage 4: 2nd wheel set: 1 alloy rim (Mit Materialabtrag) - Scratched - Replace




Damage 5: 2nd wheel set: 1 alloy rim (Mit Materialabtrag) - Scratched - Replace



Damage 5: 2nd wheel set: 1 alloy rim (Mit Materialabtrag) - Scratched - Replace



Damage 6: Wheel / tyres: Alloy rim - front left side (Mit Materialabtrag) - Scratch(es) - Replace

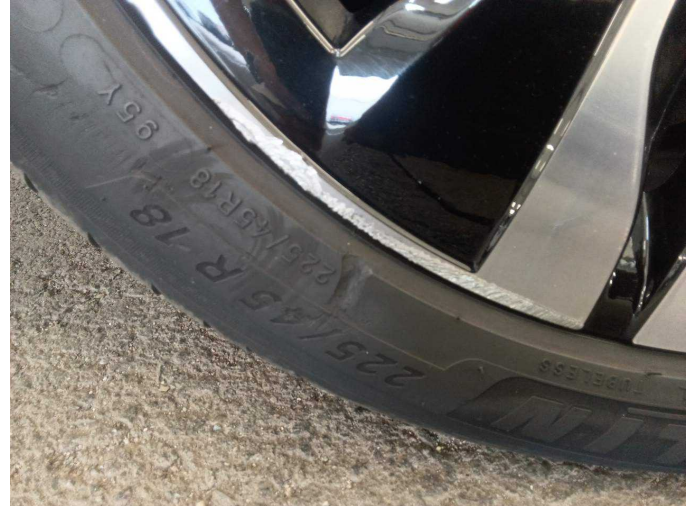

Damage 6: Wheel / tyres: Alloy rim - front left side (Mit Materialabtrag) - Scratch(es) - Replace



Damage 7: Wheel / tyres: Alloy rim - front right side (Mit Materialabtrag) - Scratch(es) - Replace




Damage 7: Wheel / tyres: Alloy rim - front right side (Mit Materialabtrag) - Scratch(es) - Replace




Damage 7: Wheel / tyres: Alloy rim - front right side (Mit Materialabtrag) - Scratch(es) - Replace



Damage 7: Wheel / tyres: Alloy rim - front right side (Mit Materialabtrag) - Scratch(es) - Replace

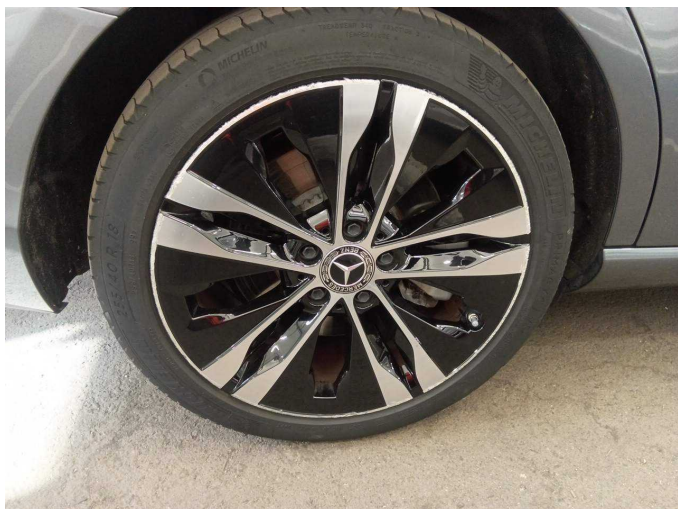

Damage 8: Wheel / tyres: Alloy rim - rear right side (Großflächig verkratzt) - Scratched - Replace

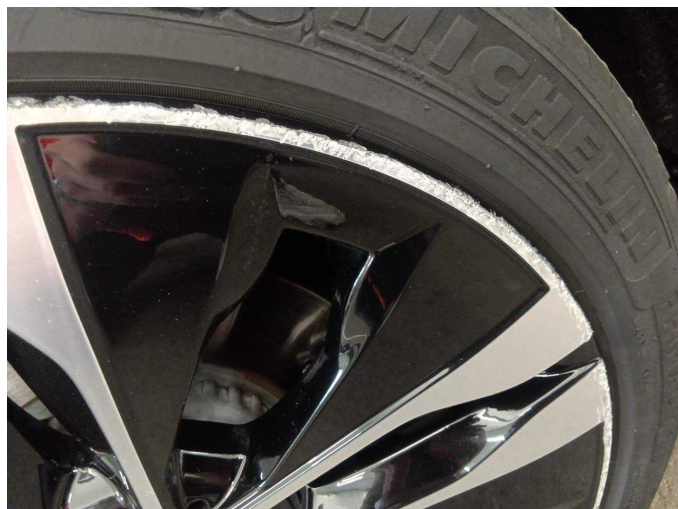


Damage 8: Wheel / tyres: Alloy rim - rear right side (Großflächig verkratzt) - Scratched - Replace




Damage 8: Wheel / tyres: Alloy rim - rear right side (Großflächig verkratzt) - Scratched - Replace



Damage 9: Rear bumper: Rear bumper - Scratch(es) - Paint

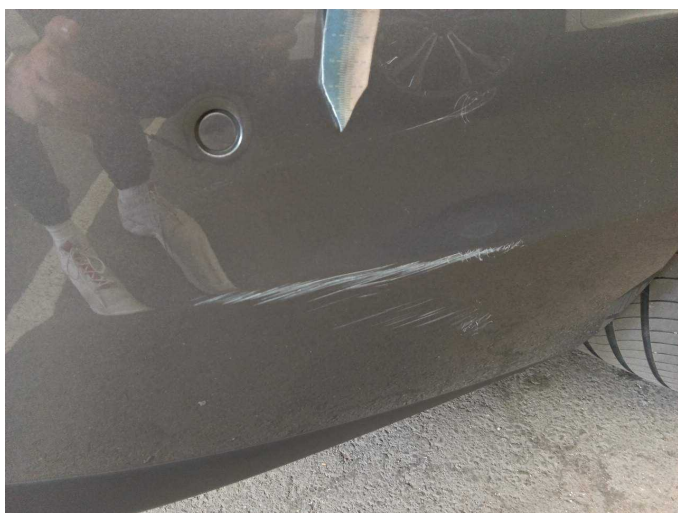

Damage 9: Rear bumper: Rear bumper - Scratch(es) - Paint

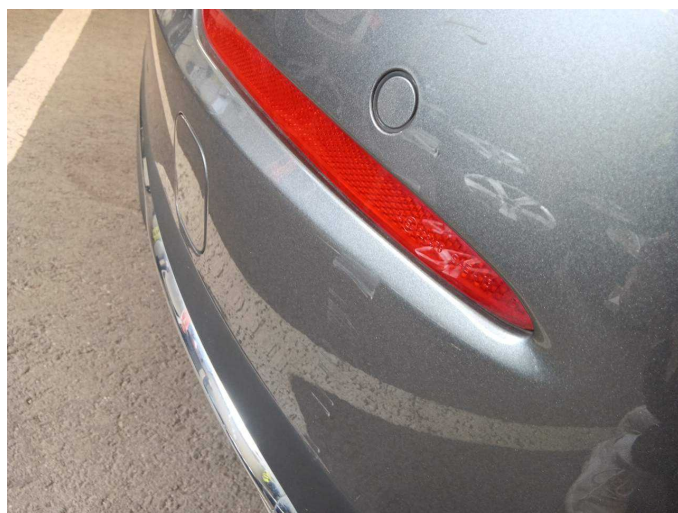

Damage 9: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Front bumper: Front bumper (& Lackschaden) - Deformed - Repair and paint



Damage 10: Front bumper: Front bumper (& Lackschaden) - Deformed - Repair and paint



Damage 10: Front bumper: Front bumper (& Lackschaden) - Deformed - Repair and paint



Damage 10: Front bumper: Front bumper (& Lackschaden) - Deformed - Repair and paint



Damage 10: Front bumper: Front bumper (& Lackschaden) - Deformed - Repair and paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1KAF5EBXPR119678

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ C 300 e 9G-TRONIC
Avantgarde

Datum	KM-Stand	Beschreibung
22.04.2026	31.755	HU + AU
03.11.2025	26.323	Regelwartungsdienst
16.08.2024	13.922	Regelwartungsdienst