



Expertise

Protocol number: 46041478
Order No. / Reference: 26453913-1
Inspection date: 3 Jun 2026

Manufacturer: Seat	Model: Alhambra 1.4 TSI S&S DSG OPF Ecomotive XCELLENCE
VIN: VSSZZZ7NZMV503617	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Seat Alhambra 1.4 TSI S&S DSG OPF Ecomotive XCELLENCE	
Vehicle Identification number	VSSZZZ7NZMV503617
Mileage (Read)	137,100 km
First registration	17 May 2021
Number of holders	2
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Black Metallic
Doors / Seats	5 / 7
Upholstery type	Cloth
Colour of upholstery	Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	8,400 km
Last service on / at	01/2026 at 133,222 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FX898042
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	7593 / ALL 00135		
Emission standard	EURO6;WLTP;DG;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,530 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 98V	Winter tyres on Light alloy	Pirelli	6mm / 6mm
2)	225/50 R17 98V	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R17 98H	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	225/50 R17 98Y	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments - Storage compartments in all front doors with holders for 1.5L bottles and atlas - under the front seats - on the instrument panel with cover - in the rear center console - in the overhead console - storage pocket and folding table on the back of the front seats - 2 front cup holders with cover - 2 cup holders in the 2nd row (if 7 seats + 2 cup holders in the 3rd row) - illuminated, lockable glove compartment with cooling function - 1 storage compartment left/right in the footwell of the 2nd row
- Lighting - Illuminated boot with tailgate puddle lights - Reflectors in the front doors - Illuminated, lockable glove compartment with cooling function
- Interior chrome applications - Chrome trim for air vents and light and hazard warning switch - Chrome trim for mirror adjustment and window regulator switches
- Electronic Stability Program (ESP) with counter-steering support - Incl. - Anti-lock Braking System (ABS) with brake assist - Traction Control (ASR) - Electronic Differential Lock (EDS) - Engine Drag Torque Control (MSR) - Trailer Stability Control
- Luggage compartment floor - Luggage compartment floor with storage compartments (only in 5-seater models) - Luggage compartment lining with storage compartments
- Heated rear window
- Interior lights front and rear with delayed shut-off
- Instrument lighting in white, adjustable; night design for switches
- ISOFIX child seat restraint system, triple in the 2nd row - Incl. Top Tether anchor point
- Air conditioning
- Front headrests (2) are height adjustable
- Steering wheel: Three-spoke leather steering wheel with multifunction controls - Leather gearshift knob
- Front center armrest with storage box - height and length adjustable
- Navigation system - 6.5" color touchscreen - CD player (MP3, WMA) - Dynamic route guidance via TMC - Navigation data for Europe (on SD card) including Mapcare - 2 SD card slots - Voice control - Bluetooth interface with integrated hands-free system - 4 speakers each in the front and rear - USB interface and 2 USB charging ports for the 2nd row of seats
- Tire pressure monitoring system
- Rear view camera
- Side and rear windows with heat-insulating glazing
- Sliding doors at the rear left and right
- Side windows from the 2nd row of seats and rear window are dark tinted.
- Seat belts: 3 three-point automatic rear belts with warning tone and light for unfastened belts
- Seats: 3 individual seats in the 2nd row - with longitudinal adjustment, backrest angle adjustment and "Easy-Fold" folding function
- Seats: Sport comfort seats in the front
- Sunshade roller blind on the rear door windows
- Driver and passenger airbags - Passenger airbag deactivation
- Airbag: Driver's side knee airbag system
- Airbag: Head airbag system for front and rear passengers
- Airbag: Side airbag for driver and front passenger
- Electrically adjustable, heated and folding exterior mirrors with ambient lighting, aspherical on the driver's side
- Exterior mirror housings in body color
- Outdoor temperature display
- LED turn signals integrated into the side of the exterior mirrors
- third brake light
- Roof rails in silver
- DPF (Diesel Particulate Filter)
- Electronic parking brake with auto-hold function
- Automatic headlight control - "Leaving home" function and manual "Coming home" function
- Chassis: Sport chassis
- Electric windows front and rear
- Luggage compartment cover - Extendable and removable
- Cruise control system
- Transmission: 6-speed manual
- LED taillights
- Rear window wiper - with intermittent function
- Interior mirror automatically dimming
- Instrument cluster - Electronic speedometer - Warning lights - Odometer and trip meter - Tachometer
- Electric child safety lock for the rear doors - operable from the driver's seat
- Comfort turn signals
- Rear headrests (3)
- Steering column with height and reach adjustment
- Illuminated makeup mirrors in the sun visors
- Multifunction display with color screen
- Fatigue detection
- Fog lights with cornering light function
- Package: Chrome package - Chrome trim on the side windows (exterior) - Chrome roof rails
- Package: Smoker's package - Consisting of front ashtray and cigarette lighter
- Upholstery: Cloth
- Rain sensor
- Wheels: Alloy wheels (4) 7 J x 17 "Dynamic II" - Mobility tires 225/50 R 17
- Headlight cleaning system
- Keyless locking and starting system Kessy
- Power steering - electromechanical, speed-dependent control
- Seat belts: Three-point automatic front belts, height-adjustable - belt tensioners
- Seats: Front passenger seat backrest can be folded down completely
- Seats: Driver's seat with electric backrest adjustment
- Seats: Front seats with height adjustment and lumbar support



- Lane departure warning system
- 12V socket - In the front center console and in the luggage compartment
- Blind spot assist
- Ultrasonic parking aid, front and rear
- Traffic sign recognition
- Lashing eyes in the luggage compartment
- Warning light for unclosed doors and luggage compartment
- Central locking including tailgate with remote control

- Start-stop system with brake energy recuperation
- Daytime running light
- Bag hooks in the luggage compartment
- Front door sill trims
- Front Assist area monitoring system with City Emergency Braking function
- Automatic hazard warning lights during emergency braking
- Electronic immobilizer
- Xenon lights: Bi-xenon with cornering lights - With dynamic headlight range control - Headlight cleaning system

Extra equipment

- Anti-theft alarm system with interior monitoring - including backup horn and tow-away protection
- Package: Business COMFORT - Adaptive Cruise Control - High Beam Assist - External Antenna Connection in the Center Armrest Storage Compartment - DAB+ - Full Link - MirrorLink™ - Android Auto - Apple CarPlay - Anti-theft Alarm System with Interior Monitoring including Backup Horn and Tow-Away Protection
- Radio accessories: FullLink - MirrorLink (compatible with Android smartphones from MirrorLink version 1.1) - Android Auto (compatible with smartphones from Android 5.0) - Apple CarPlay (compatible from iPhone 5) (Apps that comply with the specifications of the respective system or have been certified can be displayed with image and sound and operated via the touchscreen and/or voice recognition)
- Adaptive Cruise Control (ACC) up to 210 km/h
- High beam assist
- Package: Luggage compartment package - luggage net - net partition - rails on side walls with tension strap (fixable)
- Package: Winter Package - Headlight cleaning system - Heated front windshield washer nozzles - Heated front seats
- Paint finish: Metallic paint
- Radio accessories: Digital radio reception DAB+
- Radio accessories: External antenna connection in the storage compartment of the center armrest
- Seats: 7 seats - 3 individual seats in the 2nd row - 2 individual seats in the 3rd row - Easy-Entry access aid - Warning tone for unfastened seat belts
- Swiveling towbar with electric release

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Floor mats (VL) - Holes - Replace
2	Wing mirror - left side	Cap - Scratch(es) - Smart repair
3	Wing mirror - right side	Cap - Scratch(es) - Smart repair
4	Misc.	Main inspection - Due - Perform
5	Door - front left side	Door seal - Broken / torn - Replace
6	Front bumper	Front bumper - Scratch(es) - Paint
7	Bonnet	Bonnet (Vogelkotverätzung) - Paint defect - Paint
8	Rear bumper	Rear bumper - Deformed - Repair and paint



Wear and tear

No.	Component group	Description
1	Body	Body (Waschstraßenkratzer) - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 1 Apr 2025	3.655,21 €

Accident damages

No.	Accident
1	Side right

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.



Comments

- Für den montierten Radsatz wurde kein Nachweis erbracht.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.
- Es wurde keine Ausstattungsliste übermittelt, in der Rechnung gibt es keine Angaben zur Ausstattung.
- Ausstattungslinie mit Schwacke ermittelt.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

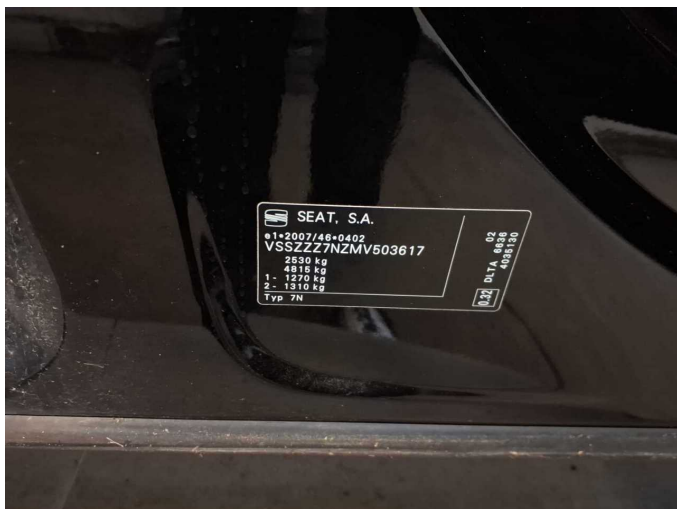


Figure 11: VIN



Figure 12: Mounted tyres

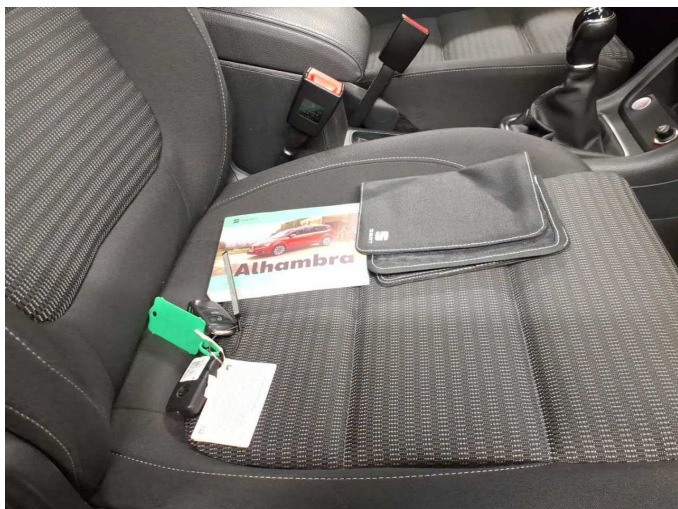


Figure 13: Documents

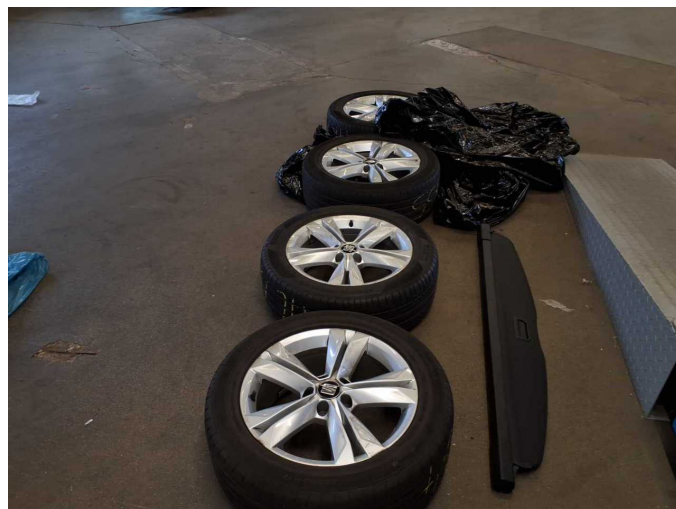


Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.

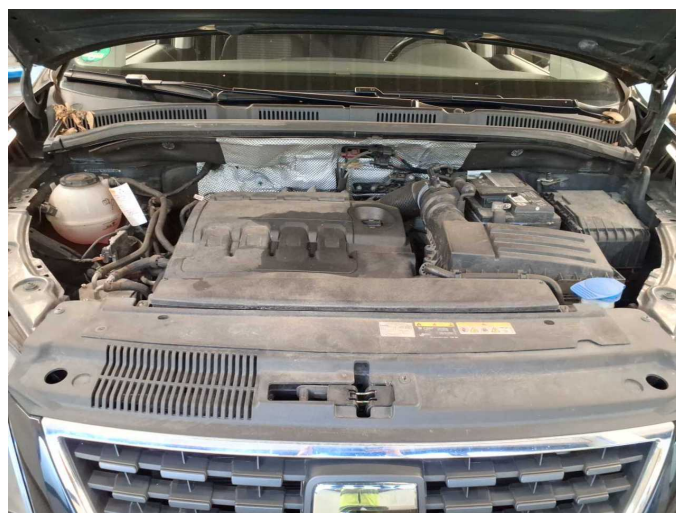


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

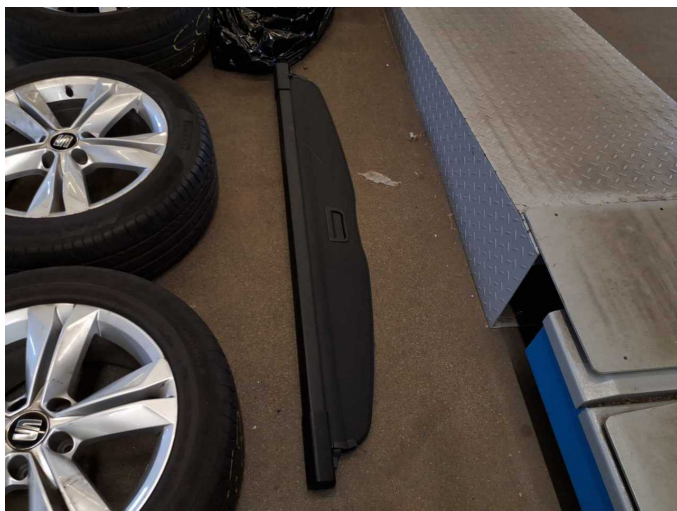


Figure 21: Misc.

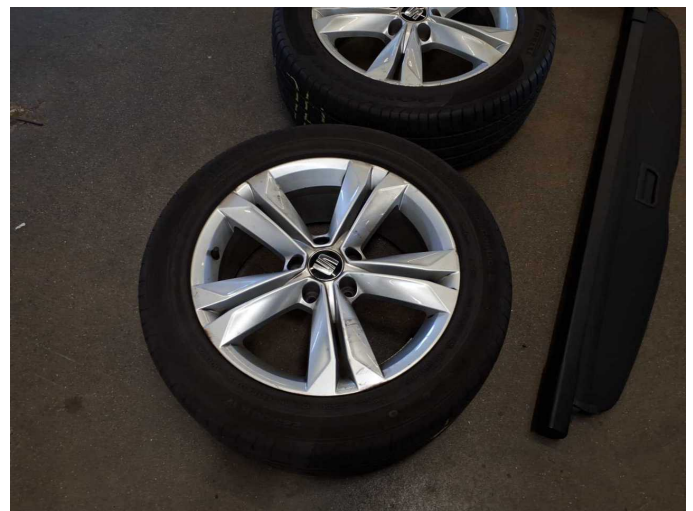


Figure 22: Misc.

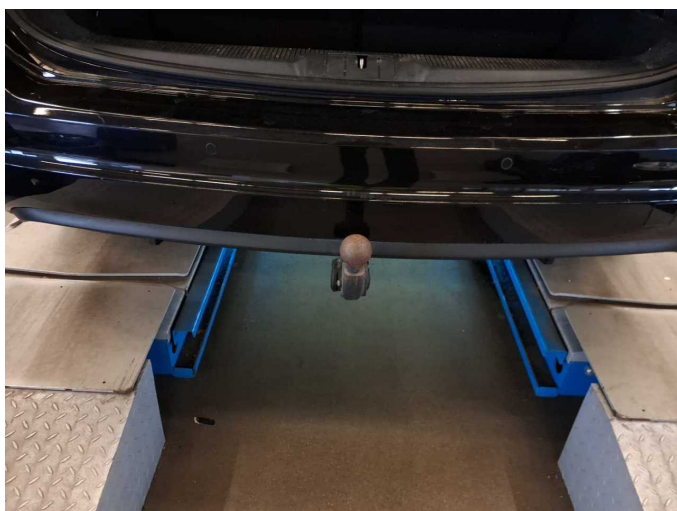


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.


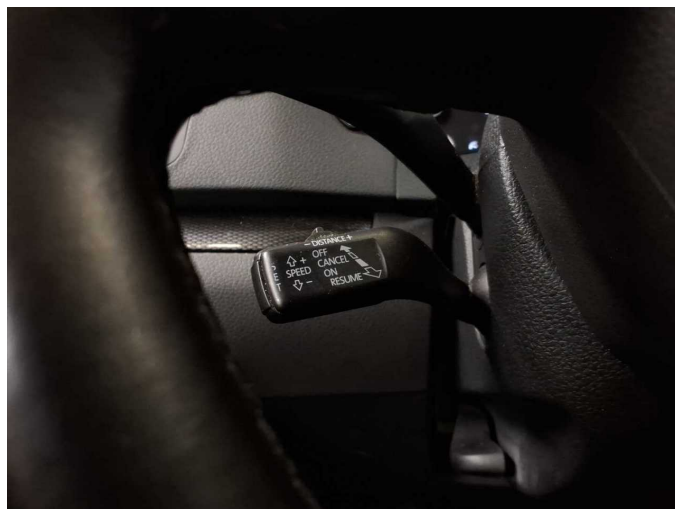


Figure 32: Misc.




Damage 1: Trim / covers: Floor mats (VL) - Holes - Replace

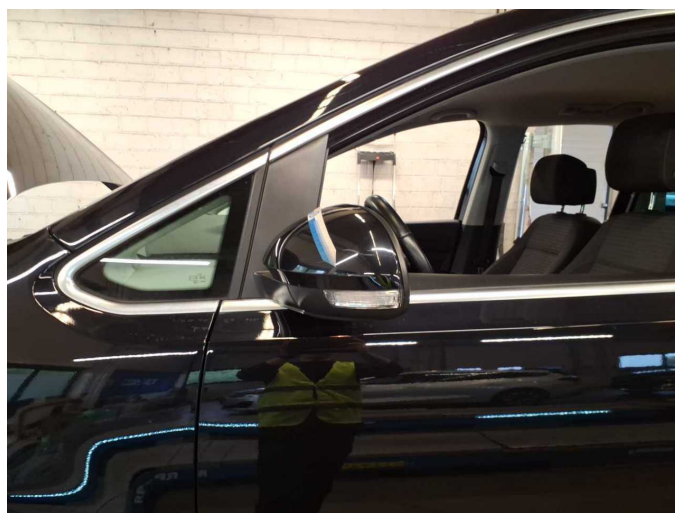

Damage 2: Wing mirror - left side: Cap - Scratch(es) - Smart repair




Damage 2: Wing mirror - left side: Cap - Scratch(es) - Smart repair

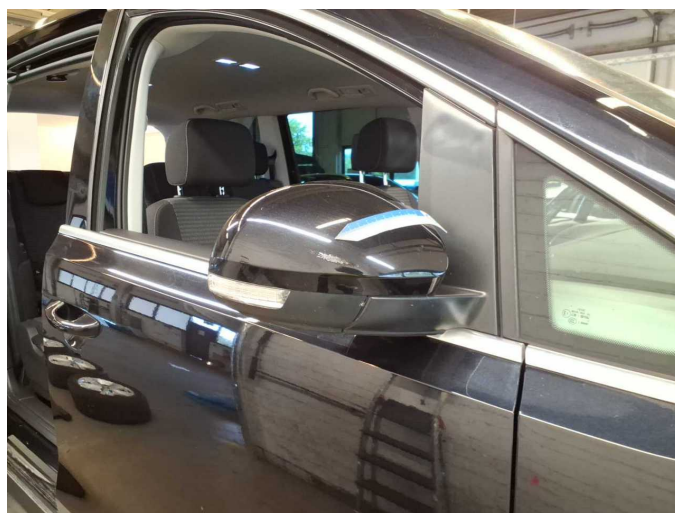


Damage 3: Wing mirror - right side: Cap - Scratch(es) - Smart repair




Damage 3: Wing mirror - right side: Cap - Scratch(es) - Smart repair

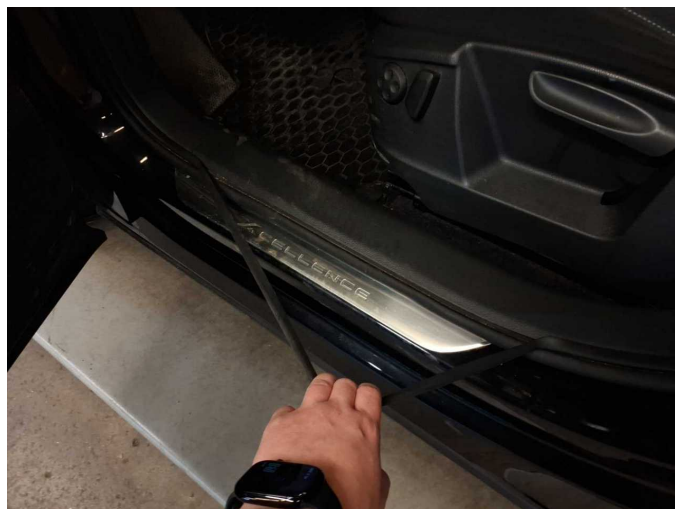

Damage 5: Door - front left side: Door seal - Broken / torn - Replace

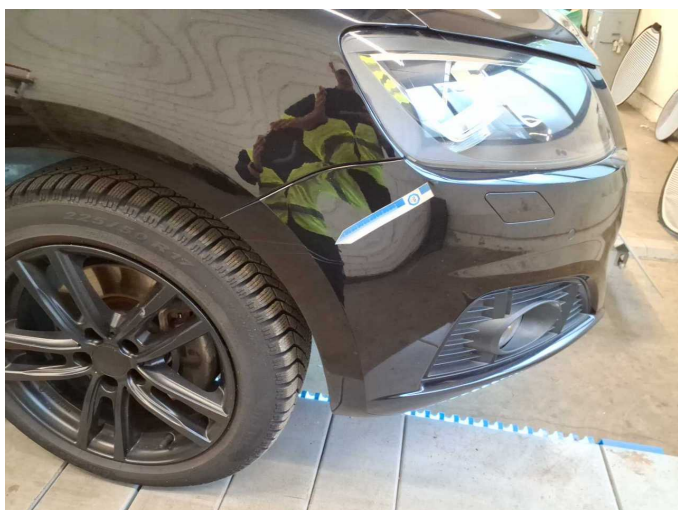


Damage 6: Front bumper: Front bumper - Scratch(es) - Paint

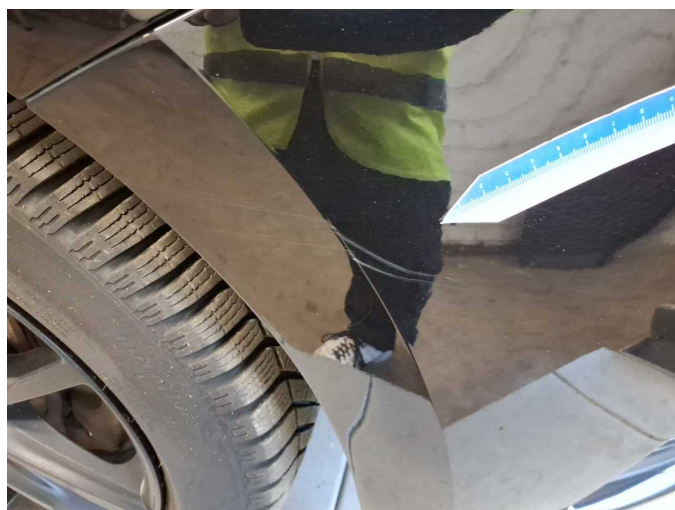

Damage 6: Front bumper: Front bumper - Scratch(es) - Paint




Damage 6: Front bumper: Front bumper - Scratch(es) - Paint

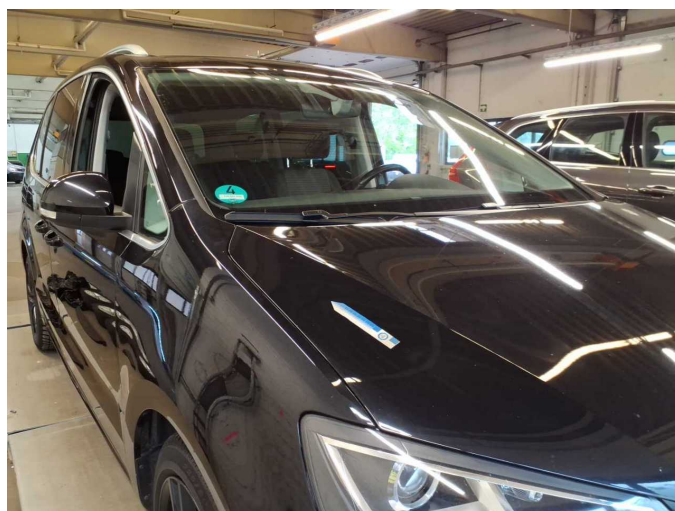


Damage 7: Bonnet: Bonnet (Vogelkotverätzung) - Paint defect - Paint



Damage 7: Bonnet: Bonnet (Vogelkotverätzung) - Paint defect - Paint

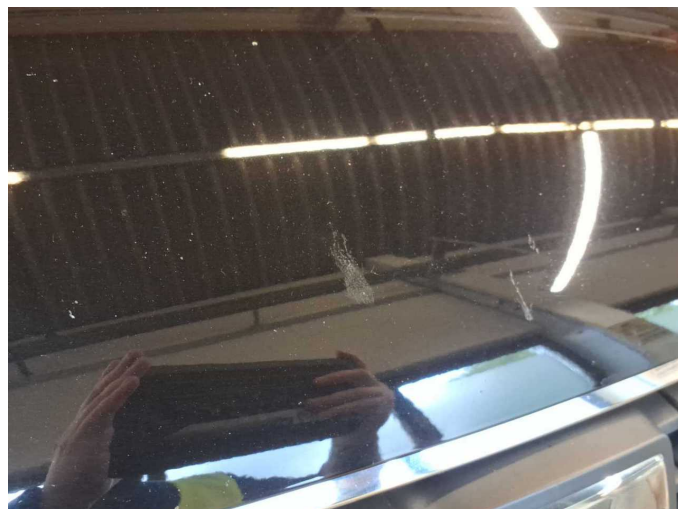


Damage 7: Bonnet: Bonnet (Vogelkotverätzung) - Paint defect - Paint

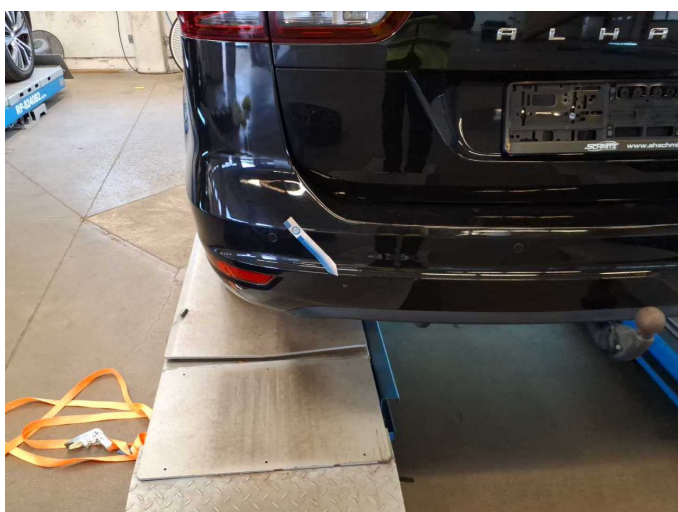

Damage 8: Rear bumper: Rear bumper - Deformed - Repair and paint



Damage 8: Rear bumper: Rear bumper - Deformed - Repair and paint

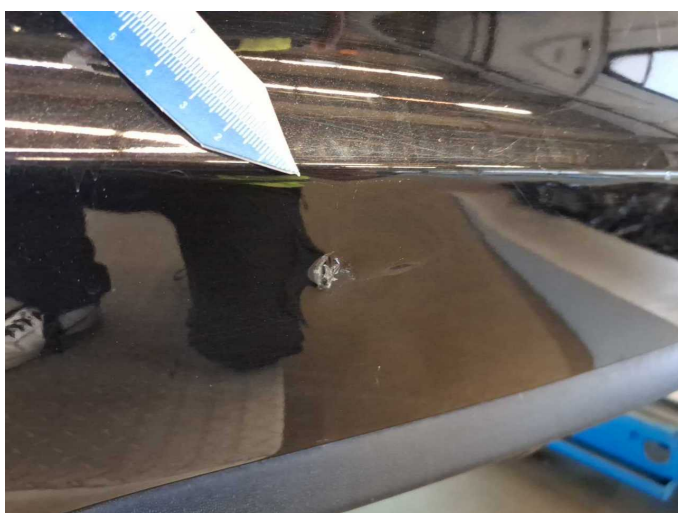


Damage 8: Rear bumper: Rear bumper - Deformed - Repair and paint




Accident 1: Side right



Accident 1: Side right

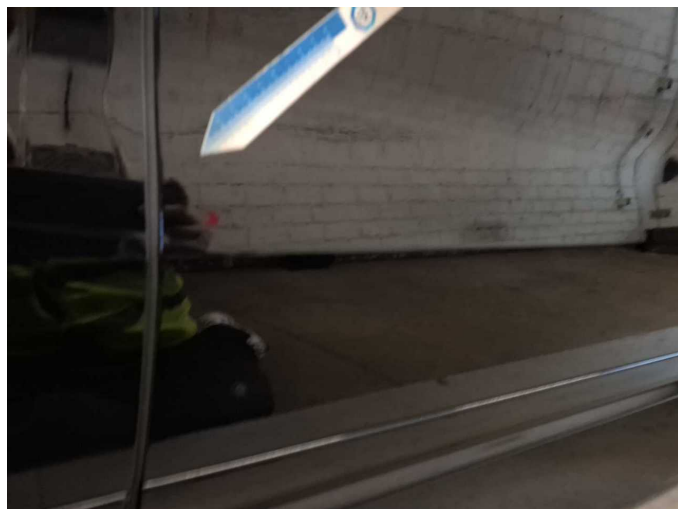


Accident 1: Side right

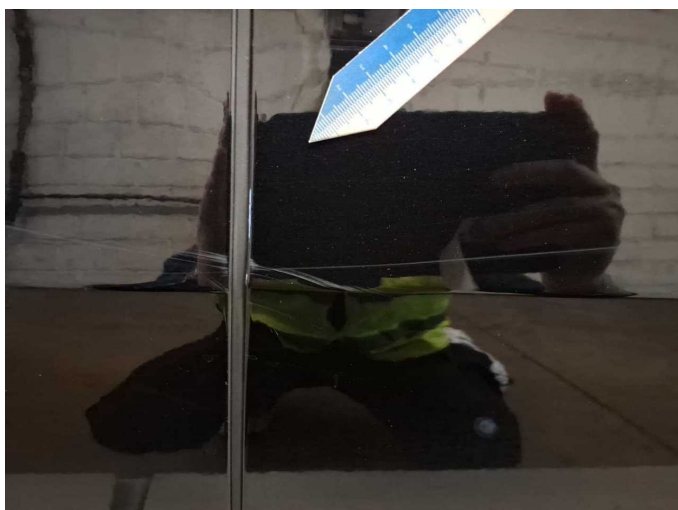

Accident 1: Side right



Accident 1: Side right

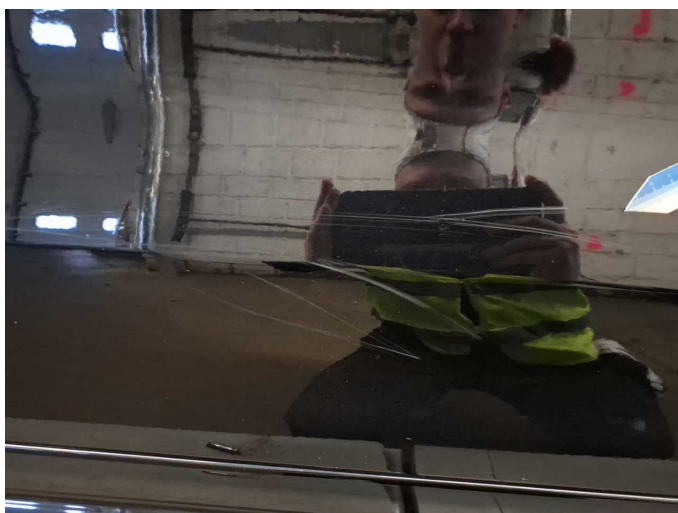

Accident 1: Side right