



Expertise

Protocol number: 46902085  
Order No. / Reference: 26755162  
Inspection date: 5 Aug 2026

Manufacturer: Volkswagen

Model: Tiguan Allspace 2.0 TSI OPF 4Motion DSG R-Line

VIN: WVGZZZ5N9NM163604



| Vehicle details                                           |                         |
|-----------------------------------------------------------|-------------------------|
| Manufacturer / Type / Model / Equipment                   |                         |
| Volkswagen Tiguan Allspace 2.0 TSI OPF 4Motion DSG R-Line |                         |
| Vehicle Identification number                             | WVGZZZ5N9NM163604       |
| Mileage (Read)                                            | 173,761 km              |
| First registration                                        | 27 Feb 2023             |
| Number of holders                                         | 1                       |
| Fuel type                                                 | Petrol                  |
| Engine displacement / Cylinder                            | 1,984 ccm / 4           |
| Power                                                     | 140 kW                  |
| Gearbox / Number of gears                                 | Automatic / 7           |
| Type of drive                                             | All-wheel drive         |
| Type of vehicle                                           | SUV                     |
| Colour / colour code                                      | Oryxweiß Perlmutteffekt |
| Doors / Seats                                             | 5 / 7                   |
| Upholstery type                                           | Alcantara / cloth       |
| Colour of upholstery                                      | Grey-Black              |
| Vehicle with smoke odor                                   | no                      |



## Vehicle details

|                                                  |                          |                                |                                                            |
|--------------------------------------------------|--------------------------|--------------------------------|------------------------------------------------------------|
| <b>Maintenance booklet / proof</b>               | digital proof / complete | <b>Next maintenance in</b>     | 16,000 km                                                  |
| <b>Last service on / at</b>                      | 04/2026 at 159,718 km    |                                |                                                            |
| <b>Key is / should be</b>                        | 2 / 2                    | <b>FZG documents</b>           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                                  |                          | <b>Letter No.</b>              | GM711835                                                   |
| <b>Previous damage / Accident</b>                | None detectable          | <b>Repainting</b>              | None detectable                                            |
| <b>Inspection conditions</b>                     | sufficient               | <b>Lifting equipment / pit</b> | yes                                                        |
| <b>Test drive</b>                                | Not performed            | <b>Engine function test</b>    | Performed                                                  |
| <b>Manufacturer key number/ type code number</b> | 0603 / CIU 04142         |                                |                                                            |
| <b>Emission standard</b>                         | EURO6                    | <b>fine dust sticker</b>       |                                                            |
| <b>Permitted total weight</b>                    | 2,300 kg                 | <b>Empty weight</b>            |                                                            |

## Tyres

### Mounted tyres

| #  | Tyre size       | Type of tyre                | Manufacturer | Tread depth |
|----|-----------------|-----------------------------|--------------|-------------|
| 1) | 255/45 R19 100V | Summer tyres on Light alloy | Continental  | 4mm / 4mm   |
| 2) | 255/45 R19 100V | Summer tyres on Light alloy | Pirelli      | 4mm / 4mm   |

### Additional tyres

| #  | Tyre size       | Type of tyre                | Manufacturer | Tread depth |
|----|-----------------|-----------------------------|--------------|-------------|
| 1) | 235/55 R18 100H | Winter tyres on Light alloy | Continental  | 7mm / 7mm   |
| 2) | 235/55 R18 100H | Winter tyres on Light alloy | Continental  | 8mm / 8mm   |

**Legend:** Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



## Equipment

### Equipment

- Klimaautomatik

|



## Standard equipment

- Storage compartments in the overhead console
- Airbag, head airbag system including front side airbags
- Airbag: Side airbags for the outer seats of the 2nd row.
- App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto
- Exterior mirror housings painted silver
- third brake light
- Chrome trim on the side windows
- Silver anodized roof rails
- Display: Digital Cockpit Pro, multicolor, various selectable info profiles
- Electronic parking brake including auto-hold function
- Driving assistant "Travel Assist" and lane keeping assistant "Lane Assist"
- Electric windows front and rear
- Pedestrian detection
- Luggage compartment lighting
- Transmission: 7-speed DSG
- Rear window heated
- Rear window wiper with intermittent function
- Interior mirror automatically dimming
- LED license plate lighting
- Rear headrests (3)
- LED matrix headlights - IQ.LIGHT
- Steering wheel: Multifunction sports steering wheel in leather, heated, with paddle shifters
- Illuminated makeup mirrors in the sun visors
- Fatigue detection
- Emergency braking assistant "Front Assist"
- Otto particulate filter
- Stainless steel pedals
- Proactive occupant protection system in conjunction with "Front Assist"
- Rain sensor
- Wheels: AirStop tires 255/45 R 19, optimized for low rolling resistance
- Gearshift knob in leather
- electromechanical power steering
- Seats: Front passenger seat backrest folds down completely
- Seats: Top comfort seats in the front
- Seats: Front seats with height adjustment
- 12-volt socket
- Bumpers in body color, in "R-Line" styling
- Textile floor mats front and rear
- Prepared for later activation: Navigation function "Discover Media" incl. "Streaming & Internet"
- Central locking without safe locking, with remote control and 2 remote keys
- Airbag for driver and front passenger including knee airbag on the driver's side
- Permanent 4MOTION all-wheel drive
- Adaptive Cruise Control (ACC) "stop & go" with speed limiter
- Hill descent control
- Chrome applications on mirror adjustment switches, window regulator switches, door pull handles
- Decorative inlays "Carbon Grey"
- Parking assistance
- Front door sill trims in aluminum, with "R-Line" logo
- Electronic Stability Program with counter-steering support
- Automatic headlight control, with daytime running lights
- Driving profile selection
- Windscreen made of laminated safety glass, heat and sound insulating
- Luggage compartment floor height adjustable in 2 stages
- Tailgate with electric opening and closing, adjustable opening angle
- Rear spoiler in R-style
- ISOFIX mounting points, also for i-Size child car seats
- Air conditioning system "Air Care Climatronic"
- Front headrests
- LED headlights with bad weather light and cornering light
- Reading lights: 2 front and 2 rear
- Light in the front footwell
- front center armrest
- Non-smoking version
- Emergency call service
- Package: Winter
- Upholstery: Fabric inner side panels in "ArtVelours"
- Radio
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring system
- Wheels: Tire Mobility Set omitted
- Wheels: Light alloy (4) "Valencia" 8.5 J x 19, Volkswagen R
- Drawers under the front seats
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Lumbar support in the front
- Seats: Heated front seats
- Start-stop system with brake energy recuperation
- Power outlet: 2 USB-C ports on the front
- Telephone interface
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Green thermal insulation glazing, sides and rear



## Extra equipment

- Electrically adjustable, folding and heated exterior mirrors (with passenger-side mirror lowering function)
- Mesh partition
- Package: Business Premium incl. Navigation (DSG) (2 USB-C ports in the front, 1 USB-C charging port on the rear center console - Head-up display - Leather multifunction steering wheel, heated, with shift paddles - Automatically heated windshield washer nozzles in the front - Voice control - "Comfort" telephone interface with inductive charging function - Heated front seats)
- Tire pressure monitoring system (informs the driver about the current tire pressure before and during the journey - the driver is informed if the tire pressure is too low or if there is a rapid loss of pressure)
- Sunshade for rear door and side windows
- Surround view "Area View" (incl. reversing camera "Rear View")
- Paint finish: Pearlescent effect
- Navigation system "Discover Media" incl. "Streaming & Internet" (8 speakers - Radio Data System (RDS) - Traffic sign recognition)
- Package: Top Package (Adaptive chassis control DCC incl. driving profile selection - Panoramic tilt/slide sunroof with panoramic roof at the rear - Darkened rear side windows and rear window)
- Park Assist system including parking aid
- Radio accessories: "Harman Kardon" sound system (8+1 speakers - 480 watts total power - digital 16-channel amplifier - subwoofer)
- Seats: 2 individual seats in the 3rd row (2 seats in the 3rd row, including rear bench seat and backrest asymmetrically split and foldable, with center armrest - luggage compartment floor with storage compartment)

## Brief expert findings

|                      |                                                                                                                                                                              |
|----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy) |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.    |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>Lifting equipment and/or a pit were available for examining the vehicle.                     |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                        |
| Engine function test | An engine test run was performed.                                                                                                                                            |

## Value reducing factors

| No. | Component group | Description                                                    |
|-----|-----------------|----------------------------------------------------------------|
| 1   | Engine          | Valve cover seal (Deckel Fehlt) - Missing - Replace            |
| 2   | Wheel / tyres   | Alloy rim - front right side - Scratched - Smart repair        |
| 3   | Wheel / tyres   | Tyre - front right side (nicht fahrbereit) - Damaged - Replace |
| 4   | Front bumper    | Spoiler (Leiste) - Deformed - Replace                          |
| 5   | Wheel / tyres   | Alloy rim - front left side - Scratched - Loss in value        |
| 6   | Seat - front    | Seat cover - left side - Broken / torn - Replace               |

## Wear and tear

| No. | Component group       | Description                                             |
|-----|-----------------------|---------------------------------------------------------|
| 1   | Misc.                 | Main inspection - No evidence - No deduction            |
| 2   | Bonnet                | Bonnet - Stone chips - No deduction                     |
| 3   | Front bumper          | Front bumper - Stone chips - No deduction               |
| 4   | Trim / covers         | Door trim - front right side - Scratched - No deduction |
| 5   | Trim / covers         | Door trim - front left side - Scratched - No deduction  |
| 6   | Door - rear left side | Door - Stone chips - No deduction                       |
| 7   | Rear bumper           | Rear bumper - Stone chips - No deduction                |

The vehicle shows signs of wear and tear commensurate with its age and use.



## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
*(Delivery by third-party service providers)*
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
*(Functional testing of driver assistance systems is not included in the scope of services!)*
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



**Figure 1:** Diagonal front (left)



**Figure 2:** Diagonal front (right)



**Figure 3:** Diagonal rear (left)



**Figure 4:** Diagonal rear (right)



**Figure 5:** Interior - front



**Figure 6:** Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

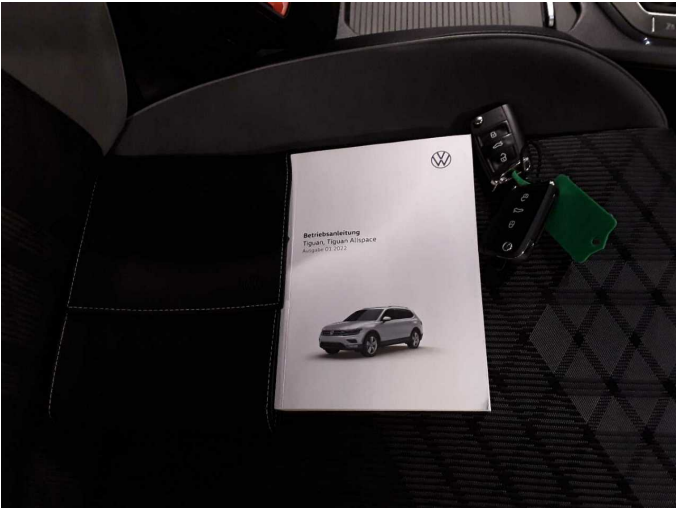


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

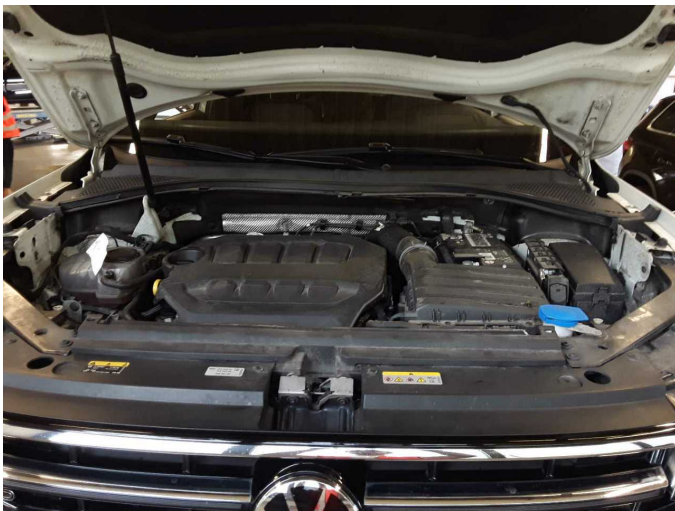


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.

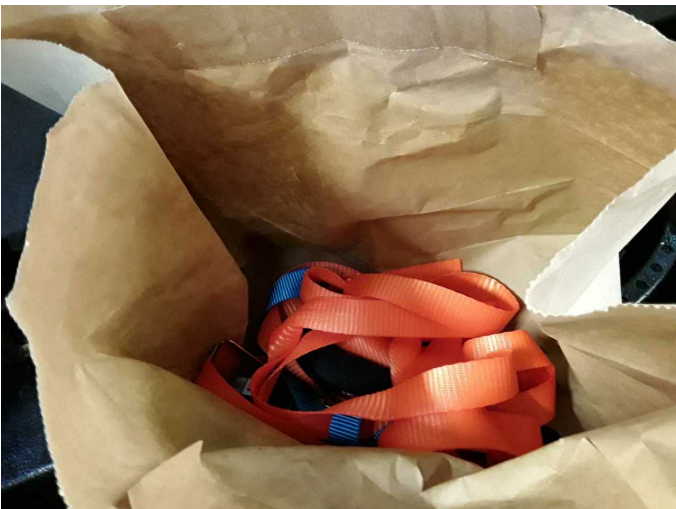


Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Figure 38: Misc.



Figure 39: Misc.



Figure 40: Misc.


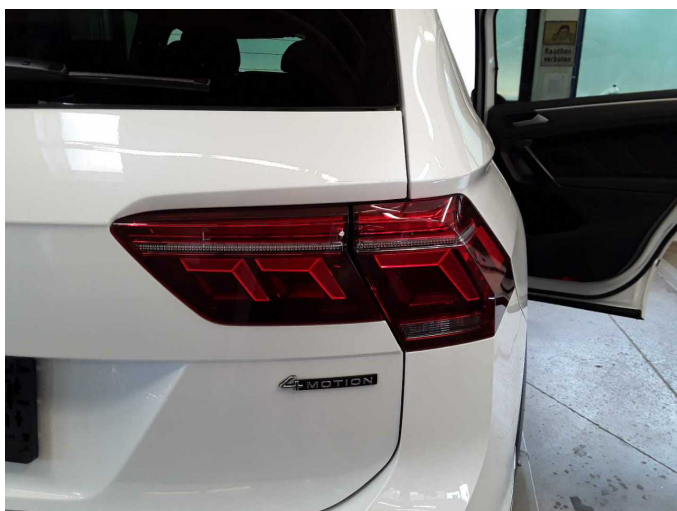


Figure 41: Misc.



Damage 1: Engine: Valve cover seal (Deckel Fehlt) - Missing - Replace

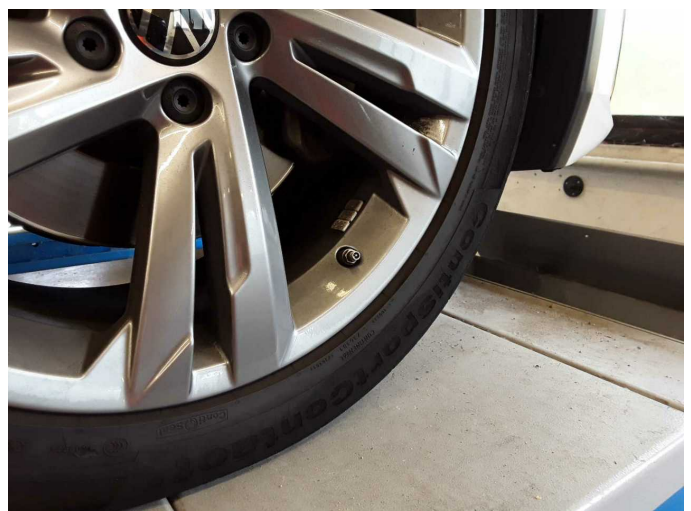

**Damage 1:** Engine: Valve cover seal (Deckel Fehlt) - Missing - Replace



**Damage 2:** Wheel / tyres: Alloy rim - front right side - Scratched - Smart repair



**Damage 2:** Wheel / tyres: Alloy rim - front right side - Scratched - Smart repair



**Damage 3:** Wheel / tyres: Tyre - front right side (nicht fahrbereit) - Damaged - Replace



**Damage 3:** Wheel / tyres: Tyre - front right side (nicht fahrbereit) - Damaged - Replace



**Damage 4:** Front bumper: Spoiler (Leiste) - Deformed - Replace



**Damage 4:** Front bumper: Spoiler (Leiste) - Deformed - Replace




**Damage 5:** Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



**Damage 5:** Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



**Damage 5:** Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value

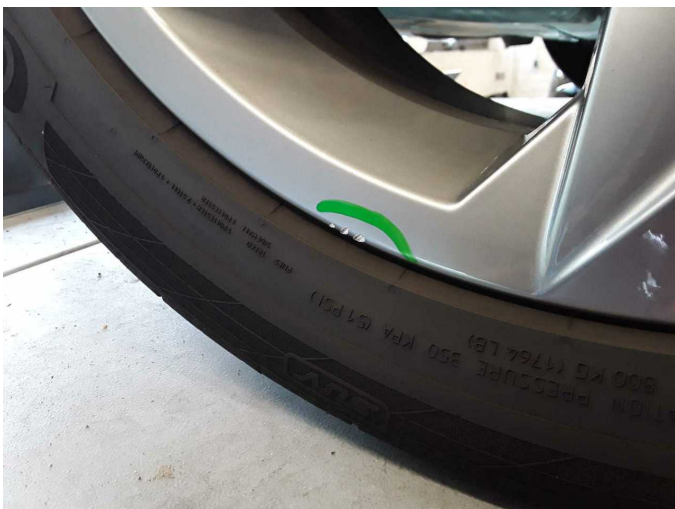

**Damage 5:** Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



**Damage 5:** Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



**Damage 5:** Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



**Damage 6:** Seat - front: Seat cover - left side - Broken / torn - Replace



**Damage 6:** Seat - front: Seat cover - left side - Broken / torn - Replace



**Wear and tear 2:** Bonnet: Bonnet - Stone chips - No deduction



**Wear and tear 2:** Bonnet: Bonnet - Stone chips - No deduction




**Wear and tear 3:** Front bumper: Front bumper - Stone chips - No deduction



**Wear and tear 3:** Front bumper: Front bumper - Stone chips - No deduction




**Wear and tear 3:** Front bumper: Front bumper - Stone chips - No deduction

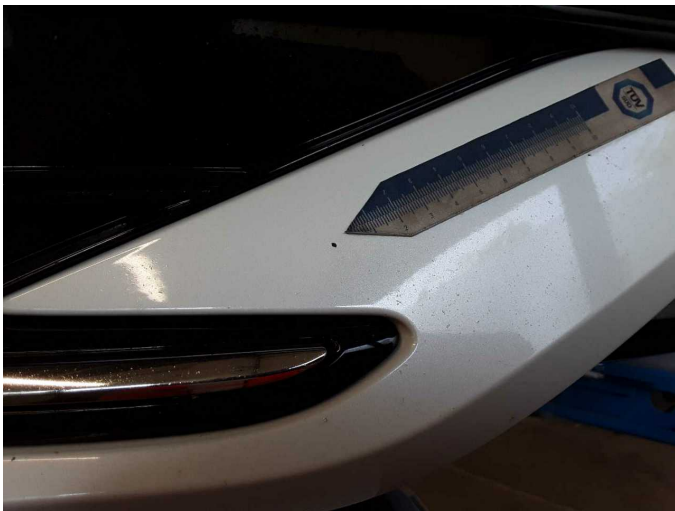

**Wear and tear 3:** Front bumper: Front bumper - Stone chips - No deduction



**Wear and tear 3:** Front bumper: Front bumper - Stone chips - No deduction

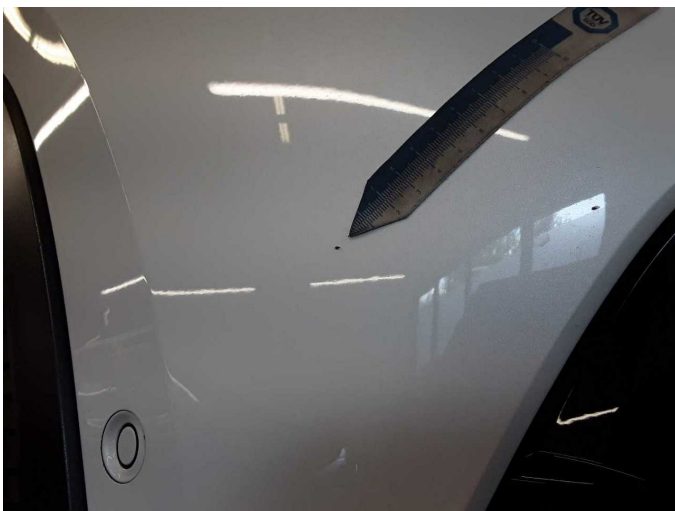


**Wear and tear 3:** Front bumper: Front bumper - Stone chips - No deduction



**Wear and tear 4:** Trim / covers: Door trim - front right side - Scratched - No deduction



**Wear and tear 4:** Trim / covers: Door trim - front right side - Scratched - No deduction

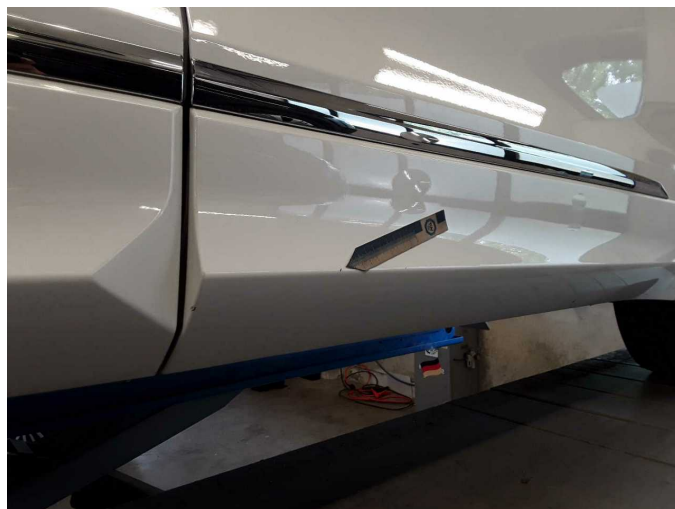

**Wear and tear 4:** Trim / covers: Door trim - front right side - Scratched - No deduction



**Wear and tear 4:** Trim / covers: Door trim - front right side - Scratched - No deduction



**Wear and tear 5:** Trim / covers: Door trim - front left side - Scratched - No deduction



**Wear and tear 5:** Trim / covers: Door trim - front left side - Scratched - No deduction



**Wear and tear 6:** Door - rear left side: Door - Stone chips - No deduction



**Wear and tear 6:** Door - rear left side: Door - Stone chips - No deduction



**Wear and tear 7:** Rear bumper: Rear bumper - Stone chips - No deduction



**Wear and tear 7:** Rear bumper: Rear bumper - Stone chips - No deduction



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ5N9NM163604  
Hersteller / Modell: VOLKSWAGEN VW Tiguan Allspace 2.0 TSI OPF 4Motion DSG R-Line

| Datum      | KM-Stand | Beschreibung                                                                                                                                                                                 |
|------------|----------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 17.04.2026 | 159.718  | AU; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges                                                                                          |
| 18.09.2025 | 129.904  | Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern                  |
| 03.02.2025 | 96.629   | Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Ölwechsel - Hinterachse; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges        |
| 05.07.2024 | 62.712   | Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern |
| 23.11.2023 | 33.138   | Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges                                                                                                                     |