



Expertise

Protocol number: 46596625
Order No. / Reference: 26631170
Inspection date: 20 Jul 2026

Manufacturer: Audi
VIN: WAUZZZF36P1012321

Model: Q3 35 TDI S tronic



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi Q3 35 TDI S tronic	
Vehicle Identification number	WAUZZZF36P1012321
Mileage (Read)	74,817 km
First registration	24 Aug 2022
Number of holders	1
Next periodical technical inspection	10/2027
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Mythossschwarz Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	3,300 km
Last service on / at	10/2025 at 61,891 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GM628814
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BOY 04747		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,155 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Hankook	5mm / 5mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Hankook	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99V	Summer tyres on Light alloy	Hankook	4mm / 4mm
2)	215/65 R17 99V	Summer tyres on Light alloy	Hankook	4mm / 4mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag for driver and front passenger
- Anti-lock braking system (ABS)
- Audi connect Remote & Control
- Audi pre sense front
- Hill start assist
- black roof rails
- Diesel particulate filter (DPF)
- Tachometer
- Door sills with plastic inserts
- Electronic Stability Control (ESC)
- Electric windows front and rear
- Adjustable speed limiter
- Transmission: S tronic 7-speed
- rear window wiper
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction
- Wheel: Tire pressure monitoring system
- Wheel: Tire repair kit
- Electromechanical power steering
- Lane change warning
- Phone: Bluetooth interface
- Electronic immobilizer
- Central locking
- Airbag: Front side airbags and head airbag system
- Audi connect Emergency Call & Service
- Audi pre sense basic
- Electrically adjustable and heated exterior mirrors
- third brake light
- Decorative inlays Micrometallic silver
- Digital instrument cluster - fully digital instrument cluster in 10.25 inches
- Electromechanical parking brake
- Chassis: Comfort chassis
- front and rear floor mats
- Legal emergency number
- Heated rear window
- Electrically operated child safety lock
- Headrests (5) front and rear
- LED headlights
- Light/rain sensor
- Wheel: Alloy wheels in 5-twin-spoke design (7 J × 17 with tires 215/65 R 17)
- Radio: MMI Radio plus
- Lane Departure Warning
- Start-stop system with recuperation
- Glazing: Windscreen in heat-insulating and acoustic glazing

Extra equipment

- Airbag: Rear side airbags
- Decorative inlays aluminum dimension silver
- Anti-theft alarm system (The anti-theft alarm system monitors the doors, front hatch, and trunk lid. The deadbolt, linked to the door locks, prevents opening via the interior door handle once the vehicle has been locked with the key. The anti-theft alarm system also offers: switchable ultrasonic interior monitoring, a theft warning via a tilt sensor, and a battery-powered horn to prevent tampering.)
- Deletion of model designation and performance/technology lettering
- Hold assist (holds the vehicle indefinitely after stopping on inclines and declines typical in road traffic.)
- 2-zone automatic climate control (electronically regulates air temperature, volume and distribution - separate temperature distribution for driver and front passenger side - sun position-dependent control - automatic recirculation control via air quality sensor - dust and odor separating allergen filter - air vents in the rear center console - separate defroster button for faster defrosting of the front and side windows)
- Front center armrest (adjustable in tilt, movable in length)
- Storage and luggage compartment package (flexible transport of items and comfort while traveling, consisting of: - storage net on the back of the front seats - storage compartment under the passenger seat - luggage compartment light (LED) in the tailgate for lighting the trunk - luggage compartment net - 12-volt socket in the trunk tray in the left side panel)
- Package: Child safety (ISOFIX child seat attachment for the front passenger seat with deactivation switch for the passenger airbag)
- Rear bench seat plus with center armrest and cupholder (rear seat back foldable in a 40:20:40 ratio - rear bench seat longitudinally adjustable - rear seat backrest tilt adjustable - including rear center armrest and cupholder)
- Seat covers in Index fabric (seat center panel in Index fabric - inner and outer seat side bolsters, headrests, front center armrest (if ordered) in solid black fabric)
- Seats: 4-way lumbar support (electrically adjustable, horizontally and vertically)
- Front seat heating (heats seat and backrest center section for standard seats, otherwise seat and backrest center section as well as seat side bolsters - individually adjustable in 3 stages for driver and front passenger via direct selection button on the climate control unit)
- Glazing: Sun protection glazing, tinted (rear window, rear door and side windows tinted)
- Aluminum look in the interior (elements on the mirror adjustment switch, the window regulator switches, the parking brake control button and door trim strips in aluminum look)
- Parking aid plus (supports the driver with acoustic signals and a display in the MMI when parking and maneuvering. The parking aid is activated by engaging reverse gear or via a button in the center console, or automatically when the distance to a detected object is less than 90 cm. Automatic activation can be switched on and off.)
- Cruise control (maintains the individually set speed between 20 and 250 km/h, provided the engine power allows. It is operated via a separate steering column stalk. The set speed is displayed on the screen. The system does not react to vehicles ahead with adaptive cruise control.)
- Paint finish: Mythos Black Metallic
- Steering wheel: Leather steering wheel in a 3-spoke design with multifunction plus (The steering wheel impresses with its high-quality look and aluminum trim and feels good in the hand. Height and reach of the steering wheel are manually adjustable. For convenient operation of the extensive standard and optional infotainment features, the steering wheel is equipped with 12 multifunction buttons.)
- Business package (MMI Navigation plus - 3-spoke leather steering wheel with multifunction plus - Audi virtual cockpit plus - Audi phone box - Audi connect Navigation & Infotainment plus - Cruise control)
- Wheel: Winter alloy wheels in 5-arm Secare design (6.5 J × 17 with winter tires 215/65 R17)
- Reversing camera (Within the system's limits, the reversing camera captures the area behind the vehicle and displays it on the MMI screen using dynamic display elements. The system allows a choice between perpendicular parking mode and trailer mode (in conjunction with a factory-installed trailer hitch). Depending on the selected mode, the calculated driving lane or a guide line for coupling a trailer is displayed. The reversing camera is discreetly integrated into the tailgate handle.)
- Seats: Front sports seats (with manual adjustment of seat height, seat longitudinal position, backrest angle, headrest and seat belt height)
- 12-volt socket and 2 x USB ports in the rear (12-volt on-board power socket and 2 x USB-C ports for charging devices)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Door - front right side	Door edge - Scratch(es) - Smart repair
3	Door - rear right side	Door edge - Scratch(es) - Smart repair
4	Wing mirror - left side	Cap - Scratch(es) - Smart repair
5	Boot lid / rear door	Boot lid - dent(s) - Smart repair
6	Rear bumper	Rear bumper - Scratch(es) - Paint

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

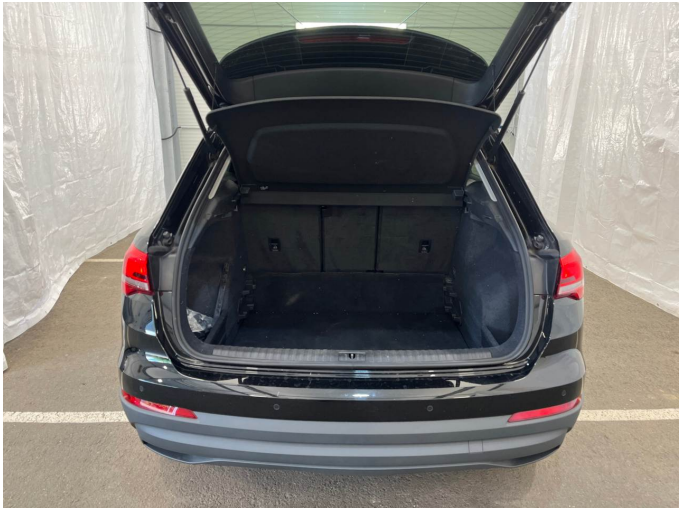


Figure 10: Cargo area

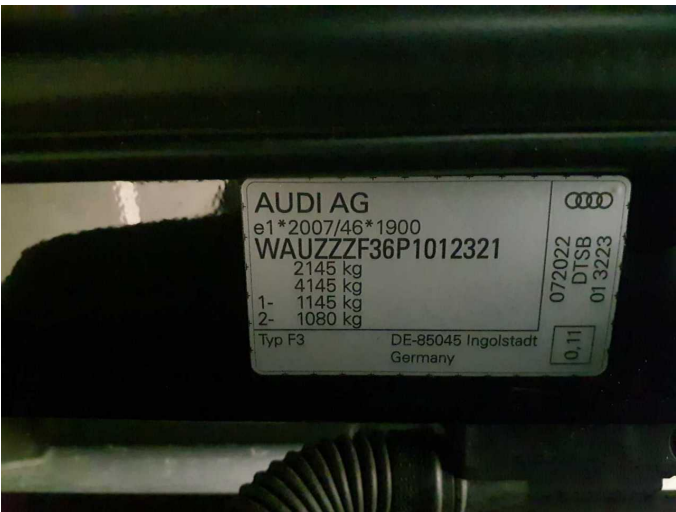


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

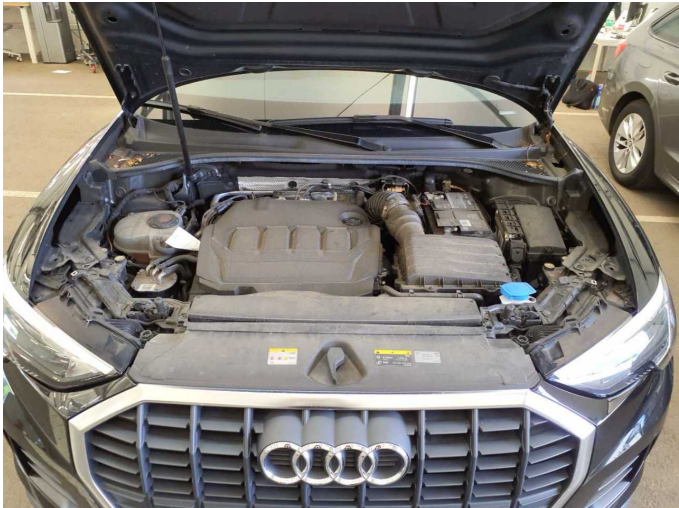


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.


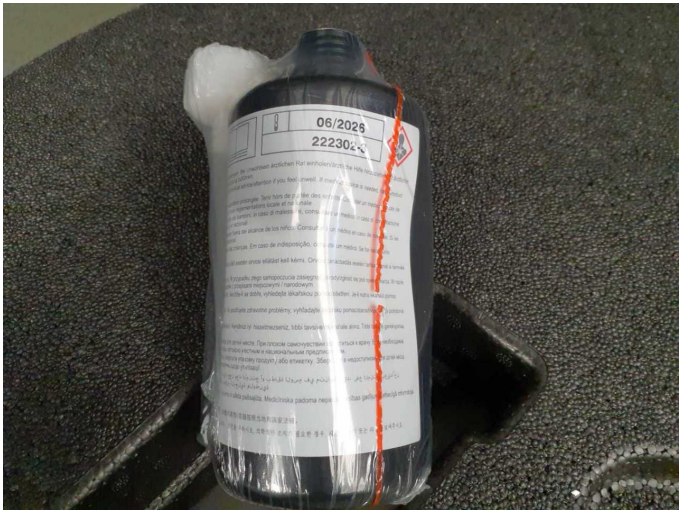


Figure 30: Misc.



Figure 31: Misc.

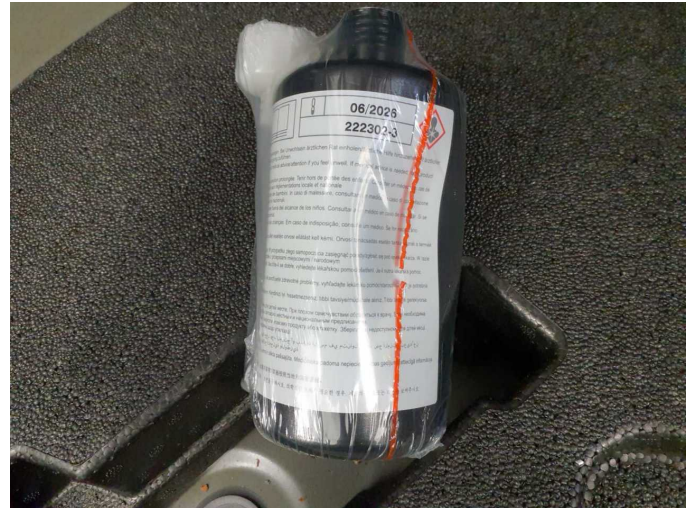


Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Door - front right side: Door edge - Scratch(es) - Smart repair




Damage 2: Door - front right side: Door edge - Scratch(es) - Smart repair

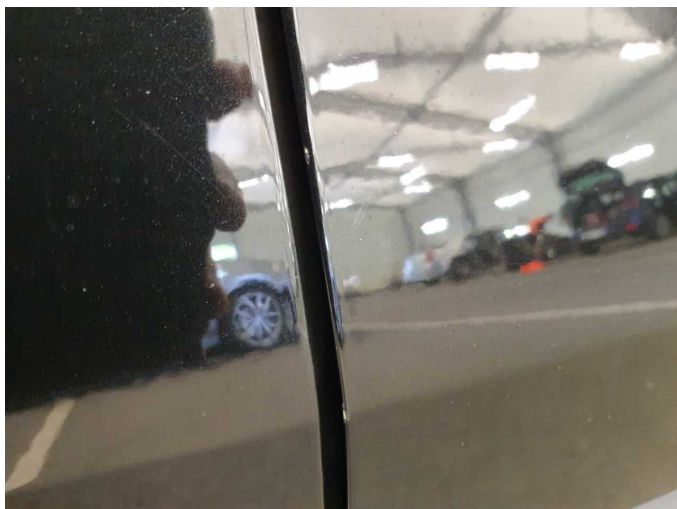

Damage 2: Door - front right side: Door edge - Scratch(es) - Smart repair



Damage 3: Door - rear right side: Door edge - Scratch(es) - Smart repair

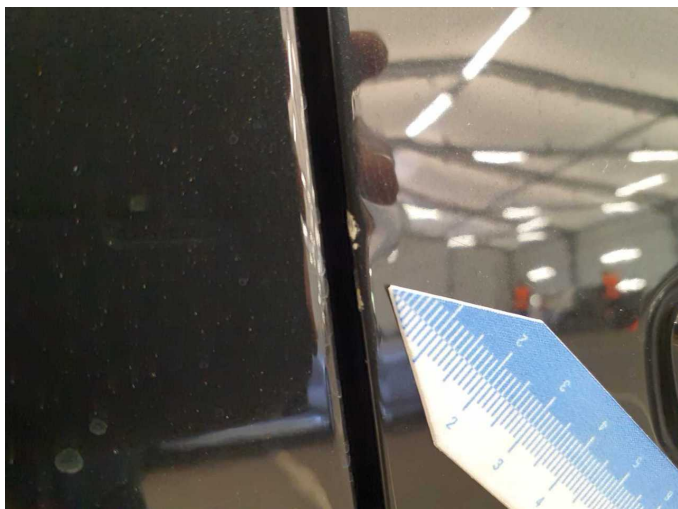


Damage 3: Door - rear right side: Door edge - Scratch(es) - Smart repair




Damage 4: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 4: Wing mirror - left side: Cap - Scratch(es) - Smart repair

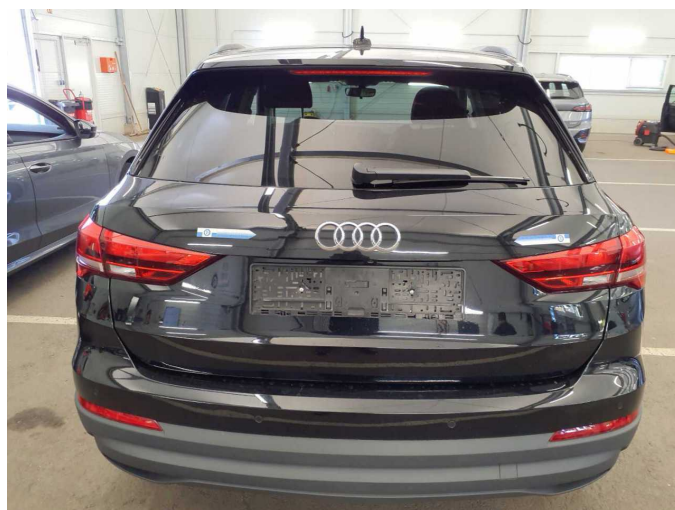

Damage 5: Boot lid / rear door: Boot lid - dent(s) - Smart repair

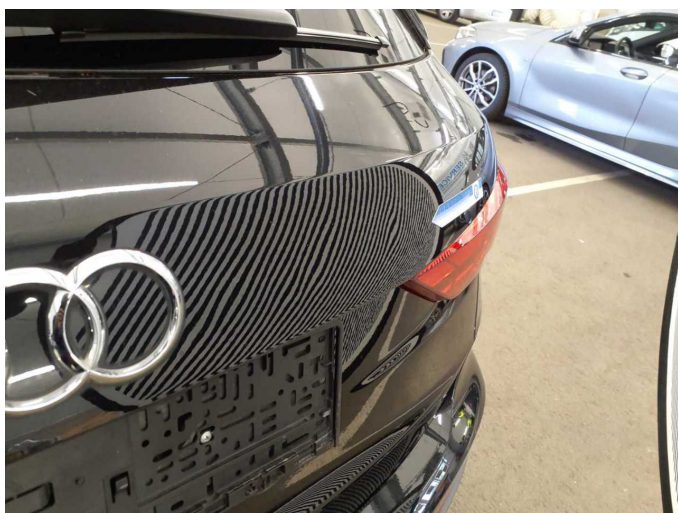


Damage 5: Boot lid / rear door: Boot lid - dent(s) - Smart repair



Damage 5: Boot lid / rear door: Boot lid - dent(s) - Smart repair



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint

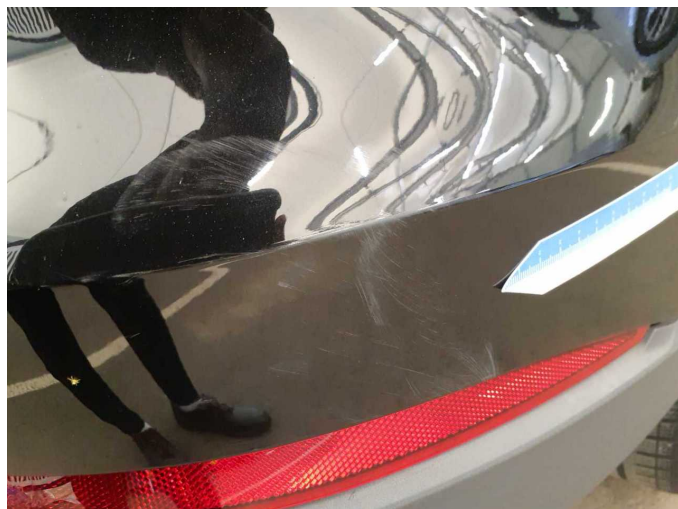

Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF36P1012321
Hersteller / Modell: AUDI AUDI Q3 35 TDI S tronic

Datum	KM-Stand	Beschreibung
24.10.2025	61.891	AU; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.12.2024	45.049	Reparatur Sonstiges
12.11.2024	44.163	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
20.06.2024	37.464	Bremsflüssigkeit; Bremsflüssigkeit ern
03.01.2024	29.496	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges