



Expertise

Protocol number: 46068725
Order No. / Reference: 26528601
Inspection date: 19 Jun 2026

Manufacturer: Volvo
VIN: YV1UZZK5VDM1808904

Model: XC60 B4 D Geartronic RDesign



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo XC60 B4 D Geartronic RDesign	
Vehicle Identification number	YV1UZZK5VDM1808904
Mileage (Read)	132,797 km
First registration	18 Feb 2021
Number of holders	1
Next periodical technical inspection	12/2026
(Report not on hand)	
Power / Engine displacement	145 kw / 1,969 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Osmium Grau-Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Grey



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	157 Tag(e)
Last service on / at	11/2025 at 124,641 km		
Key is / should be	4 / 4	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GA548022
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	9101 / BTJ 00001		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,460 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 107H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	235/60 R18 107H	Winter tyres on Light alloy	Pirelli	7mm / 7mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105V	Summer tyres on Light alloy	Continental	3mm / 3mm
2)	235/55 R19 105V	Summer tyres on Light alloy	Continental	4mm / 4mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag, driver's knee airbag
- Ambient lighting (Extended interior lighting with: - Ambient lighting (multicoloured) front and rear - Work light on the tailgate - Exit lights front and rear - Illuminated door pockets and door openers front and rear - Illuminated cup holders front - Footwell lighting rear - Reading lights rear)
- Automatic climate control with separate temperature control for driver and front passenger (and additional air vents for the 2nd row of seats (integrated in the B-pillar) including pre-ventilation and reheating of the interior when the engine is switched off via Volvo On Call smartphone app or menu)
- Automatic tailgate (electric)
- Central locking with two remote controls and integrated emergency keys (automatic locking of doors while driving (can be deactivated) - comfort opening/closing of side windows and, if applicable, sunroof via remote control - panic function integrated into the remote control)
- Chassis: Sport chassis (firmer chassis tuning - chassis height unchanged)
- CleanZone air quality system with activated carbon filter (automatic recirculation and pre-ventilation of the interior when the vehicle is unlocked)
- Connected Safety (Cloud-based warning of slippery road conditions and vehicles with hazard warning lights activated)
- Cruise control system (and variable speed limiter)
- Digital instrumentation (12.3" full graphic display (31.2 cm diagonal) with two variable round instruments and information display (e.g. for navigation map view))
- Driver Alert (Attention Warning)
- Electronic differential lock Corner Traction Control (CTC)
- Emergency brake lights (brake lights flash rapidly during heavy deceleration; hazard warning lights are automatically activated at speeds below 10 km/h)
- First aid kit and warning triangle
- Front center armrest with integrated storage compartment and cup holders
- Heated wiper blades and windshield washer nozzles
- Hill Descent Control (HDC)
- Hill Start Assist (HSA)
- IDIS - Intelligent Driver Information System (delays incoming calls or vehicle information in potentially dangerous situations)
- Immobiliser
- ISOFIX mounting for the outer rear seats
- Keyless Drive (electronic access system with sensor-controlled tailgate, waterproof micro key and illuminated door handles and puddle lights)
- Lane Keeping Aid (LKA) (Active Lane Keeping Assistant)
- Lashing eyes in the luggage compartment (foldable)
- LED headlights "Thor's Hammer" with high beam assist and integrated LED daytime running lights
- LED turn signals integrated into the exterior mirrors
- 12-volt socket at the front
- ABS - Anti-lock Braking System (with EBV)
- Airbag, side airbags for driver and front passenger and head/shoulder airbags (iC) for all occupants
- Aluminum door sill plates with Volvo lettering at the front
- Aluminum insert, metal mesh
- Anthracite headliner
- Cargo area roller blind
- Charging box under the cargo floor
- Child safety lock (rear doors)
- City Safety (automatic emergency braking system with detection of vehicles, cyclists, pedestrians and large animals, including intersection braking assistant, emergency braking assistant for oncoming traffic and steering support during evasive maneuvers)
- Diesel particulate filter
- Drive Mode (driving mode settings for engine, transmission, steering, brakes and suspension: Comfort, Eco, Dynamic, Off Road, Individual)
- Driver and passenger side airbags with two-stage deployment system
- Electric parking brake
- Electric windows front and rear (with auto-down and auto-up function)
- Electrically adjustable and heated exterior mirrors on the left and right (driver and passenger side with wide-angle optics)
- Electrically folding exterior mirrors
- ESC - Vehicle Dynamics Control
- Exhaust system with two chrome-plated tailpipes (integrated in the rear apron in trapezoidal shape)
- Fog sensor for automatic activation of the defroster function
- Glazing: Colored glazing
- Headrests (5) front and rear
- Heated rear window
- Illuminated makeup mirror for driver and front passenger
- Interior and exterior mirrors automatically dimming
- Interior lighting (headliner, front reading lights, front ambient lighting, front footwell, storage compartment behind center console, glove compartment and luggage compartment)
- Keyless Start (electronic engine start system)
- LED fog lights (integrated into the front spoiler - only when selecting the "Full LED headlights - Thor's Hammer" option including cornering lights)
- Luggage compartment partition net
- On-board computer (with vehicle control functions)
- Radio: Sensus Connect infotainment system with High Performance Sound (22.9 cm touchscreen (9" diagonal) - 330 watts of power - 10 speakers - 2x USB ports (compatible with Apple iPod/iPhone/iPad) - Bluetooth hands-free system incl. audio streaming - Internet access incl. internet radio and apps (via paired smartphone) - Voice control - Digital vehicle owner's manual - Connected Service Booking)



- Oncoming Lane Mitigation (preventive protection system when crossing the center line and approaching oncoming traffic, including steering intervention towards one's own lane)
- Outdoor temperature display
- Passenger side airbag can be deactivated
- Power outlet (12-volt connection in the luggage compartment)
- Preparation for Trailer Stability Assist (TSA)
- Radio accessories: Digital radio reception (DAB+)
- Radio accessories: Smartphone integration Apple CarPlay and Android Auto (integration of Apple iPhones and Android smartphones into the Sensus operating system)
- Radio accessories: Two USB-C ports on the back of the center console
- Rain sensor
- Rear parking assist
- Rear seats in a 40/60 split or completely foldable with pass-through function
- Road Sign Information (RSI) - Traffic Sign Recognition
- Roof rails in high-gloss black (integrated)
- Run-off Road Protection (preventive protection system in case of unintentional road leaving or impending rollovers including pre-activation of the seat belt tensioners, deactivation of the battery (plug-in hybrid only), emergency call via Volvo On Call and door unlocking)
- Seat belts (active seat belts with belt tensioners, pre-activation of the belt tensioners only in conjunction with IntelliSafe Surround - belt height adjustment front - warning tone/indication when seat belts are not fastened (for all seats))
- Seats: Driver's seat electrically adjustable (with memory function for driver's seat and exterior mirror settings (stored in the remote control))
- Seats: Heated front seats
- Sport front and rear apron
- Sport leather gearshift lever
- Sport pedals
- Steering wheel adjustable for height and reach
- Steering wheel: Sport leather steering wheel with multifunction buttons in high-gloss black
- third brake light
- Tire pressure monitoring system (with tire-specific pressure loss warning)
- WHIPS whiplash protection system (including immersion protection on all seats and energy-absorbing front seat cushions)
- Window surround in high-gloss black
- Rear center armrest (foldable) (with cup holders)
- Rear headrests foldable (electrically)
- Road Edge Detection (system to protect against unintentional leaving of the roadway through steering and braking interventions)
- Roof edge spoiler
- Safety braking system with disc brakes all around (internally ventilated) (automatic brake system pre-tensioning, brake assist and automatic hold function)
- Seats: Adjustable (electric) leg rest for driver and front passenger seats
- Seats: Driver and front passenger seats height adjustable (electrically) (including manual tilt adjustment)
- Seats: Lumbar support (4-way electrically adjustable) for driver and front passenger seats
- Sensus navigation system (3D navigation - destination input via natural voice control - dynamic route guidance with real-time traffic information - local search (surroundings search by keywords with information, ratings and photos) - Volvo Lifetime MapCare)
- Speed-sensitive power steering
- Sport exterior mirrors in high-gloss black
- Sport front grille with horizontal struts and surround in high-gloss black
- Stainless steel loading sill protector in the luggage compartment
- Start/Stop technology
- Steering wheel: Steering wheel heating
- Textile floor mats: Sport textile floor mats front and rear
- Transmission: 8-speed Geartronic automatic transmission
- Upholstery: Leather/mesh-textile sports seats (including storage compartment in the rear center armrest)
- Volvo On Call with Wi-Fi hotspot (including integrated modem, external antenna, and Wi-Fi hotspot for mobile devices). Volvo On Call features: automatic emergency call function with transmission of vehicle position and data, and alerting the Volvo On Call service center at the touch of a button (10-year subscription). Additionally, various convenience services are available via the smartphone app (3-year subscription, extendable upon request; includes extension of the emergency call function).
- Wheels: 19" 5-twin-spoke sport design alloy wheels, diamond cut/graphite look (tires 235/55 R19 with rims 7.5 x 19")
- Wheels: Tire sealant (Incl. 12-volt compressor, maximum speed 80 km/h)



Extra equipment

- Alarm system (with motion/tilt sensor, security locking and private locking (separate trunk lock))
- IntelliSafe Surround (Blind Spot Information System (BLIS) Blind Spot Assist including Lane Departure Warning for rapidly approaching vehicles including steering intervention if warning signals are ignored - Cross Traffic Alert (CTA) Cross Traffic Warning with braking intervention - warning for vehicles, cyclists and pedestrians approaching from the side when reversing out of parking spaces including braking to a standstill if warning signals are ignored - Rear Impact Mitigation - preventive protection in case of impending rear-end collisions)
- Package: Seat Comfort Package (Electrically adjustable passenger seat - memory function for passenger seat)
- Package: Xenium Package Pro (Automatic climate control with 4-zone temperature control - Panoramic glass sunroof with tilt function and integrated, continuously adjustable sunshade (electric) - Head-up display, graphic projection of driving information onto the windshield - Parking camera with 360° surround view - Front and rear parking sensors - Sensus Connect infotainment system with HIGH PERFORMANCE SOUND PRO by Harman Kardon - Enhanced air quality system with fine dust filtration according to PM2.5 air quality standard)
- Parking camera with 360° surround view
- Seats: Passenger seat electrically adjustable
- Seats: Memory function for passenger seat
- Glazing: Side and rear windows tinted (from the B-pillar back)
- Towbar (semi-electric)
- Enhanced air quality system with fine dust filtration according to air quality standard PM2.5
- Automatic climate control with 4-zone temperature control (individual climate control for driver, front passenger and rear passengers left and right including climate display for the rear)
- Paint finish: Metallic paint
- Package: IntelliSafe Package Pro (Pilot Assist: Adaptive cruise control with distance warning and lane keeping assist up to speeds of 130 km/h - IntelliSafe Surround: Blind Spot Information System (BLIS) including lane change warning for rapidly approaching vehicles and steering intervention; Cross Traffic Alert with braking intervention - cross traffic warning for vehicles, cyclists and pedestrians when reversing out of parking spaces, including braking; rear impact mitigation)
- Panoramic glass sliding sunroof with lifting function (electric) (with integrated, continuously adjustable sunshade)
- Park Assist Pilot (Intelligent parking assistant for parallel and perpendicular parking spaces (left and right) as well as exiting parallel parking spaces. Steering is controlled by the assistant, acceleration and braking by the driver. The parking space must be at least 1.2 times the length of the vehicle. - Front and rear parking aid)
- Glazing: Acoustic glazing for the side windows (UV and burglar-resistant laminated glass panes)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Trim / covers	Brightware / decorative strip (Scheibe hinten links) - Scratch(es) - Replace
3	Door - front left side	Strip - outer - Deformed - Replace
4	Mudguard - left side	Mudguard - left side - Scratch(es) - Smart repair
5	Trim / covers	Door trim - rear left side - Loss in value



Wear and tear

No. Component group Description

1 Side panel - rear left side Sill - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No. Previous damage

Extent of
damage (Net)

1 Front, Professionally repaired, Invoice of repair done Non-existent

2 Side - left, Professionally repaired, Invoice of repair done Non-existent

Repainting

No. Repainting

1 Bonnet, Professionally carried out, Invoice of repair done Non-existent

2 Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent

3 Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent

4 Door - rear left side, Professionally carried out, Invoice of repair done Non-existent

5 Door - front left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Bonnet	403 µm	Side panel - rear left side	356 µm
Side panel - rear right side	192 µm	Door - rear left side	340 µm
Door - front left side	181 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Professionally repaired previous damages were found at the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

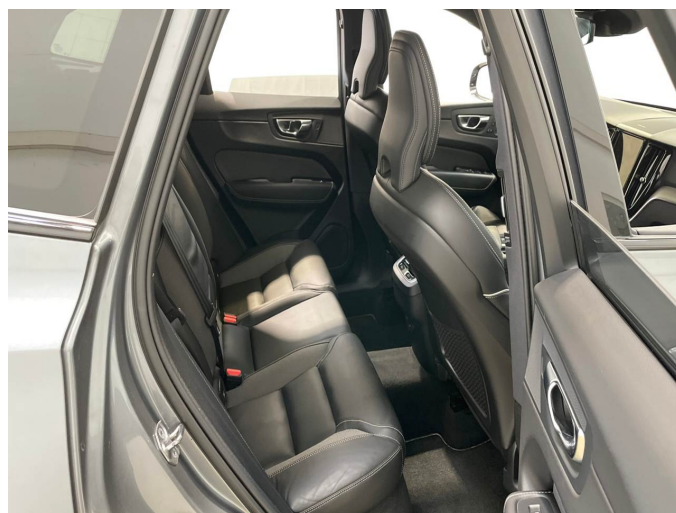


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

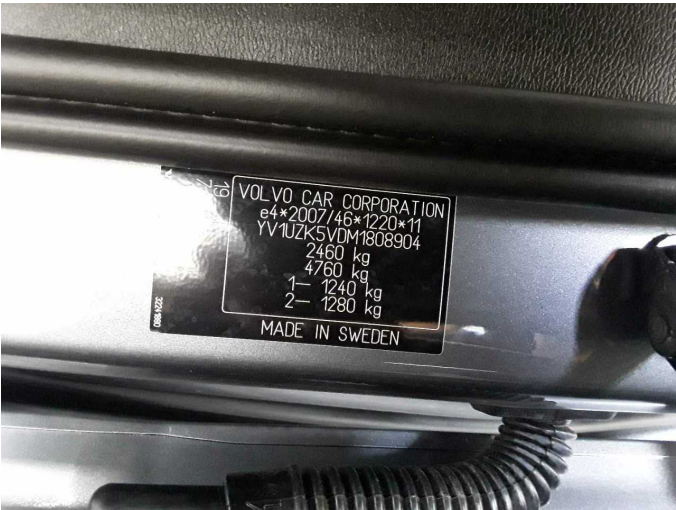


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

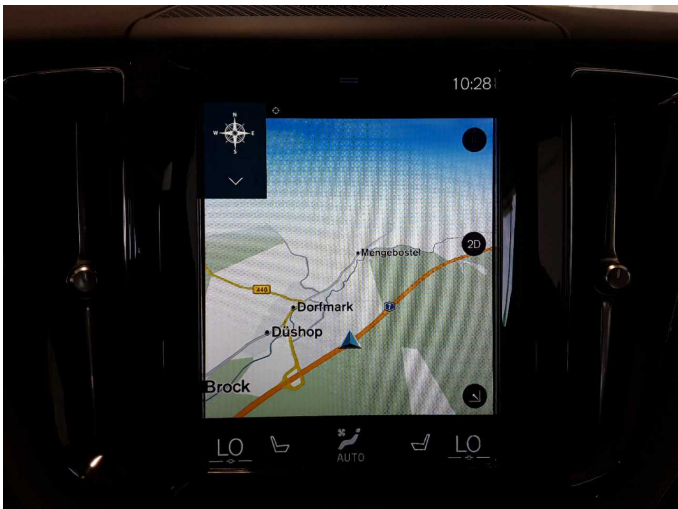


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.




Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Trim / covers: Brightware / decorative strip (Scheibe hinten links) - Scratch(es) - Replace



Damage 2: Trim / covers: Brightware / decorative strip (Scheibe hinten links) - Scratch(es) - Replace

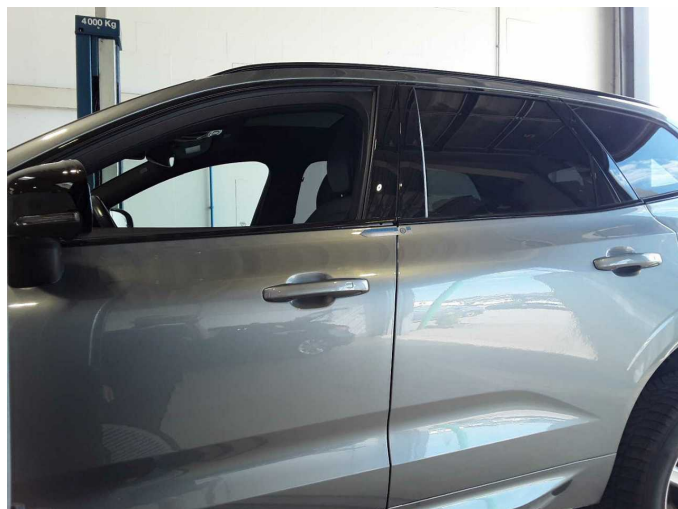

Damage 3: Door - front left side: Strip - outer - Deformed - Replace



Damage 3: Door - front left side: Strip - outer - Deformed - Replace



Damage 4: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair



Damage 4: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair



Damage 5: Trim / covers: Door trim - rear left side - Loss in value




Damage 5: Trim / covers: Door trim - rear left side - Loss in value



Repainting 1: Bonnet




Repainting 1: Bonnet

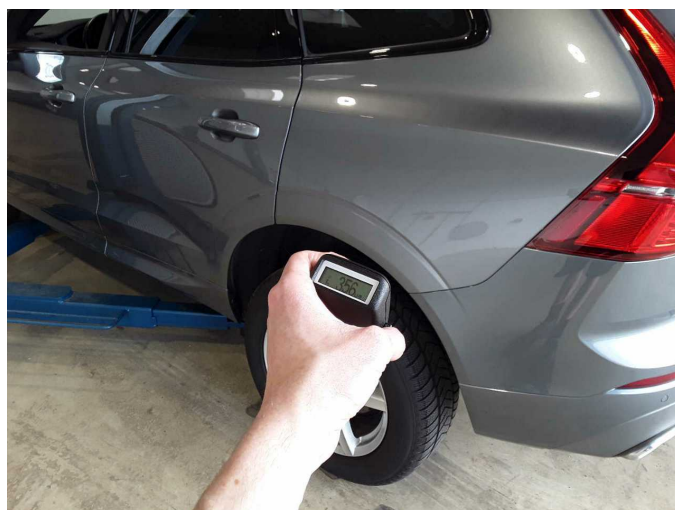

Repainting 2: Side panel - rear left side




Repainting 2: Side panel - rear left side

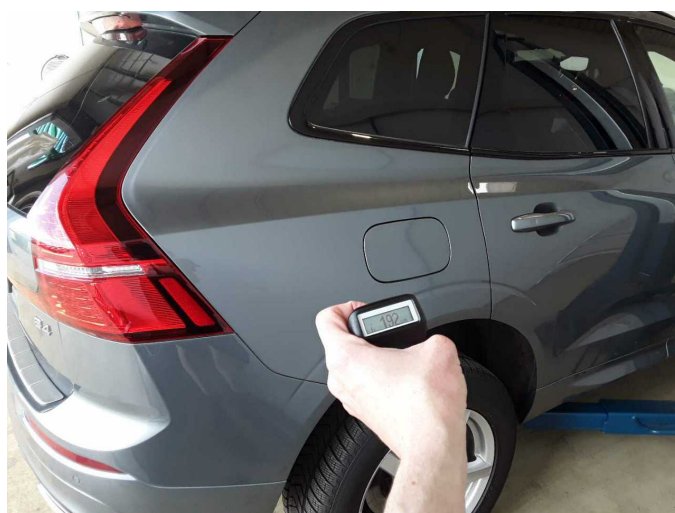

Repainting 3: Side panel - rear right side




Repainting 3: Side panel - rear right side

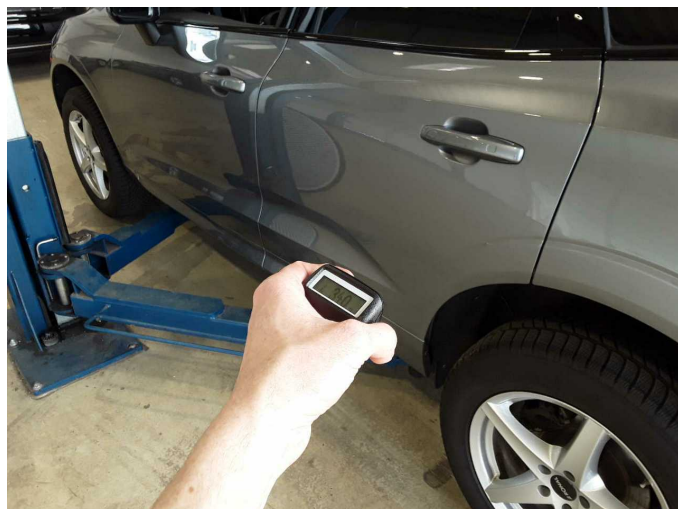

Repainting 4: Door - rear left side



Repainting 4: Door - rear left side

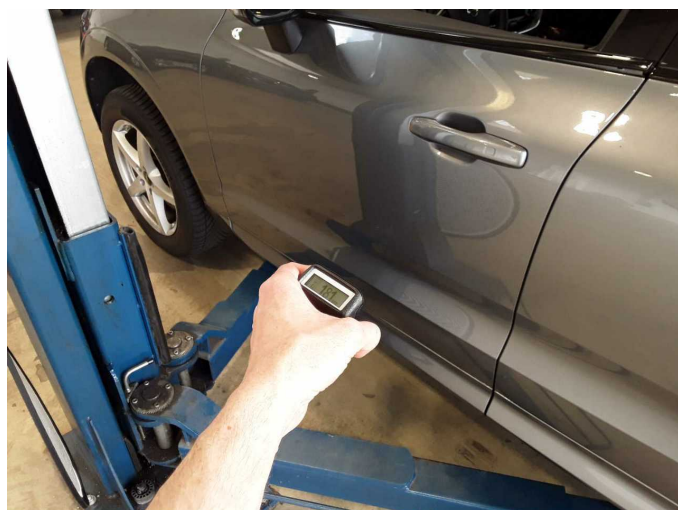

Repainting 5: Door - front left side



Repainting 5: Door - front left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: YV1UZZK5VDM1808904
Hersteller / Modell: VOLVO VOLVO XC60 B4 D Geartronic RDesign

Datum	KM-Stand	Beschreibung
27.11.2025	124.641	Bremsflüssigkeit; Bremsflüssigkeit ern; Keilriemen ern; Keilrippenriemen; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
27.08.2025	115.189	Wartung Sonstiges
03.02.2025	105.153	Systemtest/Eigendiagnose
03.12.2024	100.788	HU + AU; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.12.2023	77.226	Wartung Sonstiges
14.11.2023	74.961	Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
19.12.2022	45.720	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
21.02.2022	14.669	Kleine Inspektion; Motoröl b. Wartung; Ölfilter ern; Wartung Sonstiges