



Expertise

Protocol number: 46486488
Order No. / Reference: 26480462
Inspection date: 14 Jul 2026

Manufacturer: Mercedes-Benz
VIN: W1K5M1DB0PN400378

Model: CLA 200 d 4Matic Shooting Brake 8G-DCT Progressive



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz CLA 200 d 4Matic Shooting Brake 8G-DCT Progressive	
Vehicle Identification number	W1K5M1DB0PN400378
Mileage (Read)	146,746 km
First registration	12 May 2023
Number of holders	1
Next periodical technical inspection	05/2026 (Report not on hand)
Power / Engine displacement	110 kw / 1,950 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	Station wagon
Colour / colour code	Nachtschwarz
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	223 Tag(e)
Last service on / at	02/2026 at 129,800 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS707527
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / AHG 00043		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,185 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R17 91W	Summer tyres on Light alloy	Pirelli	4mm / 4mm
2)	205/55 R17 91W	Summer tyres on Light alloy	Pirelli	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96U	Winter tyres on Light alloy	Pirelli	6mm / 6mm
2)	205/60 R16 96U	Winter tyres on Light alloy	Pirelli	7mm / 7mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ADAPTIVE BRAKE with HOLD function, hill start assist, pre-filling and drying brakes in wet conditions
- Airbag: Kneebag for driver
- Airbag: Windowbag for driver and front passenger
- Anti-lock braking system (ABS)
- Foldable armrest for driver and front passenger
- Left and right exterior mirrors, heated and electrically adjustable, painted in body color
- Diesel particulate filter
- Tachometer
- DYNAMIC SELECT
- Electronic Stability Program (ESP)
- Electric windows (4-way)
- Velour floor mats in black
- Speed Limit Assistant
- Lockable glove compartment
- KEYLESS-GO start function
- Rear headrests (3)
- Fuel tank with a capacity of 51 liters
- Steering wheel shift paddles
- Steering: Direct steering
- Light and rain sensor
- Net in the passenger footwell
- Package: Seating comfort
- Radio: Extended MBUX functions
- Radio accessories: Digital radio (DAB)
- Radio accessories: USB interface in the storage compartment & 2 USB interfaces in the rear center console
- Gearshift lever with additional elements in silver chrome
- Seat belts CLA-Class
- Seats: Comfort seats
- Seats: Rear seat backrests are split 40:20:40 and foldable
- 12V power outlet
- Cruise control
- High-visibility vest for drivers
- Central locking
- Airbag for driver and front passenger
- Airbag: Automatic passenger airbag deactivation
- Airbag: Side airbag for driver and front passenger
- 4MATIC all-wheel drive
- Traction control (ASR)
- ATTENTION ASSIST
- Basic services
- Brake assist, active
- Double cup holder at the front
- Third brake light in LED technology
- ECO start/stop function
- Chassis: Comfort chassis
- electric parking brake
- Luggage net on driver and passenger seatbacks
- Transmission: 8G-DCT automatic
- Interior headliner fabric crystal grey
- THERMATIC automatic climate control
- Front headrests are height-adjustable
- Paint finish: Solid
- Steering wheel: Multifunction sports steering wheel in leather
- Mercedes-Benz emergency call system
- Package: Light and Visibility Package
- Upholstery: ARTICO leatherette/Bertrix fabric
- Radio: MBUX multimedia system
- Radio accessories: Communication module (LTE) for using Mercedes me connect services
- Tire pressure monitoring system (TPMS)
- Windscreen wipers with rain sensor
- Seats: iSize child seat anchorages with top tether on the outer seats
- Lane Keeping Assist, active
- Bumpers in body color
- Touchpad
- Electronic immobilizer
- Decorative elements with carbon look



Extra equipment

- Storage compartment in center console with roller blind
- Black fabric headliner
- LED High Performance headlights (The LED High Performance headlights offer greater safety at night and a distinctive, striking look. Thanks to LED technology, they illuminate the road better than conventional headlights – with lower energy consumption.)
- Package: Business (Hard drive navigation - Smartphone integration - Traffic sign assistant - Preparation for digital key handover - Connectivity package navigation - Seat heating for driver and front passenger - Active parking assistant with PARKTRONIC)
- Package: Parking package with reversing camera (including Active Parking Assist with PARKTRONIC - reversing camera)
- Package: Mirror package (interior and exterior mirrors on the driver's side automatically dimming - exterior mirrors left and right electrically folding)
- Heated windshield washer system
- Seats: 4-way lumbar support for driver and front passenger
- Seats: Driver's seat electrically adjustable with memory function (including exterior mirrors with parking position)
- Type designation removed from tailgate
- Decorative elements in dark carbon look
- EASY-PACK tailgate (electrically opening and closing tailgate - switch for electrically opening the tailgate in the driver's door - switch for electrically closing the tailgate at the bottom edge of the tailgate - manual cargo cover to cover the cargo area)
- Navigation accessories: Pre-installation for Live Traffic Information
- Package: MBUX High-End Package (Hard drive navigation - Pre-installation for Live Traffic Information - Traffic Sign Assist - Connectivity Package Navigation: Hard drive navigation, Extended Navigation Services - Smartphone Integration: Mobile phone via Apple CarPlay and Android Auto with the media system - Pre-installation for digital key handover - Wireless charging system for mobile devices or multifunction telephone - Central Media Display - Fully digital instrument display - MBUX Augmented Reality for navigation)
- Wheels: 43.2 cm (17") alloy wheels, 4-piece set in 5-twin-spoke design (vanadium silver painted and polished with 205/55 R 17 tires on 6.5 J x 17 ET 44 rims)
- Partition net for luggage compartment separation and occupant protection
- Heat-insulating dark tinted glass

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front right side	Door (Raue Oberfläche) - Paint defect - Paint
2	Mudguard - right side	Mudguard - right side (Raue Oberfläche) - Paint defect - Paint

Missing parts

Description

Documents - Log book



Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 19 May 2026	1.176,59 €
2	Side - left, Provided by user / customer, from 19 May 2026	1.737,45 €
3	Rear, Provided by user / customer, from 19 May 2026	1.808,08 €
4	Side right, Provided by user / customer, from 15 Jul 2024	1.914,25 €

Repainting

No.	Repainting
1	Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent
2	Door - rear right side, Professionally carried out, Invoice of repair done Non-existent
3	Door - front left side, Professionally carried out, Invoice of repair done Non-existent
4	Mudguard - right side, Unprofessionally carried out, Invoice of repair done Non-existent
5	Door - front right side, Unprofessionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - right side	293 µm	Side panel - rear left side	193 µm
Door - rear right side	203 µm	Door - front left side	195 µm
Door - front right side	277 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

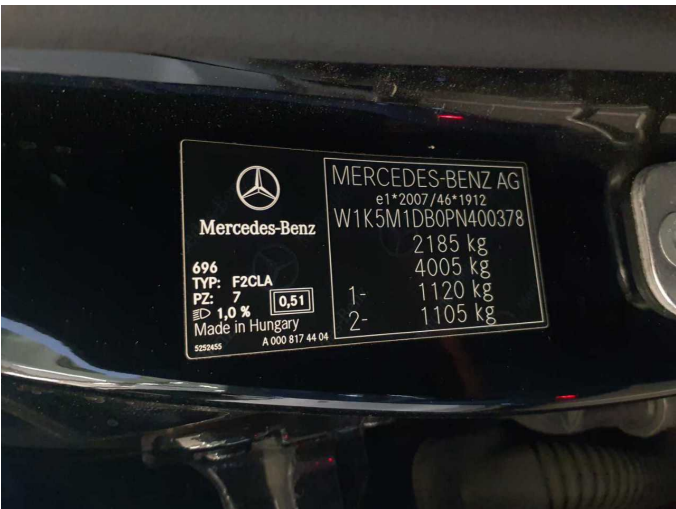


Figure 11: VIN



Figure 12: Mounted tyres

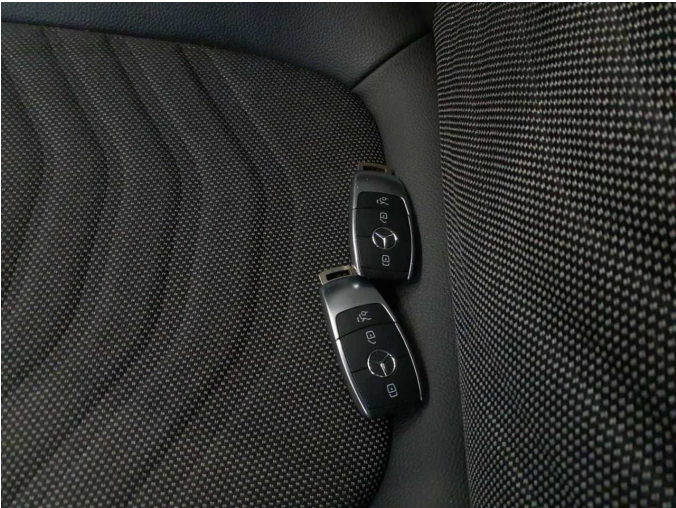


Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.

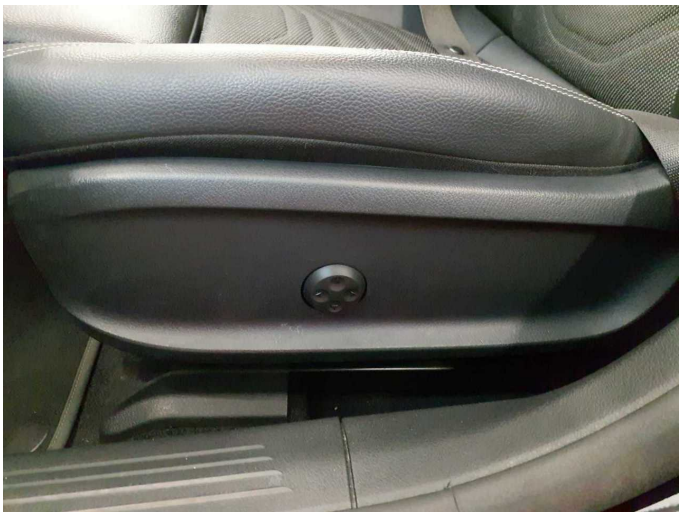


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.




Figure 29: Misc.




Damage 1: Door - front right side: Door (Raue Oberfläche) - Paint defect - Paint



Damage 1: Door - front right side: Door (Raue Oberfläche) - Paint defect - Paint

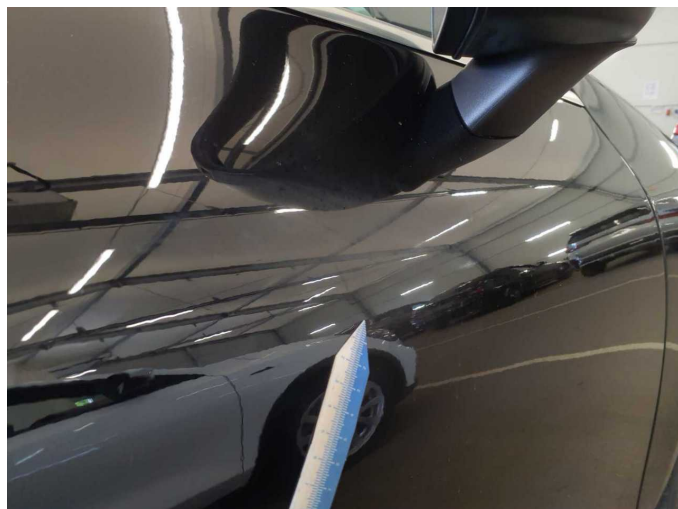

Damage 1: Door - front right side: Door (Raue Oberfläche) - Paint defect - Paint

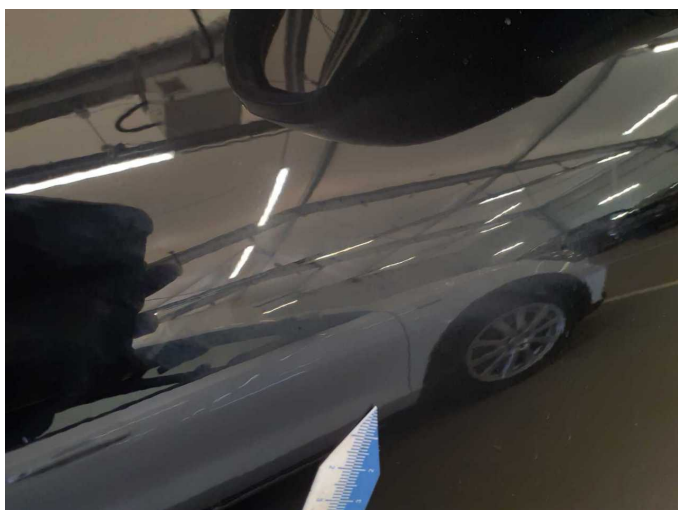

Damage 1: Door - front right side: Door (Raue Oberfläche) - Paint defect - Paint




Damage 1: Door - front right side: Door (Raue Oberfläche) - Paint defect - Paint



Damage 2: Mudguard - right side: Mudguard - right side (Raue Oberfläche) - Paint defect - Paint



Damage 2: Mudguard - right side: Mudguard - right side (Raue Oberfläche) - Paint defect - Paint

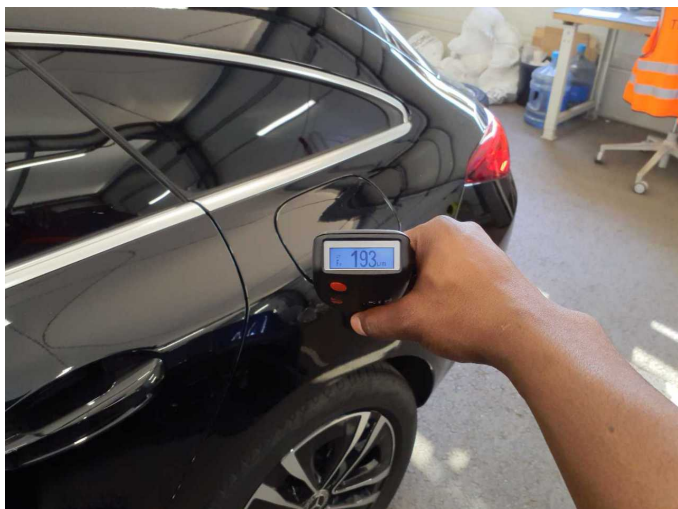

Repainting 1: Side panel - rear left side



Repainting 1: Side panel - rear left side



Repainting 2: Door - rear right side



Repainting 2: Door - rear right side



Repainting 3: Door - front left side



Repainting 3: Door - front left side



Repainting 4: Mudguard - right side



Repainting 4: Mudguard - right side



Repainting 5: Door - front right side



Repainting 5: Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1K5M1DB0PN400378

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ CLA 200 d 4Matic
Shooting Brake 8G-DCT Progressive

Datum	KM-Stand	Beschreibung
17.02.2026	129.800	Bremsklötze hinten; Regelwartungsdienst
13.08.2025	104.326	Bremsscheiben+Beläge v+h; Regelwartungsdienst
27.02.2025	79.035	Regelwartungsdienst; Regelwartungsdienst
25.07.2024	52.194	Regelwartungsdienst
20.12.2023	25.196	Regelwartungsdienst