



Expertise

Protocol number: 46050426
Order No. / Reference: 26365616
Inspection date: 19 Jun 2026

Manufacturer: Mercedes-Benz
VIN: W1NKM0FB6PF025278

Model: GLC 220 d 4Matic 9G-TRONIC AMG Line Advanced



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLC 220 d 4Matic 9G-TRONIC AMG Line Advanced	
Vehicle Identification number	W1NKM0FB6PF025278
Mileage (Read)	127,922 km
First registration	18 Apr 2023
Number of holders	1
Next periodical technical inspection	04/2026
(Report not on hand)	
Power / Engine displacement	145 kw / 1,993 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Obsidianschwarz Metallic
Doors / Seats	5 / 5
Upholstery type	Artificial leather
Colour of upholstery	Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	0 Tag(e)
Last service on / at	11/2025 at 103,007 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS686615
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	2222 / BJX 00039		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,550 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 103H	Winter tyres on Light alloy	Continental	3mm / 3mm
2)	235/60 R18 103H	Winter tyres on Light alloy	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105W	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	255/50 R19 107W	Summer tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Adaptive Highbeam Assist
- Airbag: Kneebag for driver
- Airbag: Windowbag
- 4MATIC all-wheel drive
- AMG front apron with sporty air intakes and chrome trim element
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Brake system with larger brake discs on the front axle
- Diesel particulate filter
- Downhill speed regulation (DSR)
- EASY-PACK tailgate
- Electronic Stability Program (ESP)
- Chassis: Sport chassis
- Transmission: 9G-TRONIC
- Rear window wiper/washer system
- Instrument panel and door sills in ARTICO man-made leather in black nappa look
- LED High Performance Headlights
- Steering wheel: Multifunction sports steering wheel in Nappa leather
- Navigation accessories: Extended MBUX functions
- Package: Storage
- Package: Interior light
- Package: Parking package with reversing camera
- Package: Mirror Package
- Radio accessories: Digital radio (DAB)
- Tire pressure loss warning
- Wheels: Summer tires
- Windscreen wipers with rain sensor
- Sporty engine sound
- Phone accessories: Smartphone integration
- Cruise control
- High-visibility vest for drivers
- Heat-insulating dark tinted glass
- Central locking with remote control
- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Lane Keeping Assist
- Ambient lighting
- AMG floor mats
- AMG sports pedal assembly made of brushed stainless steel with black rubber studs
- Automatic passenger airbag deactivation
- Roof rails made of glossy anodized aluminum
- Double cup holder
- Tachometer
- EASY-Pack: Cargo area cover
- Driver display
- Fingerprint scanner
- Rear window heated
- Interior headliner fabric crystal grey
- Climate: THERMATIC automatic climate control
- Radiator grille with Mercedes-Benz pattern and integrated Mercedes star
- Steering: Sport direct steering
- Center console in high-gloss black
- Navigation: MBUX Navigation Premium
- Package: Chrome Interior Package
- Package: Boot Comfort Package
- Package: Seating comfort
- Package: USB package
- Radio accessories: MBUX multimedia system
- Remote Services Plus
- Wheel accessories: TIREFIT with tire inflator compressor
- Heated seats for driver and front passenger
- Phone accessories: Wireless charging system for mobile devices
- Pre-installation for digital key handover
- Immobiliser
- Central display
- Decorative elements: metal structure



Extra equipment

- Towbar with ESP trailer stabilization
- Black fabric headliner
- Paint finish: Metallic
- Center console diamond pattern silver grey
- Package: Driving Assistance Package Plus (Active Distance Assist DISTRONIC, Active Speed Limit Assist, Extended Automatic Restart, Route-Based Speed Adaptation with Traffic Jam Definition, Active Steering Assist, Active Lane Change Assist, Active Emergency Stop Assist with SOS Radio, Emergency Lane Radio, Active Brake Assist, Turn and Intersection Radio, Traffic Jam Emergency Brake Radio, Evasive Steering Assist, Active Lane Keeping Assist, Active Blind Spot Assist, Exit Warning Radio, PRE-SAFE PLUS Pedestrian Warning Function, Traffic Sign Assist, Active Traffic Jam Assist, PRE-SAFE Impulse Side)
- Upholstery: ARTICO man-made leather
- Wheel arch trims in body color
- Wheels: Winter complete wheels M+S 4-way 45.7 cm (18") (Light alloy wheels in 5-twin-spoke design, vanadium silver painted with 235/60 R 18 on 8 J x 18 ET 32.5)
- Wheels: Complete winter wheel sets fitted at the factory
- Traffic Sign Assistant (Camera and navigation data always keep an eye on the current speed limit – so you stay oriented even in a maze of signs. Because the system constantly informs you, the risk of violations decreases. This is not only convenient, but also increases safety in everyday road traffic.)
- Chassis: AGILITY CONTROL chassis with selective damping system (The AGILITY CONTROL chassis offers optimal road holding without compromising driving comfort. The passive selective damping system ensures a confident driving experience on any road surface because it automatically optimizes rolling behavior, damping effect and stabilization.)
- Package: Night (Radiator grille with Mercedes-Benz pattern and louvre in high-gloss black - Attractive 48.3 cm (19") AMG 5-spoke light-alloy wheels in high-gloss black and polished finish 235/55 R19 on 8.0 J x 19 ET 32.5 - AMG front apron with visual underguard in high-gloss black - Belt trim strip and window surrounds in high-gloss black - Exterior mirror housings painted in high-gloss black - Roof rails in matte black, rear apron and diffuser in black)
- Package: Winter Package (heated steering wheel - heated windshield washer system)
- Wheels: 48.3 cm (19") AMG light-alloy wheels in 5-spoke design (aerodynamically optimized, painted black and high-shine finish with front axle 235/55 R19 on 8.0 J x 19 ET 32.5 and rear axle 255/50 R19 on 9.0 J x 19 ET 30)
- Cargo net (This feature protects you from loose items in the luggage compartment. The cargo net is very easy to use. You can attach or remove it in just a few steps.)
- Type designation removed from trunk lid
- Decorative elements in diamond pattern, silver-grey

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - Due - Perform
2	Wheel / tyres	Tyre - front left side - Does not meet the leasing specifications - Replace
3	Wheel / tyres	Tyre - front right side - Does not meet the leasing specifications - Replace
4	Misc.	Inspection / maintenance - Expired - Perform



Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Interior	Interior - Scratch(es) - No deduction
5	Rear bumper	Rear bumper - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 16 May 2025	1.266,47 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

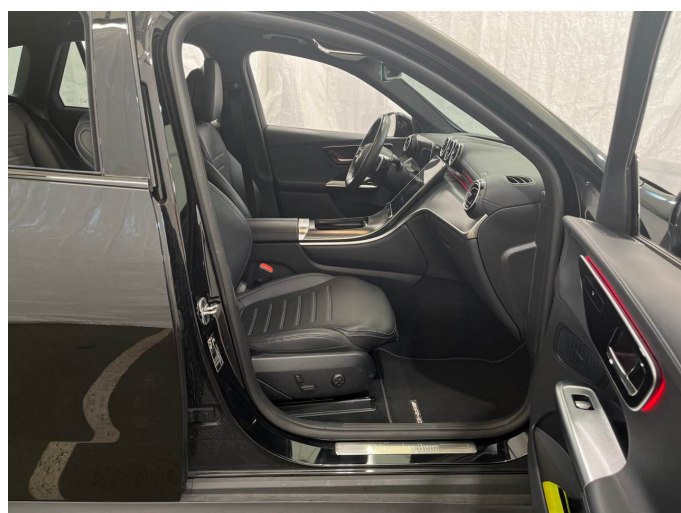


Figure 5: Interior - front

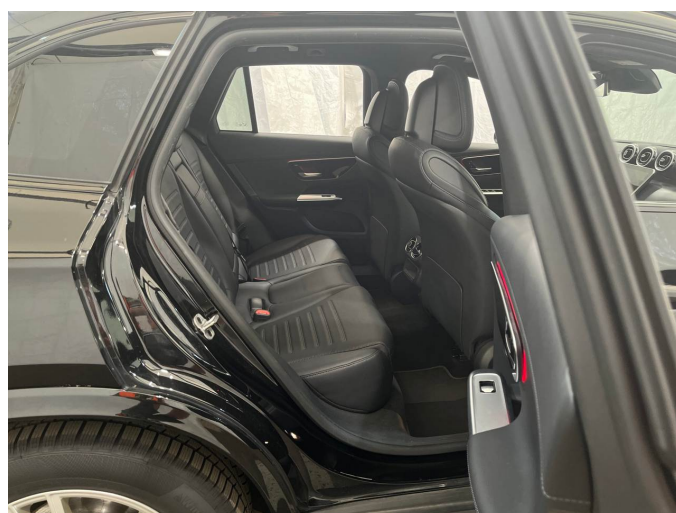


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

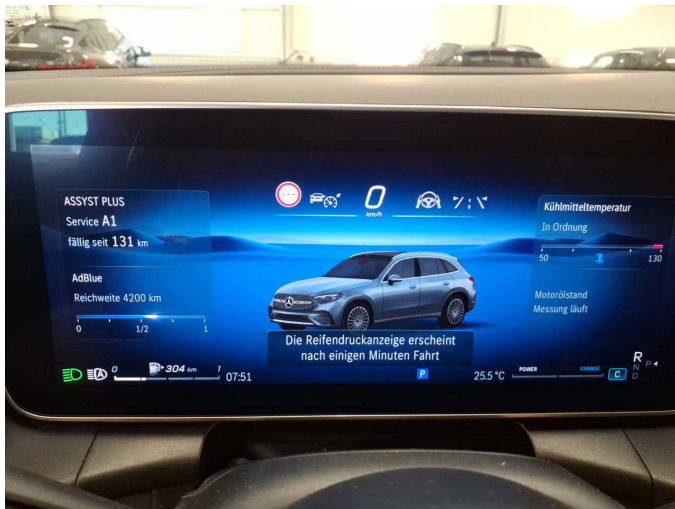


Figure 15: Documents



Figure 16: Additional tyres

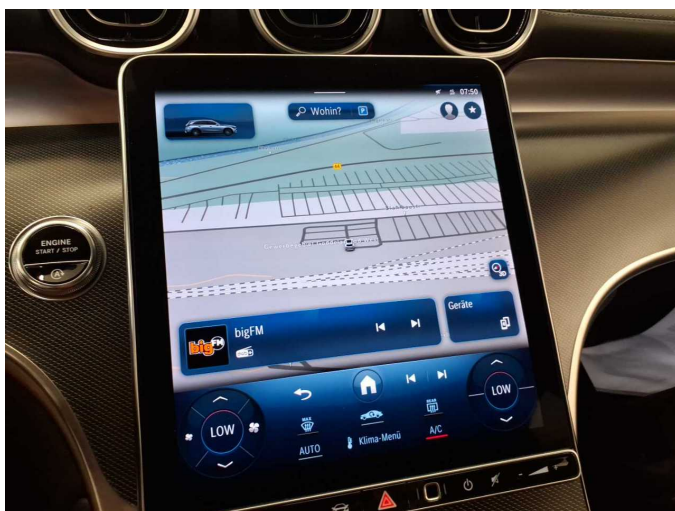


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

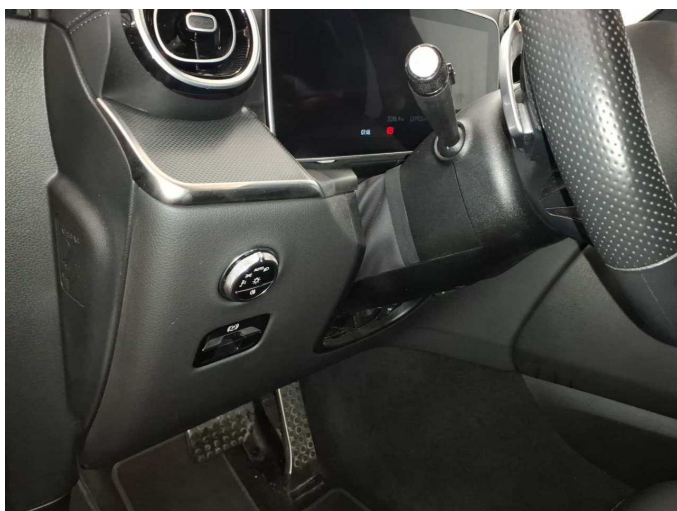


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.

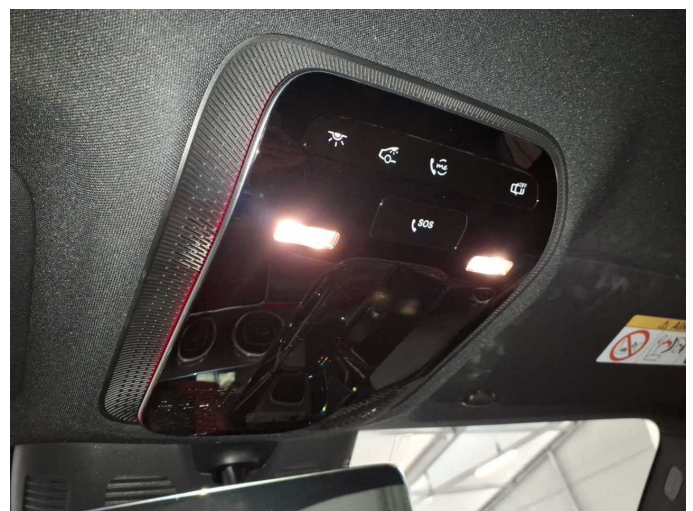


Figure 36: Misc.



Figure 37: Misc.



Damage 2: Wheel / tyres: Tyre - front left side - Does not meet the leasing specifications - Replace



Damage 2: Wheel / tyres: Tyre - front left side - Does not meet the leasing specifications - Replace



Damage 3: Wheel / tyres: Tyre - front right side - Does not meet the leasing specifications - Replace



Damage 3: Wheel / tyres: Tyre - front right side - Does not meet the leasing specifications - Replace



Damage 4: Misc.: Inspection / maintenance - Expired - Perform



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1NKM0FB6PF025278

Hersteller / Modell: MERCEDES-BENZ MB GLC 220 d 4Matic 9G-TRONIC AMG
Advanced

Datum	KM-Stand	Beschreibung
12.02.2026	116.142	Systemtest/Eigendiagnose
11.11.2025	103.007	Regelwartungsdienst
27.02.2025	75.928	Bremsinspektion vo + hi; Regelwartungsdienst
23.08.2024	49.569	Regelwartungsdienst
29.01.2024	26.683	Regelwartungsdienst