



Expertise

Protocol number: 46542274
Order No. / Reference: 26725662-2
Inspection date: 10 Jul 2026

Manufacturer: Ford

Model: S-Max 2.0 EcoBlue TITANIUM

VIN: WF0JXXWPCJMB25270



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford S-Max 2.0 EcoBlue TITANIUM	
Vehicle Identification number	WF0JXXWPCJMB25270
Mileage (Read)	149,058 km
First registration	3 Aug 2021
Number of holders	1
Next periodical technical inspection	06/2026
(Report not on hand)	
Power / Engine displacement	110 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Magnetic-Grau (Metallic)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Re-import	no
readiness to drive	Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	0 Monat(e)
Key is / should be	1 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GD543157
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	8566 / BKM 01047		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,555 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R17 103V	Winter tyres on Steel	Hankook	2mm / 2mm
2)	235/55 R17 103V	Winter tyres on Steel	Hankook	3mm / 3mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R17 103W	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	235/55 R17 103W	Summer tyres on Light alloy	Continental	2mm / 2mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments (illuminated glove compartment - map pockets on the driver's and passenger's seat backrests)
- Exterior mirrors in body color, driver and passenger side, electrically adjustable and heated (with integrated turn signals and ambient lighting and electrically foldable)
- Attachment points for safety partition grilles (attachment points 2nd row of seats)
- Hill start assist
- third brake light
- Roof rails "aluminum look"
- Diesel particulate filter (DPF)
- Tachometer
- Lane Assist including Lane Keeping Assist and Driver Alert (warns the driver of an unintentional lane change via short steering wheel vibrations (without activation of the turn signal) - additionally, active steering support assists in returning to the lane)
- Electronic parking brake
- Ford EasyFold: 2nd row seat backrests fold down electrically at the touch of a button.
- Ford Power Start function (keyless start)
- Ford Power Start function with Ford Key Free system (keyless starting and locking/unlocking)
- Luggage compartment lighting
- Transmission: 6-speed manual transmission
- Back window, heater
- rear window wiper
- Interior mirror, automatically dimming
- Isofix mounting (on all seats in the 2nd row)
- Electric child safety lock
- Air conditioning with automatic temperature control (separately adjustable for driver and passenger side (2-zone automatic climate control))
- Leather gear knob
- Steering wheel: Steering column, adjustable in height and reach
- Front and rear reading lights (with LED technology)
- MyKey key system (individually programmable second key) (setting options include: - Limiting the maximum speed and radio volume (to max. volume 15 out of 32) - Speed warning (when the set speed limit is exceeded) - Safety assistance systems cannot be deactivated - Extended warning system for unfastened seat belts)
- Fog light
- Emergency brake light (pulsating illumination of the brake lights during hard braking)
- Package: Winter (Heated windscreen - Heated leather steering wheel - Individually and variably heated front seats)
- Front and rear parking pilot system
- Tire repair kit (for use at a maximum speed of 80 km/h)
- LED taillights
- Headlight dipped beam with switch-off delay including "greeting function"
- Ambient lighting in the front (including door storage, front door handle and footwell lighting)
- Anti-lock braking system (ABS) (with Electronic Stability Program (ESP), Roll Stability Control (RSC) and Traction Control System (TCS))
- Attachment points for safety partition grilles (attachment points 1st row of seats)
- Tires: 7.5 J x 17 alloy wheels (4) with 235/55 R 17 tires (in 5x2-spoke design)
- Overhead console (with glasses storage compartment and fold-out additional mirror for eye contact with rear passengers)
- Driver information system display 25.4 cm color (on-board computer with fuel consumption and mileage information as well as outside temperature display)
- Electric front and rear windows (with anti-pinch protection and automatic opening and closing function)
- High Beam Assist
- Ford Easy Fuel (The Ford Easy Fuel convenience refueling system eliminates the need for a separate internal fuel filler cap and prevents misfueling by detecting the size difference between petrol and diesel nozzles. The filler neck only opens when the correct fuel is used.)
- Luggage compartment cover (removable)
- Cruise control system with intelligent speed limiter (interior mirror, automatically dimming - traffic sign recognition system)
- Interior lighting with delay circuit
- Intelligent Protection System (IPS): - Front headrests, 4-way height and tilt adjustable - Front airbag for driver and front passenger - Driver's knee airbag - Head and shoulder airbags, front and for 2nd row of seats - Side airbag for driver and front passenger - Side airbag for outer rear seats of the 2nd row - Seat belt tensioners and belt force limiters, front - 3-point seat belts on all seats, height adjustable in the front)
- Steering wheel: Multifunction leather steering wheel
- Front center console with padded armrest (storage compartment and 2 cup holders)
- Ford navigation system including Ford SYNC 3 with AppLink, touchscreen, DAB/DAB+ and FordPass Connect (communication and entertainment with voice control - Android Auto, Apple CarPlay - Bluetooth hands-free system and audio streaming - eCall emergency call system - live traffic - Wi-Fi hotspot - radio/CD player, 2 USB ports, 8 speakers, steering wheel controls - 20.3 cm screen - DAB/DAB+ - acoustic and visual route guidance, dynamic navigation, lane keeping assist, road map for Europe - extended voice control and voice output - Michelin travel guide for Europe - quick address search)
- Upholstery: Cloth
- Tire Pressure Monitoring System (TPMS)
- Windscreen wipers with rain sensor
- Headlight assistant with day/night sensor



- Seats: Driver and front passenger seats, 4-way manually adjustable (including manually adjustable lumbar support)
- Seats: Front sports seats (with enhanced lateral support)
- Seats: Front seats can be heated individually and variably.
- Start-stop system
- 230 volt socket
- Bumpers painted in body color
- Trays on the front seatbacks
- Premium carpet floor mats front and rear (as well as in the 3rd row of seats if ordered as an optional extra)
- Warning system for unfastened seat belts for the 1st and 2nd rows of seats (as well as the 3rd row of seats if ordered as an optional extra)
- Cigarette lighter (and ashtray in the center console)

- Electro-mechanical power steering (EPAS - Electric Power Assisted Steering)
- Seats: Flexible seating system "FoldFlatSystem (FFS)" (2nd row of seats with 3 individual seats - adjustable longitudinally - seat backrests adjustable for tilt and individually foldable - headrests retractable)
- Power outlet: 12-volt connection in the luggage compartment and in the center console
- LED daytime running lights
- Traffic sign recognition system
- Lashing eyes in the luggage compartment
- Immobiliser
- Central locking with remote control (remote luggage compartment release - second folding vehicle key)

Extra equipment

- Package: Business I (Ford navigation system incl. Ford SYNC 3, AppLink, 20.3 cm touchscreen, DAB/DAB+, voice control, support for Android Auto and Apple CarPlay, Bluetooth hands-free system and audio streaming, FordPass Connect, eCall emergency call system, live traffic information, Wi-Fi hotspot, radio/CD player, 2 USB ports, 8 speakers, steering wheel controls, LED daytime running lights, park assist with automatic parallel and perpendicular parking function, pre-collision assist, forward collision warning, active emergency braking, reversing camera)

- Fuel-operated auxiliary heater
- Paint finish: Magnetic Grey Metallic
- Paint finish: Metallic
- Safety partition net behind the 2nd row of seats
- Side windows from the 2nd row of seats and rear window, dark tinted.

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.



Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
3	Trim / covers	Floor mats - Broken / torn - Replace
4	Roof	Roof - dent(s) - Smooth repair work
5	Trim / covers	Trim / covers - Scratch(es) - Loss in value
6	Trim / covers	Roof lining - Scratch(es) - Loss in value
7	Seat - rear	Upholstery - Broken / torn - Smart repair
8	Misc.	Main inspection - Due - Perform
9	Trim / covers	Boot lid - interior trim - Scratch(es) - Loss in value
10	Engine	Engine cover - Scratch(es) - Replace
11	Seat - rear	Upholstery - Broken / torn - Replace
12	2nd wheel set	2 tyres - Worn - Replace
13	Misc.	Inspection / maintenance (12.07.2026) - Due - Perform
14	Door - rear right side	Door - Scratch(es) - Paint
15	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Repair and paint
16	Rear bumper	Rear bumper (Inklusive anbauteile) - Dent / paintcoat damage - Repair and paint
17	Front bumper	Front bumper (Inklusive anbauteile) - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Wheel / tyres	Tyres - complete set - does not meet manufacturer specifications - No deduction
2	Body	A-pillar - right side - Stone chips - No deduction
3	Door - front right side	Door - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Vehicle key

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side - left, Side right, Provided by user / customer, from 25 Jan 2025	2.805,87 €

Repainting

No.	Repainting
1	Bonnet, Professionally carried out, Invoice of repair done Non-existent
2	Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Bonnet	248 µm	Door - front right side	163 µm
--------	--------	-------------------------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Für den montierten Radsatz wurde kein Nachweis erbracht.

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

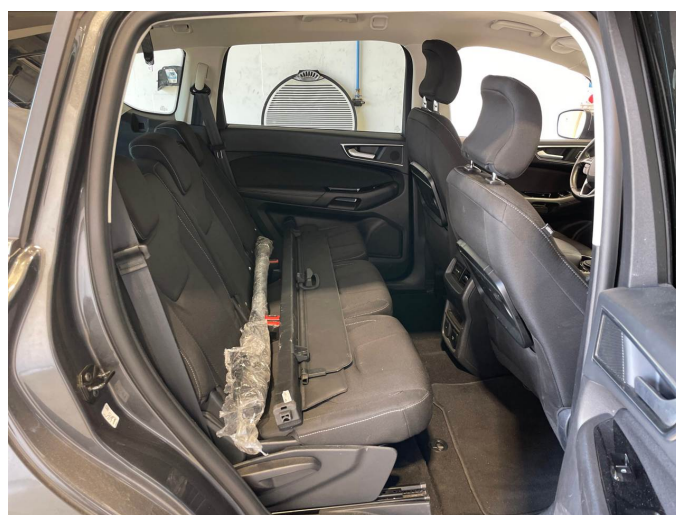


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

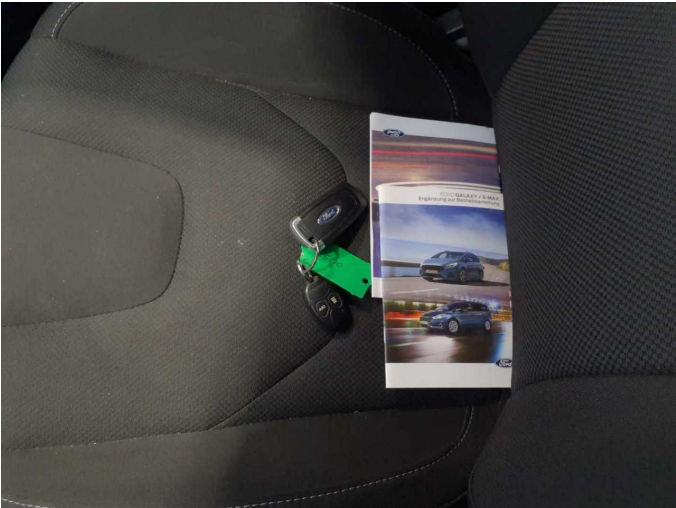


Figure 13: Documents

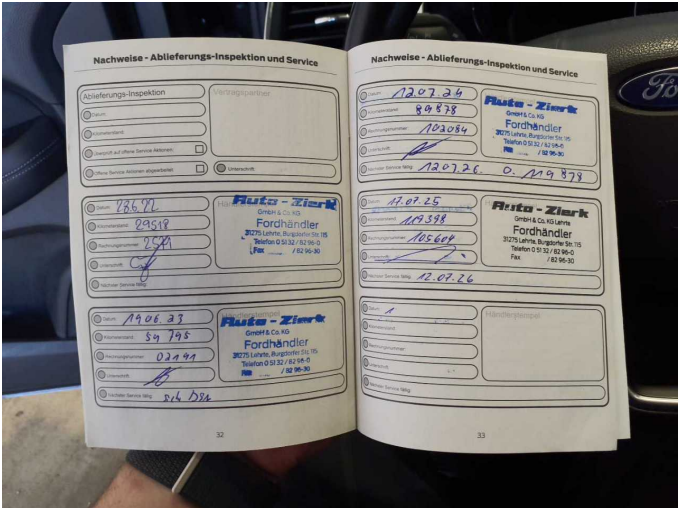


Figure 14: Documents

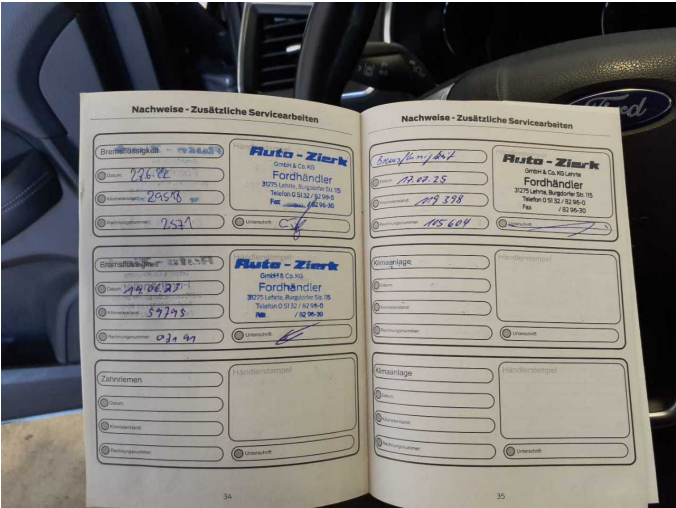


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.

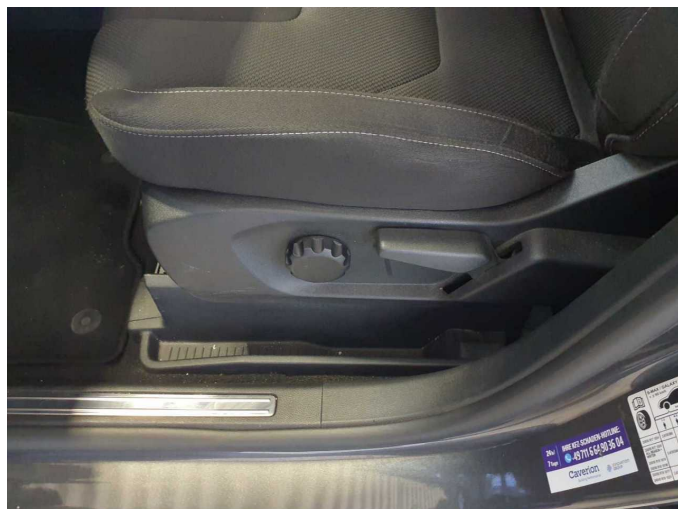


Figure 20: Misc.



Figure 21: Misc.

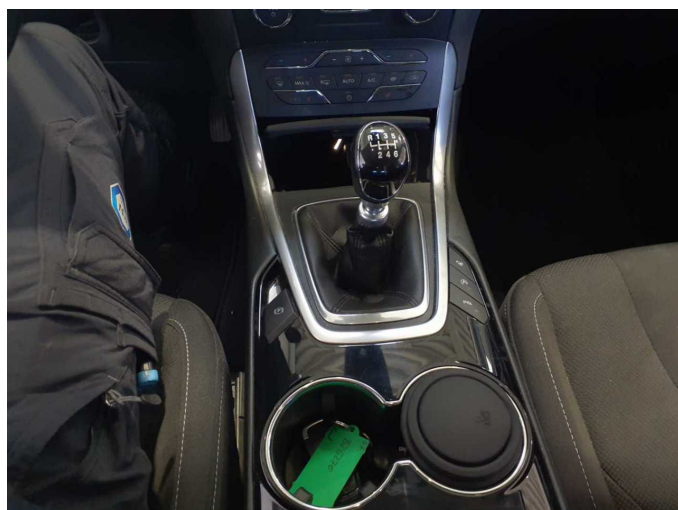


Figure 22: Misc.



Figure 23: Misc.

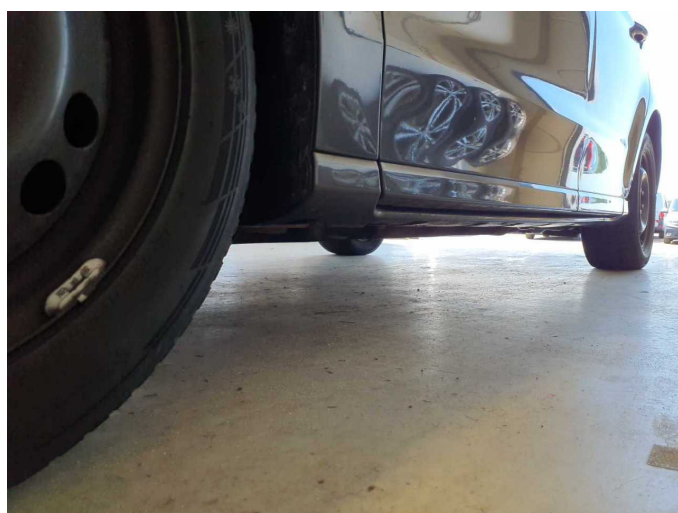


Figure 24: Misc.



Figure 25: Misc.

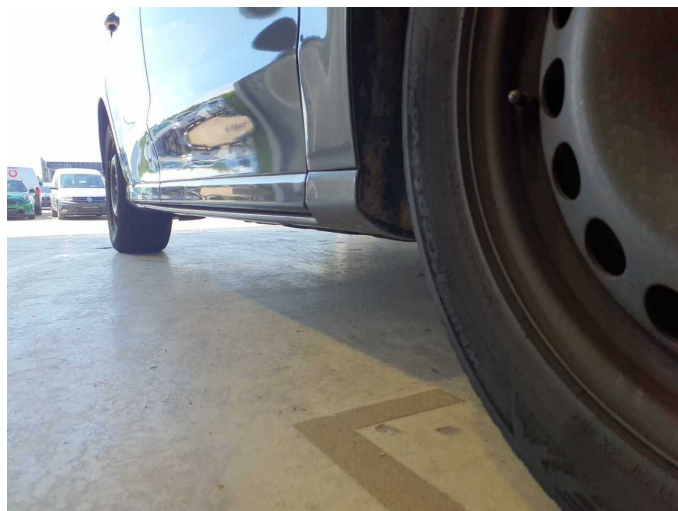


Figure 26: Misc.

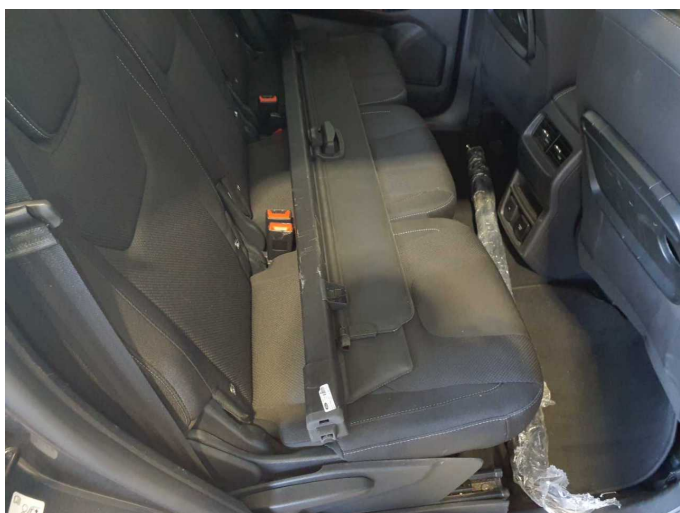


Figure 27: Misc.

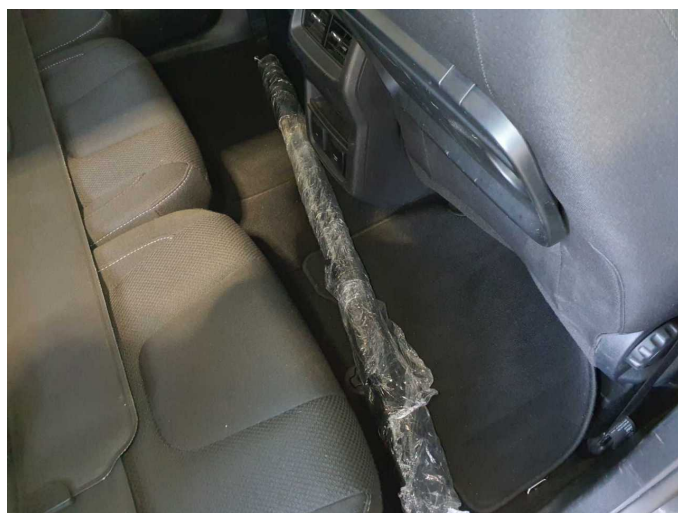


Figure 28: Misc.


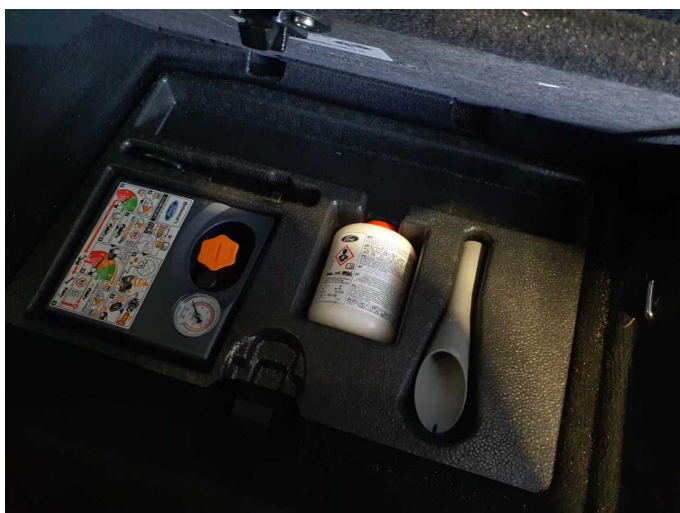


Figure 29: Misc.




Figure 30: Misc.

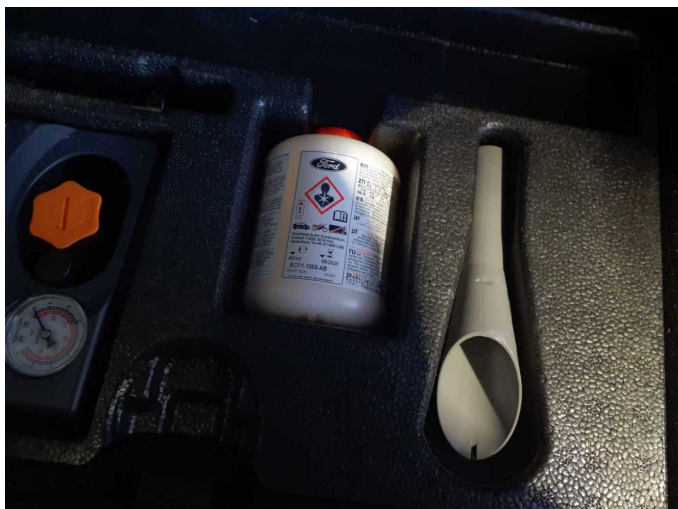


Damage 1: Equipment: Tirefit filler - Expired - Replace




Damage 2: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise

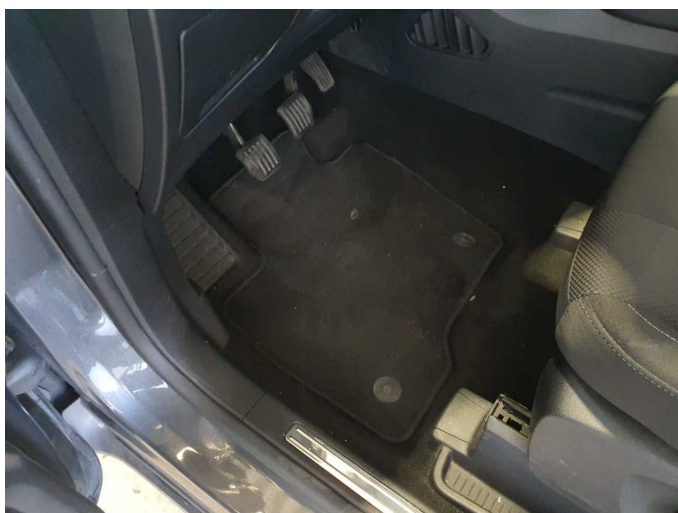


Damage 3: Trim / covers: Floor mats - Broken / torn - Replace

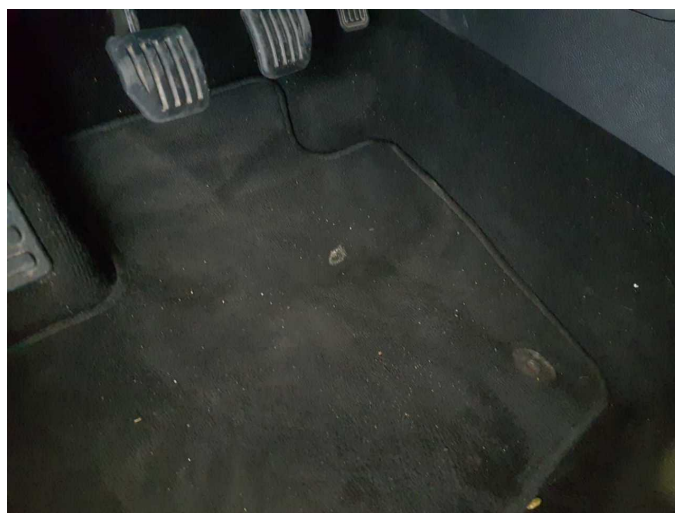

Damage 3: Trim / covers: Floor mats - Broken / torn - Replace

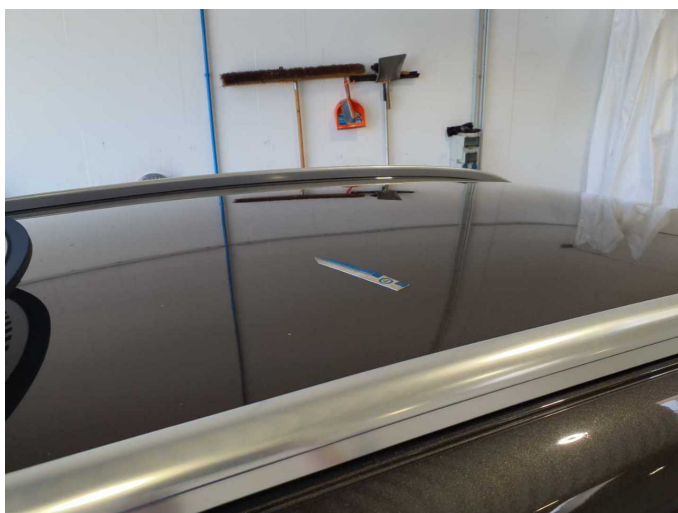


Damage 4: Roof: Roof - dent(s) - Smooth repair work

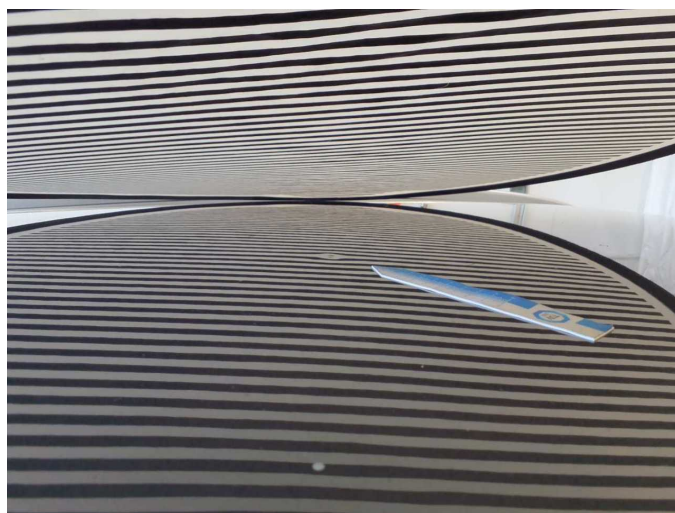

Damage 4: Roof: Roof - dent(s) - Smooth repair work



Damage 5: Trim / covers: Trim / covers - Scratch(es) - Loss in value

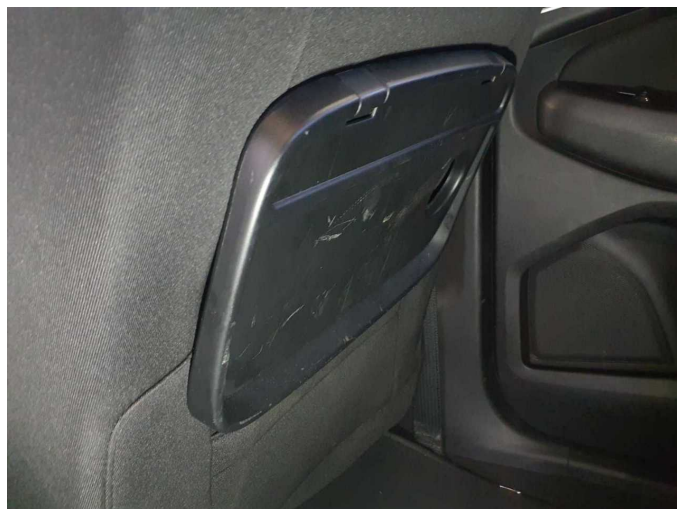


Damage 5: Trim / covers: Trim / covers - Scratch(es) - Loss in value



Damage 6: Trim / covers: Roof lining - Scratch(es) - Loss in value



Damage 6: Trim / covers: Roof lining - Scratch(es) - Loss in value

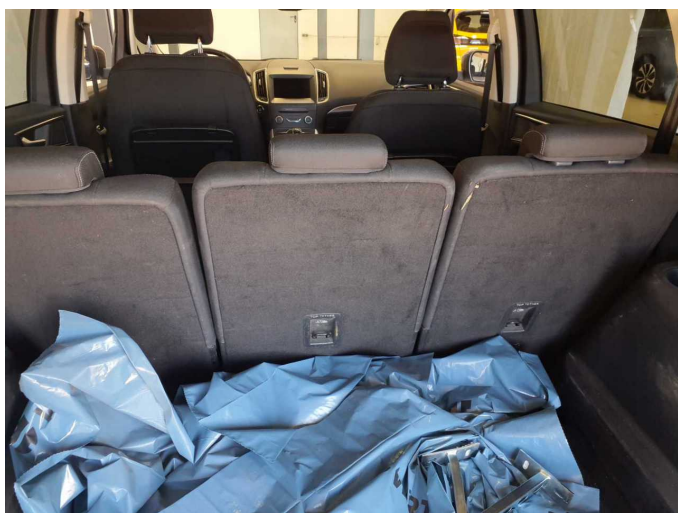

Damage 7: Seat - rear: Upholstery - Broken / torn - Smart repair



Damage 7: Seat - rear: Upholstery - Broken / torn - Smart repair



Damage 9: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value




Damage 9: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value



Damage 10: Engine: Engine cover - Scratch(es) - Replace




Damage 11: Seat - rear: Upholstery - Broken / torn - Replace

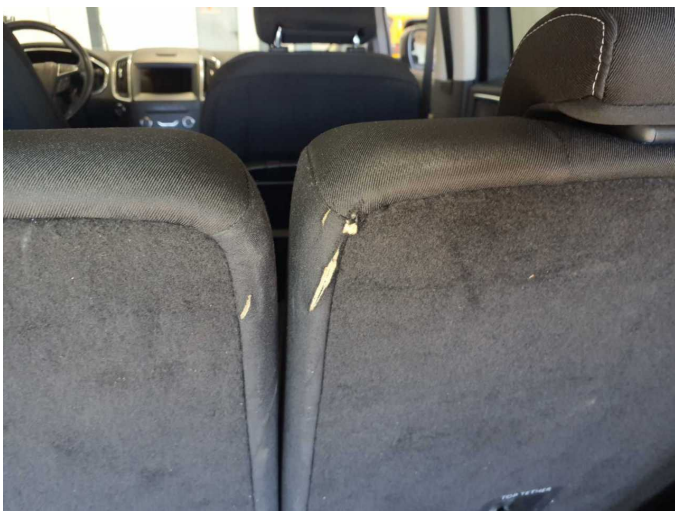


Damage 11: Seat - rear: Upholstery - Broken / torn - Replace




Damage 12: 2nd wheel set: 2 tyres - Worn - Replace

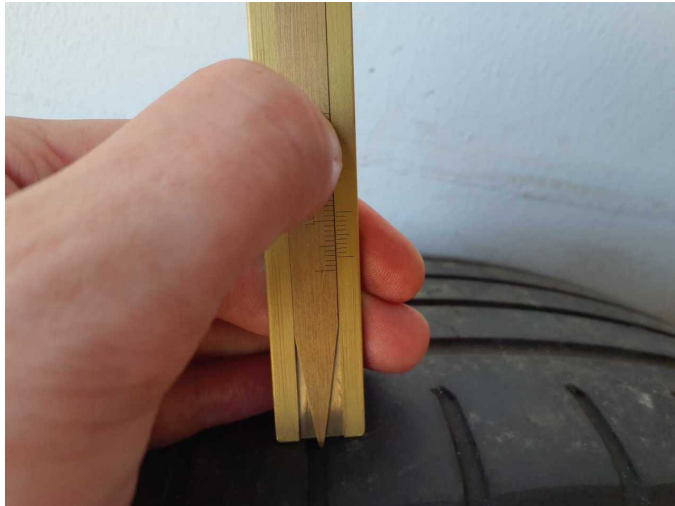


Damage 12: 2nd wheel set: 2 tyres - Worn - Replace

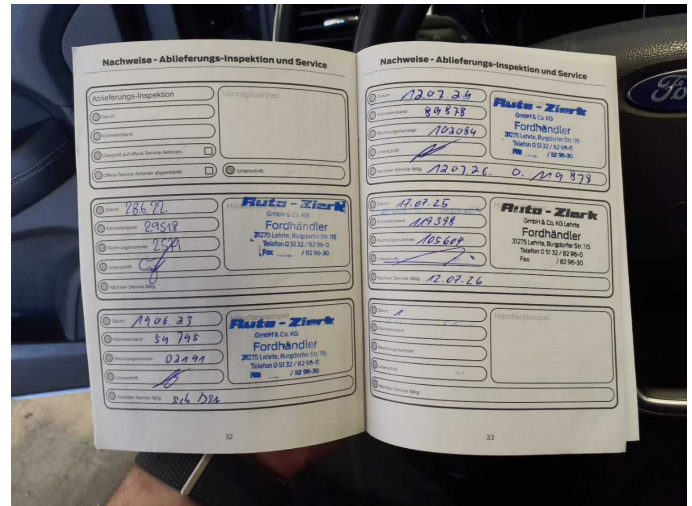

Damage 13: Misc.: Inspection / maintenance (12.07.2026) - Due - Perform

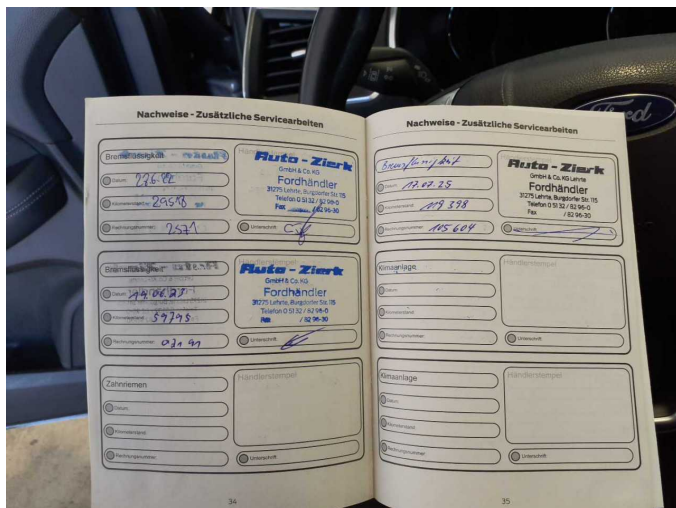


Damage 13: Misc.: Inspection / maintenance (12.07.2026) - Due - Perform

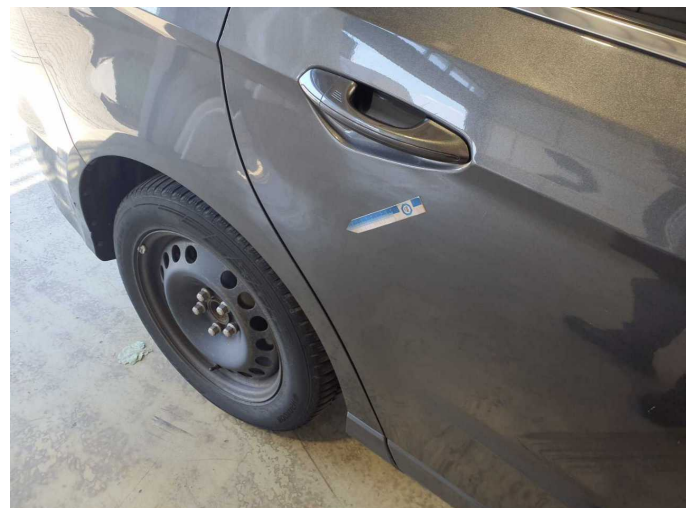


Damage 14: Door - rear right side: Door - Scratch(es) - Paint




Damage 14: Door - rear right side: Door - Scratch(es) - Paint

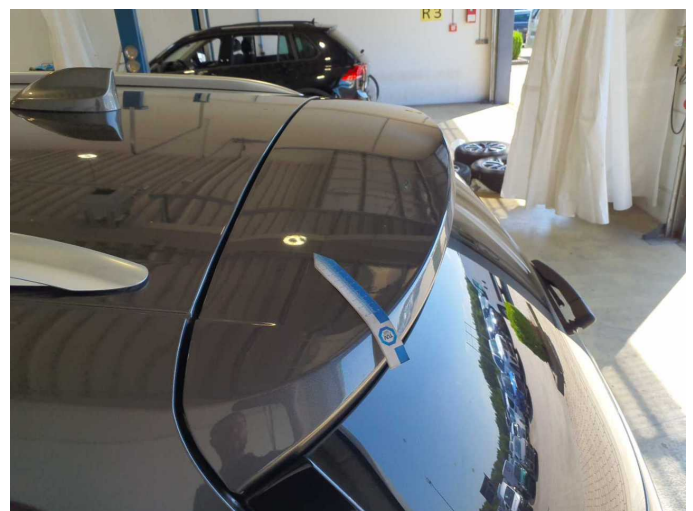

Damage 15: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

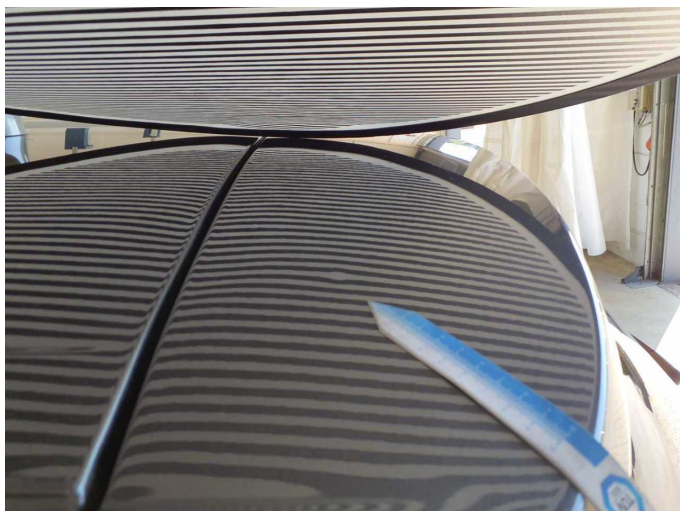

Damage 15: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

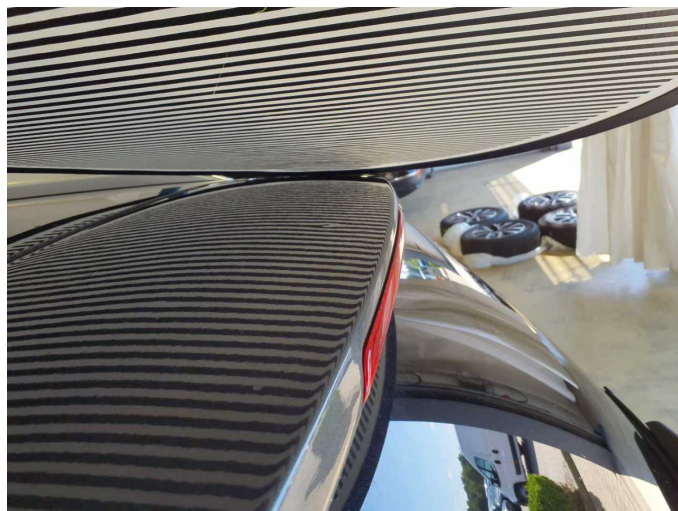

Damage 15: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint



Damage 15: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint



Damage 16: Rear bumper: Rear bumper (Inklusive anbauteile) - Dent / paintcoat damage - Repair and paint



Damage 16: Rear bumper: Rear bumper (Inklusive anbauteile) - Dent / paintcoat damage - Repair and paint




Damage 16: Rear bumper: Rear bumper (Inklusive anbauteile) - Dent / paintcoat damage - Repair and paint




Damage 16: Rear bumper: Rear bumper (Inklusive anbauteile) - Dent / paintcoat damage - Repair and paint



Damage 16: Rear bumper: Rear bumper (Inklusive anbauteile) - Dent / paintcoat damage - Repair and paint

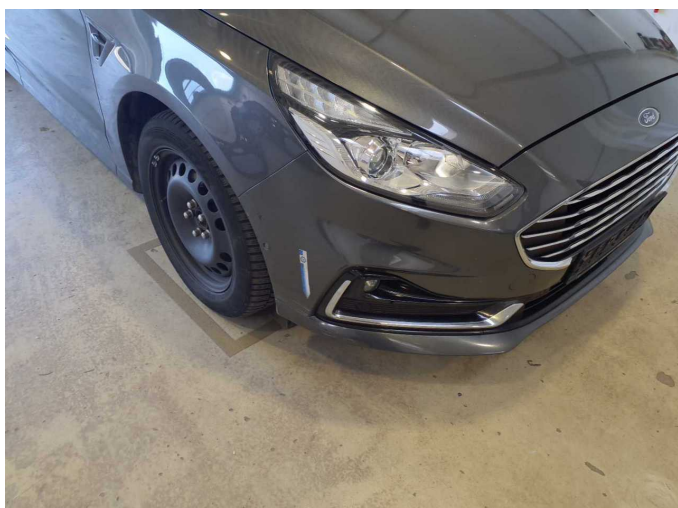


Damage 17: Front bumper: Front bumper (Inklusive anbauteile) - Dent / paintcoat damage - Repair and paint

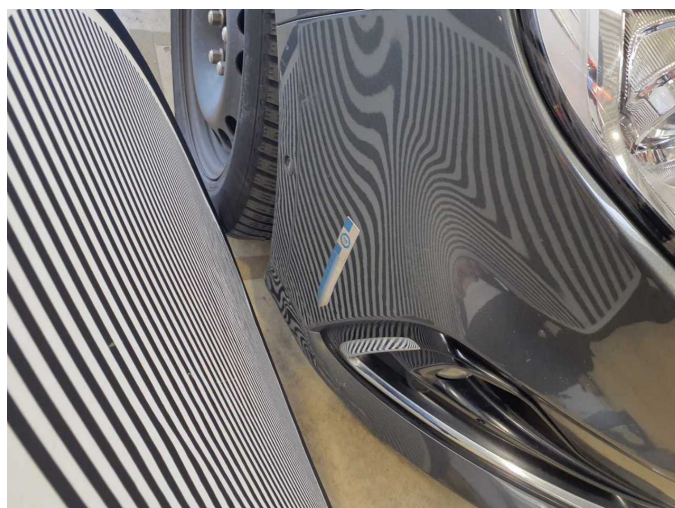

Damage 17: Front bumper: Front bumper (Inklusive anbauteile) - Dent / paintcoat damage - Repair and paint



Damage 17: Front bumper: Front bumper (Inklusive anbauteile) - Dent / paintcoat damage - Repair and paint

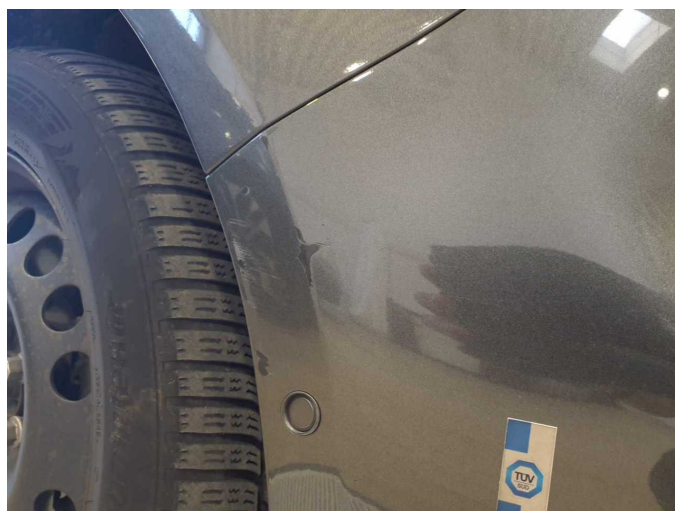

Damage 17: Front bumper: Front bumper (Inklusive anbauteile) - Dent / paintcoat damage - Repair and paint



Repainting 1: Bonnet



Repainting 1: Bonnet



Repainting 2: Door - front right side



Repainting 2: Door - front right side