



Expertise

Protocol number: 46550569
Order No. / Reference: 26559215
Inspection date: 16 Jul 2026

Manufacturer: Mercedes-Benz

Model: C 200 d T 9G-TRONIC Avantgarde Advanced

VIN: W1KAH0DB7RF151247



Vehicle details

Manufacturer / Type / Model / Equipment

Mercedes-Benz C 200 d T 9G-TRONIC Avantgarde Advanced

Vehicle Identification number W1KAH0DB7RF151247
Mileage (Read) 169,167 km
First registration 13 Feb 2024
Number of holders 1
Next periodical technical inspection 02/2027
(Report not on hand)

Power / Engine displacement 120 kw / 1,993 ccm
Fuel type / Cylinder Hybrid Diesel / E / 4
Gearbox / Number of gears Automatic / 9
Type of drive Rear drive
Type of vehicle Station wagon
Colour / colour code Obsidianschwarz metallic
Doors / Seats 5 / 5
Upholstery type Leather
Colour of upholstery Black



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	260 Tag(e)
Last service on / at	02/2026 at 151,993 km		
Key is / should be	1 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GY579361
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / BDF 00353		
Emission standard	EURO6;WLTP;EA;PI/CI;M, N1, N2	fine dust sticker	
Permitted total weight	2,400 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 94Y	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	225/50 R17 94Y	Summer tyres on Light alloy	Continental	4mm / 4mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 98H	Winter tyres on Light alloy	Continental	7mm / 7mm
2)	225/50 R17 98H	Winter tyres on Light alloy	Continental	5mm / 5mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2029		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Adaptive Highbeam Assist
- Airbag: Automatic passenger airbag deactivation
- Airbag: Side airbag for driver and front passenger
- Ambient lighting with 64 light colors
- Left and right exterior mirrors are heated and electrically adjustable
- Roof rails in polished aluminum
- Double cup holder at the front
- EASY-PACK tailgate
- Driver display
- Electric windows (4-way)
- Fingerprint scanner
- Speed Limit Assistant
- rear window wiper
- Interior headliner fabric crystal grey
- KEYLESS-GO start function
- THERMATIC automatic climate control with 2 climate zones
- Front headrests
- Cargo area cover including EASY-PACK safety net
- Steering wheel: Multifunction sports steering wheel in leather
- Navigation: MBUX Navigation Premium
- Package: Avantgarde Advanced
- Package: Trunk Comfort
- Package: Seating comfort
- Package: USB
- Radio: MBUX multimedia system
- Radio accessories: Communication module (LTE) for using Mercedes me connect services
- Remote Services
- Windscreen wipers with rain sensor
- Power steering
- Seats: Rear seat backrests foldable
- Phone accessories: Wireless charging system for mobile devices
- TIREFIT with tire inflation compressor
- Pre-installation for digital key handover
- Electronic immobilizer
- Decorative elements in diamond pattern, silver-grey
- Airbag for driver and front passenger
- Airbag: Center airbag
- Airbag: Windowbag for driver and front passenger
- ATTENTION ASSIST
- Basic services
- Brake assist, active
- Diesel particulate filter
- DYNAMIC SELECT
- Electronic Stability Program (ESP)
- Chassis: AGILITY CONTROL chassis with selective damping system and lowered suspension
- Velour floor mats
- Transmission: 9-speed automatic, 9G-TRONIC
- Heated rear window
- ISOFIX child seat attachment with top tether in the rear
- Mechanical child safety lock for the rear doors
- Rear headrests (3)
- Fuel tank with larger volume 66 l
- LED High Performance Headlights
- Mercedes-Benz emergency call system
- Center console in high-gloss black
- Package: Storage
- Package: Interior lighting package
- Package: Parking package with reversing camera
- Package: Mirror package
- Radio: Extended MBUX functions
- Radio accessories: Digital radio (DAB)
- Radio accessories: Central display
- Tire pressure monitoring system (TPMS)
- Wheels: 43.2 cm (17") alloy wheels with 10 double-spoke design
- Seats: Heated seats for driver and front passenger
- Lane Keeping Assist, active
- Phone accessories: Smartphone integration
- Cruise control
- Fully digital instrument display
- High-visibility vest for drivers
- Central locking with remote control



Extra equipment

- DIGITAL LIGHT (HD system with projection module (more than 1 million pixels per headlight) - MULTIBEAM LED background module - Topography compensation - Adaptive Highbeam Assist Plus - ULTRA RANGE high beam - Active cornering lights with predictive control - Extended fog lights, turning lights, country road lights, city lights, bad weather lights, as well as motorway lights and motorway high beams with optimized illumination of the road surface for the driving situation - Turning lights with roundabout and intersection warning - Off-road lights for vehicles - Adaptive full LED rear lights)
- Package: ENERGIZING Plus (ENERGIZING Plus comfort programs: warmth, joy, coziness, freshness, vitality, training - ENERGIZING COACH with individual program recommendations through evaluation of driving and vehicle data as well as driver data if required - Multicontour seats for driver and front passenger - Electro-pneumatic 4-way lumbar support - Seat climate control for driver and front passenger - Seat heating - AIR-BALANCE program for fragrance, ionization and purification of the air, active in all ENERGIZING programs - Ambient lighting with program-specific lighting moods)
- Package: Parking package with 360° camera (12 ultrasonic sensors: six each in the front and rear bumpers - 360° camera - Active Parking Assist with PARKTRONIC: detects parking spaces, assisted parking, assisted exiting, visual and acoustic warning of detected obstacles according to distance and position, display of camera and ultrasonic data in the central display, button for Active Parking Assist with PARKTRONIC - cross traffic warning - maneuvering braking - drive-away assist)
- Auxiliary heating
- Heat and noise insulating acoustic glass (for windshield and front doors)
- Head-up display (lens and mirror system projects a virtual image into the driver's field of vision at a distance of 4.5 m above the hood - full-color display that is easily readable even on sunny days and at night - depending on the equipment, display of, for example, navigation instructions, speed, speed limits or settings of cruise control or active distance assist DISTRONIC)
- Paint finish: Metallic
- Package: AVANTGARDE Advanced Plus (Driver's seat electrically adjustable with memory function: Driver and front passenger seats, steering column and exterior mirrors electrically adjustable and storable, seat fore/aft position and headrest height additionally electrically adjustable, 3 memory settings each for driver and front passenger, 4-way lumbar support for driver and front passenger, seat cushion depth adjustment with gapless cushion, PRE-SAFE positioning, Blind Spot Assist, Illuminated door sills with "Mercedes-Benz" lettering, Traffic Sign Assist, Ambient Lighting Plus)
- Package: Driving Assistance Package Plus (Active Distance Assist DISTRONIC, Active Speed Limit Assist, Extended Automatic Restart on Highways, Route-Based Speed Adaptation with Traffic Jam Function, Active Traffic Jam Assist, Active Steering Assist, Active Lane Change Assist, Active Emergency Stop Assist, Emergency Lane Function, Active Brake Assist with Vehicle, Bicycle and Pedestrian Detection; Intersection Function, Turning Function, Traffic Jam Emergency Braking Function, Evasive Steering Assist, Active Lane Keeping Assist, Active Blind Spot Assist, PRE-SAFE Impulse Side, PRE-SAFE System)
- Upholstery: ARTICO man-made leather
- Type designation removed from trunk lid
- Heat-insulating dark tinted glass

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Body	A-pillar - left side - Stone chips - Smart repair
2	Mudguard - left side	Mudguard - left side - Dent / paintcoat damage - Repair and paint
3	Rear bumper	Rear bumper - Scratched - Paint



Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Front bumper	Front bumper (Sandstrahl Effekt) - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Vehicle key

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

Der beiliegende Radsatz ist nicht Bestandteil der vorliegenden Fahrzeugausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

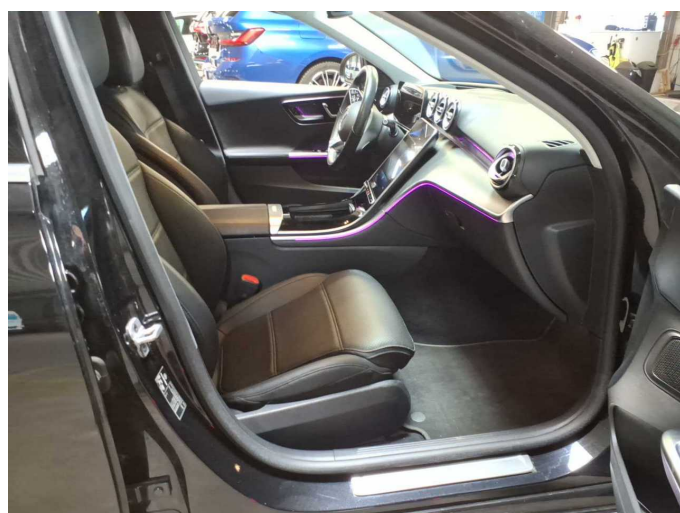


Figure 5: Interior - front

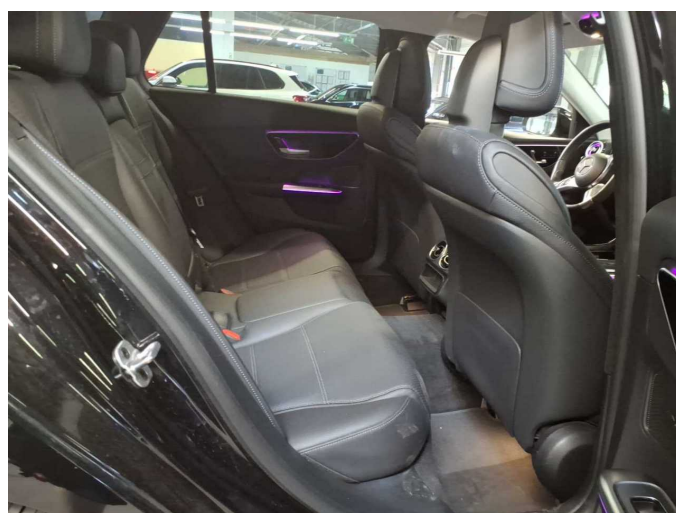


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres

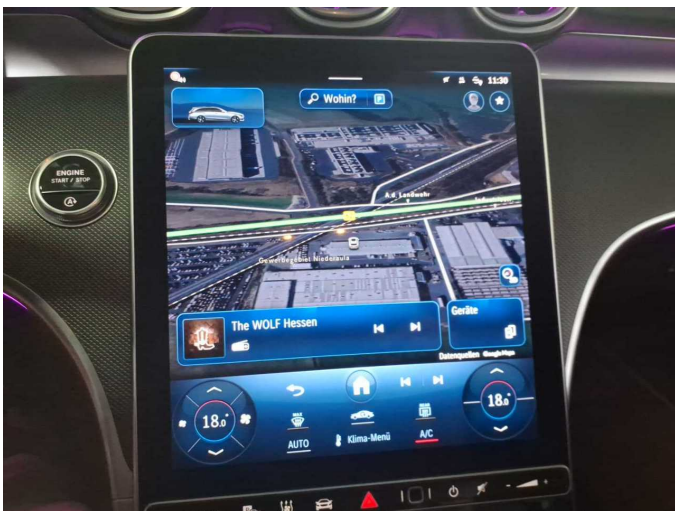


Figure 15: Navigation

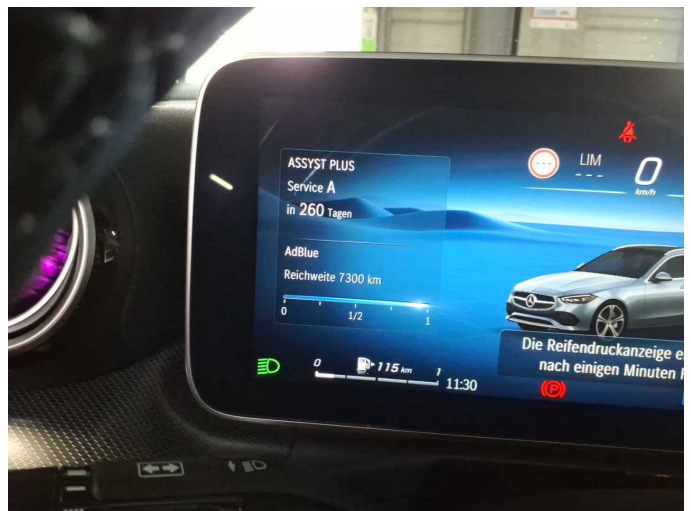


Figure 16: Misc.

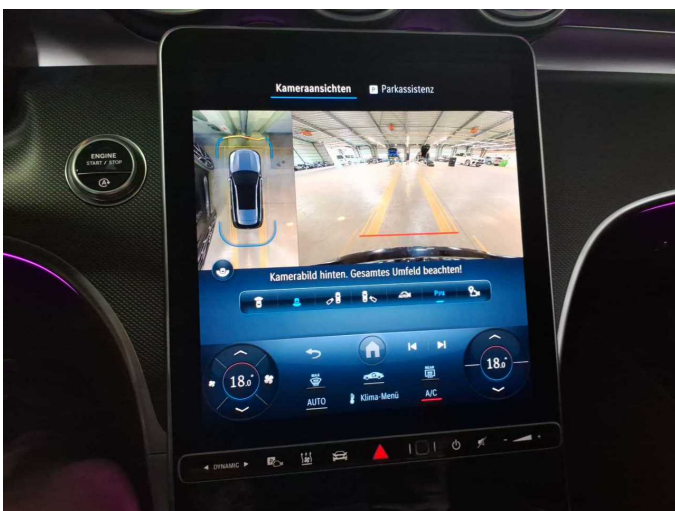


Figure 17: Misc.

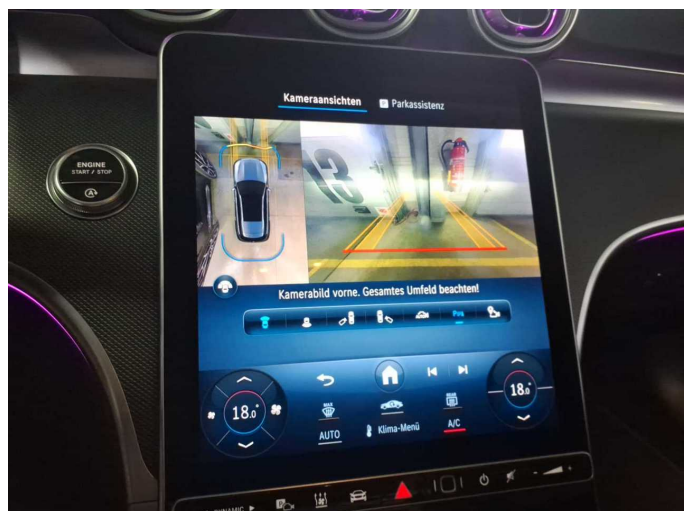


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.




Figure 25: Misc.




Figure 26: Misc.



Figure 27: Misc.

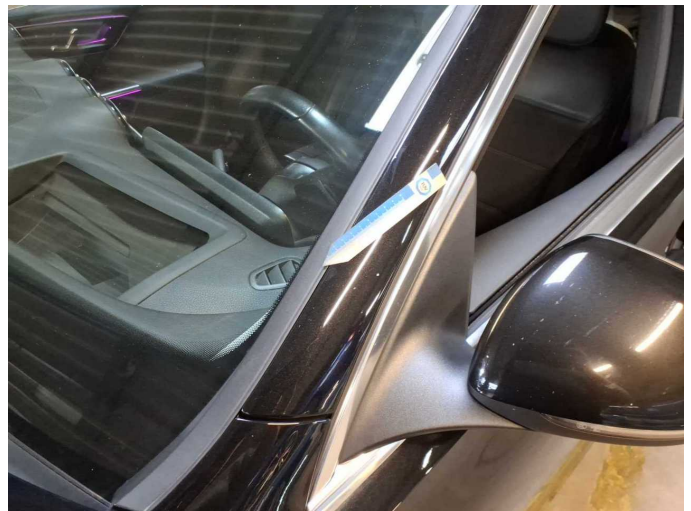

Damage 1: Body: A-pillar - left side - Stone chips - Smart repair

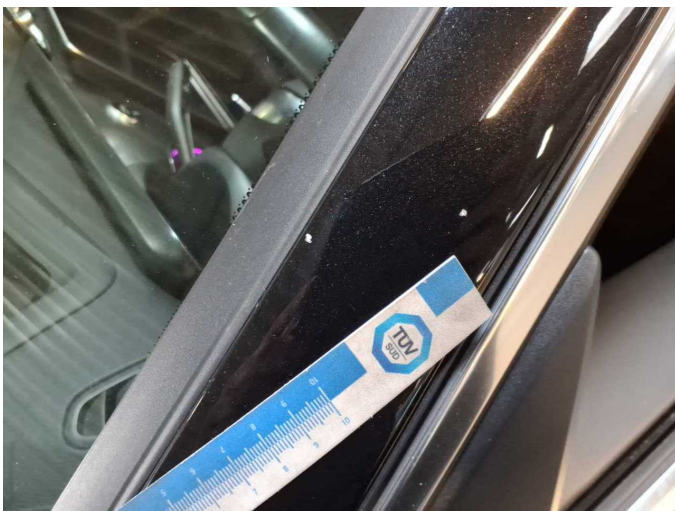

Damage 1: Body: A-pillar - left side - Stone chips - Smart repair




Damage 1: Body: A-pillar - left side - Stone chips - Smart repair




Damage 2: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint



Damage 2: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint

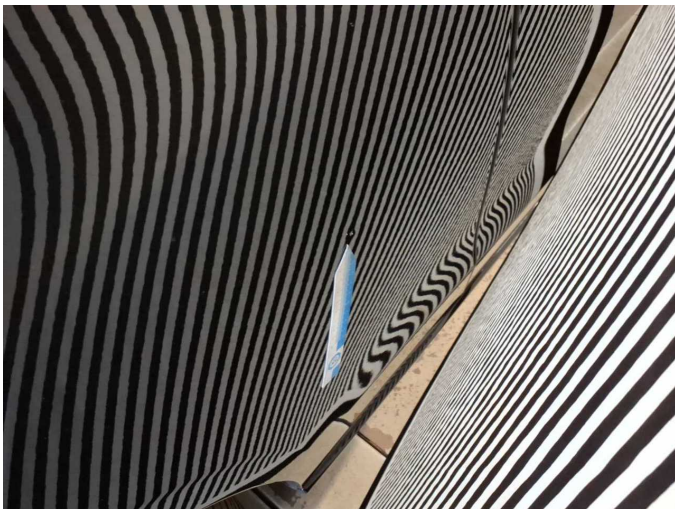

Damage 2: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint

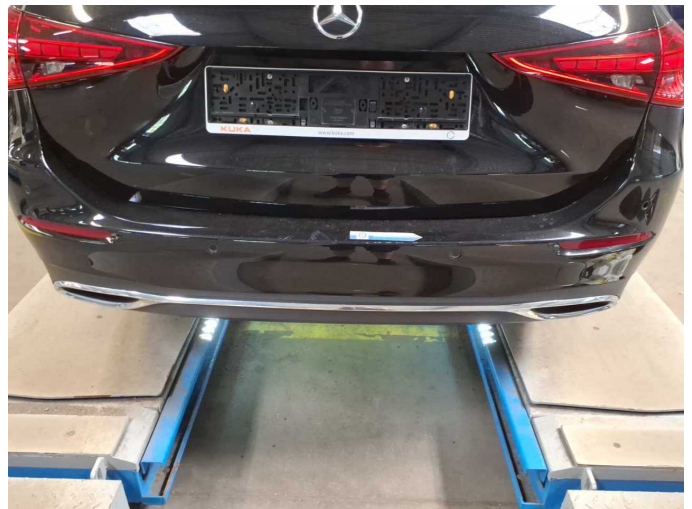

Damage 3: Rear bumper: Rear bumper - Scratched - Paint



Damage 3: Rear bumper: Rear bumper - Scratched - Paint



Damage 3: Rear bumper: Rear bumper - Scratched - Paint



Missing part 1: Equipment: Vehicle key - Missing - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1KAH0DB7RF151247

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ C 200 d T 9G-TRONIC
Avantgarde Advanced

Datum	KM-Stand	Beschreibung
09.02.2026	151.993	Bremsscheiben+Beläge v+h; Regelwartungsdienst
01.10.2025	126.577	Regelwartungsdienst
19.05.2025	101.240	Regelwartungsdienst
08.01.2025	75.796	Bremsinspektion vo + hi; Regelwartungsdienst
27.09.2024	50.786	Regelwartungsdienst
09.04.2024	24.598	Regelwartungsdienst